

COLORADO OFFICE

10758 W. CENTENNIAL RD., STE. 200
 LITTLETON, CO 80127
 TEL: (866) 981-4588
 FAX: (720)-981-5643

**WYOMING OFFICE**

5880 ENTERPRISE DR., STE. 200
 CASPER, WY 82609
 TEL: (307) 265-2373
 FAX: (307) 265-2801

LOST CREEK ISR, LLC

July 30, 2013

Mr. John Saxton
 Mail Stop T-8F5
 11545 Rockville Pike,
 Rockville, MD 20852
 Submitted via e-mail

**Re: Submittal of Mine Unit 1 Monitor Well Data
 License Number SUA-1598, Docket 40-9068**

To Whom It May Concern:

Lost Creek ISR, LLC (LCI) has initiated Mine Unit 1 monitor well sampling in an effort to familiarize staff with procedures and correct any logistical issues prior to the initiation of mining. To date, a total of two rounds of data have been analyzed by a third party lab. Three wells have returned water quality results with concentrations greater than the Upper Control Limits (UCLs) determined from baseline data. The wells with concentrations greater than the UCLs are shown in the table below:

Well Name	Sample Date	Alkalinity (mg/l)	Alkalinity UCL (mg/l)	Conductivity μ S/cm	Conductivity UCL μ S/cm
M-109	7/11/13	108	97	574	523
M-126	6/25/13	111	103	573	544
M-126	7/28/13	113	103	557	544
MU-110	7/1/13	75	51	---	---

LCI believes that the recent sample results for alkalinity and conductivity are relatively high compared to baseline values because the wells haven't been sampled for a long time and will therefore require additional purging in order to produce samples representative of the host aquifer. A review of the sampling records shows that the well sampling procedure, which requires three casing volumes be purged prior to sampling, was followed. Additional purging will be utilized to ensure future sample results for these three wells are representative of the host aquifer. Spatial variability may also be playing a role in the elevated water quality.

LCI has not initiated in situ mining within Mine Unit 1. In other words, no mining chemicals, including bicarbonate, CO₂, or oxygen, have been introduced into the wellfield. LCI has performed very limited injection in header house 1-1 to test alarms, systems, and procedures and to train employees; see the attached map. The injection occurred in all but one injection well in header house 1-1 on day shifts from July 20th to 26th (which is after the elevated parameters were detected in the monitor wells). None of the three monitor wells are in the immediate vicinity of header house 1-1.

Lost Creek ISR, LLC is a wholly-owned subsidiary of Ur-Energy Inc.

TSX: URE

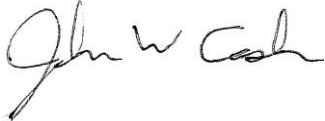
www.ur-energy.com

July 30, 2013
Re: Submittal of Mine Unit 1 Monitor Well Data
Page 2 of 2

Verification samples were not collected since the elevated water quality was detected prior to mining.

If you have any questions regarding this letter or require additional information please feel free to contact me at (307) 265-2373.

Sincerely,

A handwritten signature in black ink, appearing to read "John W. Cash". The signature is fluid and cursive, with the first name "John" being the most prominent.

John W. Cash, Vice President

Cc: Mrs. Melissa Bautz, Wyoming DEQ, w/o attachments
Mrs. Theresa Horne, Ur-Energy, Littleton

