

**NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)**

CONTROL NO: 186

FILE: INCIDENT REPORT FILE

FROM: Duek Power Co. Charlotte, N.C. W.O. Parker, Jr.		DATE OF DOC 12017-75	DATE REC'D 1-9-76	LTR XXX	TWX	RPT	OTHER
TO: N.C. Moseley		ORIG 1 Signed	CC 0	OTHER	SENT AEC PDR SENT LOCAL PDR		XXX XXX
CLASS	UNCLASS XXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-287		

DESCRIPTION: Letter Re. their ltr. of 11-13-75
Letter providing additional info. and associated
corrective action to Unusual Event Report # 75-10
concerning a weld failure.....

ENCLOSURES:

(1 Copy Received)

PLANT NAME: Oconee # 3

FOR ACTION/INFORMATION

SAB 1-14-76

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPELS W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/3 Copies	YOUNGBLOOD (E) W/ Copies	REID W/ Copies

**DO NOT REMOVE
ACKNOWLEDGED**

INTERNAL DISTRIBUTION

<u>REG FILE</u> NRC PDR OGC, ROOM P-506A GOSSICK/STAFF CASE BOYD MOORE (L) DEYOUNG (L) SKOVHOLT (L) GOLLER (L) (Ltr) P. COLLINS DENISE REG OPR FILE & REGION (2) MIPC/PE (3) STEELE	<u>TECH REVIEW</u> SCHROEDER MACCARY KNIGHT PAWLICKI SHAO **STELLO **HOUSTON **NOVAK ROSS IPPOLITO TEDESCO J. COLLINS LAINAS BENAROYA VOLLMER	DENTON **GRIMES GAMMILL KASTNER BALLARD SPANGLER <u>ENVIRO</u> MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR HARLESS	<u>LIC ASST</u> R. DIGGS (L) H. GEARIN (L) E. GOULBOURNE (L) P. KREUTZER (E) J. LEE (L) M. RUSHBROOK (L) S. REED (E) M. SERVICE (L) S. SHEPPARD (L) M. SLATER (E) H. SMITH (L) S. TEETS (L) G. WILLIAMS (E) V. WILSON (L) R. INGRAM (L) M. DUNCAN (E)	<u>A/T IND.</u> BRAITMAN SALTZMAN MELTZ <u>PLANS</u> MCDONALD CHAPMAN DUBE (Ltr) E. COUPE PETERSON HARTFIELD (2) KLECKER EISENHUT WIGGINTON F. WILLIAMS HANAUER
--	--	---	---	--

EXTERNAL DISTRIBUTION


1 - LOCAL PDR Walhalla, S.C.	1 - NATIONAL LABS	1 - PDR-SAN/LA/NY
1 - TIC (ABERNATHY) (1)(2)(10)	1 - W. PENNINGTON, Rm E-201 GT	1 - BROOKHAVEN NAT LAB
1 - NSIC (BUCHANAN)	1 - CONSULTANTS	1 - G. ULRIKSON, ORNL
1 - ASLB	NEWMARK/BLUME/AGBABIAN	1 - AGMED (RUTH GUSSMAN) Rm B-127 GT
1 - Newton Anderson	S. Sheppard	1 - J. D. RUNKLES, Rm E-201 GT
1 - ACRS SENT TO LIC ASST		
** SEND ONLY TEN DAY REPORTS		

DUKE POWER COMPANY
POWER BUILDING
422 SOUTH CHURCH STREET, CHARLOTTE, N.C. 28202

Regulatory File Cy.

December 17, 1975


WILLIAM O. PARKER, JR.
VICE PRESIDENT
STEAM PRODUCTION

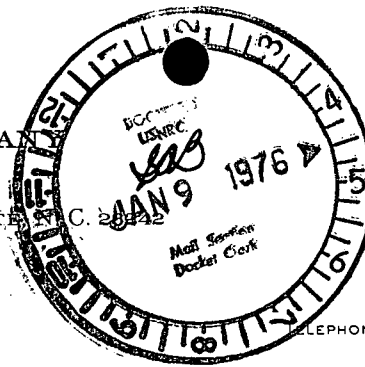

TELEPHONE: AREA 704
373-4083

Mr. Norman C. Moseley, Director
U. S. Nuclear Regulatory Commission
Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303

Re: Oconee Unit 3
Docket No. 50-287

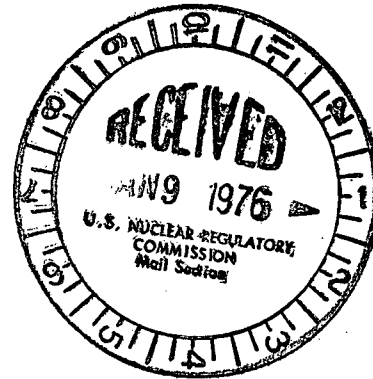

Dear Mr. Moseley:

My letter of November 13, 1975, transmitted Unusual Event Report UE-287/75-10, concerning a weld failure on a sample line from the 3A Low Pressure Injection System Cooler. The following provides additional information relating to this incident and associated corrective action.

The Corrective Action Section of UE-287/75-10 specified that representative welds in each Oconee unit would be dye penetrant tested to determine deleterious effects which may have been caused by vibration in the LPI trains. The welds listed in Units 1 and 2 were determined to be acceptable. For Unit 3, nine welds were tested, including one in each plane that would be affected by vibration, and the welds were determined to be acceptable with one exception. This weld had previously failed (refer to Abnormal Occurrence Report AO-287/74-6) and was on the same 3/4" sample line as the weld failure addressed by UE-287/75-10. Subsequently, this weld, and its adjacent line and valve, into which the crack extended, were replaced.

Very truly yours,

W.O. Parker, Jr.
William O. Parker, Jr. *By [Signature]*

EDB:ge

cc: Mr. Benard C. Rusche

DEC 18 10 21 AM '75

RENOVATION OPERATIONS
1000 17th St
ALBANY, GA

[Faint, mostly illegible text, likely bleed-through from the reverse side of the page]