

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 6135

FILE: INCIDENT REPORT FILE

FROM: Duke Power Company Charlotte, N.C. 28201 A C Thies			DATE OF DOC 5-30-75	DATE REC'D 6-4-75	LTR XXX	TWX	RPT	OTHER
TO: Mr. Norman Moseley			ORIG 1 signed	CC	OTHER	SENT AEC PDR <u>XXXX</u>		SENT LOCAL PDR <u>XXXX</u>
CLASS	UNCLASS XXXXXX	PROP INFO	INPUT	NO CYS REC'D 1		DOCKET NO: 50-287		
DESCRIPTION: Ltr trans the following: <i>Do Not Remove</i>				ENCLOSURES: Unusual Event Report UE-287/75-4 on 4-19-75, Failure of condenser circulating water valves to operate properly during test... 1 copy encl. rec'd				
PLANT NAME: Oconee Unit 3								

FOR ACTION/INFORMATION wtm 6-5-75

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPELS W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/3Copies	YOUNGBLOOD (E) W/ Copies	W/ Copies

INTERNAL DISTRIBUTION

<u>REG FILE</u> NRC PDR OGC, ROOM P-506A GOSSICK/STAFF CASE GIAMBUSSO BOYD MOORE (L) DEYOUNG (L) SKOVHOLT (L) GOLLER (L) (Ltr) P. COLLINS DENISE REG OPR FILE & REGION (2) MIPC/PE (3) STEELE	<u>TECH REVIEW</u> SCHROEDER MACCARY KNIGHT PAWLICKI SHAO **STELLO **HOUSTON **NOVAK ROSS IPPOLITO TEDESCO LONG LAINAS BENAROYA VOLLMER	DENTON **GRIMES GAMMILL KASTNER BALLARD SPANGLER <u>ENVIRO</u> MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR <u>HARLESS</u>	<u>LIC ASST</u> R. DIGGS (L) H. GEARIN (L) E. GOULBOURNE (L) P. KREUTZER (E) J. LEE (L) M. MAIGRET (L) S. REED (E) M. SERVICE (L) S. SHEPPARD (L) M. SLATER (E) H. SMITH (L) S. TEETS (L) G. WILLIAMS (E) V. WILSON (L) R. INGRAM (L)	<u>A/T IND.</u> BRAITMAN SALTZMAN MELTZ <u>PLANS</u> MCDONALD CHAPMAN DUBÉ (Ltr) E. COUPE PETERSON HARTFIELD (2) KLECKER EISENHUT WIGGINTON F. WILLIAMS HANAUER
---	--	--	--	--

EXTERNAL DISTRIBUTION

1 - LOCAL PDR <u>Walhalla, S C</u>	1 - NATIONAL LABS	1 - PDR-SAN/LA/NY
1 - TIC (ABERNATHY) (1)(2)(10)	1 - W. PENNINGTON, Rm E-201 GT	1 - BROOKHAVEN NAT LAB
1 - NSIC (BUCHANAN)	1 - CONSULTANTS	1 - G. ULRIKSON, ORNL
1 - ASLB	NEWMARK/BLUME/AGBABIAN	1 - AGMED (RUTH GUSSMAN) Rm B-127 GT
1 - Newton Anderson		1 - J. D. RUNKLES, Rm E-201 GT
5 - ACRS SENT TO LIC ASST <u>SHEPPARD</u>		
** SEND ONLY TEN DAY REPORTS		

DUKE POWER COMPANY

POWER BUILDING

422 SOUTH CHURCH STREET, CHARLOTTE, N. C. 28201

A. C. THIES
SENIOR VICE PRESIDENT
PRODUCTION AND TRANSMISSION

P. O. Box 2178

Regulatory Docket File

May 30, 1975

Mr. Norman C. Moseley, Director
U. S. Nuclear Regulatory Commission
Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303



Re: Oconee Unit 3
Docket No. 50-287

Dear Mr. Moseley:

Pursuant to Sections 6.2 and 6.6.2 of the Oconee Nuclear Station
Technical Specifications, please find attached Unusual Event Report
UE-287/75-4.


Very truly yours,

A handwritten signature in cursive script, appearing to read "A. C. Thies".

A. C. Thies

ACT:vr
Attachment

cc: Mr. Angelo Giambusso

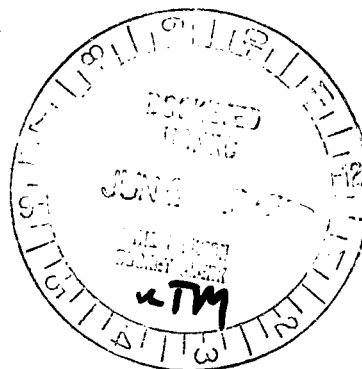

6135

DUKE POWER COMPANY
OCONEE UNIT 3

Report No.: UE-287/75-4

Report Date: May 30, 1975

Event Date: April 19, 1975

Facility: Oconee Unit 3, Seneca, South Carolina

Identification of Event: Failure of condenser circulating water valves to operate properly during test

Conditions Prior to Event: Unit in cold shutdown

Description of Event:

On April 19, 1975, the condenser circulating water (CCW) system gravity and recirculation flow test was performed on Oconee Unit 3. The test automatically shuts the six condenser discharge valves and opens the condenser emergency discharge valves to establish flow to the Keowee Hydro tailrace. In the performance of the test, three of the six condenser discharge valves, 3CCW 21, 22, and 23 did not close. The condenser emergency discharge valves did not open as they are interlocked to the condenser discharge valves.

Designation of Apparent Cause of Event:

The CCW condenser discharge valves control switches have three positions: open-remote-close. The switches for valves 3CCW 21, 22, and 23 were found in the open position. This will not allow the valves to shut upon loss of power to all CCW pumps. The position of the switch is not designated in the operating procedures.

Analysis of Event:

The purpose of the periodic test is to assure that following a loss of power to the CCW pumps, cooling water flow is maintained by gravity and siphon effect to the Keowee Hydro Plant tailrace and to verify that recirculation flow can be maintained from the intake canal back to the intake canal via the unit condenser, should a dam break accident occur. In this incident, the failure of the condenser discharge valves occurred during the time the unit was in cold shutdown and thus the function of the valves was not necessary.

In the event that the unit had been at power when all CCW pumps were lost, condenser vacuum would have decreased resulting in a turbine trip and then a high RC pressure reactor trip. Adequate heat removal capacity would have been available by the use of the main steam relief valves. In addition, the condenser discharge valves could have been manually operated to obtain

the gravity flow of condenser water. It is concluded that the health and safety of the public was not affected.

Corrective Action:

The operating procedure for the condenser circulating water system has been modified such that the CCW discharge valve control switches are specified to be in the remote position. It is considered that this action will prevent future occurrences of this nature.

MAY 33 11 00 AM '75

U.S.M. & S.
REGULATORY OPERATIONS
REGION II
ATLANTA, GA.