'JAN 1 2 1993

Docket Nos. 50-220 50-410

Mr. B. Ralph Sylvia Executive Vice President - Nuclear Niagara Mohawk Power Corporation 301 Plainfield Road Syracuse, New York 13212

Dear Mr. Sylvia:


Subject: NRC Region I Combined Inspection Report No. 50-220/92-25 and 50-410/92-29

This refers to the results of the routine resident safety inspection conducted by Messrs. W. Schmidt, W. Mattingly, S. Greenlee, and P. Drysdale from November 1 through December 12, 1992, at Nine Mile Point Units 1 and 2, Scriba, New York. Mr. Schmidt discussed the inspection findings with members of your staff at the exit meeting conducted on December 22, 1992.

This inspection was directed toward areas important to public health and safety. The enclosed NRC Region I Inspection Report describes the areas examined during the inspection. Within these areas, the inspection consisted of observation of activities in progress, interviews with personnel, and selective examinations of procedures and representative records.

Both units were operated safely by your staff. Excellent response to a degrading condition in the reactor protection system at Unit 2 and subsequent excellent response to the scram condition were observed. We do note that there was another partial loss of offsite power caused by a failure of an offsite breaker. The issue of control and maintenance of these breakers remains a concern because of their potential effect on and challenges to safety-related systems.

During observations of a surveillance test on the standby liquid control system we noted that testing personnel did not notify the inservice testing department or prepare a procedure change, as required by the procedure, when a test equipment gauge with a range outside of that specified by the procedure was installed and used. The safety significance of this installation was minor, because the gauge provided a digital read out. During our review we noted that the use of gauges with ranges outside the inservice testing plan requirements has been a previous problem. The failure to use appropriate equipment or make the appropriate notifications is a violation.

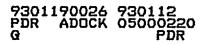

٨

- .

.

•

Ŗ

Niagara Mohawk Power Corporation 2

Based on the results of this inspection, you are required to respond to this letter and should follow the instructions relative to the Notice when preparing your response. In your response, you should document the specific actions taken and any additional action you plan to prevent recurrence of these types of issues.

Your cooperation with us is appreciated.

Sincerely,

ORIGINAL SIGNED BY: CURTIS J. COWGILL

Curtis J. Cowgill, Chief Projects Branch No. 1 Division of Reactor Projects

Enclosures:

- 1. NRC Region I Combined Inspection Report Nos. 50-220/92-25 and 50-410/92-29
- 2. Appendix A, Notice of Violation

OFFICIAL RECORD COPY

r

•

Niagara Mohawk Power Corporation

cc w/encl:

N. Carns, Vice President - Nuclear Generation C. Terry, Vice President - Nuclear Engineering J. Perry, Vice President - Quality Assurance J. Firlit, Vice President - Nuclear Support K. Dahlberg, Unit 1 Plant Manager M. McCormick, Unit 2 Plant Manager D. Greene, Manager, Licensing J. Warden, New York Consumer Protection Branch G. Wilson, Senior Attorney M. Wetterhahn, Winston and Strawn Director, Energy & Water Division, Department of Public Service, State of New York C. Donaldson, Esquire, Assistant Attorney General, New York Department of Law K. Abraham, PAO-RI (2) Public Document Room (PDR) Local Public Document Room (LPDR) Nuclear Safety Information Center (NSIC) NRC Resident Inspector State of New York, SLO Designee

3

• ,

,

•

.

Niagara Mohawk Power Corporation

4

bcc w/encls:
Region I Docket Room (with concurrences)
C. Cowgill, DRP
J. Yerokun, DRP
J. Nicholson, DRP
S. Greenlee, DRP
V. McCree, OEDO
J. Lieberman, OE
R. Capra, NRR
D. Brinkman, NRR
J. Menning, NRR
D. Holody, EO
DRS/EB SALP Coordinator
DRSS SALP Coordinator

bcc w/Letter, Notice of Violation, Report Cover Sheet and Executive Summary Only:
W. Hehl, DRP
J. Wiggins, DRP
W. Hodges, DRS
W. Lanning, DRS
L. Bettenhausen, DRS
J. Durr, DRS
R. Cooper, DRSS
S. Shenkman, DRSS

- S. Shankman, DRSS
- J. Joyner, DRSS

RI:DRP RI:DRI **RI:DRP** LNicholson CCowgill Schmidt/ss 1/192 j15792 1 15 193

OFFICIAL RECORD COPY

. . ,

r

*

5 •