


REFERENCES:

FSK-3-2  
LSK-3-2  
2CRS-103  
EE-3K  
EE-4C  
EE-4BC  
EE-3AJ

E4DCR-P02124A  
0007.159-451-553  
0007.520-001-540  
0007.510-414-151

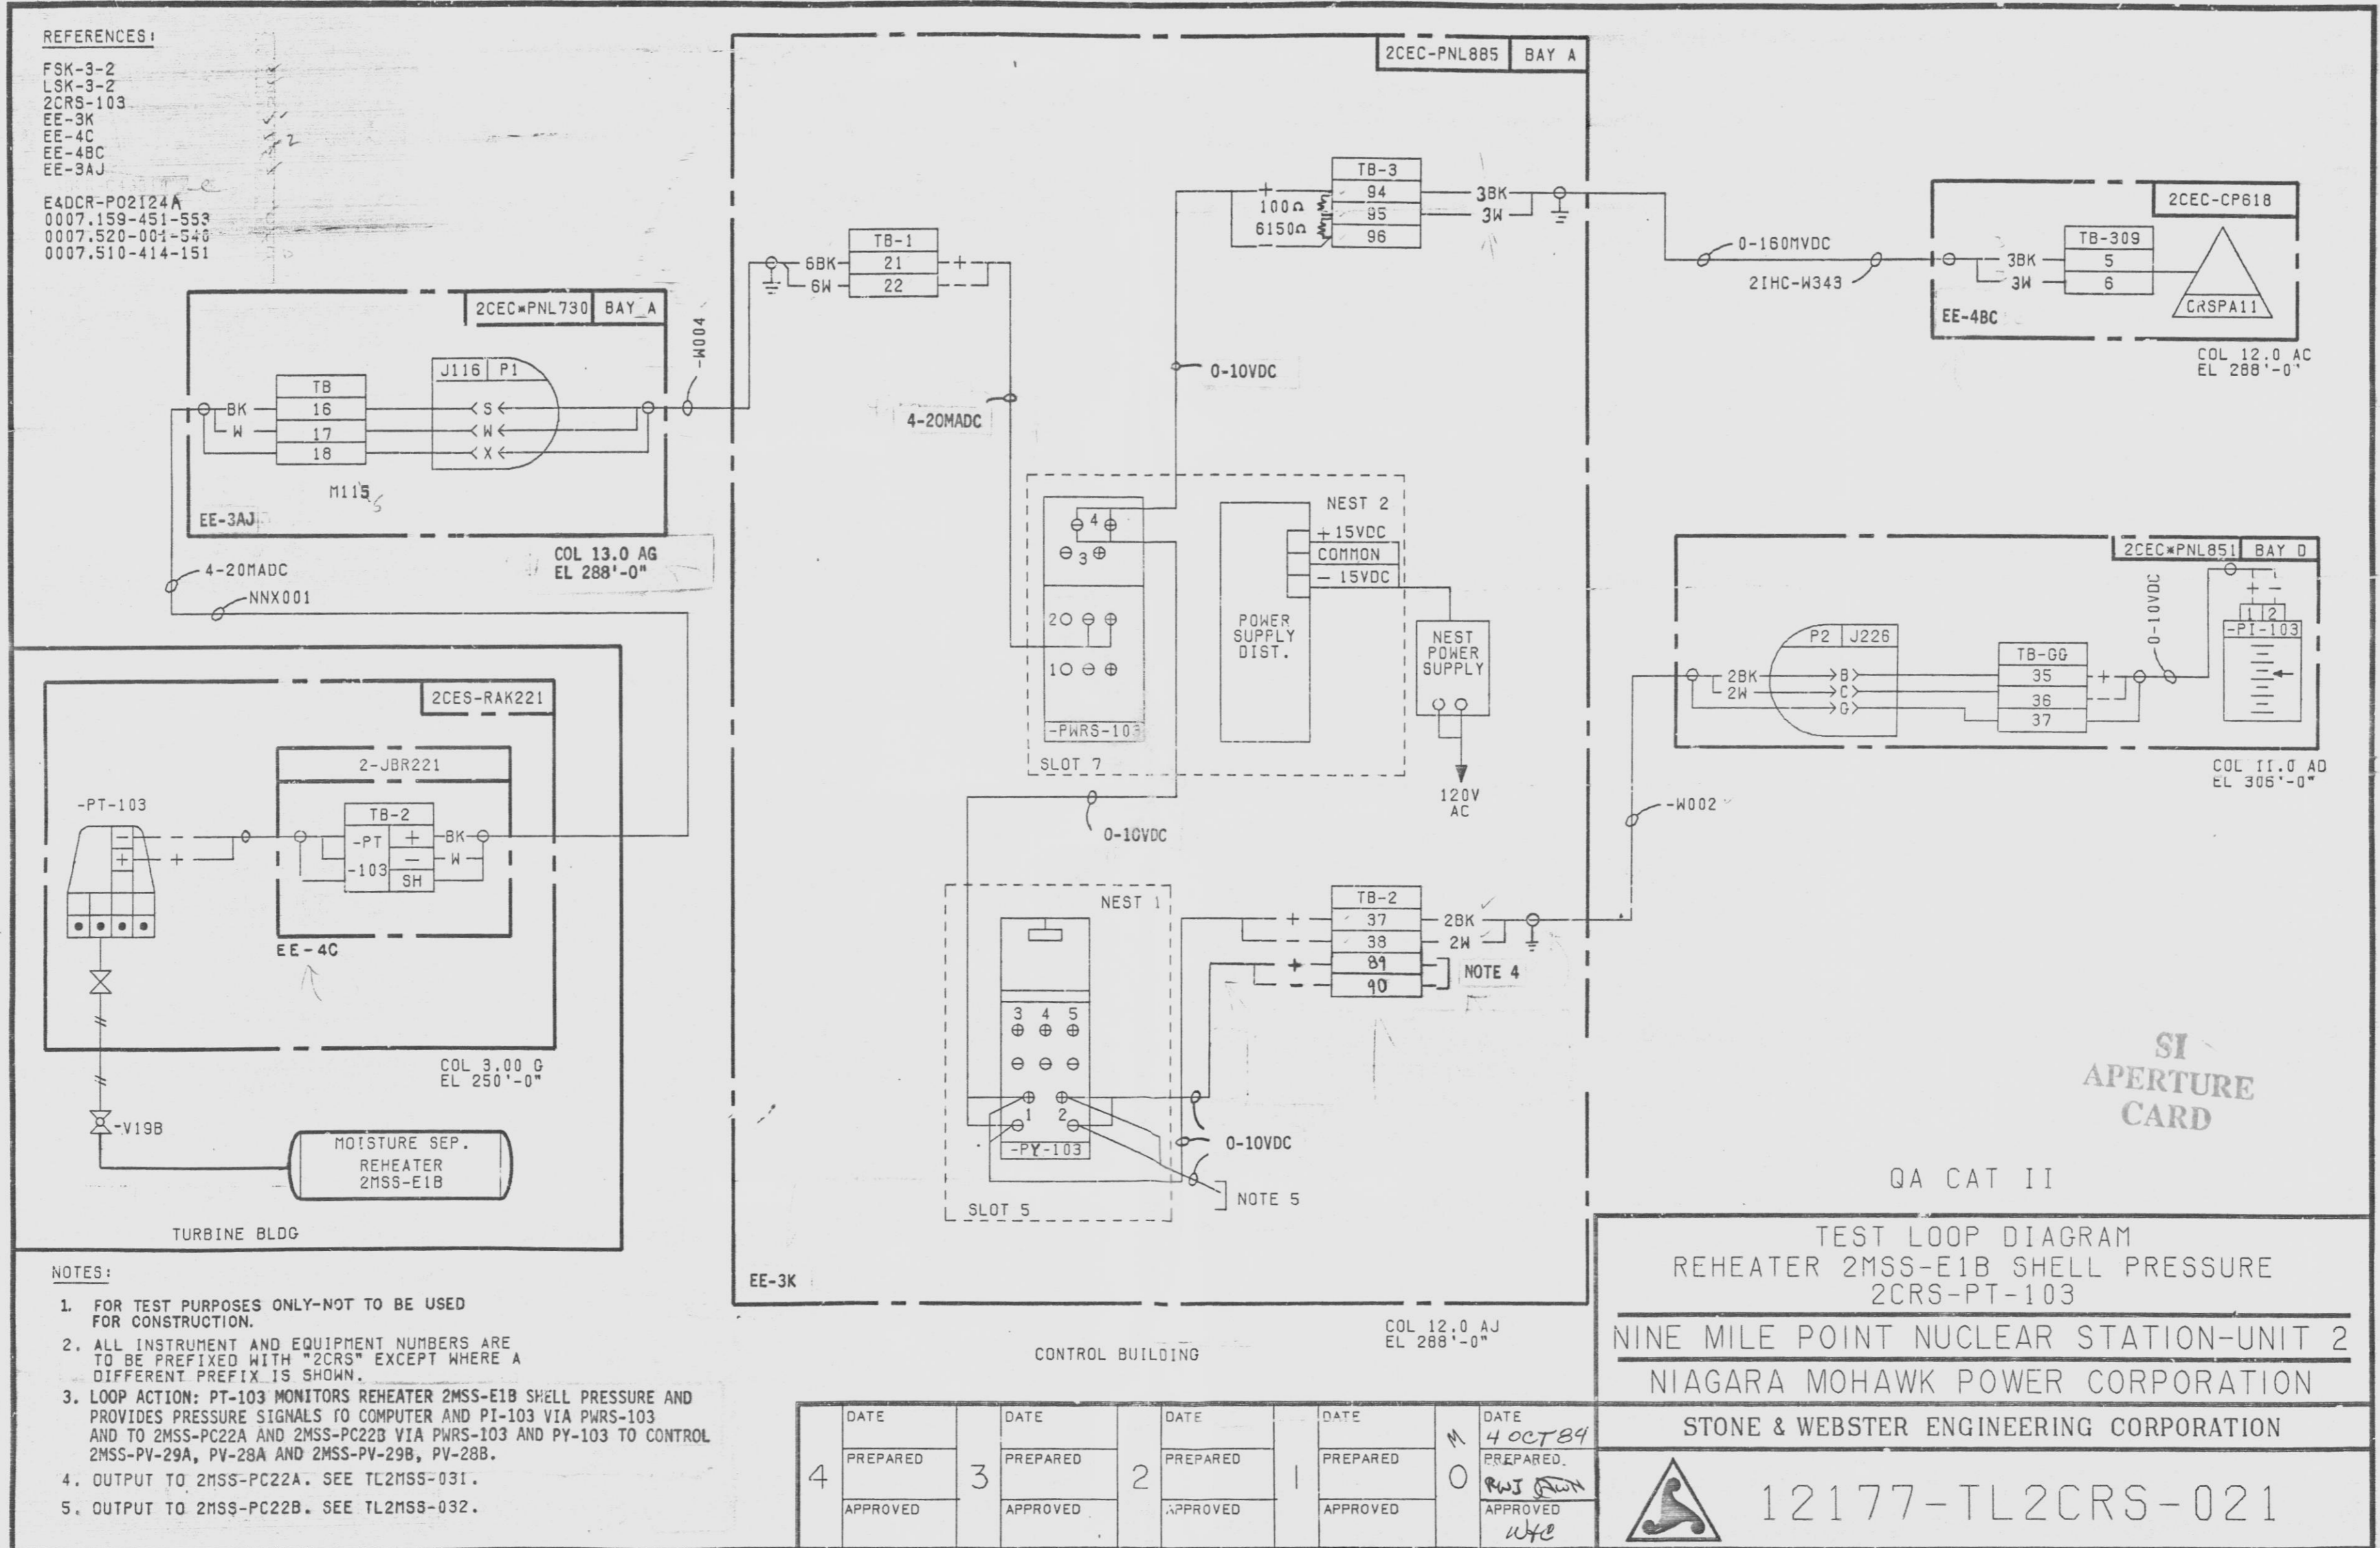

NOTES:

1. FOR TEST PURPOSES ONLY-NOT TO BE USED FOR CONSTRUCTION.
2. ALL INSTRUMENT AND EQUIPMENT NUMBERS ARE TO BE PREFIXED WITH "2CRS" EXCEPT WHERE A DIFFERENT PREFIX IS SHOWN.
3. LOOP ACTION: PT-103 MONITORS REHEATER 2MSS-E1B SHELL PRESSURE AND PROVIDES PRESSURE SIGNALS TO COMPUTER AND PI-103 VIA PWR5-103 AND TO 2MSS-PC22A AND 2MSS-PC22B VIA PWR5-103 AND PY-103 TO CONTROL 2MSS-PV-29A, PV-28A AND 2MSS-PV-29B, PV-28B.
4. OUTPUT TO 2MSS-PC22A. SEE TL2MSS-031.
5. OUTPUT TO 2MSS-PC22B. SEE TL2MSS-032.

DATE	DATE	DATE	DATE	DATE
4	3	2	1	0
PREPARED	PREPARED	PREPARED	PREPARED	PREPARED
APPROVED	APPROVED	APPROVED	APPROVED	APPROVED

TEST LOOP DIAGRAM  
REHEATER 2MSS-E1B SHELL PRESSURE  
2CRS-PT-103  
NINE MILE POINT NUCLEAR STATION-UNIT 2  
NIAGARA MOHAWK POWER CORPORATION

STONE & WEBSTER ENGINEERING CORPORATION  
12177-TL2CRS-021

9305070230 D