


OK Central
file

50-249

5-22-72

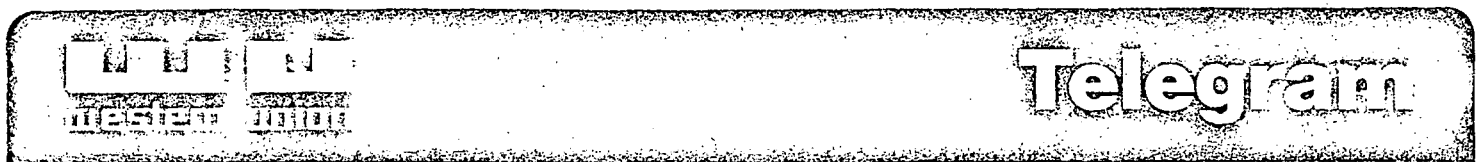

705P EST MAY 22 72 DEA601
DE JLA247 IM PDF MORRIS ILL 22 321P CDT
BOYCE GRIER, DIRECTOR DIVN OF COMPLIANCE
REGION 111 U S ATOMIC ENERGY COMMISSILN
GLENELLYN ILL 60137

TELEPHONE NO. 5122 658-3660
TELEPHONED TO BTXM
TIME DELIVERED 10 52/53
BY CC TO BE mailing

DPR-25 DRESDEN NUCLEAR POWER STATION UNIT 3. THIS WILL CONFIRM
CONVERSATION AT 1300 HOURS THIS DATE WITH H DANCE REGARDING
FAILURE OF THE HPCI TURBAN TO RESET, ON FRIDAY 5-19-72 THE
HPCI TURBAN WOULD NOT RESET FROM THE CONTROL ROOM WHEN CONDUCTING
THE MONTHLY TURBAN SURVEILLANCE THE TURBAN WAS RESENT LOCALLY
AND THE SURVEILLANCE TEST WAS THEN CMPLETED

PHE INDICATING LIGHT WHICH MONITORS THE CONTINUITY OF
THE RSET CIRCUIT WAS ENEGIZED AND INDICATED A NORMAL CONDITION.
ON SATURDAY, 5-20-72 AN ELECTRICIAN FOUND A LOOSE WIRE IN THE
TURBAN RESET SOLENOID THE WIRE WAS RECONNECTED B Y 6PM SATUKDAY.

SF-1201 (R5-69)

Misc

WESTERN UNION

Telegram

THIS SITUATION WOULD PROBABLY PREVENTED HPCI FROM INITIATING
UNDER ACCIDENT CONDITIONS. NEW SOLENOIDS HAVE BEEN ORDERED
AND WILL BE REPLACED ON BOTH UNITS 2&3
W P WARDEN OLANT SUPT DRESDEN STATION

DPR-25 3 1300 HPCI 5-19-72 HPCI 5-20-72 6PM HPCI 2&3. (411)

SF-1201 (RS-69)

MAY 25 1972