JAN 8 1991

Docket No. 50-315/90-24 Docket No. 50-316

Indiana Michigan Power Company ATTN: Mr. Milton P. Alexich Vice President Nuclear Operations Division 1 Riverside Plaza Columbus, OH 43216

Gentlemen:

This letter refers to the follow up maintenance team inspection conducted by Mr. Z. Falevits and others of this office on December 3-7, 1990. This inspection covered activities at the Donald C. Cook Nuclear Plant authorized by NRC Operating Licenses No. DPR-58 and No. DPR-74. The purpose of the inspection was to evaluate progress in the area of maintenance since the maintenance team inspection (MTI) that was conducted in December 1989. The inspection findings were discussed with Mr. A. Blind and others of your staff on December 7, 1990.

The enclosed copy of our inspection report identifies the areas examined during the inspection. Within these areas, the inspection consisted of a selective examination of work packages, procedures, and representative records; in addition, observations were made and interviews were conducted with your personnel.

During the previously conducted MTI, the inspectors identified that the areas in most need of improvement were management involvement and support of maintenance, preventive maintenance programs, work control, material condition, technical support, and procedures. During this follow up inspection, the team determined that your actions in response to the weaknesses identified during the MTI were generally good. Specifically, the team noted increased plant and senior management involvement in the maintenance process which had resulted in the development of a number of maintenance improvement programs. Due to your decision to implement some of these improvements in a slow and deliberate manner, we were unable to evaluate the effectiveness of a number of the more significant improvements and timely positive results of the implementation of these improvements were not obtained.

No violations of NRC requirements were identified during the course of this inspection.

In accordance with 10 CFR 2.790 of the Commission's regulations, a copy of this letter and the enclosed inspection report will be placed in the NRC Public Document Room.

TEOL


• •

. .

*

r

■ • • • • • •

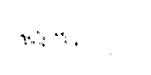

i.

.

.

Indiana Michigan Power Company

JAN 8 1991

We will gladly discuss any questions you have concerning this inspection.

2

Sincerely,

Creating Signal William A

for

T. O. Martin, Director Division of Reactor Safety

Enclosure: Inspection Reports No. 50-315/90024(DRS); No. 50-316/90024(DRS)

cc w/enclosure: A. A. Blind, Plant Manager DCD/DCB (RIDS) OC/LFDCB Resident Inspector, RIII James R. Padgett, Michigan Public Service Commission EIS Coordinator, USEPA Region 5 Office Michigan Department of Public Health D. C. Cook, LPM, NRR Commissioner Curtiss, OCM/JC Directors/Division of Reactor Safety RI, RII, RIV, RV


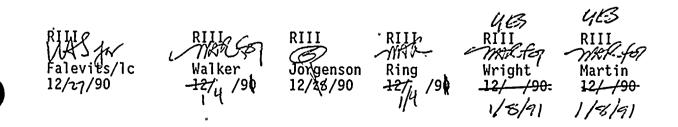


TABLE OF CONTENTS

1.0	Principal Persons Contacted
2.0	Licensee Action on Previous Inspection Findings
3.0	Inspection Results
3.1	Inspection Purpose and Method
3.2	Review of Plant Operations Historic Data
3.3	Management Philosophy, Organization and Administration of Maintenance Activities
3.3.1	Maintenance Philosophy
3.3.2	Management Organization and Administration
3.3.3	Preventive Maintenance Program
3.3.4	Equipment Identification
3.3.5	Conduct Performance Measurement
3.4	Technical Support
3.4.1	Engineering Support
3.4.2	System Engineering
3.4.3	Maintenance Engineering
3.4.4	Maintenance Trending
3.5	Ongoing Maintenance
3.5.1	Ongoing Electrical Maintenance
3.5.2	Ongoing Mechanical Maintenance
3.5.3	Ongoing I&C Maintenance
3.6	Post Maintenance Testing
3.7	QC/QA Involvement
3.7.1	QC Involvement in Maintenance
3.7.2	QA Audits and Surveillances
3.7.3	QA Plant/Corporate Interface
4.0	Exit Meeting



I

,