

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL.
(TEMPORARY FORM)

CONTROL NO: 926

FILE: _____

FROM: Rochester Gas & Elec. Corp. Rochester, N.Y. L.D. White, Jr.		DATE OF DOC 1-26-76	DATE REC'D 1-30-76.	LTR XXX	TWX	RPT	OTHER
TO: G. Goller		ORIG 1. Signed	CC 0	OTHER ..	SENT NRC PDR SENT LOCAL PDR		XXX XXX
CLASS	UNCLASS XXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-244		

DESCRIPTION:
Letter re. their ltr. of 12-23-75...
Inspection of Hydraulic Shock Absorbers (Snubbers)
(L Copy Received)

ENCLOSURES:

**DO NOT REMOVE
ACKNOWLEDGED**

PLANT NAME: RE Ginna # 1

<u>SAFETY</u>	<u>FOR ACTION/INFORMATION</u>	<u>ENVIRO</u>	<u>SAB 2-3-76</u>
ASSIGNED AD _____	ASSIGNED BRANCH CHIEF _____	PROJECT MANAGER _____	
BRANCH CHIEF <u>PURPLE w/s</u>	LIC ASST. _____ W/ ACRS		
PROJECT MANAGER _____	LIC. ASST. <u>SHEPPARD</u> W/16 CYS ACRS		

INTERNAL DISTRIBUTION

<u>REG FILES</u>	<u>SYSTEMS SAFETY</u>	<u>PLANT SYSTEMS</u>	<u>SITE SAFETY & ENVIRO ANALYSIS</u>
NRC PDR	HEINEMAN	TEDESCO	DENTON MULLER.
OELD	SCHROEDER	BENAROYA	
GOSSICK/STAFF	<u>ENGINEERING</u>	LAINAS	<u>ENVIRO TECH.</u>
I&E (2)	MACCARY	IPPOLITO	ERNST
MIPC	KNIGHT	<u>OPERATING REACTORS</u>	BALLARD
<u>PROJECT MANAGEMENT</u>	SIHWELL	STELLO	SPANGLER
BOYD	PAWLICKI	<u>OPERATING TECH.</u>	GAMMILL
P. COLLINS	<u>REACTOR SAFETY</u>	EISENHUT	STEPR
HOUSTON	ROSS	SHAO	HULMAN
PETERSON	NOVAK	BAER	
MELTZ	ROSETOCZY	SCHWENCER	<u>MISCELLANEOUS</u>
HELTEMES	CHECK	GRINES	<u>MCDONALD</u>

EXTERNAL DISTRIBUTION

LOCAL PDR Lyons, & Rochester, N.Y. NATIONAL LAB _____ W/ CYS
TIC REGION V-I&E-(WALNUT CREEK) BROOKHAVEN NAT. LAB
NSIC LA PDR ULRIKSON (ORNL)
ASLB CONSULTANTS

... ..

...

...

...

...

...

... ..

...

...


8

...



Regulatory


File Cy.

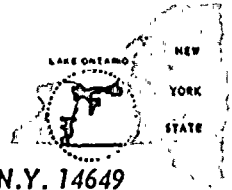


ROCHESTER GAS AND ELECTRIC CORPORATION, 100 EAST AVENUE, ROCHESTER, N.Y. 14649

LEON D. WHITE, JR.
VICE PRESIDENT

TELEPHONE
AREA CODE 716 546-2700

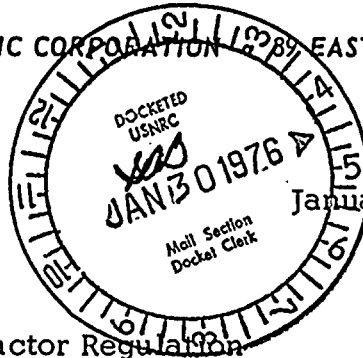

January 26, 1976

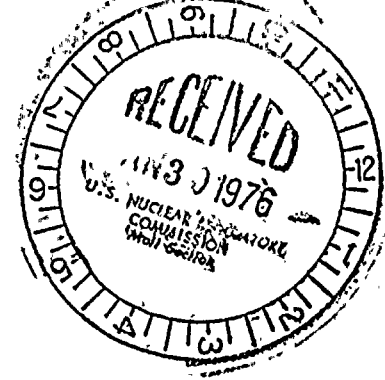

Director of Nuclear Reactor Regulation
ATTN: Mr. Karl Goller
Assistant Director for Operating Reactors
Division of Operating Reactors
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Subject: Inspection of Hydraulic Shock Absorbers (Snubbers)
R. E. Ginna Nuclear Power Plant, Unit No. 1
Docket No. 50-244

Dear Mr. Goller:

In accordance with Mr. Skovholt's letter of October 1, 1973, concerning periodic inspection of hydraulic shock absorbers (snubbers), an inspection of all snubbers both inside and outside of containment was completed on January 12, 1976.

All snubbers were considered operable at this inspection. The accumulator of the Bergen-Paterson unit outside of containment, reported in our letter dated December 23, 1975, was replaced and found to have a scored cylinder. The strut of the Bergen-Paterson unit outside of containment, reported in our letter dated November 24, 1975 as having developed wear at its attachment pin, was replaced. Examination of the pin and bearing indicated the bearing to be within tolerances.

During the inspection fluid was added to five of the eight Grinnell snubber units located on the pressurizer relief piping. There was no evidence of leakage. The "A" Steam Generator reservoir for the Steam Generator restraints was found to be empty after the outage. The reservoir was refilled and surveillance has been increased on it. The reservoir acts as a makeup tank only since the hydraulic units are dual chambered with internal displacement tubing. Leakage is believed to be from the tubing connections to the units which are not readily accessible for maintenance.

Very truly yours,

L. D. White, Jr.

