


VIRGINIA ELECTRIC AND POWER COMPANY
RICHMOND, VIRGINIA 23261

July 1, 1975

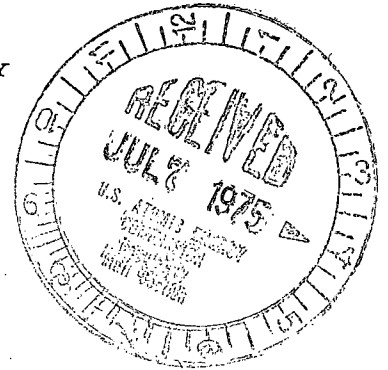

REGULATORY DOCKET FILE COPY

Mr. Norman C. Moseley, Director
Office of Inspection and Enforcement
United States Nuclear Regulatory Commission
Region II - Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303

Serial No. 586
PO&M/JTB:clw
Docket No. 50-281
License No. DPR-37

Dear Mr. Moseley:

Pursuant to Surry Power Station Technical Specification 6.6.B.1, the Virginia Electric and Power Company hereby submits forty (40) copies of Abnormal Occurrence Report No. A0-S2-75-10.

The substance of this report has been reviewed by the Station Nuclear Safety and Operating Committee and will be placed on the agenda for the next meeting of the System Nuclear Safety and Operating Committee.


Very truly yours,

C. M. Stallings

C. M. Stallings
Vice President-Power Supply
and Production Operations

Enclosures
40 copies of A0-S2-75-10

cc: Mr. K. R. Goller

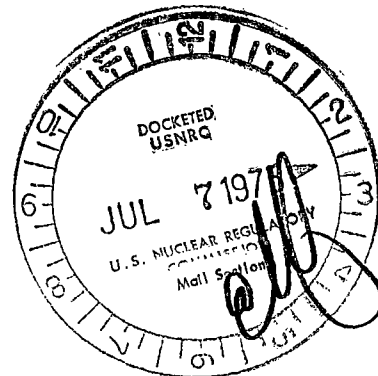

7238

LICENSEE EVENT REPORT

AO-S2-75-10

CONTROL BLOCK:

--	--	--	--	--	--

1 6

[PLEASE PRINT ALL REQUIRED INFORMATION]

01	V	A	S	P	S	2	0	0	-	0	0	0	0	0	0	-	0	0	4	1	1	1	0	0	1
7	8	9	14	15	25	26	30	31	32																
01	CONT	P	0	T	L	0	5	0	-	0	2	8	1	0	6	2	4	7	5	0	6	2	6	7	5
7	8	57	58	59	60	61	68	69	74	75	80														

EVENT DESCRIPTION

02 During normal operation on Unit No. 2, service water pump 2-SW-P-4B developed a seal
03 leak. Water filled the valve pit containing the isolation valve MOV-SW-202B. Water
04 caused electrical short in motor operator. MOV-SW-202A remained operable. Pump
05 leak and motor operator were repaired. The above is contrary to Tech Spec 1.0.I.6.
06 AO-S2-75-10

07	W	A	E	V	A	L	V	O	P	A	L	2	0	0	N
7	8	9	10	11	12	17	43	44	47	48					

CAUSE DESCRIPTION

08 Limitorque motor operator SMB-000. Water leaking from pump ran across floor and into
09 valve pit filling the pit with water and flooding motor of MOV-SW-202B. Floor
10 plating above pit will be sealed to prevent a recurrence.

11	E	1	0	0	N/A	A	N/A							
7	8	9	10	12	13	44	45	46						

12	Z	Z	N/A	N/A										
7	8	9	10	11	44	45								

PERSONNEL EXPOSURES

13	0	0	0	Z	N/A									
7	8	9	11	12	13									

PERSONNEL INJURIES

14	0	0	0	N/A										
7	8	9	11	12										

OFFSITE CONSEQUENCES

15	N/A													
7	8	9												

LOSS OR DAMAGE TO FACILITY

16	Z	N/A												
7	8	9	10											

PUBLICITY

17	N/A													
7	8	9												

ADDITIONAL FACTORS

18	N/A													
7	8	9												

19														
7	8	9												

NAME: E. M. Sweeney, Jr.

PHONE: (804) 357-3184