

CENTRAL FILES
PDR:HQ
LPDR
TIC
NSIC

UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
611 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76012

October 19, 1979

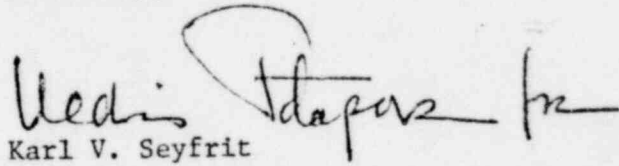
Docket No. 50-267

Public Service Company of Colorado
ATTN: Mr. C. K. Millen
Senior Vice President
P. O. Box 840
Denver, Colorado 80201

Gentlemen:

Enclosed is IE Circular No. 79-21, "Prevention of Unplanned Releases of Radioactivity," which provides information on inadvertent releases/on-site spills of radioactivity. Should you have any questions related to the enclosed suggested preventive measures, please contact this office.

Sincerely,


Karl V. Seyfrit
Director

Enclosures:

1. IE Circular 79-21
2. IE Circulars Issued
in the Last Six Months

cc: D. W. Warembourg, Nuclear Production
Manager
Fort St. Vrain Nuclear Station
P. O. Box 368
Platteville, Colorado 80651

L. Brey, Manager, Quality Assurance

1271 130

7911050

219

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Circular No. 79-21
Date: October 19, 1979
Page 1 of 2

PREVENTION OF UNPLANNED RELEASES OF RADIOACTIVITY

Numerous incidents of unplanned releases of radioactivity have been reported to the NRC within the past few months. These incidents of leaks, overflows and spills have resulted in contamination of areas outside of plant buildings. The attached table provides you with summary information on these events, their apparent causes, the radiological consequences and the corrective actions.

We believe that a number of these incidents could have been avoided and preventive actions for these types of unplanned releases should be instituted by all reactor licensees. Based on the reported incidents, the following preventive measures can minimize the occurrence of such events.

1. Review of procedures for transfer of radioactive liquids. Errors in written procedures have led to mistakes in valve line-ups and tank overflows. Written procedures, including check lists for valve line-ups, should be developed and followed for operations which could cause spills of radioactivity. Management controls, including audits, should be employed to assure verbatim compliance with such procedures.
2. Review of "as-built" systems having the potential of inadvertent releases because of design or construction errors. Consider items such as:
 - a. Tank overflows should be routed to liquid radwaste tanks.
 - b. Storm drains should be located away from areas with a high potential for spills.
 - c. Consideration should be given to drip pans under equipment, such as pumps and valves, from which leakage is expected.
 - d. Cofferdams should be installed under doors to areas with a potential for radioactive spills.
 - e. Preoperational testing should be conducted that would permit radioactive unit(s) under construction.

1271 131

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO

7908220128

No. of pages: _____