

TIC



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION IV
611 RYAN PLAZA DRIVE, SUITE 1000
ARLINGTON, TEXAS 76012

August 6, 1979

In Reply Refer To:

RIV

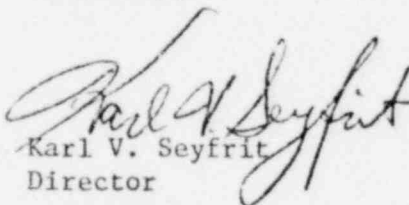
Docket No. STN 50-482/IE Bulletin No. 79-18

Kansas Gas & Electric Co.
Attn: Mr. Glenn L. Koester
Vice President-Operations
Post Office Box 208
Wichita, Kansas 67201

Gentlemen:

The enclosed IE Bulletin 79-18 is forwarded to you for information. No written response is required. If you desire additional information regarding this matter, please contact this office.

Sincerely,


Karl V. Seyfrit
Director

Enclosure:

1. IE Bulletin No. 79-18
2. List of IE Bulletins Issued
in Last 6 Months

cc: w/enclosures

Messrs. Nicholas A. Petrick, SNUPPS
D. T. McPhee, Kansas City Power and Light Company
Gerald Charnoff, Shaw, Pittman, Potts & Trowbridge
E. W. Creel, Kansas Gas and Electric Company

7908160 | 21

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

IE Bulletin No. 79-18
Date: August 6, 1979
Page 1 of 2

AUDIBILITY PROBLEMS ENCOUNTERED ON EVACUATION OF PERSONNEL FROM HIGH-NOISE AREAS

Description of Circumstances:

In January 1979, a number of licensee personnel were engaged in routine activities in the auxiliary building at the Florida Power Corporation, Crystal River Unit 3 nuclear plant. While these individuals were working in the auxiliary building, in a high-noise (fan) area, an unplanned release of radioactive noble gases was detected by building monitors within the auxiliary building at concentrations which caused the licensee to initiate the facility emergency plan auxiliary building evacuation procedure. The facility Emergency Officer (Shift Supervisor) assessed the monitor readings and initiated an auxiliary building evacuation. The evacuation announcement, made over the licensee's PA system, was not heard by the personnel working in the high-noise area. Licensee personnel did evacuate the auxiliary building upon observing that other personnel had left, and after calling the control room to inquire if an evacuation had been initiated. During these occurrences, licensee personnel were not exposed to quantities of radionuclides above regulatory guidance. However, the potential existed for inadvertent unnecessary exposure of individuals to radioactive materials.

Subsequent to the NRC followup inspection of this occurrence, Florida Power Corporation initiated an assessment of this situation and performed an engineering evaluation and identified several plant areas where the annunciator system needed audibility improvement. The licensee has installed a new auxiliary building evacuation tone signal and may add visual alarm indicators in areas of very high-noise.

Action to be Taken by the Licensees:

For all power reactor facilities with an operating license:

1. Determine whether current alarm systems and evacuation announcement systems are clearly audible or visible throughout all plant areas with emphasis on high-noise areas. Determination is to be made with the maximum anticipated

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7908030403

No. of pages: 5