



UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
REGION IV  
611 RYAN PLAZA DRIVE, SUITE 1000  
ARLINGTON, TEXAS 76012

CENTRAL FILES  
PDR:HQ  
LPDR  
TIC  
NSIC

August 10, 1979

Docket No. 50-267

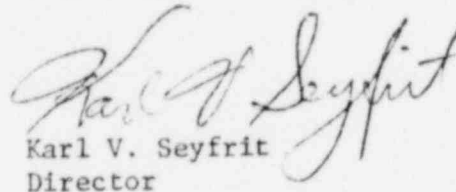
Public Service Company of Colorado  
ATTN: Mr. C. K. Millen  
Senior Vice President  
P. O. Box 840  
Denver, Colorado 80201

Gentlemen:

Enclosed is IE Bulletin No. 79-19, which requires action by you with regard to your reactor facility with an operating license.

Should you have questions regarding this Bulletin or the actions required of you, please contact this office.

Sincerely,

  
Karl V. Seyfrit  
Director

Enclosures:

1. IE Bulletin No. 79-19
2. List of Bulletins Issued  
in Last Six Months

cc: D. W. Warembourg, Nuclear Production  
Manager  
Fort St. Vrain Nuclear Station  
P. O. Box 368  
Platteville, Colorado 80651

L. Brey, Manager, Quality Assurance

7908160054

UNITED STATES  
NUCLEAR REGULATORY COMMISSION  
OFFICE OF INSPECTION AND ENFORCEMENT  
WASHINGTON, D.C. 20555

IE Bulletin No. 79-19  
Date: August 10, 1979  
Page 1 of 3

PACKAGING OF LOW-LEVEL RADIOACTIVE WASTE FOR TRANSPORT AND BURIAL

Description of Circumstances:

Low-level radioactive waste is that waste which can be transferred and shipped to one of three waste burial facilities which are located in and licensed by the Agreement States of Nevada, South Carolina, and Washington. On July 10, 1979, the Governors of the three states notified NRC Chairman Hendrie of the serious and repeated disregard for rules governing the shipments of low-level radioactive wastes to these burial facilities.

Examples of violations of Agreement State, DOT and NRC rules follow:

Improperly packaged uranium fines igniting packaged liquid scintillation vials in combustible waste is believed to have caused a fire and destruction of a truck at the Beatty, Nevada burial facility on May 14, 1979.

On July 2, 1979, three of twelve steel containers shipped to the Beatty burial facility were found to be leaking radioactive material. The material was described on the bill of lading as being a solid inorganic salt (evaporator concentrates solidified with urea formaldehyde) from a reactor facility. The Governor of the State of Nevada ordered the drums to be shipped out of the state and the burial facility was temporarily closed.

On July 30, the first shipment into the reopened Beatty facility contained free liquid in "solid" material. The radioactive contents were sand filters used at an insitu leaching process at a uranium mill.

Forty-three shipments with sixty-three deficiencies were observed during the package inspection program between April 10 and July 5, 1979, by the Agreement State of South Carolina, at the Barnwell, South Carolina burial facility. The shipments were from reactor, medical, industrial and military facilities.

On June 28, 1979, the Federal Highway Administration issued a Notice of Violation to a reactor facility proposing a \$10,000 fine for truck contamination resulting from improper closures on 55-gallon drums of LSA material and for improper loading of the drums on the vehicle.

These are a few examples of shipments of waste to burial facilities which did not fully meet NRC, DOT and Agreement State requirements, which were developed to protect the health and safety of the Agreement State Governors of the three States with licensees. If the situation is not rectified, the Agreement States would deny use of the three burial sites.

DUPLICATE DOCUMENT

Entire document previously  
entered into system under:

ANO 7908070515

No. of pages: 6