



UNITED STATES
NUCLEAR REGULATORY COMMISSION
REGION I
631 PARK AVENUE
KING OF PRUSSIA, PENNSYLVANIA 19406

Docket Nos. 50-289
50-320

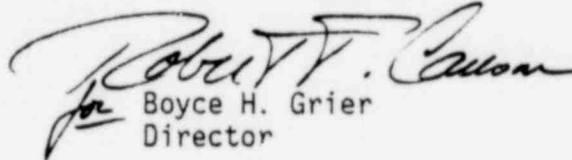
NOV 26 1979

Metropolitan Edison Company
ATTN: Mr. R. C. Arnold, Sr.
Senior Vice President
100 Interpace Parkway
Parsippany, New Jersey 07054

Gentlemen:

The enclosed IE Circular No. 79-23 is forwarded to you for information. No written response is required. If you have any questions related to the subject, please contact this office.

Sincerely,


Boyce H. Grier
Director

Enclosures:

1. IE Circular No. 79-23
2. List of Recently Issued IE Circulars

CONTACT: S. D. Ebnetter
(215-337-5296)

cc w/encls:

J. G. Herbein, Vice President Nuclear Operations
E. G. Wallace, Licensing Manager
G. P. Miller, Manager Support Services and Logistics
G. P. Miller, Acting, Superintendent Unit 1
W. E. Potts, Unit 1 Superintendent - Technical Support
J. J. Colitz, Manager Plant Engineering
R. F. Wilson, Director TMI-2 Recovery, Acting
J. B. Logan, Superintendent Unit 2
G. A. Kunder, Unit 2 Superintendent - Technical Support
I. R. Finfrock, Jr.
R. W. Conrad
G. F. Trowbridge, Esquire
J. B. Lieberman, Esquire
Ms. Mary V. Southard, Chairperson, Citizens for a Safe Environment
John T. Collins, Deputy Director, NRC, TMI Support

1555 165

7912110 054

ENCLOSURE 1

UNITED STATES
NUCLEAR REGULATORY COMMISSION
OFFICE OF INSPECTION AND ENFORCEMENT
WASHINGTON, D.C. 20555

SSINS: 6830
Accessions No:
7910250496

IE Circular No. 79-23
Date: November 26, 1979
Page 1 of 1

MOTOR STARTERS AND CONTACTORS FAILED TO OPERATE

Gould, Inc., Electrical Products Group, reported to the NRC on September 11, 1979 potential defects in certain NEMA size 3, Starters and Contactors. A possible binding or seizure of the carrier assembly, within the support plate of the stationary contact assembly, is caused by an undersized dimension of the support legs.

Starters and contactors with date code 7822 to 7935, model and serial numbers A10, A11, A12, A13, A14, A20, A21, A22, and P10 are involved. Faulty units were manufactured and distributed between June 1, 1978 and August 30, 1979. The attached listing of nuclear plants, which have received some of this motor control equipment, represents a preliminary check of shipment records. This listing, however, may not be complete.

Gould, Inc., will recall uninstalled items for retrofit and has retrofit kits available for field installation.

Based on the above, licensees are advised to verify all motor starter and contactor shipments received from Gould, Inc., between June 1, 1978 and August 30, 1979, and assure that applicable model and serial number components are corrected by retrofit and subsequent electrical operation tests.

No written response to this Circular is required.

If you desire additional information regarding this matter, contact the Director of the appropriate NRC Regional Office.

Attachment:
Listing of Nuclear Plants

1555 166

DUPLICATE DOCUMENT

Entire document previously
entered into system under:

ANO 7910250496

No. of pages: 4