

United States Department of Energy



LONG-TERM SURVEILLANCE PLAN FOR THE SHIPROCK DISPOSAL SITE, SHIPROCK, NEW MEXICO

December 1993



Uranium Mill Tailings Remedial Action Project

INTENDED FOR PUBLIC RELEASE

This report has been reproduced from the best available copy. Available in paper copy and microfiche.

Number of pages in this report: 132

DOE and DOE contractors can obtain copies of this report from:

Office of Scientific and Technical Information
P.O. Box 62
Oak Ridge, TN 37831
(615) 576-8401

This report is publicly available from:

National Technical Information Service
Department of Commerce
5285 Port Royal Road
Springfield, VA 22161
(703) 487-4650

LONG-TERM SURVEILLANCE PLAN FOR THE
SHIPROCK DISPOSAL SITE,
SHIPROCK, NEW MEXICO

December 1993

This document supersedes document number UMTRA-DOE/AL-350204.0000

Prepared for
U.S. Department of Energy
UMTRA Project Office
Albuquerque, New Mexico

Prepared by
Jacobs Engineering Group Inc.
Albuquerque, New Mexico

This is a controlled document. The holder of the document will be notified of page/content changes and will be responsible for inserting all changes to keep the document current.

TABLE OF CONTENTS

| <u>Section</u> | <u>Page</u> |
|--|-------------|
| 1.0 INTRODUCTION | 1-1 |
| 1.1 Background | 1-1 |
| 1.2 Licensing process | 1-2 |
| 1.3 Long-term surveillance plan | 1-2 |
| 2.0 FINAL SITE CONDITIONS | 2-1 |
| 2.1 Site history | 2-1 |
| 2.2 Site description | 2-3 |
| 2.2.1 Description and location of disposal site area | 2-3 |
| 2.2.2 Neighboring land uses | 2-7 |
| 2.2.3 Disposal site access and security | 2-7 |
| 2.2.4 Disposal cell design | 2-10 |
| 2.2.5 Design criteria | 2-12 |
| 3.0 SITE DRAWINGS AND PHOTOGRAPHS | 3-1 |
| 3.1 Disposal site map and drawings | 3-1 |
| 3.1.1 Disposal site vicinity map | 3-1 |
| 3.1.2 Disposal site map | 3-1 |
| 3.1.3 Disposal site as-built drawings | 3-2 |
| 3.2 Site baseline photographs | 3-2 |
| 3.3 Site aerial photographs | 3-2 |
| 3.4 Site inspection photographs | 3-2 |
| 3.4.1 Features to be photographed | 3-4 |
| 4.0 PERMANENT SITE SURVEILLANCE FEATURES | 4-1 |
| 4.1 Survey monuments | 4-1 |
| 4.2 Boundary monuments | 4-1 |
| 4.3 Site markers | 4-5 |
| 4.4 Entrance and perimeter signs | 4-5 |
| 4.5 Settlement plates | 4-5 |
| 4.6 Additional site surveillance features | 4-5 |
| 4.6.1 Erosion control markers | 4-5 |
| 4.6.2 Reference posts | 4-12 |
| 5.0 GROUNDWATER MONITORING | 5-1 |
| 5.1 Groundwater characterization | 5-1 |
| 5.1.1 Hydrostratigraphy | 5-1 |
| 5.1.2 Background groundwater quality | 5-2 |
| 5.2 Groundwater monitoring network | 5-2 |
| 6.0 SITE INSPECTIONS | 6-1 |
| 6.1 Inspection frequency | 6-1 |
| 6.2 Inspection team | 6-1 |
| 6.3 Preparation for inspections | 6-2 |

TABLE OF CONTENTS (Continued)

| <u>Section</u> | <u>Page</u> |
|--|-------------|
| 6.4 Site inspection and inspection checklist | 6-2 |
| 6.4.1 Off-site areas | 6-3 |
| 6.4.2 On-site areas | 6-3 |
| 6.4.3 Modifying processes | 6-4 |
| 6.5 Site inspection map | 6-5 |
| 6.6 Reporting requirements | 6-5 |
| | |
| 7.0 UNSCHEDULED INSPECTIONS | 7-1 |
| 7.1 Follow-up inspections | 7-1 |
| 7.2 Contingency inspections | 7-2 |
| 7.3 Inspection report | 7-2 |
| | |
| 8.0 CUSTODIAL MAINTENANCE AND REPAIR | 8-1 |
| 8.1 Planned maintenance | 8-1 |
| 8.2 Unscheduled maintenance or repair | 8-1 |
| 8.3 Certification and reporting requirements | 8-2 |
| | |
| 9.0 CORRECTIVE ACTION | 9-1 |
| 9.1 Problem identification | 9-1 |
| 9.2 Implementation of corrective action | 9-4 |
| 9.3 Certification and reporting requirements | 9-4 |
| | |
| 10.0 RECORD KEEPING AND REPORTING REQUIREMENTS | 10-1 |
| 10.1 Records | 10-1 |
| 10.2 Reports | 10-2 |
| | |
| 11.0 EMERGENCY NOTIFICATION AND REPORTING | 11-1 |
| 11.1 Agency agreements | 11-1 |
| 11.2 Unusual occurrences | 11-1 |
| 11.3 Earthquakes | 11-2 |
| 11.4 Meteorological events | 11-2 |
| | |
| 12.0 QUALITY ASSURANCE | 12-1 |
| 12.1 Groundwater monitoring | 12-1 |
| | |
| 13.0 PERSONNEL HEALTH AND SAFETY | 13-1 |
| 13.1 Health and safety | 13-1 |
| 13.2 Reportable incidents | 13-2 |
| | |
| 14.0 LIST OF CONTRIBUTORS | 14-1 |
| | |
| 15.0 REFERENCES | 15-1 |

TABLE OF CONTENTS (Concluded)

| | |
|--------------|---|
| ATTACHMENT 1 | NRC CONCURRENCE AND LICENSING DOCUMENTATION |
| ATTACHMENT 2 | SITE OWNERSHIP/CUSTODY DOCUMENTATION |
| ATTACHMENT 3 | PERMANENT SITE FILE INDEX |
| ATTACHMENT 4 | SITE INSPECTION PHOTO LOG |
| ATTACHMENT 5 | INITIAL SITE INSPECTION CHECKLIST |
| ATTACHMENT 6 | AGENCY NOTIFICATION AGREEMENTS |

LIST OF FIGURES

| <u>Figure</u> | <u>Page</u> |
|--|-------------|
| 2.1 Former mill site, Shiprock, New Mexico, site | 2-2 |
| 2.2 Area map, Shiprock, New Mexico, disposal site | 2-4 |
| 2.3 Disposal site location, Shiprock, New Mexico | 2-5 |
| 2.4 Physiographic setting, Shiprock, New Mexico, disposal site | 2-6 |
| 2.5 Land use in the vicinity of Shiprock, New Mexico, site, 1993 | 2-8 |
| 2.6 Final site conditions, Shiprock, New Mexico, disposal site | 2-9 |
| 2.7 Disposal cell cover cross section, Shiprock, New Mexico, disposal cell | 2-11 |
| | |
| 4.1 Typical survey monument, Shiprock, New Mexico, disposal site | 4-2 |
| 4.2 Typical boundary monument/erosion control marker, Shiprock, New Mexico, disposal site | 4-4 |
| 4.3 Site marker - SMK-1 located at site entrance, Shiprock, New Mexico, disposal site | 4-6 |
| 4.4 Site marker - SMK-2 located at crest of disposal cell, Shiprock, New Mexico, disposal site | 4-7 |
| 4.5 Site marker incised message, Shiprock, New Mexico, disposal site | 4-8 |
| 4.6 Entrance and perimeter signs, Shiprock, New Mexico, disposal site | 4-9 |
| 4.7 UMTRA Project settlement plate, Shiprock, New Mexico, disposal site | 4-10 |
| | |
| 5.1 Bedrock surface contours on terrace | 5-3 |
| 5.2 Representative cross section, Shiprock, New Mexico, site | 5-4 |
| | |
| 9.1 Corrective action, UMTRA Project long-term surveillance program | 9-2 |
| 9.2 Key elements in the corrective action process | 9-3 |

LIST OF PLATES

- 1 Shiprock disposal site map

LIST OF TABLES

| <u>Table</u> | <u>Page</u> |
|---|-------------|
| 2.1 Shiprock disposal site access key holders | 2-10 |
| 3.1 Aerial photography specifications for the Shiprock disposal site | 3-3 |
| 4.1 Survey coordinates and elevations for survey monuments and erosion control markers at the Shiprock, New Mexico, disposal site | 4-3 |
| 4.2 Survey coordinates and elevations as of October 6, 1986, for settlement plates at the Shiprock, New Mexico, disposal site | 4-11 |

LIST OF ACRONYMS

| <u>Acronym</u> | <u>Definition</u> |
|----------------------|---|
| ac | acre |
| cm | centimeter |
| cm/s | centimeters per second |
| DOE | U.S. Department of Energy |
| EPA | U.S. Environmental Protection Agency |
| ft | foot |
| GJPO | Grand Junction Projects Office |
| ha | hectare |
| in | inch |
| km | kilometer |
| LTSP | long-term surveillance plan |
| m | meter |
| MCL | maximum concentration limit |
| mi | mile |
| MSL | mean sea level |
| NECA | Navajo Engineering and Construction Authority |
| NRC | U.S. Nuclear Regulatory Commission |
| NWS | National Weather Service |
| pCi/m ² s | picocuries per square meter per second |
| QA | quality assurance |
| RAP | remedial action plan |
| RRM | residual radioactive material |
| SM | survey monument |
| TAC | Technical Assistance Contractor |
| UMTRA | Uranium Mill Tailings Remedial Action |
| UMTRCA | Uranium Mill Tailings Radiation Control Act |
| USGS | U.S. Geological Survey |
| VCA | Vanadium Corporation of America |

1.0 INTRODUCTION

The long-term surveillance plan (LTSP) for the Shiprock, New Mexico, Uranium Mill Tailings Remedial Action (UMTRA) Project disposal site describes the surveillance activities for the Shiprock disposal cell. The U.S. Department of Energy (DOE) will carry out these activities to ensure that the disposal cell continues to function as designed. This final LTSP is being submitted to the U.S. Nuclear Regulatory Commission (NRC) as a requirement for issuance of a general license for custody and long-term care for the disposal site. The general license requires that the disposal cell be cared for in accordance with the provisions of this LTSP.

This Shiprock, New Mexico, LTSP documents whether the land and interests are owned by the United States or an Indian tribe and describes in detail the long-term care program through the UMTRA Project Office. It is based on the DOE's *Guidance for Implementing the UMTRA Project Long-term Surveillance Program* (DOE, 1992a).

1.1 BACKGROUND

Title I of the *Uranium Mill Tailings Radiation Control Act* (UMTRCA) of 1978 (42 USC §7901 *et seq.*) authorized the DOE to perform remedial action at the Shiprock, New Mexico, uranium processing site. The purpose of the remedial action was to reduce the potential adverse health impacts associated with the residual radioactive material (RRM) at the processing site and at other properties contaminated by materials from the site.

The Shiprock site and adjacent lands are part of the Navajo Indian reservation. The DOE and the Navajo Nation entered into a cooperative agreement under the UMTRCA, establishing the terms and conditions whereby the remedial action was conducted (DOE Cooperative Agreement No. DE-FC04-83AL16258). The DOE described and evaluated its plan for stabilizing the RRM at the Shiprock site in an environmental assessment (DOE, 1984) and a remedial action plan (RAP) (DOE, 1985).

The remedial action was performed to meet the U.S. Environmental Protection Agency's (EPA) cleanup standards for inactive uranium processing sites (40 CFR Part 192, Subparts A-C). The NRC concluded that the DOE adequately characterized the hydrogeology and groundwater conditions of the Shiprock disposal site to demonstrate compliance with the groundwater protection aspects of the original EPA standards (issued on January 5, 1983). The NRC determined that the EPA's proposed groundwater protection standards (proposed rule published in 52 FR 36000 on September 24, 1987) do not apply to the Shiprock disposal site because the NRC had already concurred with the remedial action at the Shiprock site in 1985 before the proposed standards were issued. The NRC concurred with the DOE's plan to address compliance with the proposed EPA groundwater standards in the floodplain alluvium and on the terrace beyond the disposal cell as part of the DOE's groundwater restoration program for the UMTRA Project (NRC, 1990; 1991).

1.2 LICENSING PROCESS

The NRC has developed regulations (10 CFR §40.27) [effective November 29, 1990 (55 FR 45591)] issuing a general license for the long-term care of DOE UMTRA Project (Title I) disposal sites, including the Shiprock disposal site. The license is available to the DOE (or any succeeding federal agency designated by the President) and has no termination date. The purpose of this general license is to ensure that the UMTRA Project disposal sites will be cared for in a manner that protects the public health and safety and the environment upon completion of remedial actions. A disposal site is accepted under the general license 1) when the NRC concurs that the remedial action is complete at that site and formally accepts the site LTSP, and 2) when the DOE obtains custody or ownership of the disposal site.

Concurrence from the NRC on the completion of the remedial action at Shiprock was received on May 9, 1991 (Attachment 1). A legal description of the Shiprock disposal site and documentation of site custody are provided in Attachment 2. The Shiprock disposal site will be licensed by the NRC under provisions of 10 CFR §40.27 for long-term surveillance and maintenance. The general license becomes effective for the Shiprock disposal site after the NRC accepts the LTSP. Responsibility for conducting the long-term surveillance program will be transferred from the DOE UMTRA Project to the DOE's long-term surveillance and maintenance program. The DOE Grand Junction Projects Office (GJPO), Grand Junction, Colorado, will become the responsible program office. Programmatic transfer of site responsibility will be initiated by a letter from the UMTRA Project Office to the GJPO within 30 days after the NRC accepts the LTSP.

This LTSP identifies the DOE's plans for surveillance, maintenance, and emergency response necessary to protect public health and the environment as specified 10 CFR §40.27.

Because no groundwater restoration activities are required for the Shiprock disposal site itself, the license will take effect in one step (NRC, 1990).

Acquisition

The Navajo Nation will retain ownership of the Shiprock disposal site. However, the DOE has entered into a custodial care agreement with the Navajo Nation to restrict entry and public use and to provide federal access to the disposal site for long-term care activities. The custodial care agreement, including a description of the boundaries associated with the Shiprock disposal site, is provided in Attachment 2.

1.3 LONG-TERM SURVEILLANCE PLAN

This document describes the long-term surveillance program to be implemented at the Shiprock site to ensure that the disposal cell continues to perform as

designed. The plan is based on the DOE's *Guidance for Implementing the UMTRA Project Long-term Surveillance Program* (DOE, 1992a).

As required under 10 CFR §40.27, this LTSP addresses the following:

- Site description and ownership.
- Description of final site conditions.
- Site inspection procedures and personnel.
- Custodial maintenance and corrective action programs.
- Record keeping and reporting requirements.
- Quality assurance.
- Emergency response.

2.0 FINAL SITE CONDITIONS

2.1 SITE HISTORY

The former Navajo Mill at Shiprock was designed and built by Kerr-McGee Oil Industries, Inc. The mill, ore storage, raffinate ponds, and tailings piles occupied approximately 145 acres (ac) [58 hectares (ha)] leased from the Navajo Nation (Figure 2.1). Kerr-McGee operated the mill from 1954 until 1963, when it was purchased by the Vanadium Corporation of America (VCA). The VCA, which later merged with Foote Mineral Company, continued operations until 1968. When the lease expired in 1973, control of the site reverted to the Navajo Nation.

The mill processed a total of about 1.5 million short tons (1.4 million tonnes) of ore along with smaller quantities of bulk precipitates from heap leach operations (from the Monument Valley area) and purchased vanadium liquor. A two-stage sulfuric acid leaching circuit, countercurrent washing circuit, and uranium and vanadium solvent extraction circuits were used. Tailings from the washing circuit and yellow cake filtrates were pumped to the tailings disposal areas, while raffinate from the solvent extraction circuits was allowed to evaporate and infiltrate the ground from separate holding ponds.

After the site reverted to the Navajo Nation, a 40-ac (16-ha) portion of the 145-ac (58-ha) area was occupied by the Navajo Engineering and Construction Authority (NECA). The NECA established a training school for heavy equipment operators and used the lower tailings pile as a practice ground. These activities enlarged the pile and spread the tailings over most of the former holding pond area. In April 1974, the EPA conducted a radiation survey at the site. It noted that the training activities were adversely affecting radiological conditions and recommended that these activities be redirected toward decontamination of the site and interim stabilization of the tailings. This recommendation was accepted and carried out until mid-1978 with guidance and support from the EPA. The EPA guideline for off-pile decontamination was to reduce the net aboveground exposure rate to less than 10 microroentgens per hour above background (DOE, 1985).

The remedial action at the Shiprock disposal site was completed in 1986. Approximately 2.5 million tons (2.3 million tonnes) of contaminated materials were stabilized in place in a disposal cell covering approximately 77 ac (31 ha). Tailings and contaminated materials from adjacent off-site areas (including the escarpment and the floodplain of the San Juan River and vicinity properties) were placed in the original tailings pile and compacted for stability, resulting in the existing disposal cell. The disposal cell and immediately surrounding area encompass approximately 105 ac (42 ha).

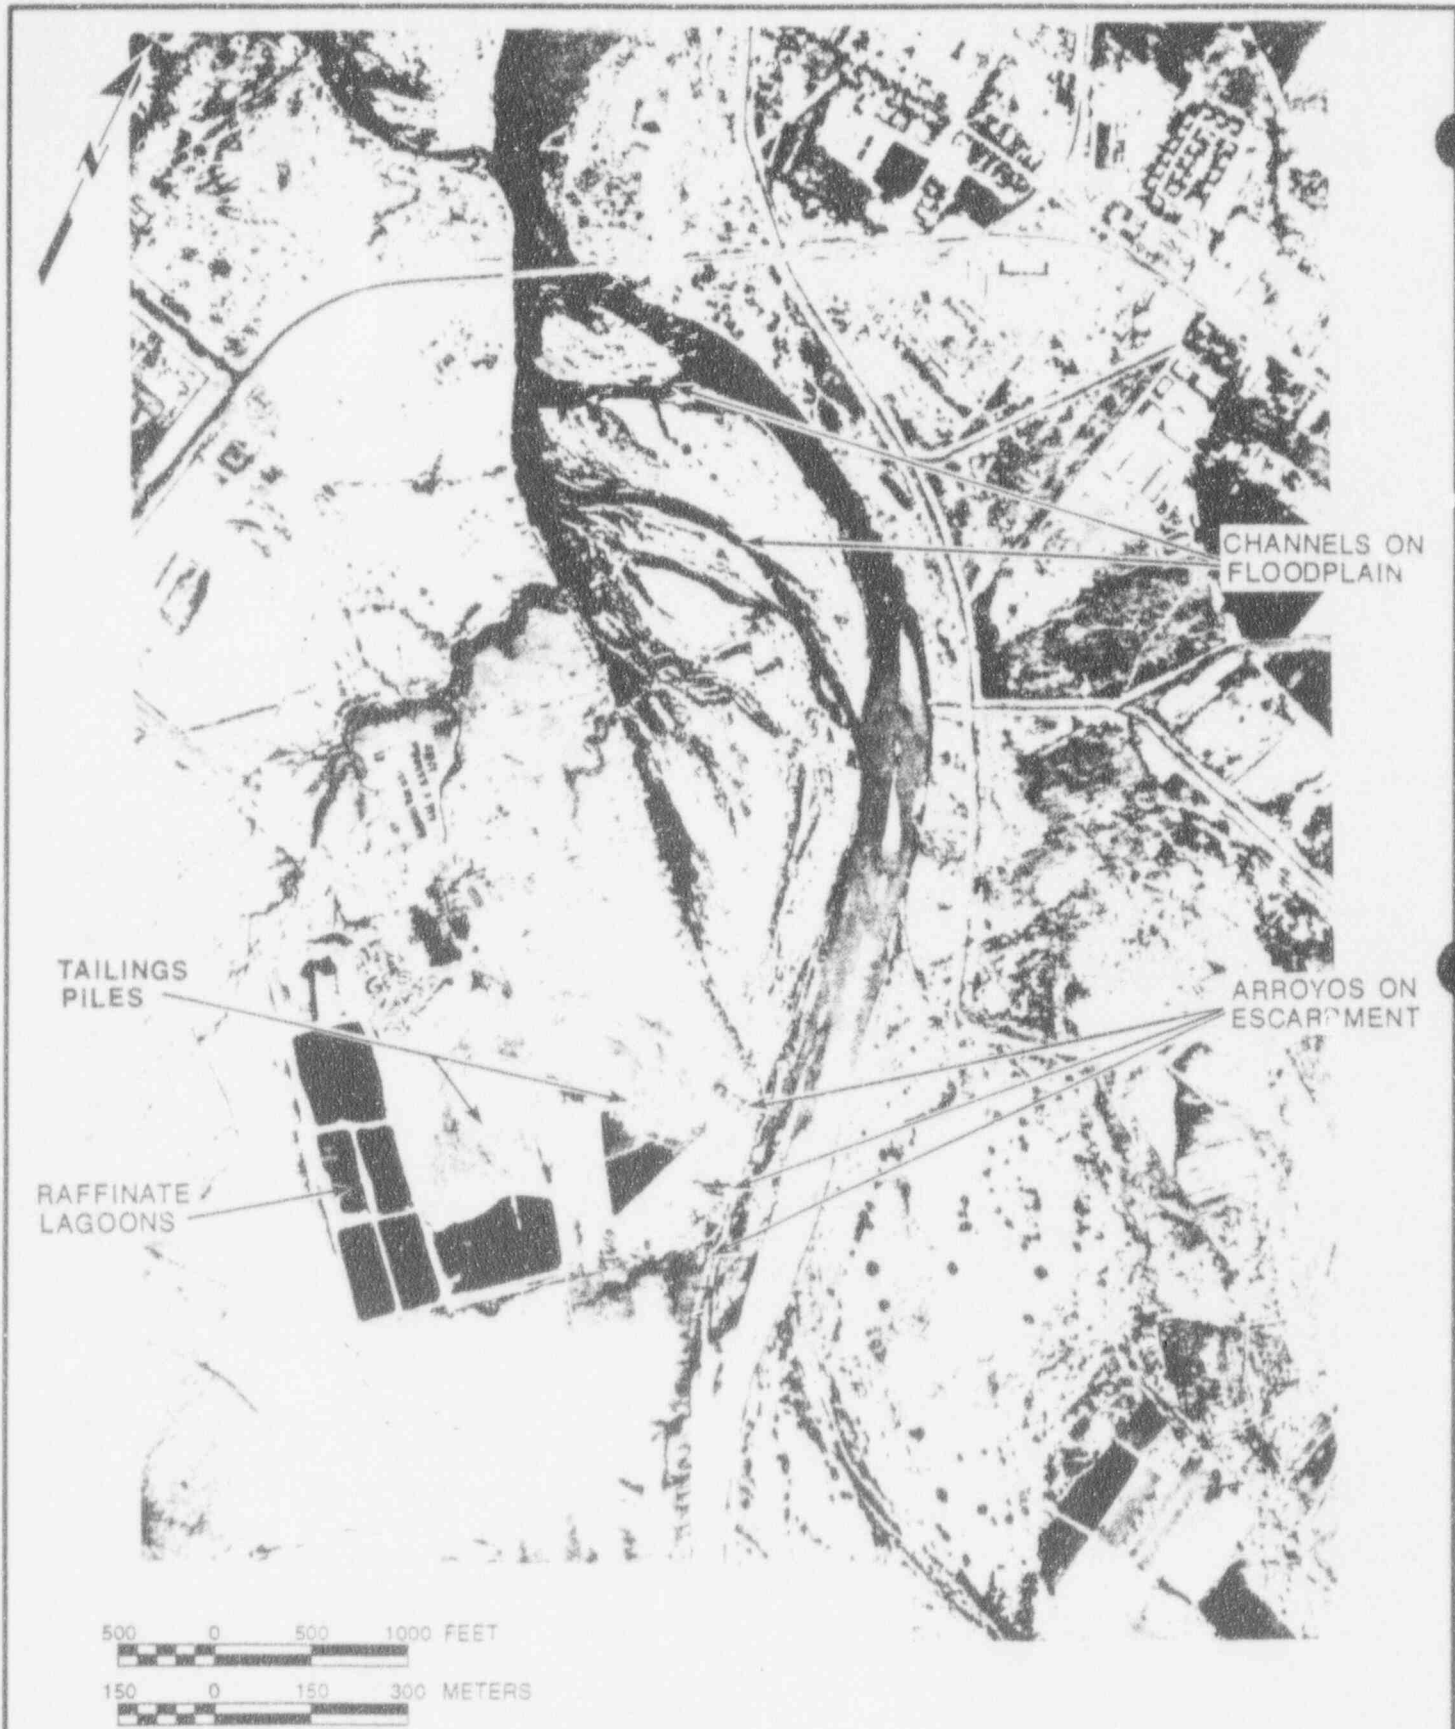


FIGURE 2.1
 FORMER MILL SITE
 SHIPROCK, NEW MEXICO, SITE

2.2 SITE DESCRIPTION

2.2.1 Description and location of disposal site area

The Shiprock disposal site is in San Juan County, New Mexico, Sections 25 and 36, Township 30 North, Range 18 West, and in Section 31, Township 30 North, Range 17 West, New Mexico Principal Meridian (Figures 2.2 and 2.3). The site is located on a 105-ac (42-ha) tract of land on the Navajo Indian Reservation 1 mile (mi) [1.6 kilometers (km)] south of the town of Shiprock, New Mexico, on the southern bank of the San Juan River (DOE, 1992b). The town of Shiprock is approximately 30 mi (48 km) west of Farmington, New Mexico, and 27 mi (40 km) southeast of Four Corners. Figure 2.2 shows the main highways in the vicinity of the site. Additionally, the Shiprock disposal site can be located using the following directions (Figure 2.3):

- From Shiprock, proceed south on U.S. Highway 666.
- From the junction of U.S. Highway 64 and U.S. Highway 666 south of Shiprock, proceed south on U.S. Highway 666 for 0.3 mi (0.5 km) to a gravel road.
- Proceed east on the gravel road for 0.5 mi (0.8 km) to the NECA compound.

The Shiprock disposal site is on an elevated river terrace on the southwest side of the San Juan River (Figure 2.4). The area is relatively level, with natural elevation ranging from a high of approximately 4980 feet (ft) [1520 meters (m)] above mean sea level (MSL) along the southwestern edge of the property to a low of about 4940 ft (1510 m) along the top of a 50-ft (15-m) high, northwest-southeast trending escarpment that separates the elevated terrace from the modern floodplain of the San Juan River. Southwest of the disposal site, the terrace continues gently upward for approximately 2500 ft (760 m), where it meets the weathered and colluvial covered bedrock uplands at an elevation of about 5040 ft (1540 m) above MSL.

The floodplain of the San Juan River is at the base of the escarpment to the north of the disposal cell. It begins approximately 1500 ft (460 m) upstream of the site, widens to about 1600 ft (490 m), then pinches out against the bedrock escarpment at the bridge supporting U.S. Highway 666 over the San Juan River, approximately 2000 ft (610 m) downstream of the northwestern corner of the site.

Two arroyos are located to the east and west of the tailings site. Bob Lee Wash is an arroyo bordering the western side of the site. Many Devils Wash is a parallel arroyo approximately 2500 ft (760 m) southeast of the site.

The climate of the region is generally arid and desert-like. On the terrace above the San Juan River, vegetation is sparse. Some of the floodplain was cleared of vegetation during remediation, but in other areas vegetation, consisting mainly of tamarisks, is extremely dense.



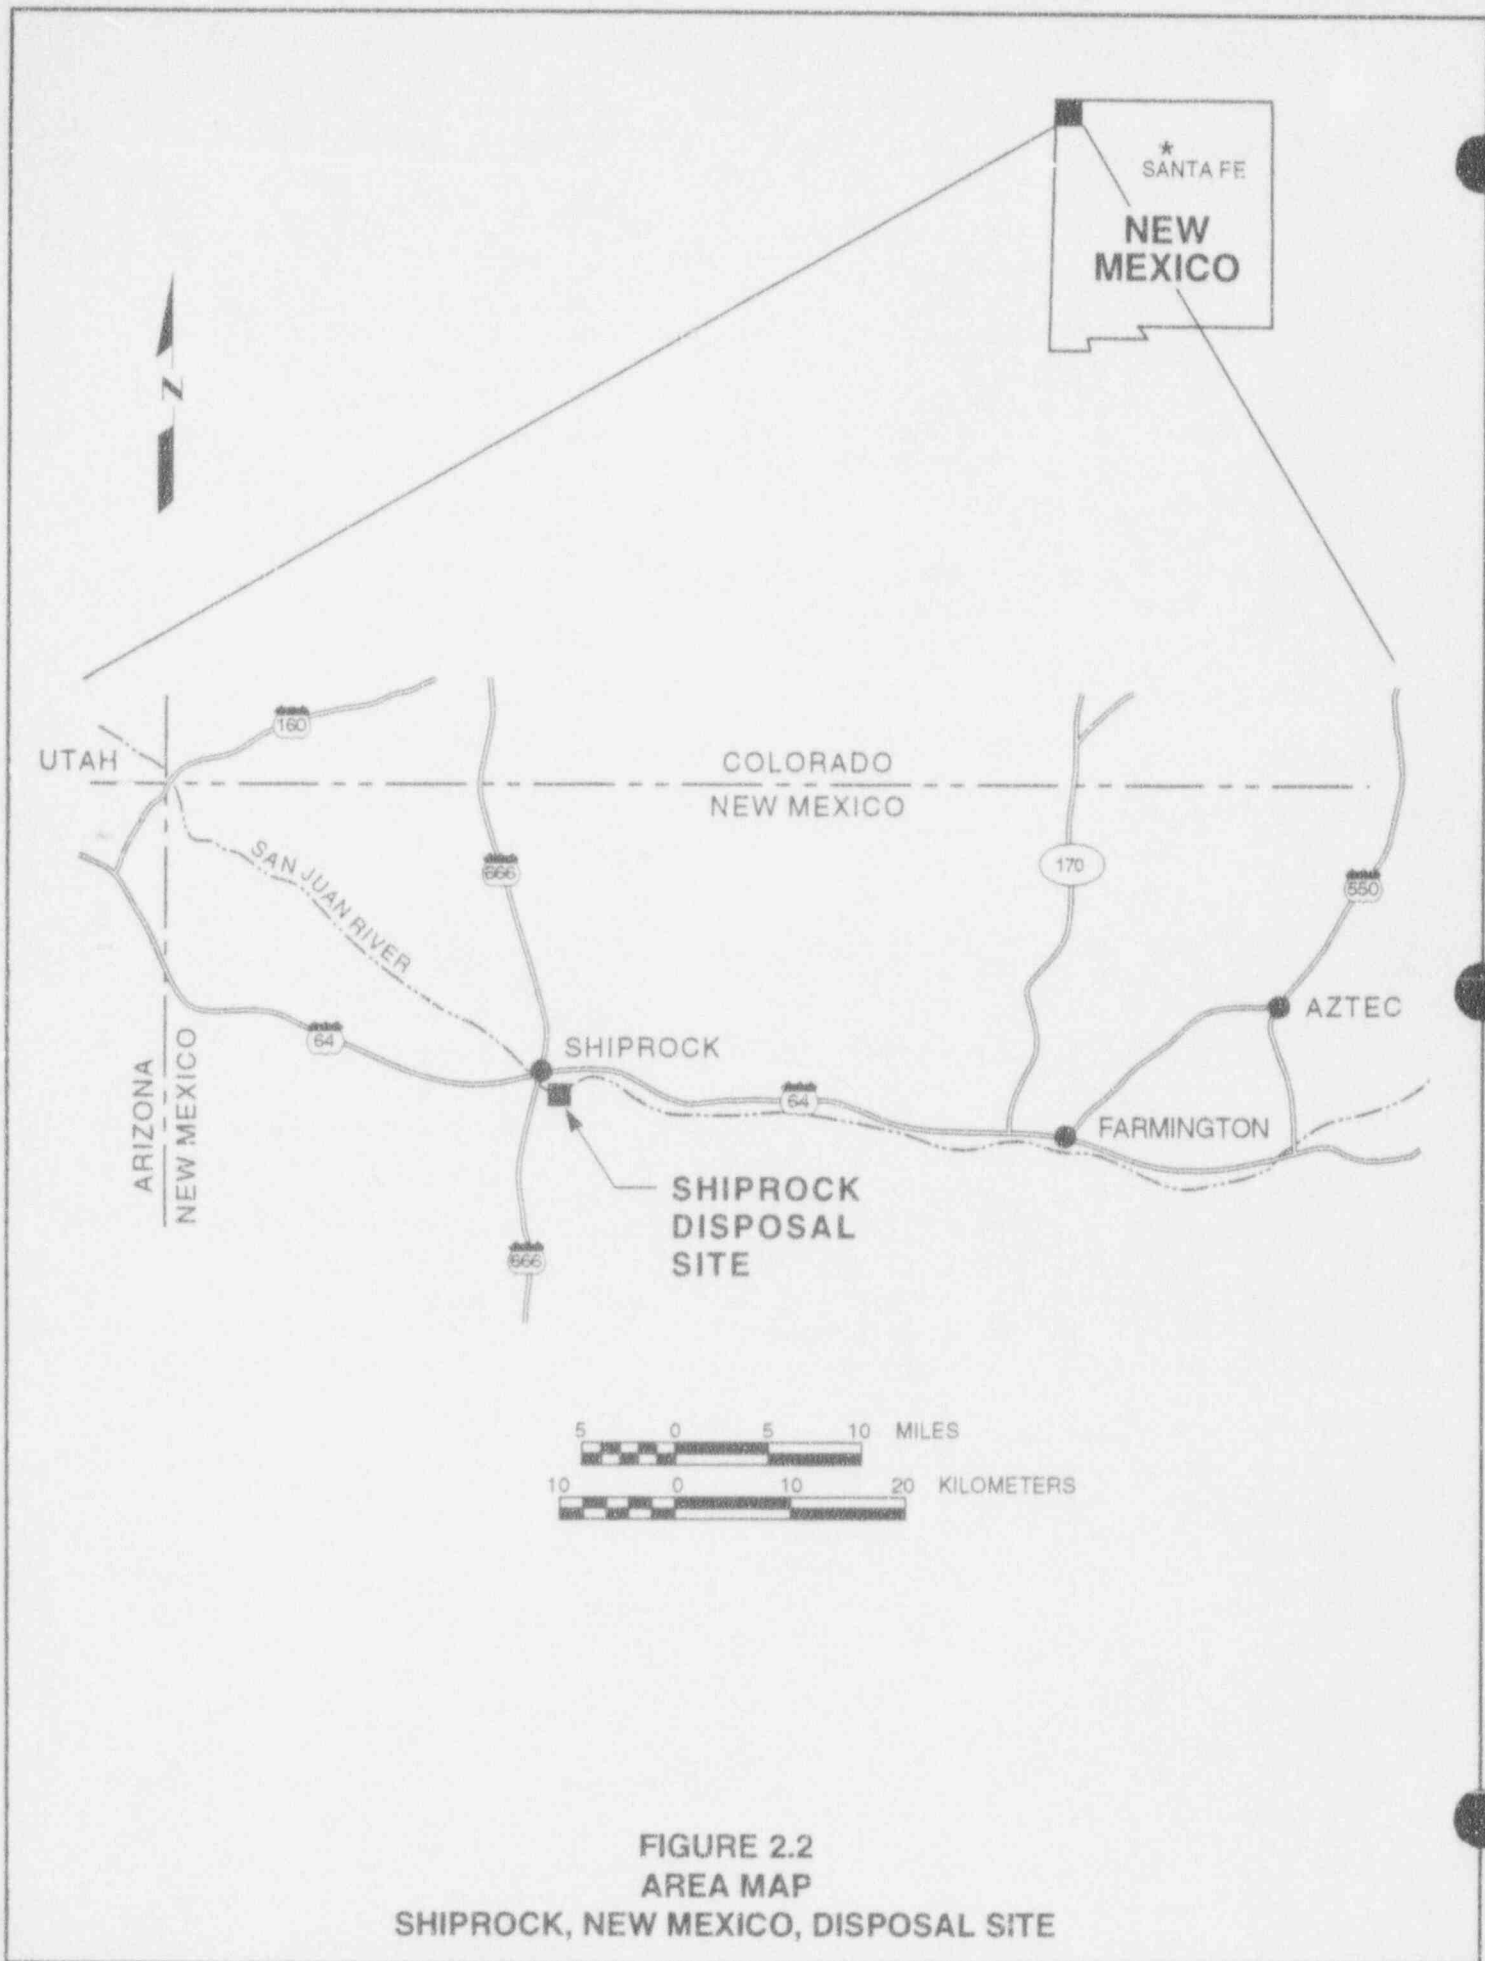


FIGURE 2.2
 AREA MAP
 SHIPROCK, NEW MEXICO, DISPOSAL SITE

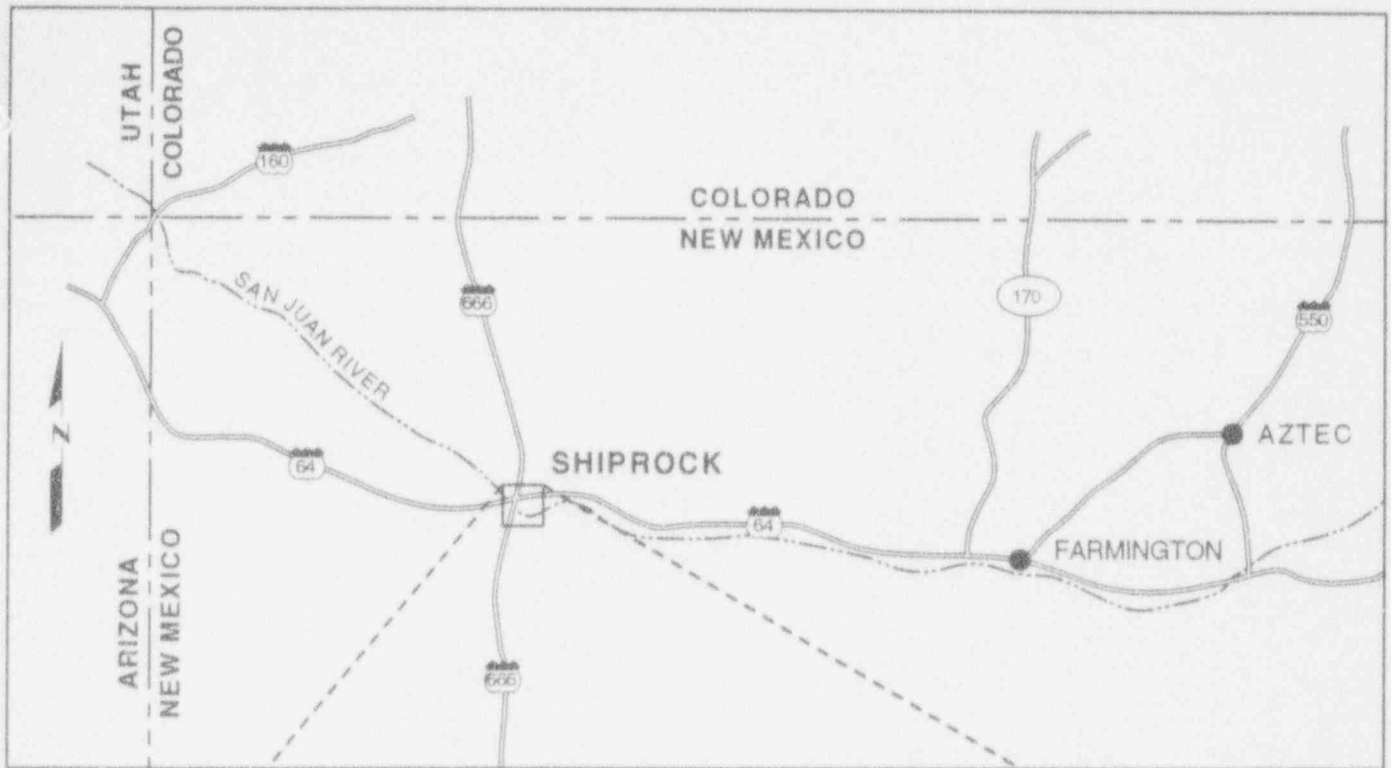


SHIPROCK DISPOSAL SITE

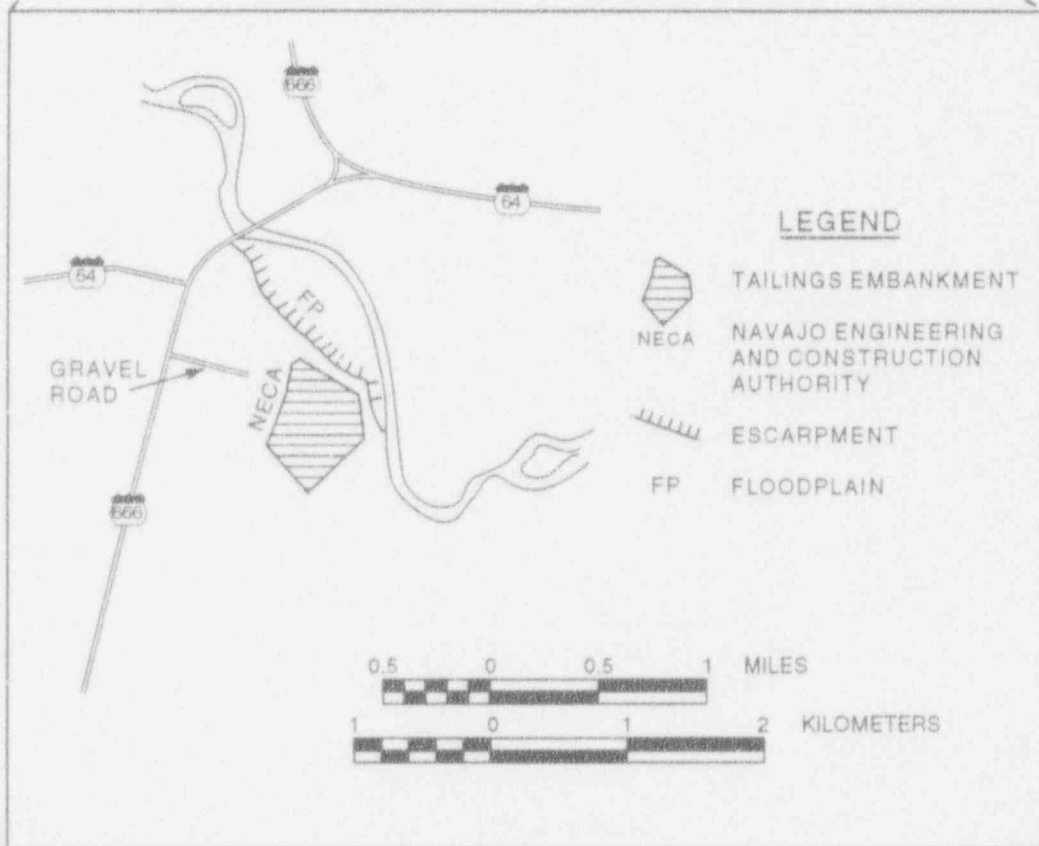

**FIGURE 2.3
DISPOSAL SITE LOCATION
SHIPROCK, NEW MEXICO**

REF: DOE, 1992b.

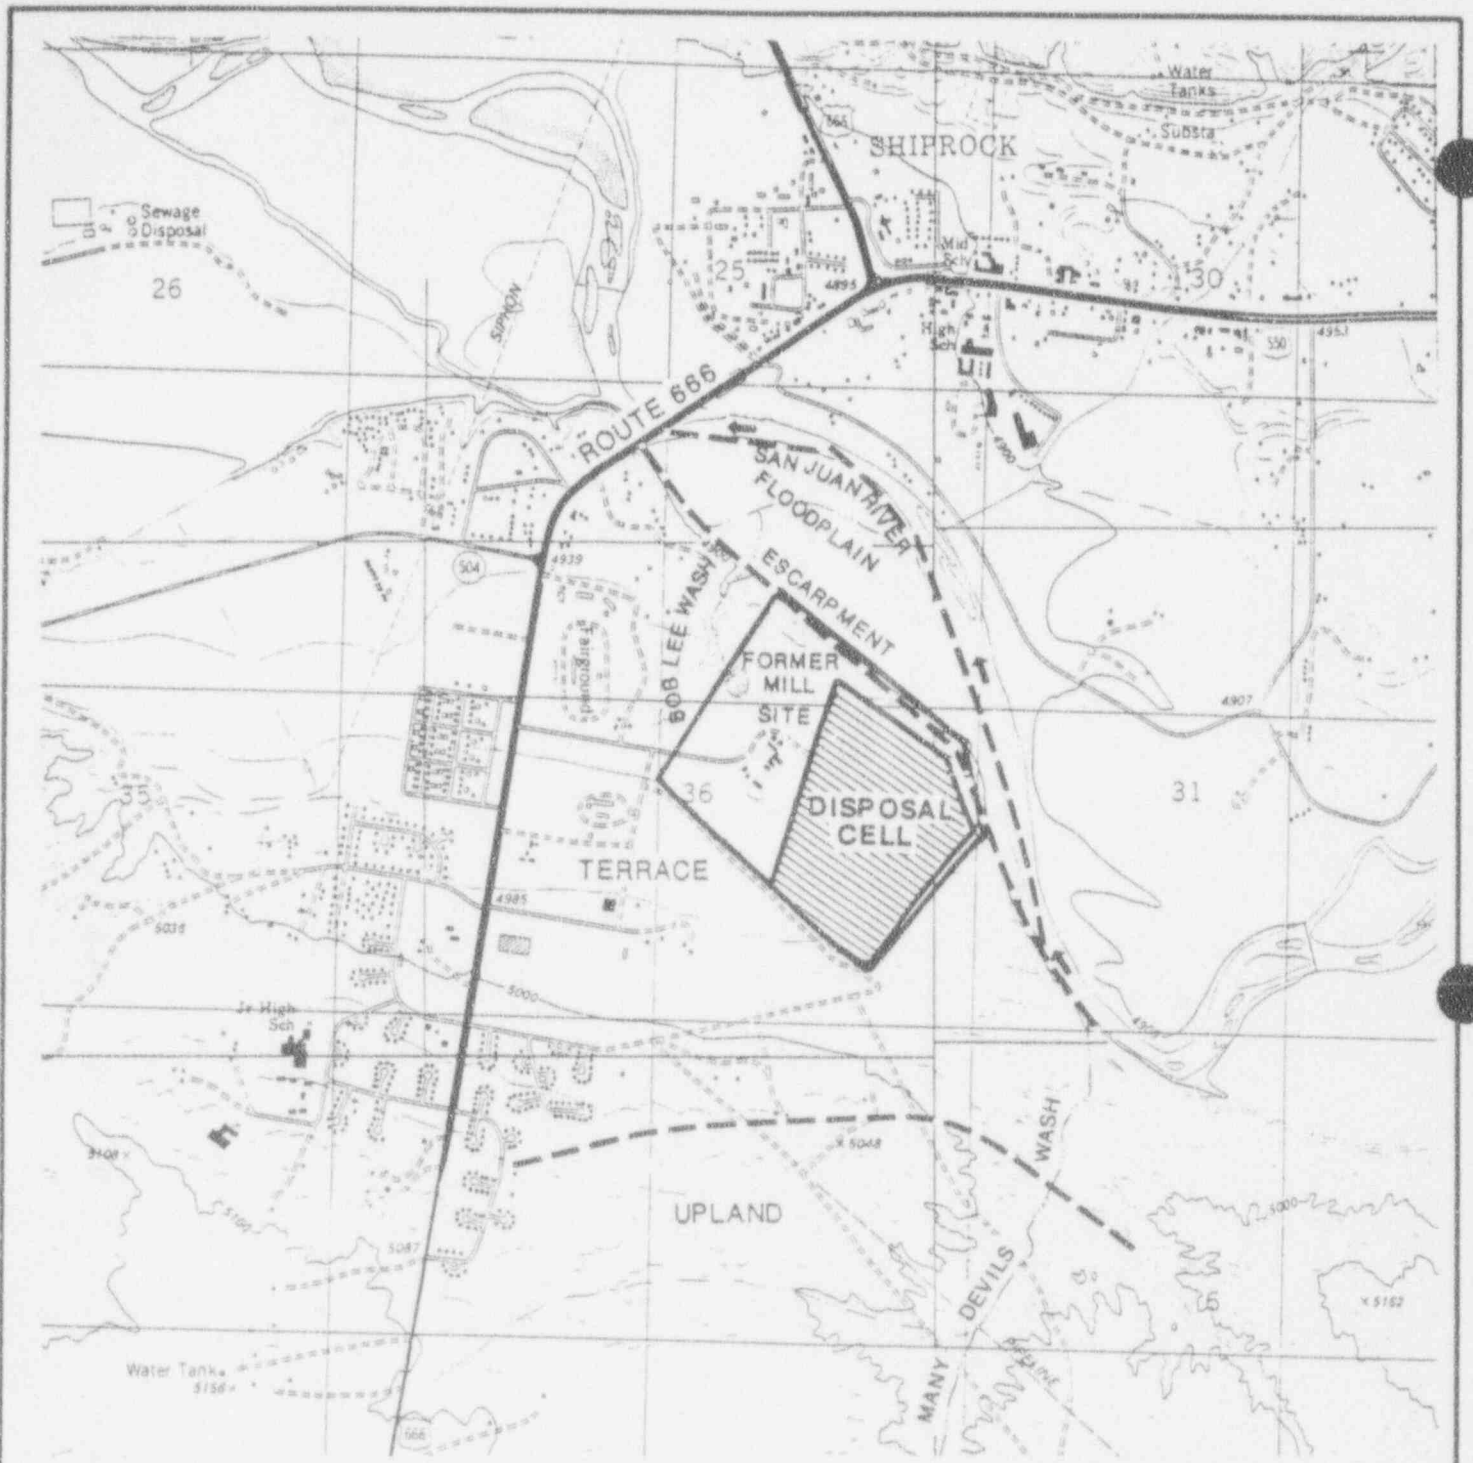

LEGEND

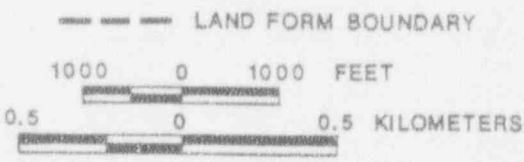


FIGURE 2.4
PHYSIOGRAPHIC SETTING
SHIPROCK, NEW MEXICO, DISPOSAL SITE

2.2.2 Neighboring land uses

The Shiprock disposal site is on the Navajo Indian reservation adjacent to the unincorporated town of Shiprock. Figure 2.5 shows the land uses in the vicinity of the site.

According to unofficial estimates of Shiprock's population in 1980 (FBDU, 1981), there were 90 people living within 0.5 mi (0.8 km) of the site and 2200 within 1 mi (1.6 km). In 1983, the population of Shiprock was estimated at 8000.

A mix of residential and commercial development exists near the site. A U.S. Public Health Service building, NECA facilities, Abandoned Mine Land Program office buildings, and fairgrounds are immediately west of the former mill site. West of U.S. Highway 666 is a residential area. The regraded borrow pit used to supply cover material for the disposal cell is south of the site.

Several residences are located west of Bob Lee Wash and southwest of the site. Approximately 80 people live in a residential area west of Bob Lee Wash (TAC, 1993). This community consists of approximately 15 households. A field search and inquiries in 1993 did not identify any domestic or other wells north of the San Juan River within or near the residential areas neighboring the site. Treated San Juan River water is provided to these residents by the Navajo Tribal Utility Authority (DOE, 1993). NECA is also connected to the municipal water and sewer systems.

2.2.3 Disposal site access and security

Two locked gates provide restricted access to the Shiprock disposal site (Figure 2.6): one to the disposal cell and the other to the terrace north and east of the disposal cell.

The locked gate at the far west corner of the security fence around the disposal site allows entry to the disposal cell. Access to the terrace north and east of the disposal cell is via the locked gate at the north end of the NECA compound. This gate is at the far west corner of the security fence around the northwest-directed outflow channel area. There are 21 perimeter signs providing notice to the public concerning the purpose of the site. Two site markers identifying the contents of the disposal cell are also located at the site.

Navajo authorities will be notified periodically of DOE site visits so that they may choose to send observers. Keys to the lock on the disposal site gates are held by the Navajo Nation. Additional keys are kept by the DOE UMTRA Project Manager; the Technical Assistance Contractor (TAC) UMTRA Project Manager; and the GJPO Supervisory, General Engineer (Table 2.1).

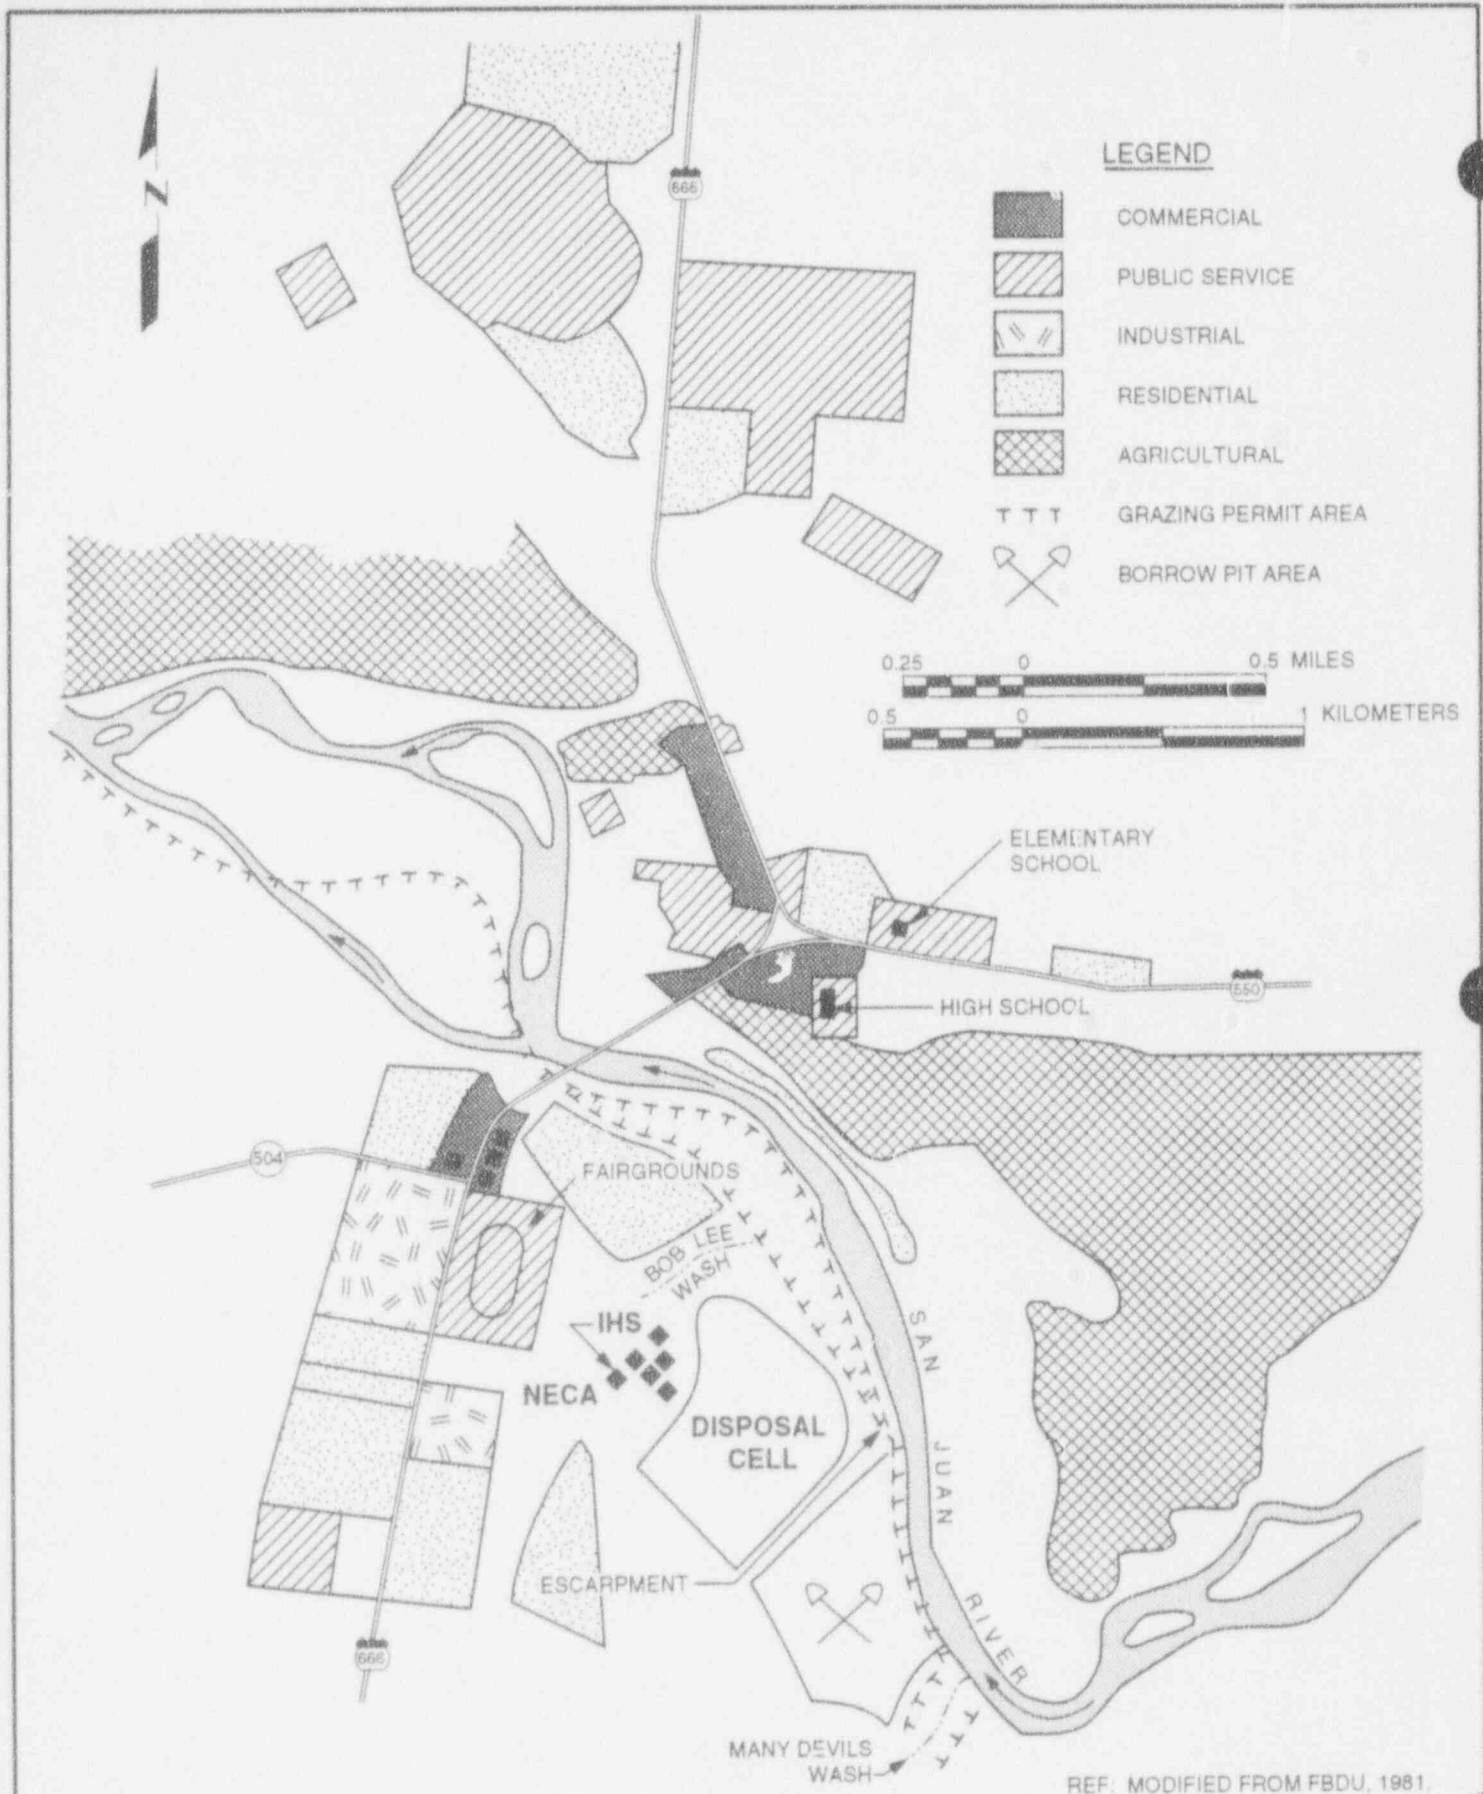


FIGURE 2.5
LAND USE IN THE VICINITY OF
SHIPROCK, NEW MEXICO, SITE, 1993

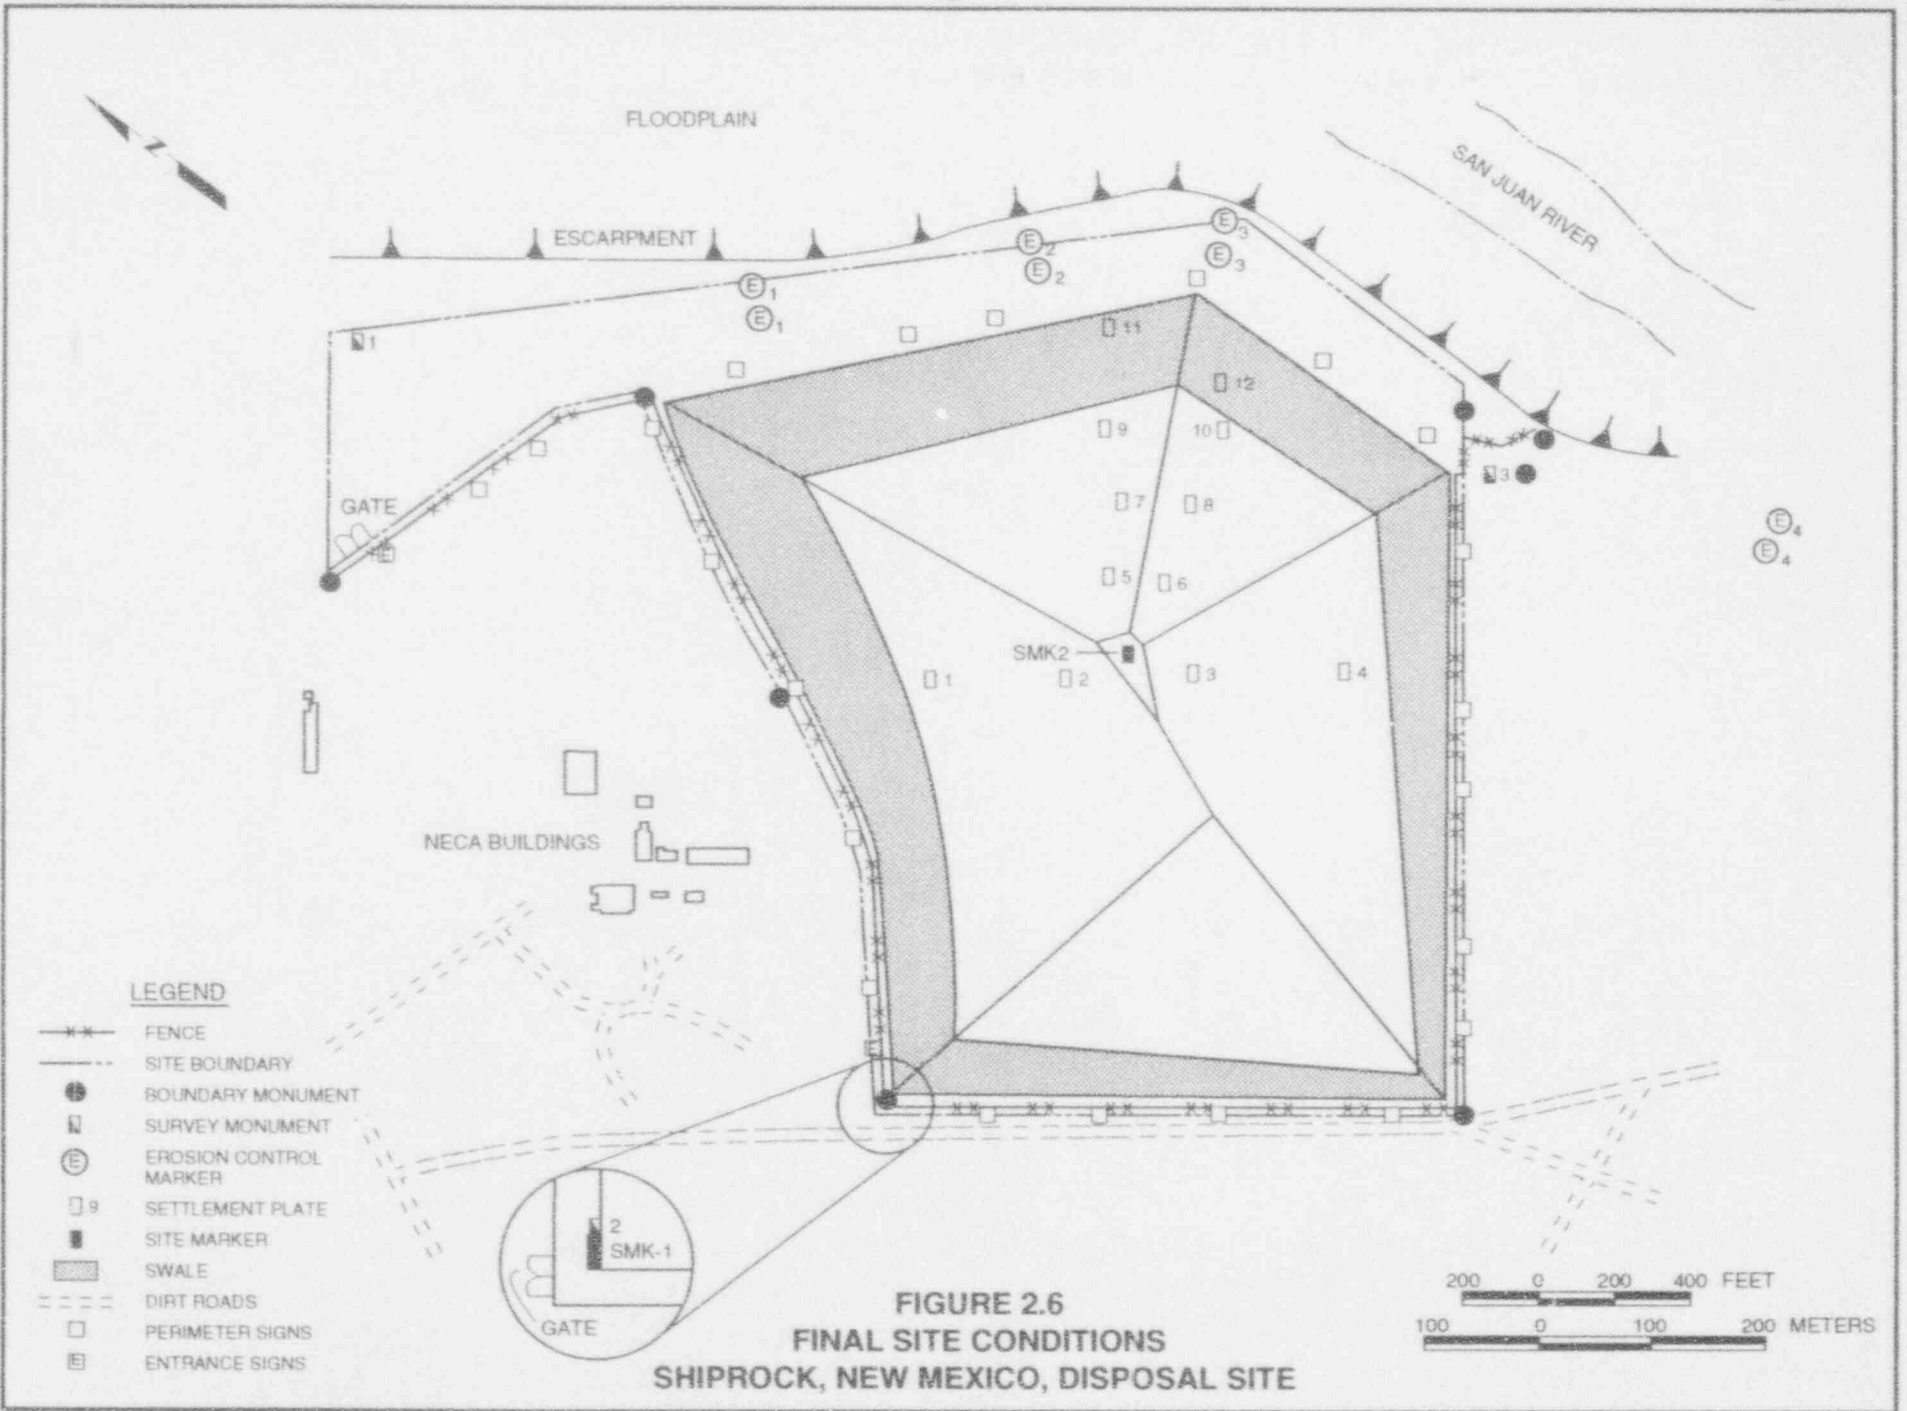


FIGURE 2.6
FINAL SITE CONDITIONS
SHIPROCK, NEW MEXICO, DISPOSAL SITE

Table 2.1 Shiprock disposal site access key holders

| Title and current contact | Telephone | Address |
|---|----------------|---|
| DOE UMTRA Project Manager (Albert Chernoff) | (505) 845-4022 | U.S. Department of Energy UMTRA Project Office 2155 Louisiana NE, Suite 4000 Albuquerque, New Mexico 87110 |
| TAC UMTRA Project Manager (Roger Nelson) | (505) 888-1300 | Jacobs Engineering Group Inc. 2155 Louisiana NE, Suite 10,000 Albuquerque, New Mexico 87110 |
| Supervisory, General Engineer GJPO (Joe Virgona) | (303) 248-6006 | 2597 B 3/4 Road Grand Junction, Colorado 81503 |


The scheduled Shiprock disposal site inspections (Section 6.0) will monitor the effectiveness of the security measures at the Shiprock disposal site. The DOE 24-hour emergency telephone number on the entrance signs (Section 4.0) and agreements with local agencies to notify the DOE in the event of an emergency or breach of site integrity (Section 11.0) will provide additional security measures.

2.2.4 Disposal cell design

The final condition of the Shiprock disposal cell is shown in Figure 2.6. The abovegrade disposal cell is an asymmetrical pentagon with a maximum side length of 1800 ft (550 m) and a minimum side length of 800 ft (244 m). The maximum height of the disposal cell is approximately 48 ft (15 m) above the original ground surface. The sides of the disposal cell have a maximum slope of one vertical to five horizontal. The top varies in slope from 2 to 4 percent. The disposal cell covers approximately 77 ac (31 ha).

Figure 2.7 shows a typical cross section of the Shiprock disposal cell cover. The cover consists of two components: an infiltration/radon barrier and an erosion protection layer. The infiltration/radon barrier is 6.4 ft (2 m) thick on the top and 7.0 ft (2.1 m) thick on the sides. This layer consists of predominantly sandy silt compacted to a hydraulic conductivity of not more than 2.5×10^{-5} centimeters per second (cm/s). It was designed to protect the groundwater by minimizing infiltration into the disposal cell and reduce radon emanations from the disposal cell to less than 20 picocuries per square meter per second ($\text{pCi}/\text{m}^2\text{s}$).

The erosion protection layer, on the top consists of a 1-ft (0.3-m) thick layer of Type A riprap underlain by a 6-inch (in) [15-centimeter (cm)] thick layer of bedding material. For the sides, this layer consists of a 1-ft (0.3-m) thick layer

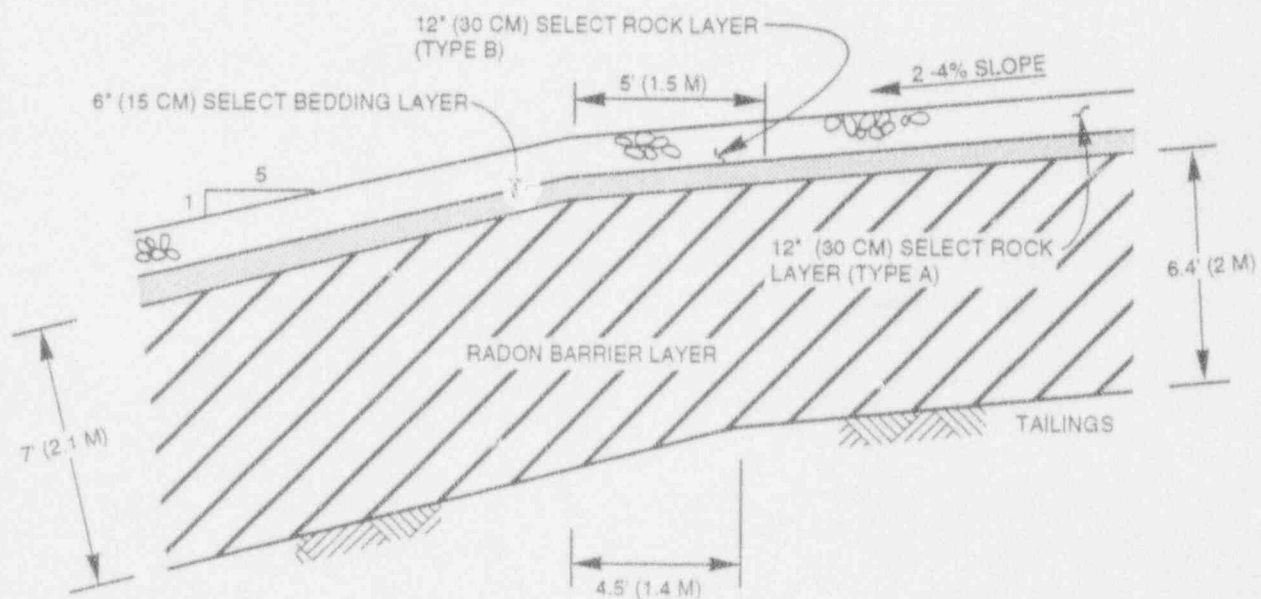

TYPICAL COVER SECTION

FIGURE 2.7
DISPOSAL CELL COVER CROSS SECTION
SHIPROCK, NEW MEXICO, DISPOSAL CELL

of Type B riprap underlain by a 6-in (15-cm) thick layer of bedding material. The as-built rock cover is twice the required thickness as indicated by site calculations for erosion control.

A rock-lined drainage ditch diverts surface water runoff around and away from the disposal cell to a rock-lined dissipation area.

2.2.5 Design criteria

The surface conditions of the disposal cell will be monitored during the scheduled inspections to determine whether the disposal cell and erosion protection measures are performing as designed. Guidelines to be followed when inspecting the disposal cell and criteria for corrective actions or repairs are as follows:

- Crest—Observations will be made in all directions for any features that are anomalous or unexpected and that may require a closer inspection. Inspectors will walk around the edge and along diagonal transects of the crest. Additional transects, at approximately 50-yd (46-m) intervals, will be walked along the sideslopes. The inspectors will search for evidence of any differential settling, subsidence, or cracks. The rock cover will be examined for evidence of rapid deterioration. Individual rocks will be examined for excessive fracturing, oxidation, or other signs of deterioration. Areas of sand accumulation and volunteer plant growth will be noted.
- Slopes—Modifications to the disposal site are most likely to occur on the lower portions of the slopes. Therefore, a careful examination at the toe of the slope will be a key part of this inspection. Settlement or sliding, although highly unlikely, will be apparent by the presence of bulges and depressions, cracks, or scarps. Any localized change in vegetation will be described and examined. During the inspections, the slopes will be examined for evidence of animal intrusion, burrowing, changes in vegetation, and human activity. Cattle, sheep, or wildlife may inadvertently wander onto the site, but they are not likely to remain.
- Drainage ditch and drainage channels—The inspectors will walk along the entire length of each channel to determine whether the channels have been functioning and can be expected to continue to function as designed. The channels and sideslopes will be examined for evidence of erosion or sedimentation, slides, incipient erosion channels, debris, or growing vegetation. The sideslopes will also be examined for evidence of piping or burrowing by animals, which could lead to sloughing of material into the channel.

3.0 SITE DRAWINGS AND PHOTOGRAPHS

At the completion of remedial action, the Shiprock disposal site as-built conditions were documented with as-built drawings, baseline photographs, and aerial photographs (MK-F, 1987a). This information will be used to illustrate baseline conditions against which future conditions at the disposal site can be compared.

3.1 DISPOSAL SITE MAP AND DRAWINGS

A site atlas has been prepared that includes a vicinity map, a topographic map, and a disposal site map. The site atlas will be updated as necessary. All of the drawings are archived in the permanent site file as identified in the permanent site file index (Attachment 3). The necessary documentation from the site file will be provided to the GJPO following licensing for use in the DOE long-term surveillance program. Any new maps and drawings prepared during the long-term surveillance program will be maintained and archived by the GJPO.

3.1.1 Disposal site vicinity map

A disposal site vicinity map has been prepared for the Shiprock site and placed in the site file. The map encompasses an area with a radius of approximately 1.5 mi (2.4 km) from the center of the disposal site.

The Shiprock disposal site vicinity map shows the disposal site boundary; the disposal cell; the latitude and longitude, section, township, range, and principal meridian of the site; the surface drainage systems; and the roads.

3.1.2 Disposal site map

A topographic survey was made of the Shiprock disposal site following completion of the remedial action. The map has a scale of 1 in = 200 ft and a contour interval of 2 ft. In addition to topography, the map shows the following:

- Disposal site property boundary, fences, gates, and access roads.
- Outline of the base and crest of the disposal cell.
- Permanent site surveillance features (e.g., monuments, markers, and signs).
- Settlement plates.
- Site coordinate system.

The Shiprock disposal site map is presented in Plate 1.

The Shiprock disposal site map will serve as the base map for site inspections (Section 6.4). A new, separate inspection map will be prepared after each inspection as necessary. Each site inspection map will indicate the year of the inspection and the type of inspection. All site base maps and periodic site inspection maps will become part of the Shiprock permanent site file.

3.1.3 Disposal site as-built drawings

Upon completion of remedial action, as-built conditions were documented in final as-built drawings. The as-built drawings are included in the Shiprock completion report (MK-F, 1987a) and are in the Shiprock permanent site file. The as-built drawings will be used to document changes in site conditions or to develop corrective action plans, if required.

3.2 SITE BASELINE PHOTOGRAPHS

A photographic record of final site conditions is located in the Shiprock permanent site file. This record consists of a series of aerial and ground photographs that provide a baseline visual record to complement the as-built drawings.

Ground photographs were taken both during and after construction to record site construction activities and final site conditions. The post-construction photographs provide an orientation tool prior to site inspections and provide a baseline record of the surveillance features. The baseline photographs can be compared to ground photographs taken during site inspections to see if there are any significant differences in the Shiprock disposal site's appearance.

3.3 SITE AERIAL PHOTOGRAPHS

Aerial photographs for the Shiprock disposal site were taken in 1987 after surface remedial action was completed. These aerial photographs provide a permanent record of final site conditions. The photographs will be used to monitor changes in site conditions (e.g., erosion patterns, vegetation changes, land use) over time and to provide a useful orientation tool prior to disposal site inspections. Aerial photographs are contained in the Shiprock permanent site file. The need for new aerial photographs will be evaluated at 5-year intervals, beginning with the year the license becomes effective for the Shiprock site. The specifications for aerial photographs at the Shiprock disposal site are summarized in Table 3.1. More detailed guidance is provided in Attachment 3 of the *Guidance for Implementing the UMTRA Project Long-term Surveillance Program* (DOE, 1992a).

3.4 SITE INSPECTION PHOTOGRAPHS

Photographs will be taken during site inspections to document conditions of the disposal cell and the disposal site. These photographs will provide a continuous record for monitoring changing conditions over time. These photographs can be compared with the baseline photographs to determine whether the integrity of the site has been affected.

Table 3.1 Aerial photography specifications for the Shiprock disposal site

| | |
|--------------------------|--|
| Area to be photographed | Final disposal site plus a minimum of 0.25 mi (0.4 km) beyond site boundaries unless site conditions require otherwise. |
| Products to be delivered | One set of vertical color, infrared stereo contact prints, 9-in (23 cm), scale 1 in = 200 ft (1 cm = 24 m) (representation fraction 1:2400); double weight, glossy, not trimmed. One index map, scale 1 in = 200 ft (1 cm = 24 m); flight lines and frame numbers will be provided. One set of 2 each of low and high oblique photographs (and negatives) in natural color, 8- x 10-in (20- x 25-cm); or 9- x 9-in (23- x 23-cm) contact prints. |
| Flight date | To be determined upon the acceptance of this LTSP. |
| Camera | Precision, 9- x 9-in (23- x 23-cm) format for vertical photos. A 35-millimeter (single lens reflex) or larger format camera for oblique photos is acceptable. |
| Film | Eastman-Kodak Aerochrome Infrared 2443, or its equivalent, for vertical photos. Eastman-Kodak Ektacolor, or its equivalent, for oblique photos. |
| Filter | Wratten Nos. 12 or 15 for infrared photos. Skylight filter for color photos. |
| Flight line coverage | 60 percent end overlap; 30 percent average side overlap. |
| Ground control | Control stations will be second order, Class 1, for horizontal control and third order for vertical control (standard U.S. Geological Survey map accuracy specifications). |

Each photograph will be recorded individually on the photo log form (Attachment 4). An appropriate description of the feature photographed and the corresponding azimuth, as necessary, will be entered on the log form. Copies of photographs and the photo log from each site inspection will be included in the site inspection report.

Whenever possible, a photograph should include a reference point such as a survey monument, boundary monument, site marker, or monitor well. For large-scale features such as drainage ditches or disposal cell slopes, a north arrow and scale should be included for reference.

For specific areas where the photograph is used to monitor changes over time, the distance from the feature and the azimuth will be recorded, and all subsequent photographs will be taken from the same orientation to provide a more accurate picture of changing conditions. The magnetic declination of the compass will be corrected for true north. This information will also be provided on the site inspection checklist and photo log.

All site inspection photographs taken, as well as all corresponding photo log forms, will be maintained in the Shiprock permanent site file (Attachment 3).

3.4.1 Features to be photographed

The disposal site features documented in the standard set of ground photographs will include the following:

- Monuments, signs, site markers, and erosion control markers.
- Fences, gates, and access roads.
- The disposal cell (crest, sideslopes, apron, and surrounding area). Panoramic sequences of photographs from selected vantage points may be used for this purpose.
- Sideslopes and changes along the grade between the topslopes and sideslopes.
- Diversion ditches.
- Off-site features that the inspector deems significant and that may affect the site in the future. These may include areas of the escarpment with significant sloughing, the main point of fluvial attack of the escarpment to the east of the site, and headward erosion from Bob Lee Wash at the northwestern corner of the site.
- Volunteer vegetation on the disposal cell and any other vegetation that may affect the integrity of the site.

- Aeolian sedimentation or erosion.
- Any other evidence of erosion the inspector deems significant (gullies, rills, etc.).
- Erosion protection material (riprap).

Any Shiprock disposal site feature or condition that requires the inspectors to make a written comment, explanation, or description will be photographed. Photographs will be taken to provide a record of developing trends in site conditions. These records will be used to make decisions concerning additional inspections, custodial maintenance or repairs, or corrective actions. The number of photographs, the view angles, and the lenses used will be up to the judgment of the inspectors, keeping in mind site conditions, lighting conditions, and the goal of having sufficient photographs for agency review.

4.0 PERMANENT SITE SURVEILLANCE FEATURES

The permanent surveillance features at the Shiprock disposal site include survey and boundary monuments, erosion control markers, site markers, and entrance and perimeter signs. Eight boundary monuments and three survey monuments define the corners of the legal boundaries of the disposal site's fenced, irregularly shaped perimeter (Plate 1). Twenty-one warning signs were placed at spaced intervals around the perimeter of the disposal site so that one or more signs will be visible in daylight to a person approaching from any direction. Warning signs were also posted at the entrance gates to the site. One of the entrance signs and one granite site marker were placed at the entrance gate to the disposal cell located at the southwest corner. A second granite site marker was placed near the center of the crest of the disposal cell.

The surveillance features were constructed and emplaced in accordance with the specifications described below.

4.1 SURVEY MONUMENTS

The three survey monuments (SM-1 through SM-3) at the disposal site consist of reinforced concrete monuments with Berntsen Model RT-1 metal markers cast into their tops (Figure 4.1). The magnet within the metal markers and the four metal bars used as reinforcement for the concrete will allow a metal detector to locate monuments should they become buried over time. The monuments extend approximately 1 ft (0.3 m) above the ground surface and 5 ft (1.5 m) below ground.

The three survey monuments are located on the north, west, and east corners of the site and establish a permanent horizontal control based on the project grid system (Table 4.1). Survey monument (SM)-1 is just inside the security fence near the edge of the terrace north of the disposal cell (see Figure 2.6 and Plate 1). SM-2 is just inside the entrance gate near the southwest corner of the disposal cell. SM-3 is located just outside the security fence near the east corner of the disposal cell. The monuments are referenced to the southeast corner of Section 36, Township 30 North, Range 18 West. Coordinates for the survey and erosion control monuments are presented in Table 4.1. These monuments were surveyed to second-order survey standards in accordance with the DOE's LTSP guidance document (DOE, 1992a).

4.2 BOUNDARY MONUMENTS

Berntsen federal aluminum survey monuments, Model A-1, were used for the eight boundary monuments (Figure 4.2). Ceramic magnets are epoxied in the cap and base of each monument and are vertically oriented so that they can be detected easily if they become covered. Each 4-ft (1.2-m) long monument is set with the cap flush with the ground surface.

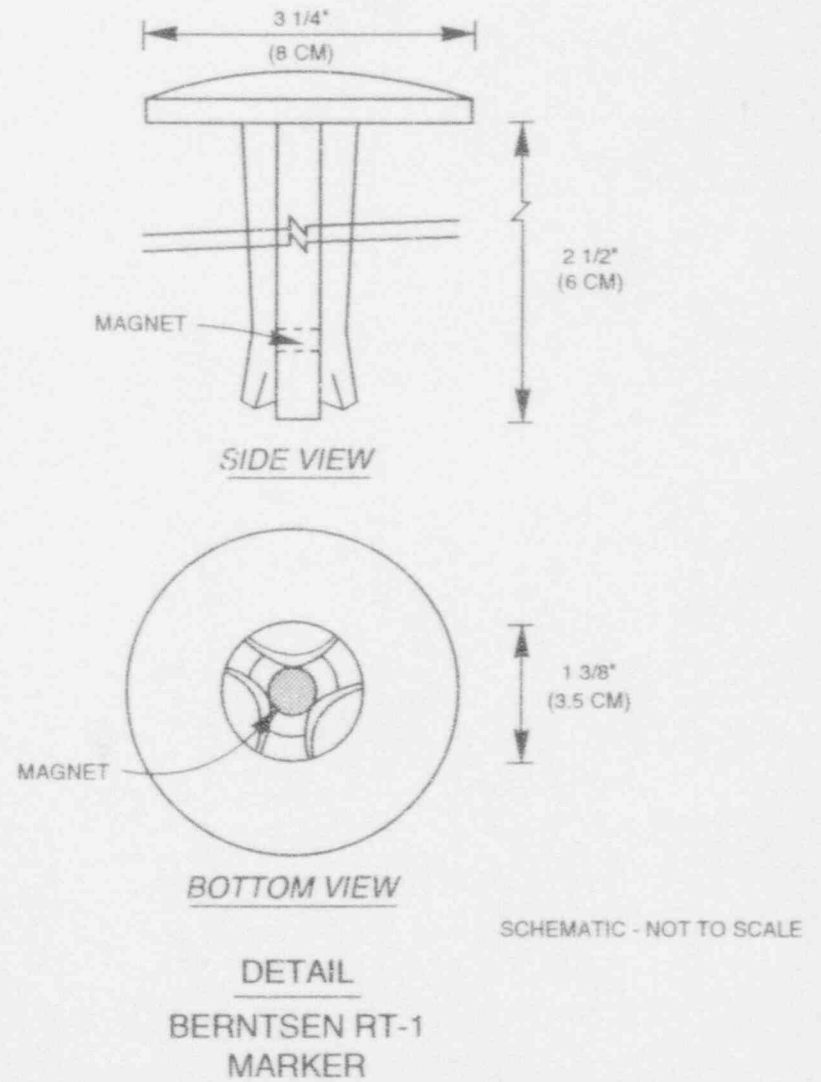
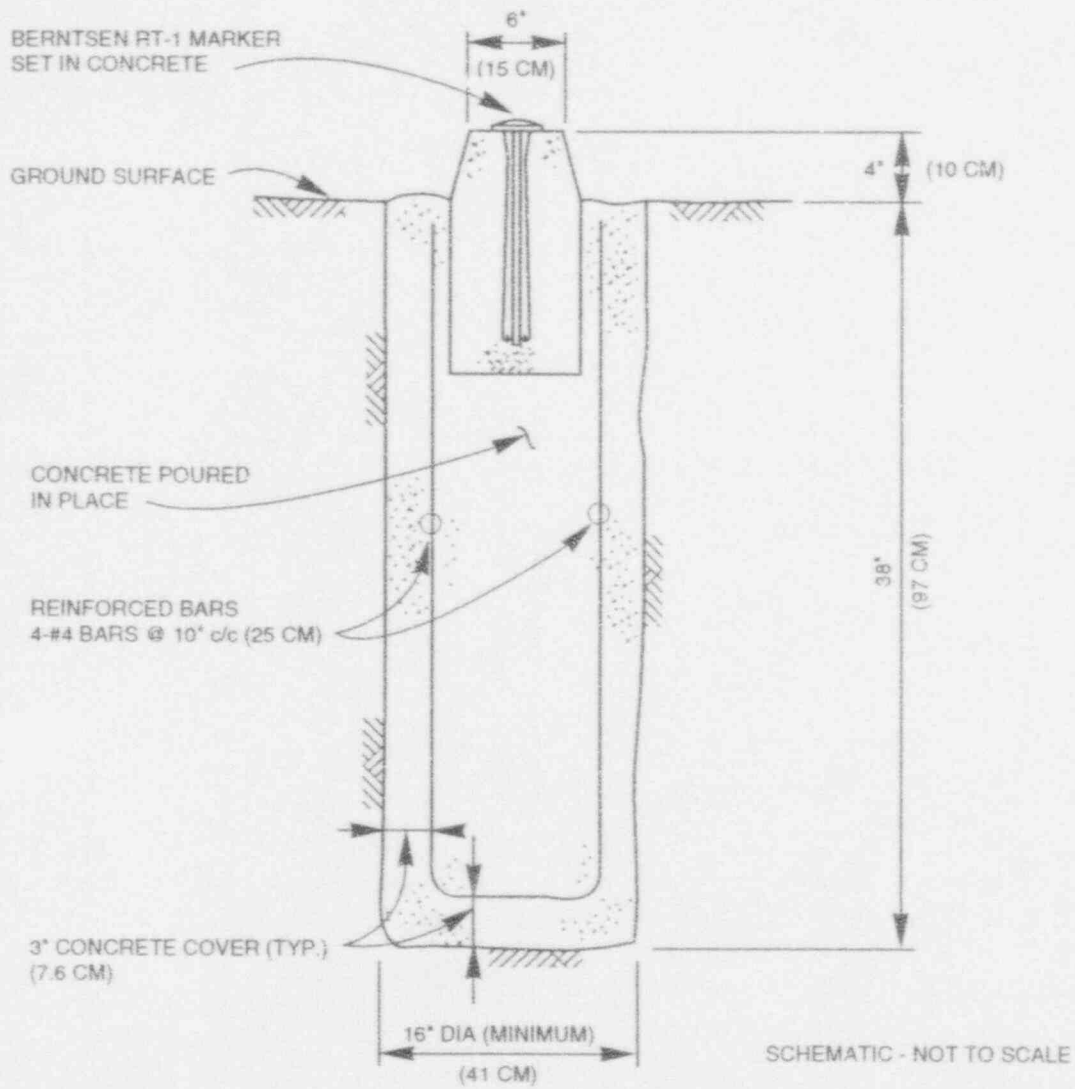


FIGURE 4.1
TYPICAL SURVEY MONUMENT
SHIPROCK, NEW MEXICO, DISPOSAL SITE

REF: MK-F, 1987b.

Table 4.1 Survey coordinates and elevations for survey monuments and erosion control markers at the Shiprock, New Mexico, disposal site

| Feature | Coordinates ^a | | Elevation (ft) |
|-----------------------|--------------------------|------------|-------------------|
| | North (N) | East (E) | |
| Survey monument No. 1 | 9988.716 | 9996.083 | 4940.59 |
| Survey monument No. 2 | 7372.778 | 9660.897 | 4971.68 |
| Survey monument No. 3 | 7582.866 | 11,758.705 | 4957.71 |
| Erosion marker No. 1 | 9287.530 | 10,725.032 | 4956.33 |
| Erosion marker No. 1A | 9260.727 | 10,711.991 | 4957.18 |
| Erosion marker No. 2 | 8770.181 | 11,396.851 | 4959.36 |
| Erosion marker No. 2A | 8744.071 | 11,382.744 | 4959.36 |
| Erosion marker No. 3 | 8467.083 | 11,771.022 | 4960.59 |
| Erosion marker No. 3A | 8451.638 | 11,745.680 | 4959.38 |
| Erosion marker No. 4 | 7030.900 | 12,217.951 | 4958.95 |
| Erosion marker No. 4A | 7020.818 | 12,189.691 | 4958.22 |

^aSee Figure 2.6 for relative locations of these features. The coordinates are based on the project survey control point (N 10,000.00, E 10,000.00) located at the southeast corner of Section 36, Township 30 North, Range 18 West.

BERNTSEN FEDERAL ALUMINUM BOUNDARY MONUMENT, MODEL A-1, STANDARD LOGO CAP

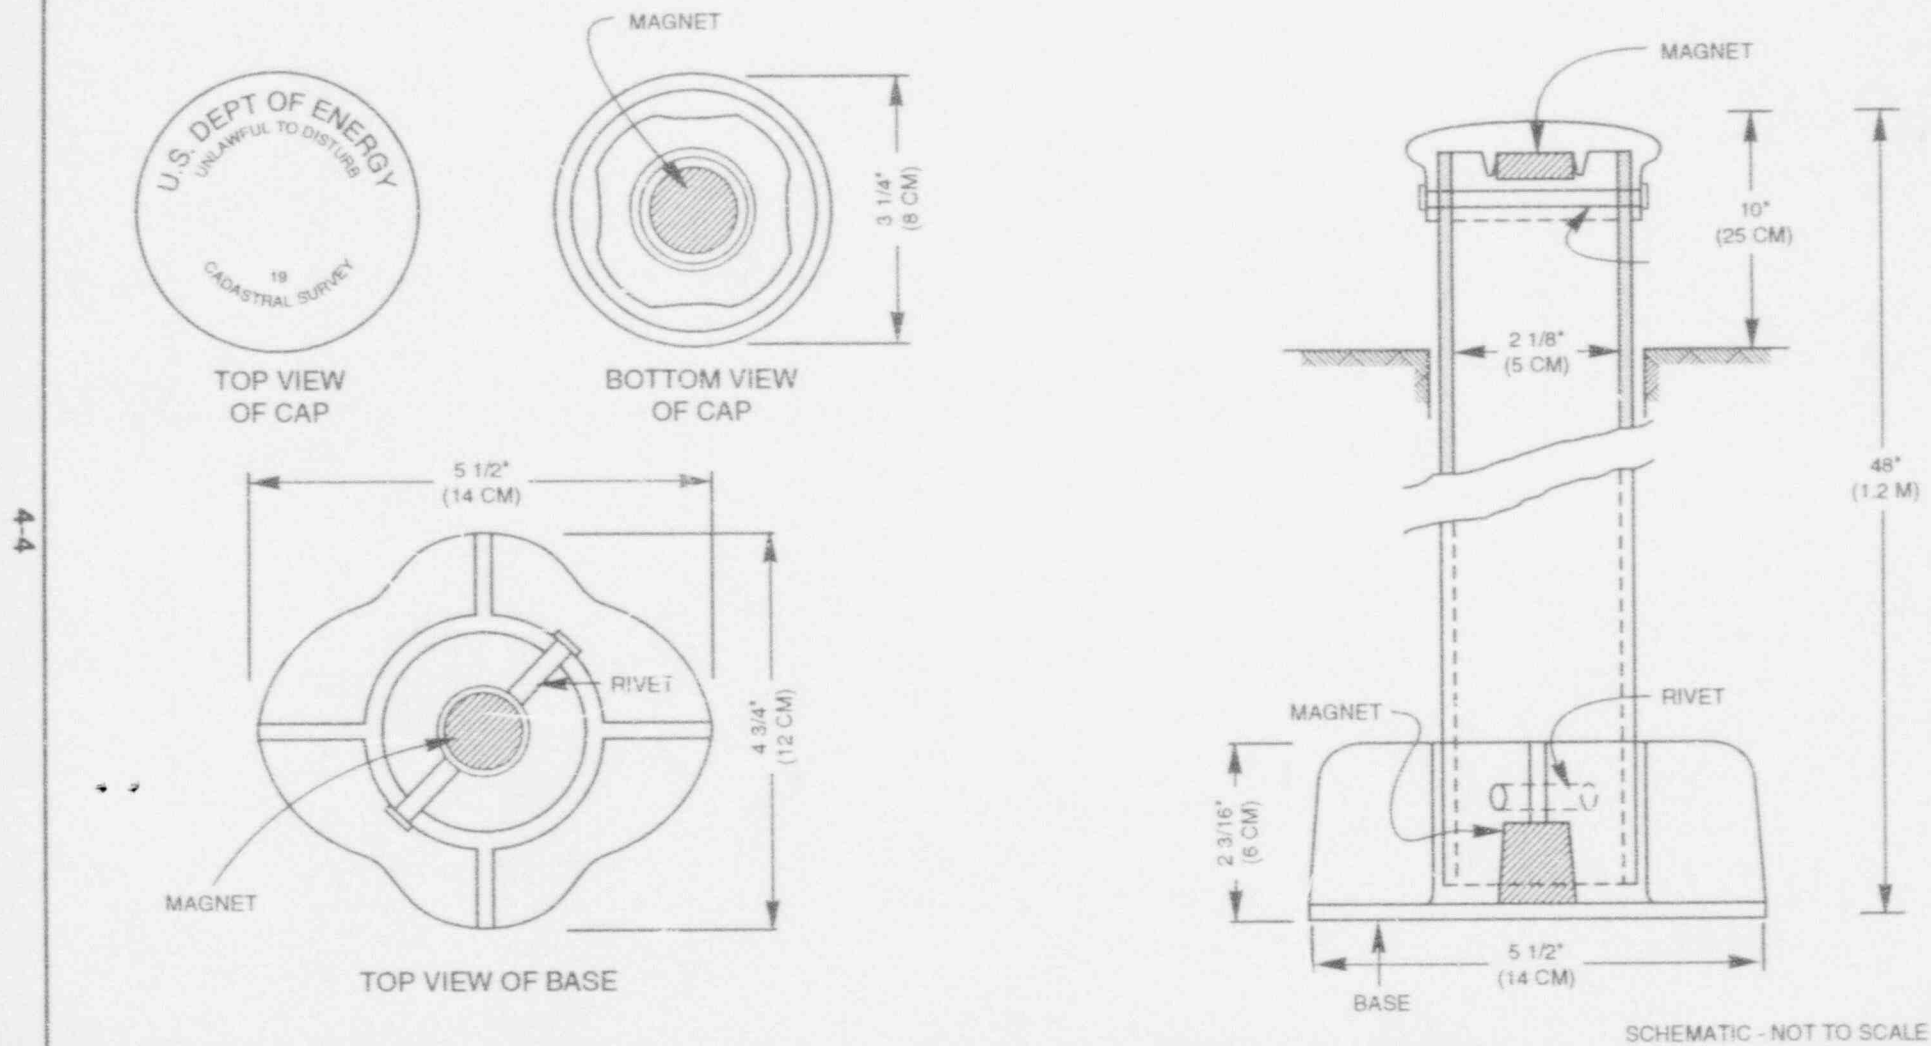


FIGURE 4.2
TYPICAL BOUNDARY MONUMENT/EROSION CONTROL MARKER
SHIPROCK, NEW MEXICO, DISPOSAL SITE

REF: MK-F, 1987b.

4.3 SITE MARKERS

Two unpolished granite site markers were installed on the Shiprock disposal cell. Site marker SMK-1, located near the entrance to the disposal cell, is set in a bed of reinforced concrete that extends 4.3 ft (1.3 m) below ground surface (Figure 4.3). Site marker SMK-2, located at the crest of the disposal cell, is set in a bed of reinforced concrete that extends to the bottom of the riprap layer (Figure 4.4). The inscriptions on the two site markers identify the general location of the Shiprock disposal cell, the boundary of the site, the date of closure (September 1986), the tonnage of tailings (2,520,000 tons), and the curies of radioactivity (1746 curies of Ra-226). The international radiation symbol is also inscribed in each marker (Figure 4.5).

4.4 ENTRANCE AND PERIMETER SIGNS

Signs are posted on the two entrance gates to the Shiprock disposal site. The entrance signs are of the dimensions and specifications shown in Figure 4.6. The 21 perimeter signs mounted on the fence around the disposal site display the international symbol indicating the presence of radioactive materials and state that the site contains uranium mill tailings and that trespassing is forbidden. The perimeter signs are of the dimensions and specifications shown in Figure 4.6. The locations of perimeter signs are shown on Plate 1.

4.5 SETTLEMENT PLATES


The Shiprock disposal cell contains 12 settlement plates (Figure 4.7). These plates were installed during construction across the northeastern portion of the cell where fill was placed over substantial thicknesses of slime tailings (Figure 2.6 and Plate 1). These settlement plates were monitored during and immediately following construction to determine whether any differential settlement was occurring. The monitoring data indicated that settlement was essentially complete before final grading was performed.

The settlement plates were not intended to be used as permanent surveillance features, and there are no plans to monitor them routinely. However, if future site inspections detect settling problems in the northeastern portion of the disposal cell, these plates could be surveyed. Table 4.2 shows the elevations of the settlement plates at the completion of remedial action. These elevations are considered the baseline against which any future measurements would be compared.

4.6 ADDITIONAL SITE SURVEILLANCE FEATURES


4.6.1 Erosion control markers

Four pairs of erosion control markers (eight total) were installed along the edge of the escarpment at the locations shown in Figure 2.6 and in Plate 1. The erosion control markers are Berntsen Model A-1 boundary monuments

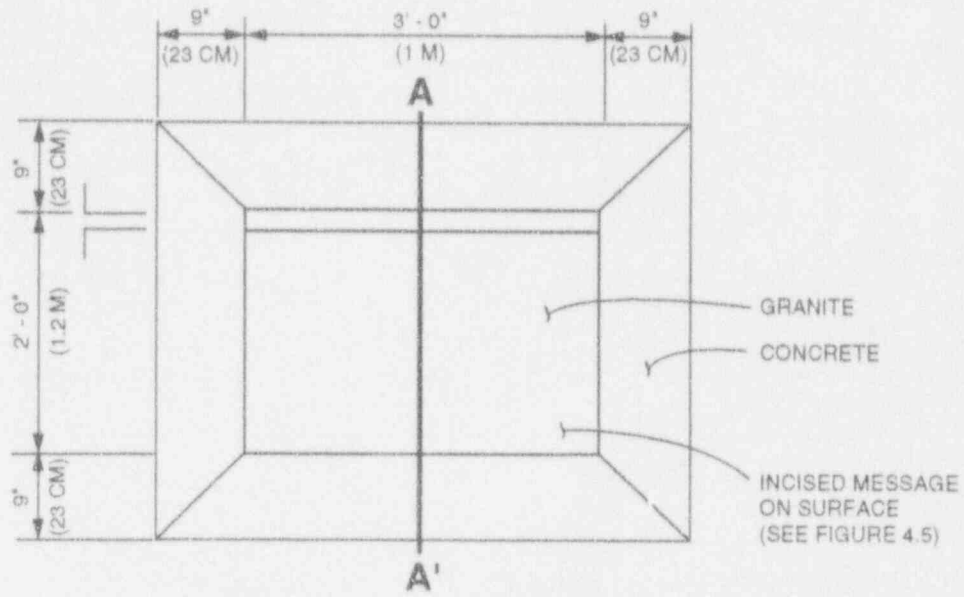

PLAN VIEW

SCHEMATIC - NOT TO SCALE

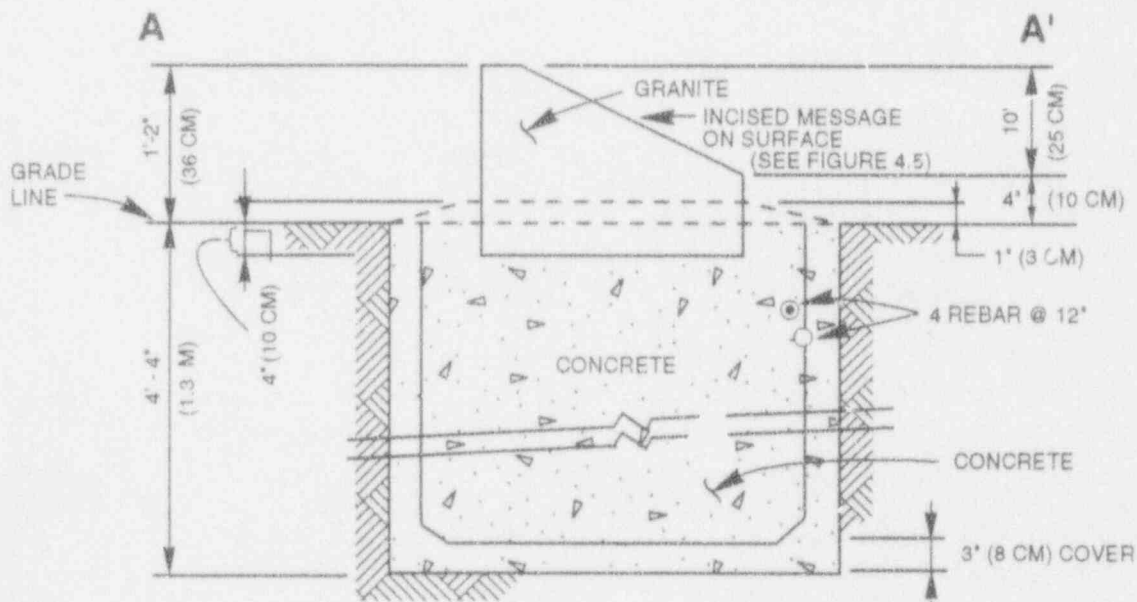


SECTION A-A'

SCHEMATIC - NOT TO SCALE


REF: MK-F, 1987b.

FIGURE 4.3
 SITE MARKER - SMK-1
 LOCATED AT SITE ENTRANCE
 SHIPROCK, NEW MEXICO, DISPOSAL SITE

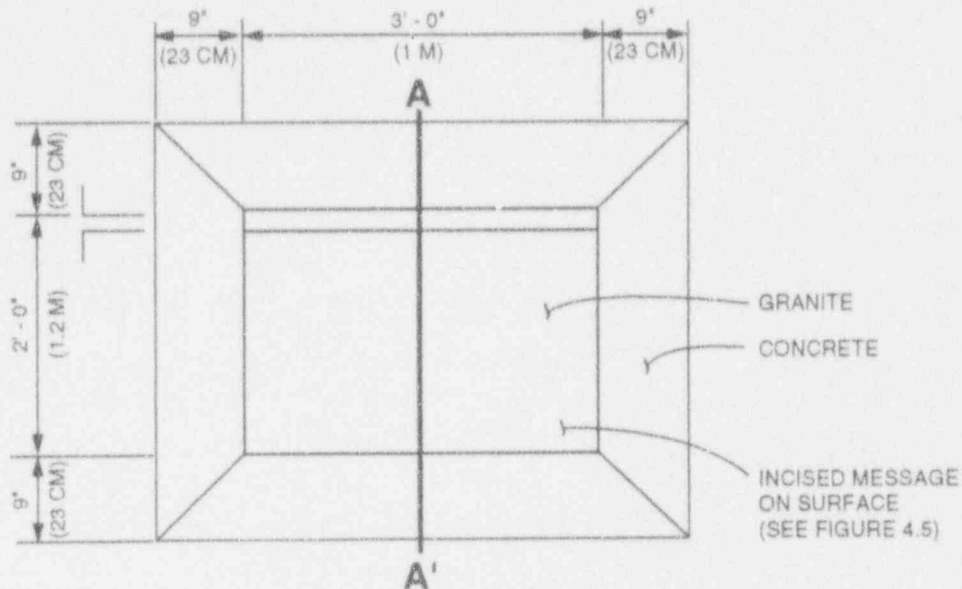

PLAN VIEW

SCHEMATIC - NOT TO SCALE

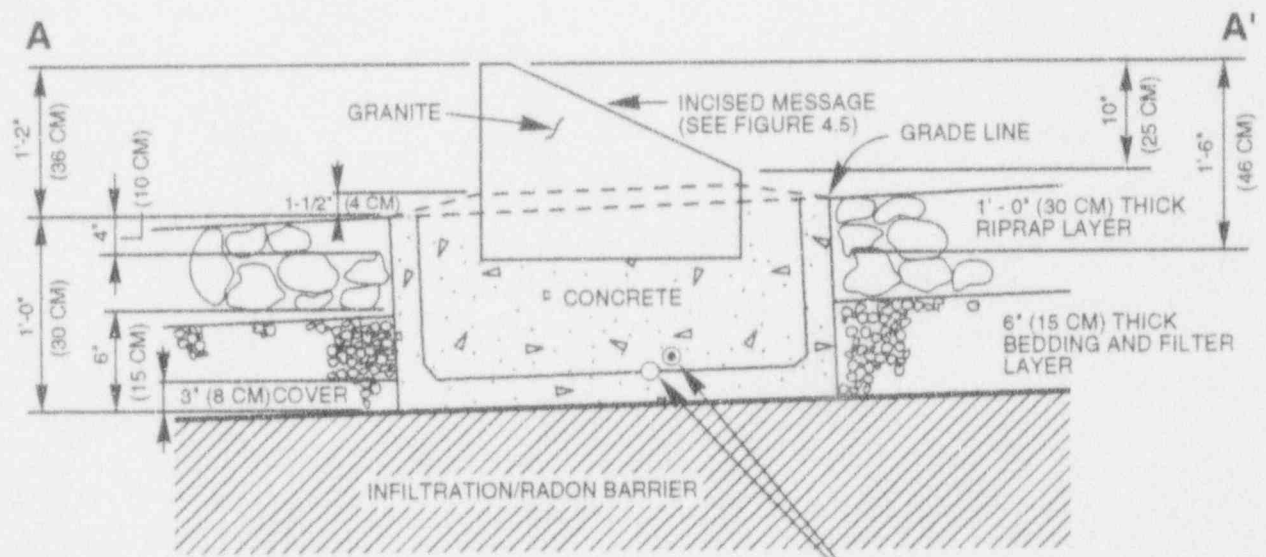

NOTE: MINIMUM DEPTH OF INCISING TO BE 1/4" (0.6 CM).

#4 REBAR @ 12" (30 CM) EACH WAY

SECTION A - A'

SCHEMATIC - NOT TO SCALE


REF: MK-F, 1987b.

FIGURE 4.4
SITE MARKER - SMK-2
LOCATED AT CREST OF DISPOSAL CELL
SHIPROCK, NEW MEXICO, DISPOSAL SITE

BM
+

SHIPROCK, NEW MEXICO

| | |
|-----------------------|--------------------|
| DATE OF CLOSURE: | SEPTEMBER 1986 |
| WET TONS OF TAILINGS: | 2,520,000 |
| RADIOACTIVITY: | 746 CURIES, RA-226 |

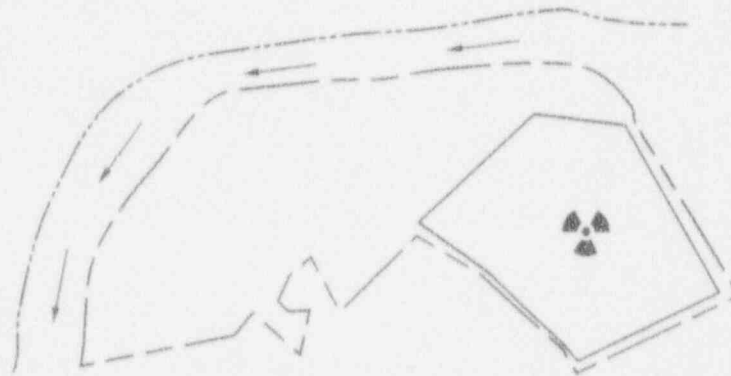



NOTE: MINIMUM DEPTH OF INCISING IS 1/4" (6CM).

INCISED MESSAGE

REF: MK-F, 1987b.

FIGURE 4.5
SITE MARKER INCISED MESSAGE
SHIPROCK, NEW MEXICO, DISPOSAL SITE

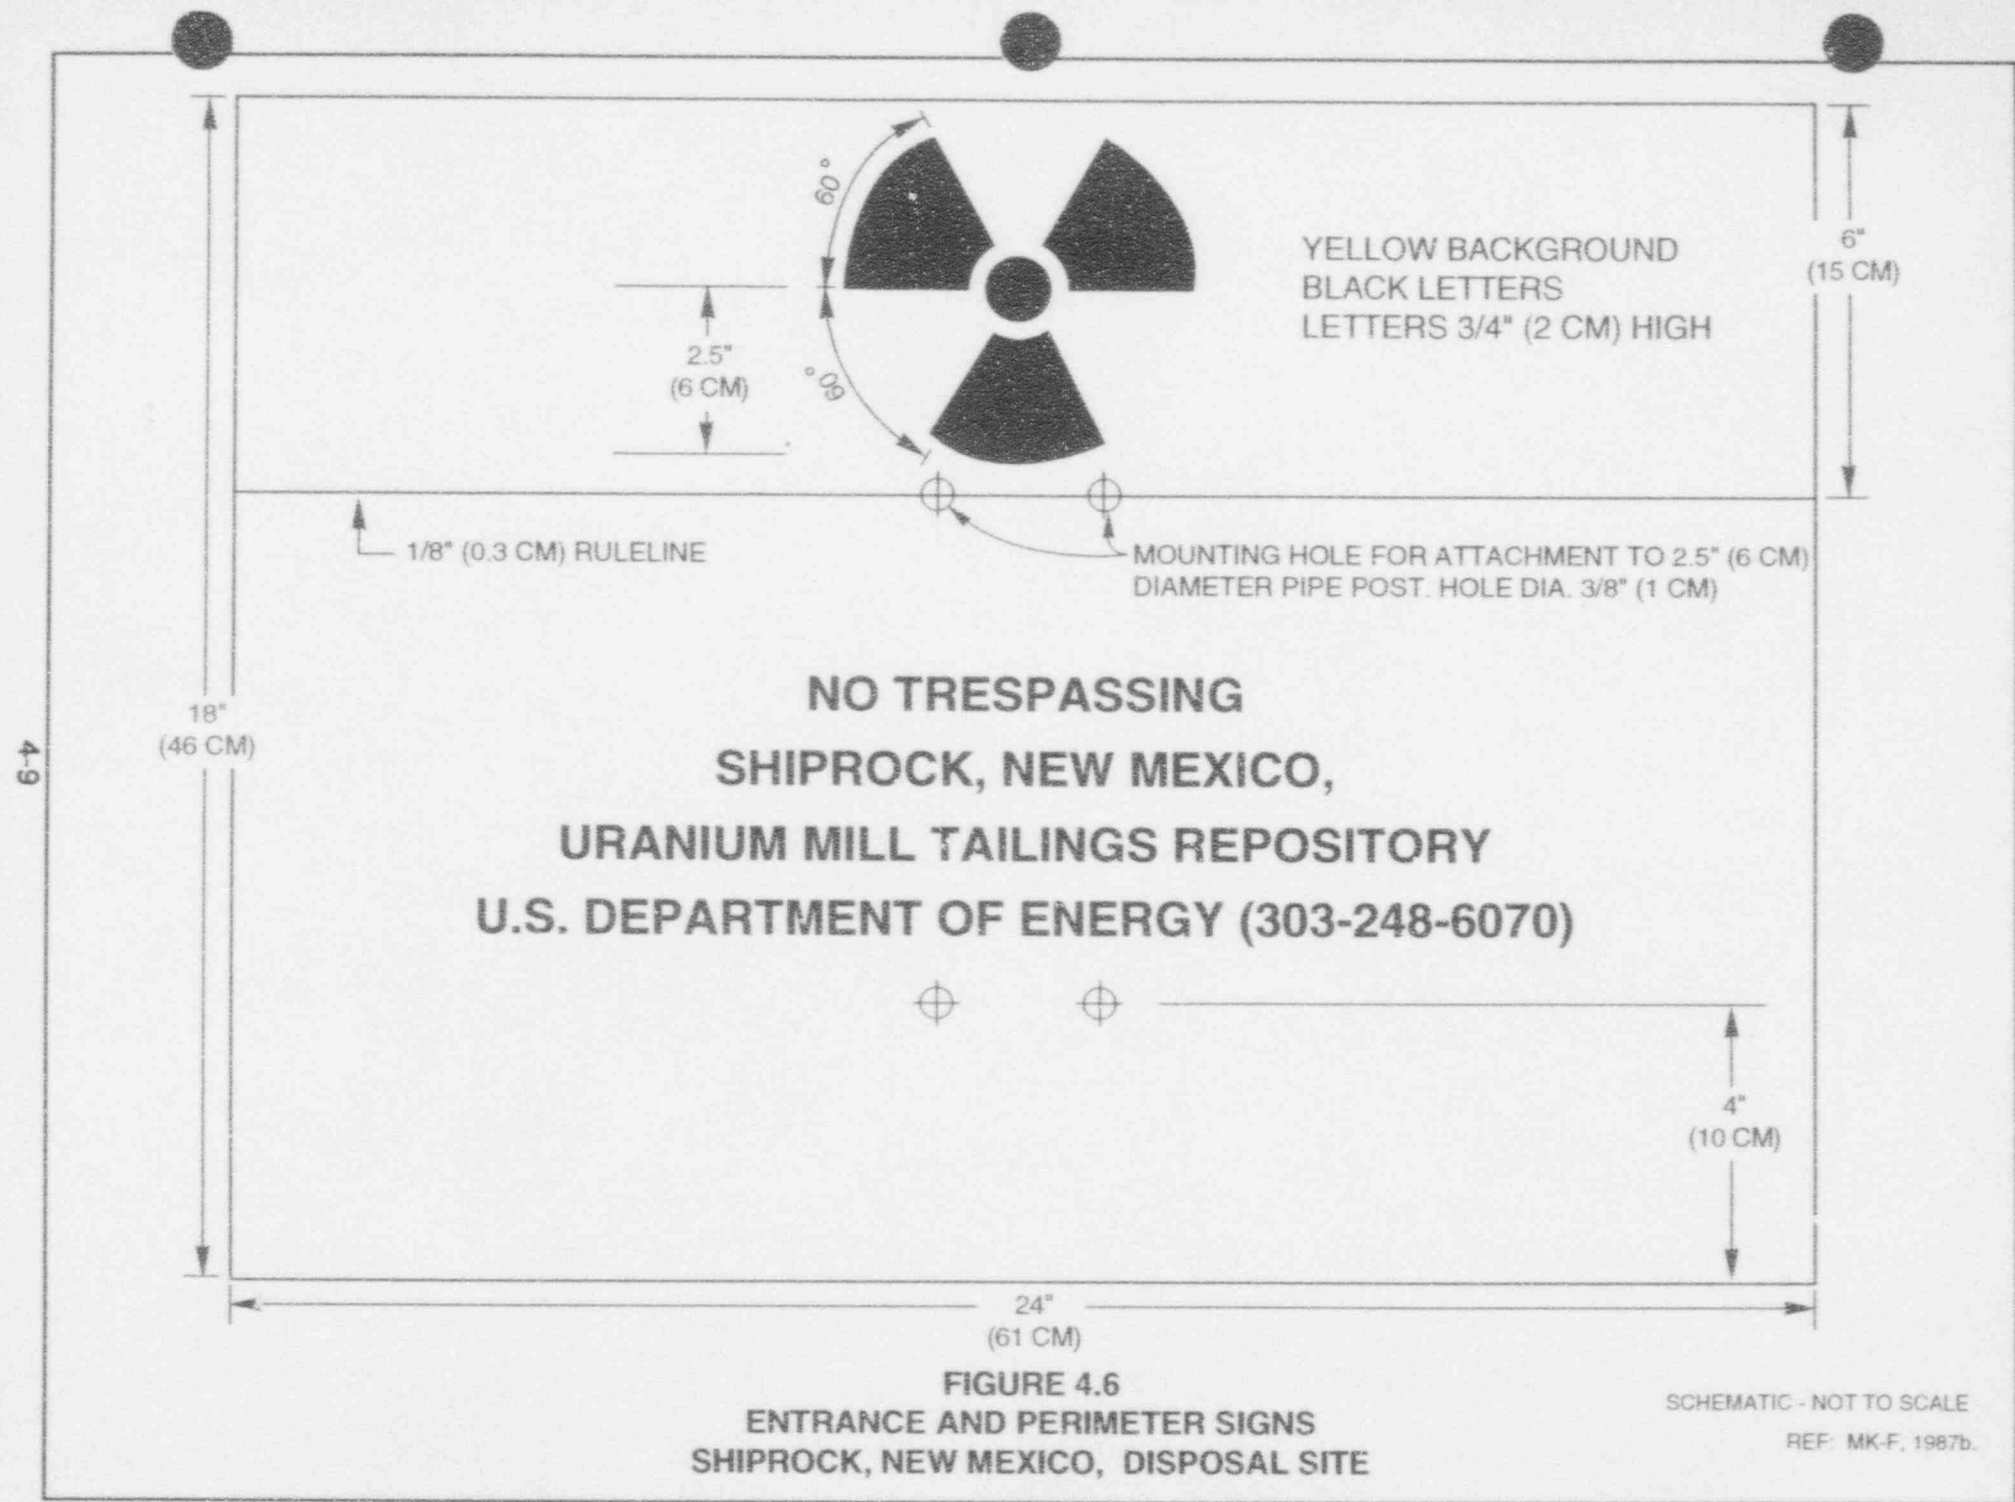

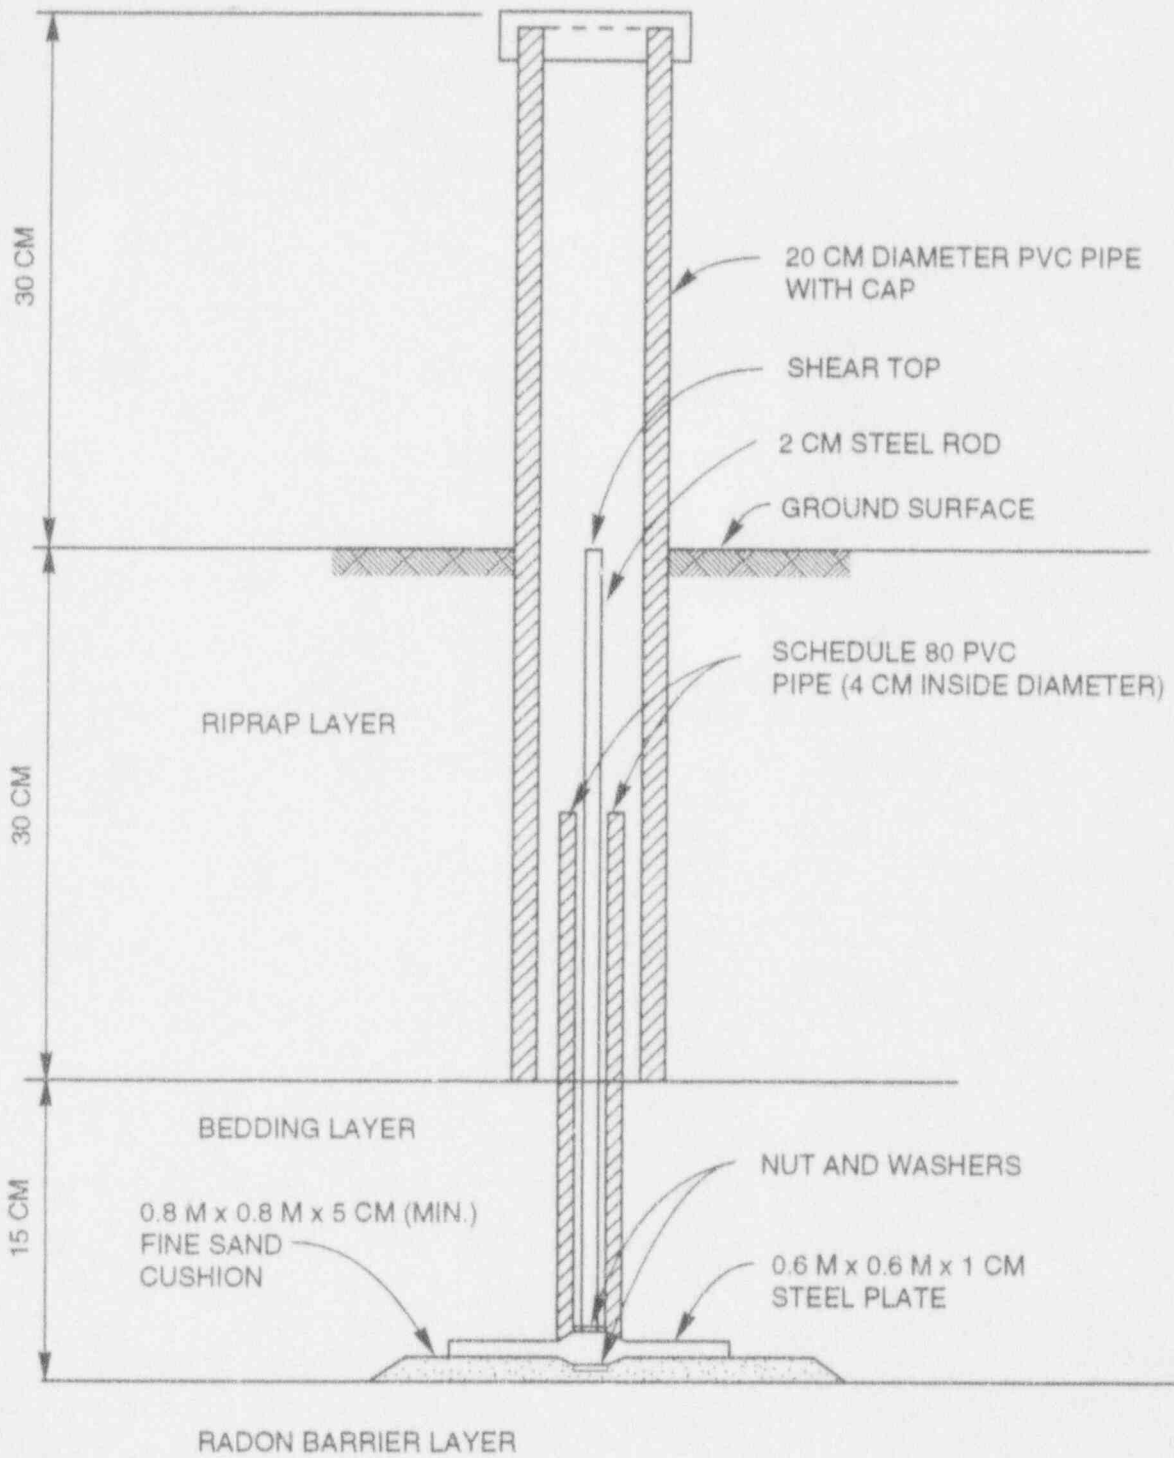

NOTE: POLYVINYL CHLORIDE (PVC)

SCHEMATIC - NOT TO SCALE

FIGURE 4.7
UMTRA PROJECT SETTLEMENT PLATE
SHIPROCK, COLORADO, DISPOSAL SITE

Table 4.2 Survey coordinates and elevations as of October 6, 1986, for settlement plates at the Shiprock, New Mexico, disposal site

| Feature | Coordinates ^a | | Elevation ^b (ft) |
|-------------------------|--------------------------|----------|--------------------------------|
| | North (N) | East (E) | |
| Settlement plate No. 1 | 8171.07 | 10437.19 | 4992.77 |
| Settlement plate No. 2 | 7934.33 | 10665.42 | 5001.27 |
| Settlement plate No. 3 | 7850.93 | 10935.21 | 5004.34 |
| Settlement plate No. 4 | 7404.21 | 11171.51 | 4993.43 |
| Settlement plate No. 5 | 7999.95 | 10963.77 | 5002.33 |
| Settlement plate No. 6 | 7871.11 | 11070.57 | 5001.82 |
| Settlement plate No. 7 | 8152.21 | 11108.20 | 4996.92 |
| Settlement plate No. 8 | 7986.09 | 11254.89 | 4995.68 |
| Settlement plate No. 9 | 8280.09 | 11189.18 | 4991.60 |
| Settlement plate No. 10 | 8067.71 | 11415.21 | 4990.27 |
| Settlement plate No. 11 | 8444.92 | 11306.62 | 4964.21 |
| Settlement plate No. 12 | 8139.78 | 11485.12 | 4979.40 |

^aSee Figure 2.6 for relative locations of the settlement plates. The coordinates are based on the project survey control point (N 10,000.00, E 10,000.00) located at the southeast corner of Section 36, Township 30 North, Range 18 West.

^bThe error factor in the elevation is ± 0.05 ft (0.02 m).

(Figure 4.2) with the standard logo cap. Each 4-ft (1.2-m) long marker is set with the cap extending approximately 1 ft (0.3 m) above ground surface.

4.6.2 Reference posts

No reference posts have been installed at the Shiprock disposal site to help inspection teams locate boundary and survey monuments. If the monuments become difficult to locate due to shifting sands or plant growth, one 5-ft (1.5-m) reference post may be installed in concrete at each location.

5.0 GROUNDWATER MONITORING

The NRC has determined that the hydrogeology and groundwater conditions at the Shiprock disposal site have been adequately characterized. It was concluded that the site is over an aquifer not useful as a source of water for drinking or any other beneficial purpose because of its poor quality, limited areal extent, and low yield (NRC, 1990; 1991).

In accordance with these findings, no additional hydrogeologic investigations are planned for the disposal site and no cell performance monitoring of groundwater is proposed as part of the long-term surveillance program. The hydrogeology and groundwater conditions at the site are summarized below.

5.1 GROUNDWATER CHARACTERIZATION

The DOE has identified the constituents of concern and conducted a preliminary characterization of the hydrogeologic units and the hydraulic and transport regimes at the Shiprock disposal site. Details are provided in Appendix D of the Shiprock RAP (DOE, 1985) and in the Shiprock baseline risk assessment (DOE, 1993).

5.1.1 Hydrostratigraphy

The disposal site is on an elevated river terrace on the southwest side of the San Juan River as described in Section 2.2.1 of this LTSP.

The terrace alluvium beneath the disposal cell is between 10 and 45 ft (3 to 13 m) thick. This alluvium consists of interbedded sands and silts with lenses of gravel and cobbles. The alluvium is underlain by approximately 1000 ft (300 m) of Mancos Shale consisting of flat-lying beds of shales and sandy shales. The Mancos Shale is relatively impermeable at depth, but the upper 10 to 30 ft (3 to 9 m) are discontinuously weathered and fractured. The Mancos Shale is underlain by the Dakota Sandstone and Morrison Formation.

Groundwater below the disposal site occurs in the alluvium; the upper, weathered part of the Mancos Shale; in fractures or sandstone tongues in the unweathered Mancos Shale; and in the Dakota Sandstone and Morrison Formation. The groundwater in the alluvium and in the upper part of the Mancos Shale is unconfined and constitutes the uppermost aquifer. Groundwater in the Dakota Sandstone and Morrison Formation is confined and has a piezometric surface that is above the water table in the alluvium and upper part of the Mancos Shale. The higher piezometric head, combined with the low permeability of the unweathered Mancos Shale, will preclude movement of impacted water beneath the tailings pile into the deeper aquifers.

The terrace alluvium is recharged by precipitation. This water is perched on the Mancos Shale and moves across its surface. The surface of the Mancos was eroded by the San Juan River and has shallow erosional valleys and low ridges

that could cause the perched groundwater to flow to the west-northwest (Figure 5.1). There are not enough data to develop an accurate flow map of the groundwater in the terrace alluvium.


The groundwater also percolates down into the upper, fractured part of the Mancos Shale. Some of this water moves horizontally along bedding planes and emerges as seep along the escarpment face immediately to the north of the disposal site. It is also anticipated that groundwater in the Mancos may flow below the floodplain toward the San Juan River, the local base level in the region. This water would then move up out of the Mancos into the alluvium of the floodplain or directly into the river (Figure 5.2).

5.1.2 Background groundwater quality






Monitor wells were installed to the north, east, south, and west of the disposal site to define the extent of the contaminant plume and determine background groundwater quality. The groundwater in all of these wells exhibits evidence of impacts by the former milling operations and/or the tailings pile. Background groundwater quality is defined as the groundwater quality from a hydrogeologic unit at the disposal site that has not been contaminated by uranium processing activities (*Technical Approach Document* [TAD]) (DOE, 1989). Because the Shiprock disposal cell overlies an existing contaminant plume that resulted from surface uranium processing activities at the site between 1954 and 1968, background groundwater quality or maximum concentration limits (MCL) cannot be used to establish concentration limits to evaluate the initial performance of the disposal cell. Additional investigations will be conducted as part of the DOE's groundwater restoration program (NRC, 1990; 1991).


5.2 GROUNDWATER MONITORING NETWORK

The tailings at Shiprock were stabilized in place in accordance with the EPA standards (40 CFR Part 192), and with the concurrence of the NRC (Attachment 2). Based on the hydraulic properties of the cover design and field testing of the cover, the NRC concluded that infiltration through the cover and stabilized tailings has been reduced to the maximum extent practicable. Given these conclusions and the conditions of existing groundwater contamination, the NRC has excluded the Shiprock disposal site from any further monitoring to determine cell integrity in conjunction with the long-term surveillance program.

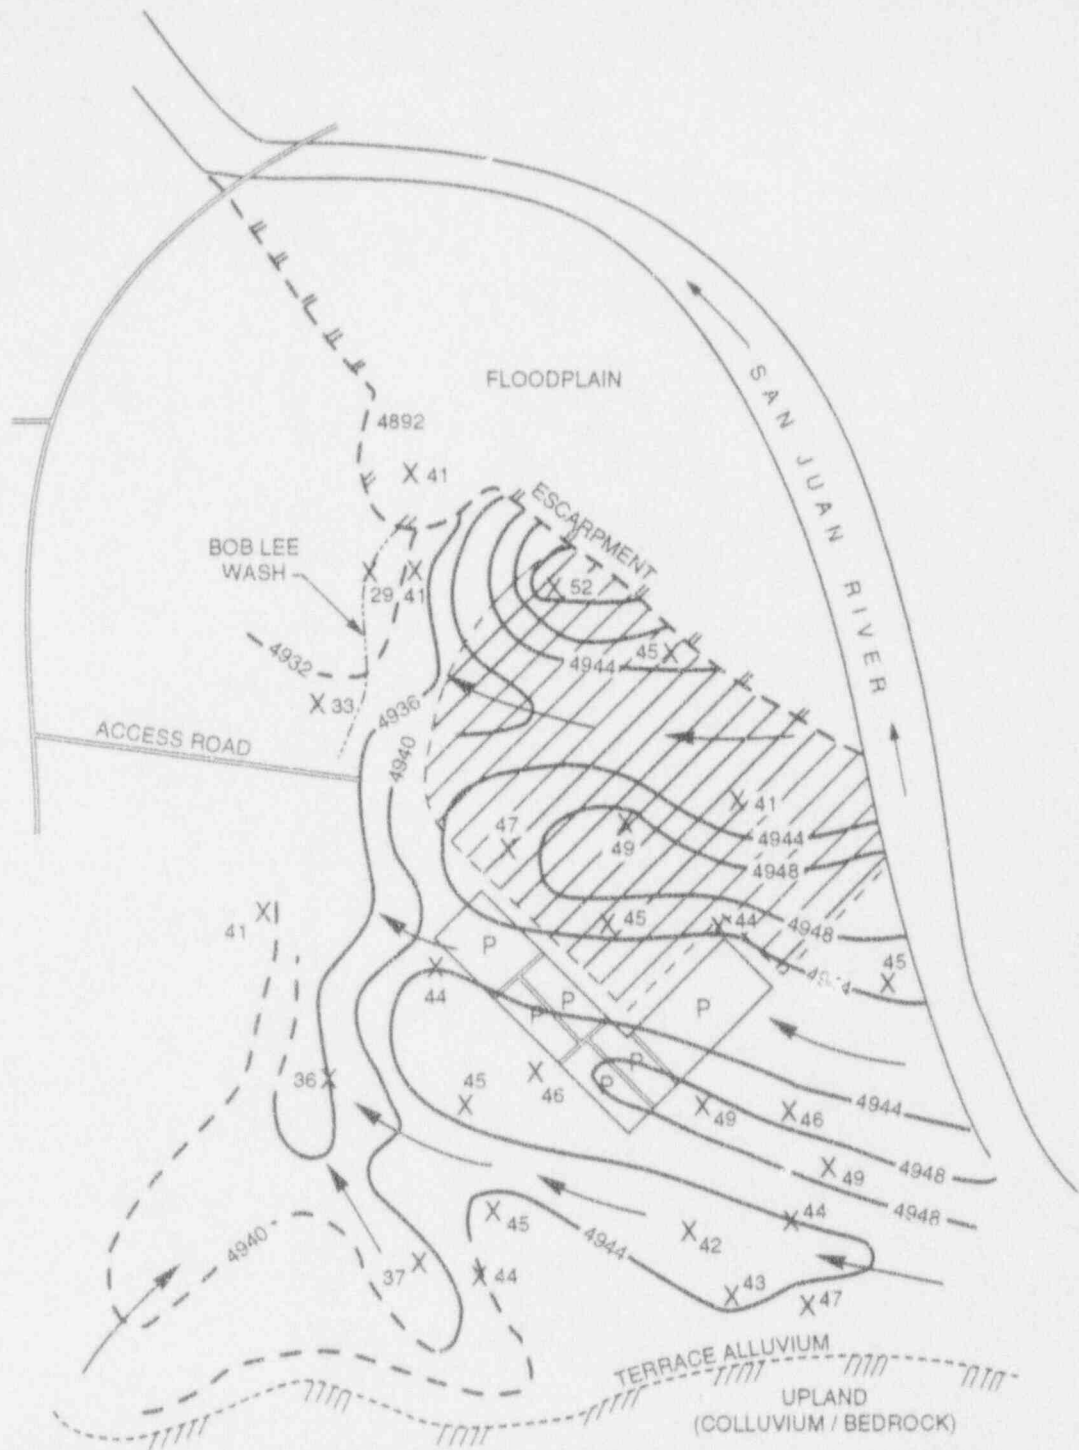


LEGEND

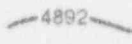-  BEDROCK SURFACE CONTOUR
-  BEDROCK ELEVATION IN BORING (+4900)
-  SWALE ON BEDROCK SURFACE
-  FORMER TAILINGS PILES AND MILL SITE
-  FORMER RAFFINATE POND

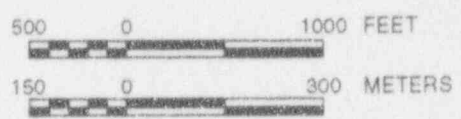

**FIGURE 5.1
BEDROCK SURFACE CONTOURS ON TERRACE**

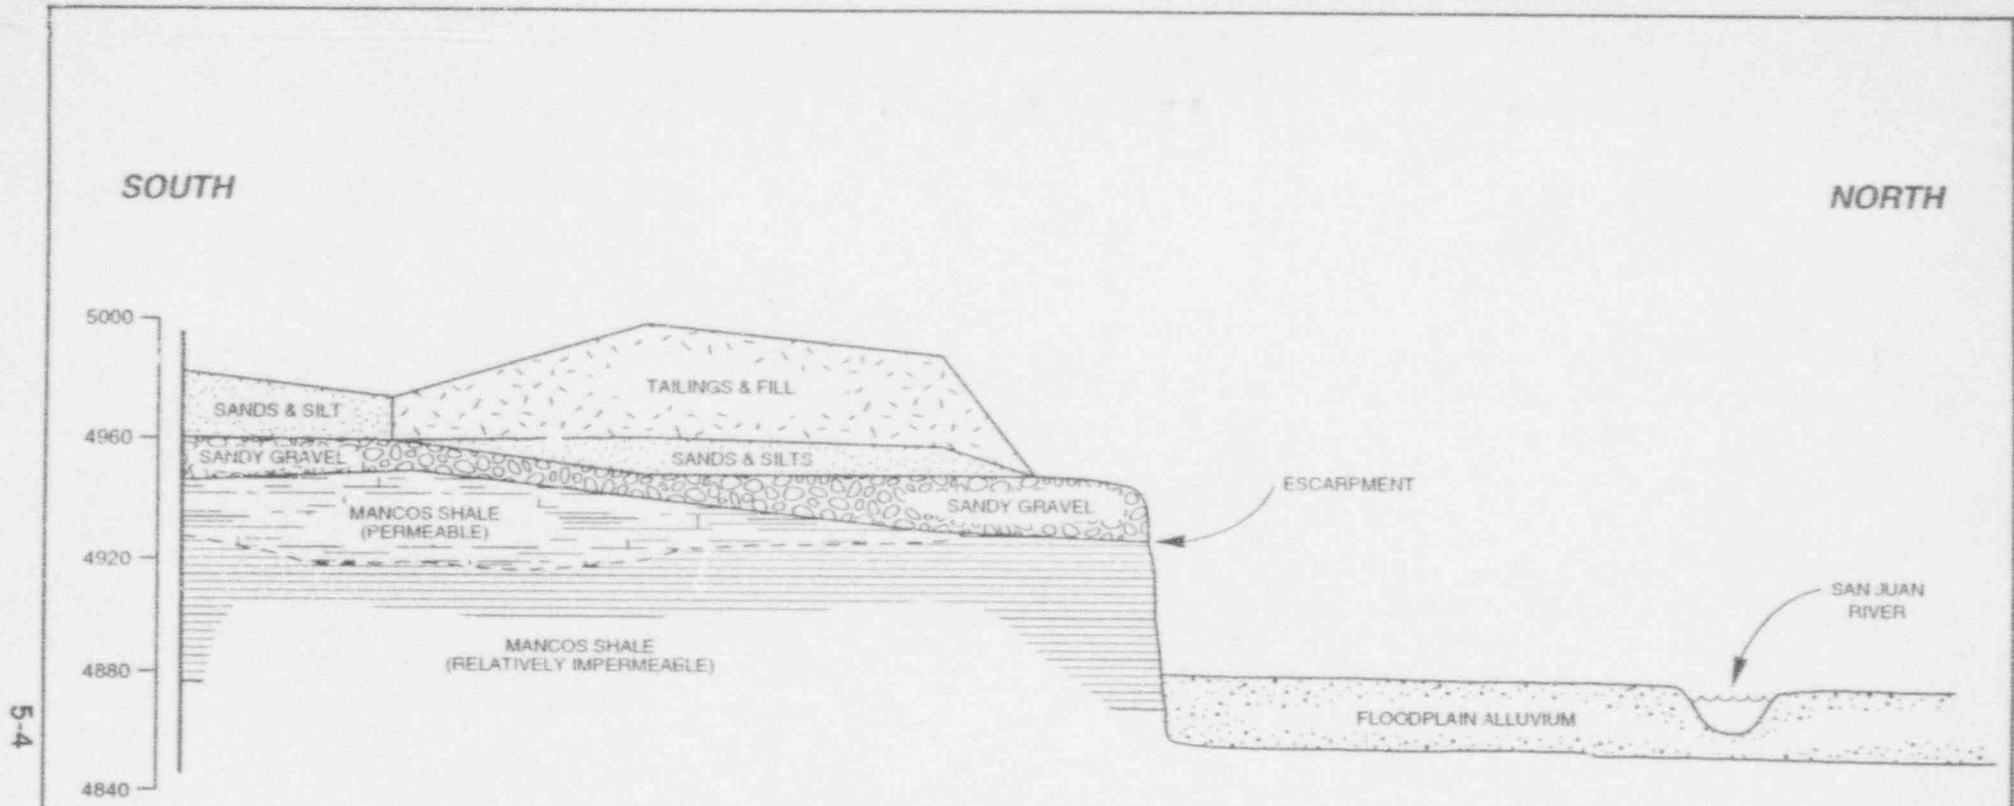

5-4

ELEVATION
IN FEET
(MSL)

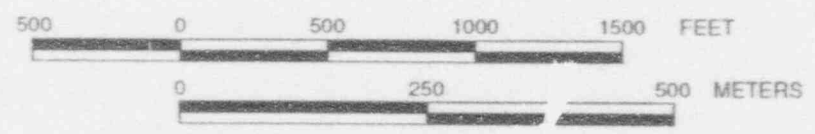


FIGURE 5.2
REPRESENTATIVE CROSS SECTION
SHIPROCK, NEW MEXICO, SITE

6.0 SITE INSPECTIONS

Inspections of the Shiprock disposal site are conducted to ensure that it continues to function as designed. The primary objective of a site inspection is to identify potential problems before extensive maintenance, corrective action, or repairs are needed. The inspection team will be knowledgeable in the processes that could adversely affect the site. A fundamental part of the inspection will be the detection and documentation of progressive change over time due to slow-acting processes such as settlement, creep, or piping. The findings recorded during these inspections, when compared against the initial baseline conditions, will provide a basis for conducting future inspections. The three types of site inspections are as follows:

- Annual or scheduled site inspections.
- Follow-up inspections.
- Contingency inspections.

Each site inspection will be documented by a report identifying the findings of the inspection. Copies of each inspection report will be submitted to the NRC and the Navajo Nation and will be placed in the Shiprock permanent site file.

6.1 INSPECTION FREQUENCY

Scheduled site inspections at the Shiprock disposal site will be conducted annually for the first 5 years following licensing. At the end of the 5-year period, the GJPO will evaluate the need to continue annual inspections. The recommendation will be based on an evaluation of the annual reports and any other reports that have been filed due to the need for maintenance or unscheduled events. If a determination is made that inspections are required less frequently, the GJPO will modify the LTSP and submit it to the NRC for acceptance. The Navajo Nation will also receive a copy for review.

Site inspections at the Shiprock disposal site should preferably take place in the summer, during the growing season of volunteer plants to see if the plants are affecting the integrity of the cover and if any maintenance of the disposal cell cover is necessary.

6.2 INSPECTION TEAM

The inspection team will consist of a chief inspector and one or more assistants. The chief inspector will be a geotechnical engineer/geologist or civil engineer knowledgeable in the processes that could adversely affect the site. Because the Shiprock disposal site has a rock cover, a plant specialist may be required to analyze volunteer plant growth on the cover. Additionally, because of the potential for shifting sands and sand accumulation on the cover, a geologist may be required to document the changes and the potential long-term effects. The need for specific specialists will be determined by GJPO based on results of previous inspections.

Where necessary, for follow-up or assessment inspections, the team will include additional technical experts appropriate to the problems under investigation.

6.3 PREPARATION FOR INSPECTIONS

Before conducting an inspection, inspectors will complete the following tasks:

- Review the final LTSP, the permanent site file, the previous site inspection report(s) and site inspection map(s), and all maintenance or corrective action reports.
- Prepare the site inspection checklist based on previous inspections or repairs; incorporate any needed modifications.
- Verify and update the names and telephone numbers of all parties with whom access or notification agreements have been executed.
- Verify the DOE 24-hour telephone number and appropriate tribal agency telephone numbers and contacts. Arrange to change all signs, as needed.
- Schedule the site inspection.
- Notify the NRC and tribal representatives so that they may attend the inspection if they so choose.
- Notify NECA.
- Assemble the equipment needed to conduct the inspection.
- Adjust the magnetic declination of the Brunton compass to be used in the field for that of the Shiprock area (currently 13.0 degrees east of true north).

6.4 SITE INSPECTION AND INSPECTION CHECKLIST

The site inspection will cover the disposal site area, the disposal cell, and the immediate off-site areas. All site inspection activities and observations should be recorded and described using the as-built drawings, site inspection checklist (Attachment 5), site inspection map, field notebook, and photographs. Observations and photographic stations will be recorded on the field maps. After each inspection, the site inspection map will be drafted and retained in the Shiprock permanent site file.

The initial site inspection checklist is a guideline for the inspectors during their inspection. At the completion of each inspection, the checklist will be revised to include new information or to delete items that are no longer pertinent. The revisions to the checklist will be documented in the inspection report.

The inspection checklist content or format may change over time to accommodate ongoing inspection needs. This is the responsibility of the inspection team. Significant changes should be well documented.

A photographic record of each site inspection will be obtained. Disposal site conditions will be documented by ground photographs to provide a record of developing trends and to enable the DOE to evaluate the need for and extent of future activities. Any site feature or condition that requires the inspectors to make a written comment, explanation, or description will be photographed, if possible. A site inspection photo log will be used for recording the photographs (Attachment 4). All features will be photographed and recorded as specified in Section 3.4. The number of photographs, the view angles, and the lenses used are up to the judgment of the inspectors, as long as sufficient photographs are taken for agency review.

6.4.1 Off-site areas

A reconnaissance of the areas within 0.25 mi (0.4 km) of the site boundary will be made. Any change in existing land use that could increase the probability of human intrusion onto the site will be noted. Shifts in the channel of the San Juan River or excessive sloughing along the escarpment that could affect the integrity of the disposal cell will also be noted. The base of the escarpment will be traversed from the eastern end of the floodplain to Bob Lee Wash (Figure 2.1), and signs of seepage will be noted.

6.4.2 On-site areas

The inspection team will step off a series of transects around the perimeter of the disposal site; along the base, crest, and sideslopes of the disposal cell; and in and around the diversion channels to evaluate the integrity of the disposal cell site. Sufficient transects must be walked so that the disposal site area is thoroughly covered and inspected. Diagonal transects of the crest will be made, and the edge of the crest will be walked. Additional transects, at approximately 50-foot intervals, will be walked along the sideslopes. Transects along the entire length of each diversion channel will be made to determine whether the channels have been functioning and can be expected to continue to function as designed.

At a minimum, the site perimeter and site area transects will be checked for damage or disturbance to the following features:

- Site perimeter roads.
- Fences, gates, and signs.
- Permanent site surveillance features.
- Site area vegetation or volunteer plant growth.
- Sedimentation or erosion.
- Drainage ditches.

All permanent surveillance features (Section 4.0) will be examined for evidence of disturbance. Naturally occurring changes in site features will be noted and assessed for the need for maintenance or corrective action. If disturbance or damage to site surveillance features is evident, a recommendation for maintenance or repair will be made.

Transects along the engineered component (diversion channels, cell sideslopes, cell crest, and cover) will be walked along their complete length and examined for evidence of the following:

- Structural instability due to differential settlement, subsidence, cracking, sliding, or creep.
- Erosion as evidenced by the development of rills or gullies.
- Sedimentation or debris.
- Rapid deterioration of the rock cover caused by weathering or erosion.
- Removal of rock or other disposal cell material.
- Seepage.
- Intrusion (inadvertent or deliberate) by humans or animals.
- Animal burrowing.
- Vandalism.
- Development of trails from human or animal activity.
- Volunteer plant growth.

6.4.3 Modifying processes

At the Shiprock disposal site, processes of concern include settling, subsidence, slumping, plant and animal intrusion, erosion (gulying), and aeolian sedimentation. If any modifying features are observed during the inspection, the following data should be recorded on the inspection checklist:

- Evidence of settlement or sliding, including the presence of bulges or depressions, cracks, or scarps.
- Extant of the area affected, stability, and nature of movement.
- Number of modifying features, spacing, length, depth, and width.
- Related erosional features.

- Patterns of occurrence.
- Plant or animal species found at the site.
- Location and density of volunteer plant growth.

If new conditions requiring continuing observation, monitoring, or immediate action are discovered during the inspection, the inspector should quantify the observed conditions and identify the appropriate level of action for subsequent inspections.

6.5 SITE INSPECTION MAP

A new Shiprock disposal site inspection map will be prepared following each scheduled inspection using the Shiprock disposal site map (Plate 1) as a base. This map will include the following:

- Inspection traverses.
- Photographic locations.
- Locations and descriptions of any new, anomalous, or unexpected features.
- Features identified during previous inspections for observation or monitoring.
- Date of inspection.

6.6 REPORTING REQUIREMENTS

Upon completion of the field inspection, Section D of the site inspection checklist will be completed and the certification statement signed. The checklist and field notes will provide the basis for documenting the site inspection.

A revised site map will be created that notes any potential problems or other site conditions that may require future attention. All new drawings will be labeled with the type of site inspection and the date the site inspection was performed.

All photographs will be logged on a site inspection photo log (Attachment 4). A separate photo log will be completed for each roll of film exposed, with an entry made for each photograph taken. The completed photo logs will become part of the inspection report.

Documentary evidence of abnormal, anomalous, new, or unusual conditions or situations (e.g., downhill creep, terracing) will be obtained to provide a record of developing trends and to enable the responsible agency to make reasonable decisions concerning follow-up inspections, custodial maintenance, repair, and corrective action. Photographs may be used to provide such evidence and augment the checklist and annotated overlays.

A site inspection report will be prepared describing surveillance activities at the disposal site. The inspection report will include the information identified in the LTSP guidance document (DOE, 1992a). At a minimum, the report will include a narrative, inspection checklists, photographs and photo logs, maps, field notes, inspector qualifications, and a certification of inspection. All problems, active or potential, will be identified and described in the report, along with recommendations for follow-up inspections, custodial maintenance or repair, or corrective action, if required.

The site inspection report and supporting documentation, maps, and drawings will become part of the LTSP permanent site file. As specified in Appendix A, Criterion 12, of 10 CFR Part 40, the DOE will submit the site inspection report to the NRC within 90 days of the last scheduled inspection for that calendar year. Copies will also be provided to the Navajo Nation. A copy of all site inspection reports will be maintained in the Shiprock permanent site file.

7.0 UNSCHEDULED INSPECTIONS

The need for an unscheduled inspection may be triggered by any of the following:

- Findings from an annual or scheduled site inspection.
- Other site visits, such as for groundwater sampling, special studies, corrective action, or other DOE activities.
- Reports from law enforcement agencies or the public.
- Reports from the Earthquake Early Warning Service, the National Weather Service, or the Bureau of Reclamation.

Typically, the need for an unscheduled inspection will be triggered by the discovery of a specific problem. The NRC and the Navajo Nation will be notified if the reported problem indicates that the disposal cell has been compromised or if extensive corrective action or repair is needed. If an unscheduled inspection identifies a problem requiring significant repairs or corrective actions, an inspection/preliminary assessment report is required.

7.1 FOLLOW-UP INSPECTIONS

Follow-up inspections are unscheduled inspections conducted to investigate and further quantify specific problems detected during a scheduled site inspection, groundwater sampling event, special study, or other DOE activity. They are necessary to assess whether processes currently active on or near the site pose any future threat to the site if left unchecked and to evaluate the need for immediate custodial maintenance, repair, or corrective action. Follow-up inspections will be made by specialists in the discipline appropriate to the problem that has been identified.

The first step of a follow-up procedure is an on-site visit to gather firsthand knowledge of the problem and develop a plan of action to conduct the tests or studies necessary to understand the phenomenon in progress. Additional visits may then be scheduled to gather the data needed to draw conclusions and recommend corrective action.

Upon completion of the follow-up inspection, the DOE will analyze the information gathered, assess the situation, and prepare an inspection/preliminary assessment report. If immediate maintenance, repair, or corrective action is warranted, the DOE will notify the NRC and the Navajo Nation promptly as specified in Section 9.0 of this document.

7.2 CONTINGENCY INSPECTIONS

Contingency inspections are unscheduled inspections ordered by the DOE when it receives outside information indicating that site integrity has been or may be threatened. Trigger events for contingency inspections may include reports of severe intrusion by humans or livestock, severe rainstorm or flooding, or the occurrence of some unusual event such as an earthquake or tornado in the vicinity.

The DOE has entered into notification agreements with the following federal and tribal agencies. These agencies have agreed to notify the DOE of unusual events at the Shiprock disposal site:

- National Weather Service, Albuquerque, New Mexico.
- National Earthquake Information Service, Denver, Colorado.
- Bureau of Reclamation, Durango, Colorado.
- Shiprock Navajo Police, Shiprock, New Mexico.

Contingency inspections will be carried out in two or more steps. The first step will be an on-site visit to gather firsthand knowledge of the problem and develop a plan of action to conduct the tests or studies necessary to understand the phenomenon in progress. Additional visits may then be scheduled to gather the data needed to draw conclusions and recommend corrective action.

7.3 INSPECTION REPORT

If a follow-up or contingency inspection identifies a problem requiring significant repairs or corrective action, the DOE is required by 10 CFR Part 40.27 to submit an inspection/preliminary assessment report to the NRC within 60 days of the initial report. The Navajo Nation also will receive a copy of the report. At a minimum, this report will include the following:

- A description of the problem.
- A preliminary assessment of the maintenance, repair, or corrective action required.
- Assessment data, including field and inspection data, and photographs.
- Field inspector names and qualifications.
- Conclusions and recommendations.

A copy of the report and all other data and documentation will be maintained in the Shiprock permanent site file. If appropriate, the annual (or scheduled) Shiprock disposal site inspection report will also contain the results of the follow-up or contingency inspections.

8.0 CUSTODIAL MAINTENANCE AND REPAIR

Custodial maintenance will be performed at the Shiprock disposal site as needed. In general, the decision to conduct maintenance or repair will be based on the results of scheduled site inspections, follow-up inspections, or contingency inspections.

8.1 PLANNED MAINTENANCE

Planned maintenance at the Shiprock disposal site will be limited to a spraying program to control unwanted vegetation growth on the disposal cell. Due to the arid conditions at the site and the sporadic frequency and amount of rainfall, this spraying will occur as needed. Vegetation growth will be monitored during inspections conducted during the growing season. If significant vegetation is found, a maintenance visit to apply a herbicidal spray will be scheduled.

8.2 UNSCHEDULED MAINTENANCE OR REPAIR

Unscheduled custodial maintenance activities that may be required at the Shiprock disposal site include the following:

- Repair of gates and fences.
- Replacement of perimeter warning signs.
- Reestablishment of survey control and boundary monuments and erosion control markers.
- Eradication of deep-rooting trees and shrubs.
- Removal of tumbleweeds or other debris from the diversion channel or from around fences.
- Control of burrowing animals.
- Placement of fill in gullies or rills.
- Replacement of erosion barrier rock cover materials.

For these types of custodial actions, the GJPO will prepare a purchase order and statement of work (including subcontractor qualifications) authorizing the repair.

If any problems are identified indicating that the integrity of the disposal cell may be affected, the recommended repair action must be approved in advance by the NRC and handled as a corrective action (refer to Section 9.0).

8.3 CERTIFICATION AND REPORTING REQUIREMENTS

The following information on unscheduled maintenance or repair will be maintained in the Shiprock permanent site file and reported as part of the inspection report to the NRC.

- Summary of work required.
- Work order, purchase order, or statement of work.
- Contractor qualifications, if applicable.
- Contractor documentation of completion of work.
- DOE certification of completion of work

If the action is considered significant, the subcontractor must submit verification of the completed work and/or a written report to the GJPO. The DOE will inspect the site, as necessary, and review the report before certifying that all work was completed in accordance with any required specifications. Copies of all records, documentation, and certifications must be included in the Shiprock permanent site file. Documentation will be transmitted to the NRC and the Navajo Nation.

9.0 CORRECTIVE ACTION

If the stability of the disposal cell is threatened, corrective actions that could include temporary emergency measures will be carried out to correct the problem. In addition, the DOE will evaluate the factors that caused the problem and ensure that recurrence is minimized or avoided.

When a potential problem is identified, the DOE will notify the NRC and the Navajo Nation and submit an inspection/preliminary assessment report of the situation to the NRC and the Navajo Nation for review within 60 days of problem identification. The preliminary assessment report will evaluate the problem and will provide recommendations for the next step (e.g., immediate action or continued evaluation). After the NRC and Navajo Nation have reviewed the report and recommendations, the DOE will develop a corrective action plan and submit it to the NRC for approval. The DOE may also choose to combine the inspection and recommendation in one report, depending on the severity of the problem. With NRC approval, the corrective action plan will be implemented by the DOE. Figure 9.1 illustrates the general sequence of events in the corrective action process, and Figure 9.2 identifies the key elements in the corrective action process.

9.1 PROBLEM IDENTIFICATION

Site inspections by qualified inspectors and routine custodial maintenance are designed to identify potential problems before corrective action is needed. However, it is recognized that extreme natural events may occur, that vandalism may affect the surface, or that other unanticipated events may occur. Additional data collection or evaluative monitoring may be needed to assess whether the processes associated with the problem would pose any future threat to the site if left unchecked.

The initial step in identifying the problem could include one or more on-site inspections. The inspection/preliminary assessment would include, but not be limited to, the following:

- Quantifying the nature and extent of the problem.
- Reevaluating the engineering design parameters germane to the problem.
- Establishing a data collection and/or evaluative monitoring program to quantify the magnitude of the problem.

Because of the standards to which the Shiprock disposal site was designed, it is considered extremely unlikely that problems will occur. However, some situations that may require corrective action at the Shiprock disposal site include the following:

- Unforeseen subsidence of the disposal cell or its foundation.

PROBLEM INDICATING CORRECTIVE ACTION IDENTIFIED

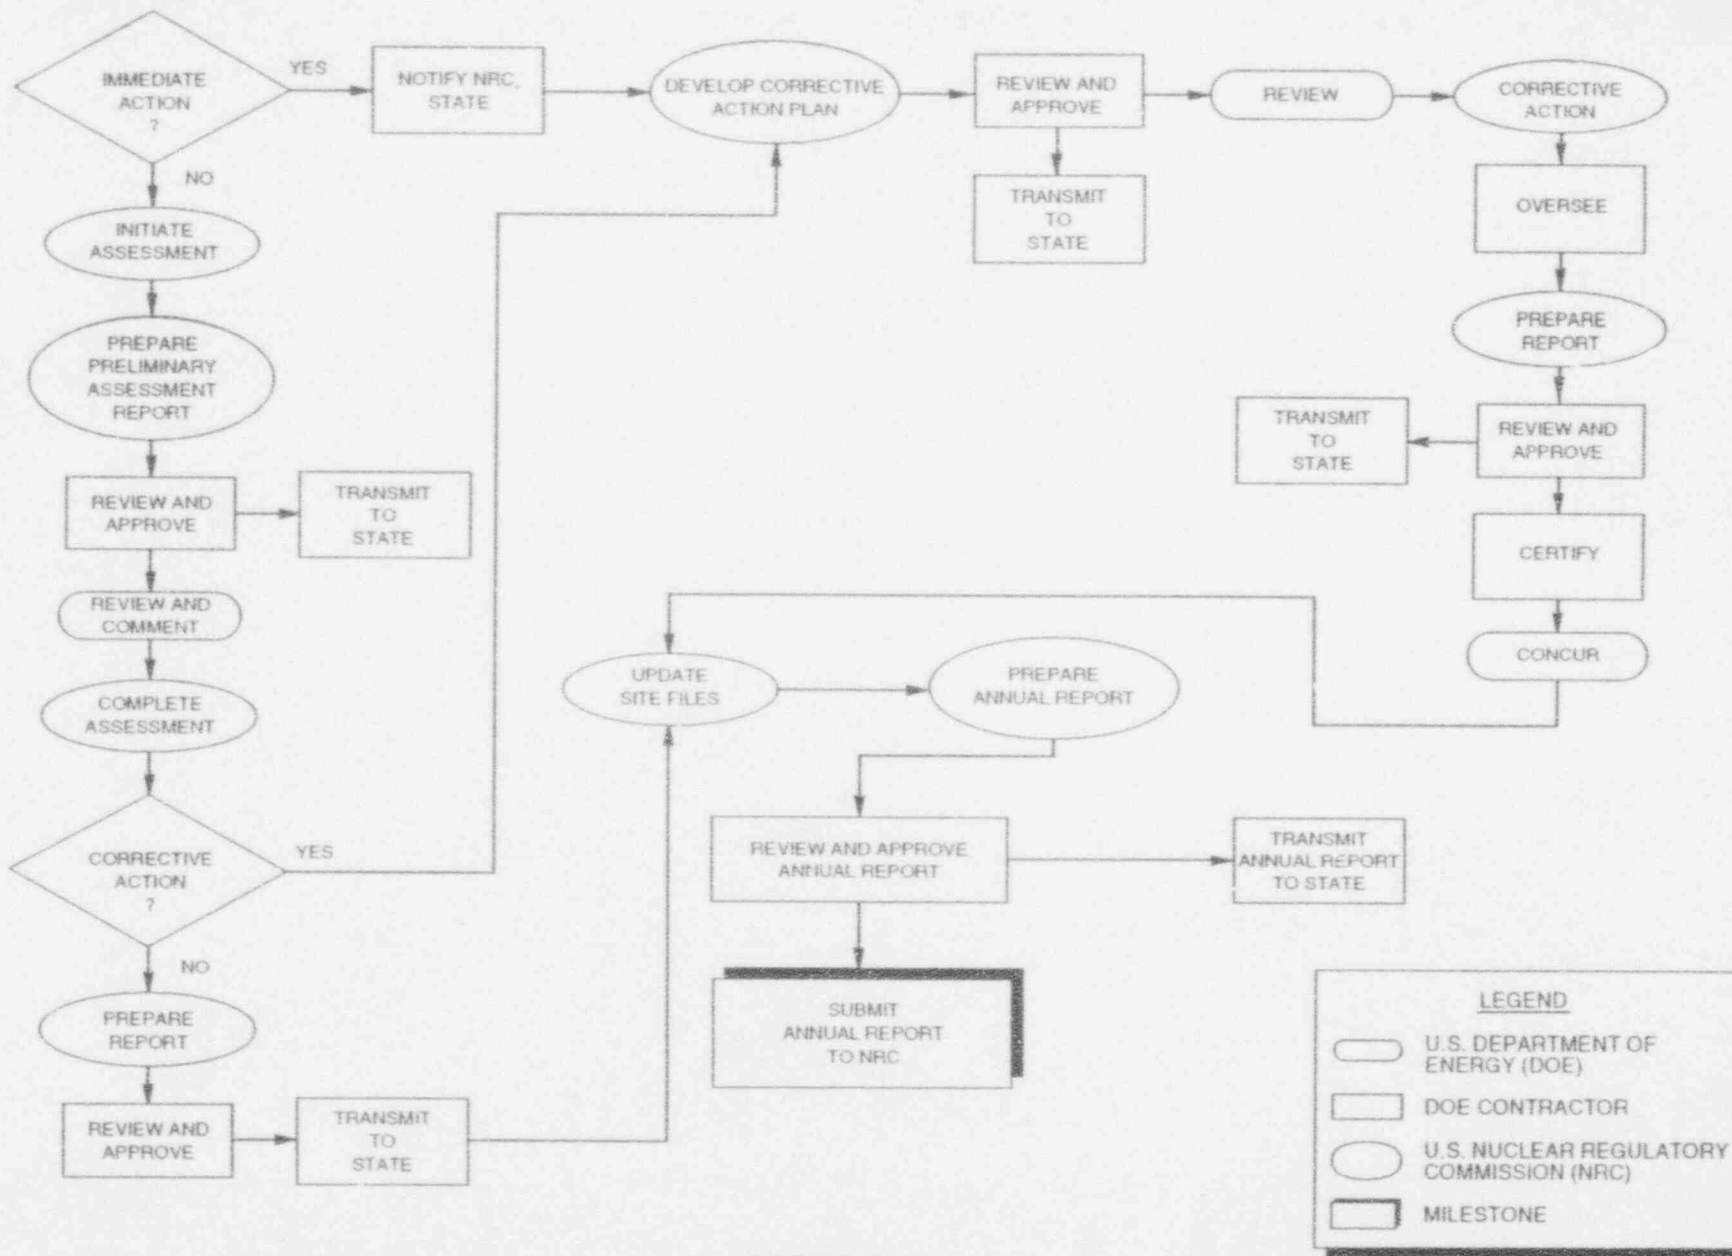


FIGURE 9.1
CORRECTIVE ACTION
UMTRA PROJECT LONG-TERM SURVEILLANCE PROGRAM

NEED FOR CORRECTIVE ACTION IDENTIFIED

- DOCUMENT AND REPORT PROBLEM TO NRC, STATE, AND TRIBES
- EVALUATE PROBLEM AND PROPOSE A SOLUTION
- DEVELOP CORRECTIVE ACTION PLAN AND NOTIFY NRC, STATE
- SELECT CONTRACTOR TO PERFORM CORRECTIVE ACTION
- ESTABLISH CONTRACTUAL CONDITIONS FOR PERFORMING CORRECTIVE ACTION AND GUARANTEE CORRECTIVE ACTION WILL BE PERFORMED IN ACCORDANCE WITH CONTRACTUAL AGREEMENTS AND DESIGN SPECIFICATIONS

IMPLEMENTATION

- MONITOR PROGRESS OF CORRECTIVE ACTION
- VERIFY COMPLETION OF CORRECTIVE ACTION

CERTIFICATION

- VERIFY CORRECTIVE ACTION AS DESIGNED CORRECTS THE PROBLEM
- ENSURE RECURRENCE OF PROBLEM IS MINIMIZED OR AVOIDED
- CERTIFY COMPLETION OF CORRECTIVE ACTION IN ACCORDANCE WITH 40 CFR 192
- SUBMIT CERTIFICATION REPORT TO NRC

REF: DOE, 1992a.

FIGURE 9.2
KEY ELEMENTS IN THE CORRECTIVE ACTION PROCESS

- Gullies that have cut through or are threatening to cut through the outer cover.
- Slides on the slopes of the disposal cell.
- Significant deterioration of the rock cover.
- Cracks that extend deeply into the disposal cell cover.
- Persistent animal burrowing or excessive vegetation growth on the disposal cell.
- Removal of some of the disposal cell material by humans or natural events such as flash floods.
- Significant erosion at the edge of the escarpment.
- Increased seepage along the escarpment or deterioration of the surface water quality.

9.2 IMPLEMENTATION OF CORRECTIVE ACTION

The DOE will define detailed procedures for implementing the corrective action when a corrective action becomes necessary. Implementing a corrective action program could be carried out in two or more steps. If a preliminary assessment recommends a phased response to the problem, a program of additional characterization with additional data collection and/or evaluative monitoring would be implemented to draw conclusions and recommend the appropriate corrective action.

9.3 CERTIFICATION AND REPORTING REQUIREMENTS

While a corrective action is being performed or evaluated, the DOE may prepare progress reports on the corrective action. The NRC will be given a copy of each report, or the report will be attached to the final report. In any event, the NRC will be informed of the problem and the solution being evaluated. All reports will be provided to the Navajo Nation. All reports, data, and documentation generated during the corrective action will be included in the Shiprock permanent site file.

Following completion of the corrective action, the DOE will certify that all work was completed in accordance with the design specifications and EPA standards. The DOE will submit the report and the certification statement to the NRC for acceptance. The Navajo Nation will also receive copies of this documentation. A copy of the accepted certification statement will become part of the Shiprock permanent site file.

10.0 RECORD KEEPING AND REPORTING REQUIREMENTS

The DOE will maintain the Shiprock permanent site file. The file will contain all the information necessary to prepare for and conduct site surveillance. Carefully compiled, complete, and accurate reports of site surveillance activities will be maintained in accordance with archival procedures set forth in 41 CFR Part 101 and 36 CFR Part 1220-1238 (Subchapter B - Records Management).

As required by 10 CFR §40.27 (55 FR 45591), the DOE will provide an annual report to the NRC documenting the results of the long-term surveillance program. Copies of the annual report will be provided to the Navajo Nation and will be added to the Shiprock permanent site file. Annual reports and site records will accomplish the following:

- Document the history of disposal site performance.
- Provide the information necessary to forecast future site surveillance needs.
- Demonstrate that information on site integrity is available to the public.
- Assure the NRC that licensing provisions are being met.

10.1 RECORDS

The permanent Shiprock long-term surveillance program permanent site file will contain all the information necessary for carrying out the long-term surveillance program. These documents will be maintained by the GJPO in Grand Junction, Colorado, in accordance with DOE Order 1324.2A, *Records Disposition*. All original deeds, custody agreements, and other property documents will be kept at the DOE Facilities and Property Management Division, Albuquerque, New Mexico. Surveillance and maintenance documentation maintained at the GJPO will exist as a record collection separate from the UMTRA Project Document Control Center.

All information will be available for review by the NRC and the public. The Shiprock permanent site file will include the following:

- Licensing documentation.
- Site-specific LTSP.
- Disposal site legal description, title, custody documentation, and cooperative agreements.
- Interagency agreements, authorizations, and access agreements.
- Documentation of rights of entry.
- Environmental assessment and finding of no significant impact.
- Disposal site characterization report.

- Final RAP and final design for construction.
- Pertinent design and construction documents and drawings.
- Site certification report (certification summary, completion, and final audit reports).
- As-built drawings.
- Site atlas (vicinity, topographic, and base maps).
- Baseline and aerial photographs.
- Groundwater monitoring reports and records.
- Additional monitoring reports and records.
- Monitor well permits and abandonment records.
- Annual reports to the NRC.
- Annual inspection reports and records.
- Follow-up or contingency inspection preliminary assessments, reports, and records.
- Custodial maintenance or repair reports and records.
- Corrective action plans, reports, and records.
- Quality assurance (QA) program plan.

A more detailed site file index is contained in Attachment 3. Original UMTRA Project records and files will be archived at the DOE UMTRA Project Office, Albuquerque, New Mexico. Copies of the documentation and annual updates or additions during the long-term surveillance program will be kept in the permanent site file held by the GJPO, Grand Junction, Colorado. The GJPO will update the Shiprock LTSP site file, as necessary, after completing the disposal site inspections.

10.2 REPORTS

The GJPO will provide an annual report to the NRC documenting the results of the annual site inspections and any other activities conducted in conjunction with the long-term surveillance program. Criterion 12 to Appendix A of 10 CFR Part 40 requires that the annual report be submitted within 90 days after the date of the last UMTRA Project site inspection for that calendar year.

The GJPO will also submit reports to the NRC documenting follow-up or contingency inspections and any corrective action plans. If any unusual damage or disruption is discovered, Criterion 12 requires that all preliminary inspection reports be submitted within 60 days of the discovery.

Results of the ongoing groundwater monitoring program for the floodplain area will be contained in a separate report not related to the long-term surveillance program. Groundwater monitoring specific to disposal site surveillance was determined to be inapplicable to the Shiprock disposal site.

11.0 EMERGENCY NOTIFICATION AND REPORTING

The Shiprock disposal cell was designed to comply with 40 CFR Part 192 with minimum maintenance and oversight for at least 200 years and up to 1000 years. However, due to unforeseen events, problems could develop that affect the disposal cell's ability to remain in compliance with 40 CFR Part 192. Because of this possibility, the DOE has notified state and federal agencies requesting notification of any purposeful intrusion or damage discovered or reported at the Shiprock disposal site as well as the occurrence of an earthquake, tornado, or flood in the Shiprock disposal site area.

11.1 AGENCY AGREEMENTS

The DOE has negotiated formal agreements with tribal, state, and federal agencies for emergency notification. If intrusion or damage is discovered or reported at the Shiprock disposal site, or if an earthquake, tornado, or flooding occurs in the Shiprock disposal site area, these agencies will notify the DOE and an investigation into the occurrence will take place. Copies of the notification agreements are presented in Attachment 6. The designated point of contact for emergency notification is the GJPO's 24-hour phone line [(303) 248-6070]. This number is posted on the Shiprock disposal site entrance signs and perimeter signs so that members of the public can notify the DOE if problems are discovered.

The agreements shall be carried out in accordance with the requirements of DOE Order 5000.3B, *Occurrence Reporting and Processing of Operations Information*. In accordance with this order, the UMTRA Project Office will be the designated facility contact until the Shiprock site is brought under the NRC general license. After that, the designated facility contact will be the GJPO.

The contact lists and telephone numbers for all agencies and parties with whom the DOE has entered into agreements will be updated annually, in conjunction with the site inspection, and included in the disposal site inspection report (refer to Section 7.2).

11.2 UNUSUAL OCCURRENCES

The DOE has requested notification of unusual events at the Shiprock site from the following agencies:

- Shiprock Navajo Police: The DOE has requested that the GJPO be notified of unusual occurrences in the disposal site area that may affect the surface or subsurface stability.
- Bureau of Reclamation, Durango, Colorado: The DOE has requested that the GJPO be notified if a dam failure or a large-scale release due to a flood event greater than the outflow capacity of Navajo Dam is imminent.

11.3 EARTHQUAKES

The DOE subscribes to the U.S. Geological Survey (USGS) Early Warning Service for notification when an earthquake of sufficient magnitude threatens a disposal site. This service provides data on the magnitude of the event and the location of the epicenter.

The USGS National Earthquake Information Center will notify the DOE GJPO if a seismic event(s) occurs that fits any of the following descriptions:

- Any earthquake of magnitude 3.0 or greater, within 0.3 degree [about 20 mi (30 km)] of the site.
- Any earthquake of magnitude 5.0 or greater, with 1.0 degree [about 70 mi (110 km)] of the site

11.4 METEOROLOGICAL EVENTS

The DOE will complete an agreement for a continuing reporting service with the New Mexico State Office of the National Weather Service (NWS) in Albuquerque, New Mexico. The NWS will notify the DOE GJPO within 8 hours of issuance of a flash flood warning or a tornado warning in San Juan County, New Mexico.

Returned response letters from all of the agencies will be kept in the permanent site files.

12.0 QUALITY ASSURANCE

The GJPO is responsible for developing QA procedures specific to the UMTRA Project long-term surveillance program. The GJPO QA program plan should specify requirements for the following:

- Program planning.
- Program activities, including inspections, site maintenance, corrective action, and emergency responses.
- Required monitoring.
- Qualifications and training of personnel.
- Surveillance and audits of program.
- Analytical QA.
- Analytical data validation.

All Shiprock disposal site inspections, records, photographs, maps, and other information related to the long-term surveillance program for the Shiprock disposal site are subject to formal and unannounced audits conducted by the DOE UMTRA Project Office or the NRC. Specific QA criteria have already been developed for aerial photographs (DOE, 1992a).

12.1 GROUNDWATER MONITORING

Groundwater monitoring will not be performed at the Shiprock disposal cell. Therefore, no QA activities specific to groundwater monitoring will apply to the Shiprock long-term surveillance program.

13.0 PERSONNEL HEALTH AND SAFETY

DOE Order 5480.1B, *Environment, Safety and Health Program for DOE Operations*, establishes personnel health and safety procedures for all DOE operations. After a disposal site is licensed and transferred to the GJPO, health and safety procedures for GJPO personnel and GJPO subcontractors will be the responsibility of the GJPO. The GJPO will determine health and safety requirements for its personnel in accordance with applicable orders and federal regulations. Because the disposal cell was constructed to control radium-226 and radon-222 releases from the residual radioactive material to within regulatory standards [40 CFR Part 192.02(a)], radiation exposure tracking and dosimetry badges are not needed.

13.1 HEALTH AND SAFETY

The inspector's health and safety training and certifications, the locations and telephone numbers for emergency medical and law enforcement facilities, and the facility contact 24-hour telephone number should be verified prior to a site inspection.

Specific safety concerns at the Shiprock disposal site include ponded water; slip, trip, and fall hazards; animal, snake, and insect bites; heat and cold stress; fire hazards; punctures and cuts; and driving hazards.

Emergency medical and law enforcement

Local emergency medical and law enforcement agencies have been briefed on the scope of work at the Shiprock disposal site during the long-term surveillance and maintenance phase. The pertinent 24-hour emergency numbers are as follows:

- Fire: (505) 368-4333.
- Hospital: (505) 368-4971.
- Ambulance: (505) 368-4971, ext. 660.
- Police/sheriff: (505) 368-4383.

These agencies can also be contacted by dialing 911.

The nearest phone is at the NECA office on land northwest and adjacent to the disposal cell.

The nearest hospital with an emergency room is the Shiprock Indian Health Services Hospital in Shiprock [phone number (505) 368-4971]. This hospital also has a trauma center. The hospital is on the west side of U.S. Highway 666 north, approximately 0.5 mi (0.8 km) north of the intersection of U.S. Highway 550 and U.S. Highway 666 in the center of Shiprock.

The San Juan Hospital is in Farmington, New Mexico [phone number (505) 325-5011]. Directions to the hospital from the site are as follows:

- Drive west on the gravel road from the site to U.S. Highway 666.
- Turn north on U.S. Highway 666 and drive into Shiprock.
- Turn east on U.S. Highway 64 in Shiprock and drive approximately 30 mi (19 km) (45 minutes) to Farmington.
- Coming into Farmington, turn south on State Highway 371.
- The hospital is on the corner of State Highway 371 and West Maple Street.

13.2 REPORTABLE INCIDENTS

The inspection team will be briefed by the GJPO health and safety officer on potential site hazards and other requirements prior to site inspection or any site visit.

In accordance with DOE Order 5000.3B, any accident, injury, or environmental event (e.g., tornado, flood, etc.) occurring during the site inspection is a reportable incident. The condition or event will be reported to the GJPO facility manager or designated contact within 8 hours of the incident. The GJPO facility manager's 24-hour telephone number for reporting an incident is (303) 248-6070.

14.0 LIST OF CONTRIBUTORS

The following individuals contributed to the preparation of this report.

| Name | Contribution |
|---|---|
| M. Day, D. Tarbox | Overall document responsibility; authorship |
| E. Artiglia, C. Silva, L. Ulland, C. Yancey, | Document review |
| A. Groffman | Geochemistry |
| G. Hartmann | Engineering design |
| D. Tarbox | Hydrology, hydrogeology |
| L. Keith, C. Slosberg | Text processing |
| B. Harvey | Graphic design |
| A. Cree, D. Thalley | Technical editing |

15.0 REFERENCES

- DOE (U.S. Department of Energy), 1993. *Baseline Risk Assessment of Groundwater Contamination at the Uranium Mill Tailings Site Near Shiprock, New Mexico*, DOE/AL/62350-48D, DOE UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- DOE (U.S. Department of Energy), 1992a. *Guidance for Implementing the UMTRA Project Long-term Surveillance Program*, UMTRA-DOE/AL-350125.0000, Revision 1, final, DOE UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- DOE (U.S. Department of Energy), 1992b. *1991 Annual Prelicensing Inspection of the Shiprock, New Mexico, UMTRA Project Disposal Site*, DOE/ID/12584-102, prepared for the U.S. Department of Energy by Chem-Nuclear Geotech, Inc., DOE Grand Junction Projects Office, Grand Junction, Colorado.
- DOE (U.S. Department of Energy), 1989. *Technical Approach Document*, UMTRA-DOE/AL-050425.0002, DOE UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- DOE (U.S. Department of Energy), 1985. *Remedial Action Plan and Site Conceptual Design for Stabilization of the Inactive Uranium Mill Tailings Site at Shiprock, New Mexico*, UMTRA-DOE/AL-050504.0039, prepared by the U.S. Department of Energy (with subsequent modifications), UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- DOE (U.S. Department of Energy), 1984. *Environmental Assessment of Remedial Action at the Shiprock Uranium Mill Tailings Site, Shiprock, New Mexico*, DOE/EA-0232, DOE UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- FBDU (Ford, Bacon and Davis Utah, Inc.), 1981. *Engineering Assessment of Inactive Uranium Mill Tailings, Shiprock Site, Shiprock, New Mexico*, DOE/UMT-0104 FBDU 360-02 UC 70, July 1981, prepared by Ford, Bacon and Davis Utah, Inc., for the U.S. Department of Energy, UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- MK-F (MK-Ferguson), 1987a. *Shiprock, New Mexico, Uranium Mill Tailings Site Remedial Action Completion Report*, prepared by MK-F for the U.S. Department of Energy, UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- MK-F (MK-Ferguson), 1987b. *MK-Ferguson Construction Subcontracts, UMTRA Project Surveillance and Maintenance Plan, Shiprock, New Mexico*, MK-Ferguson Company, Albuquerque, New Mexico.

- NRC (U.S. Nuclear Regulatory Commission), 1991. *Final Completion Report Review for the Remedial Action at the Shiprock Uranium Mill Tailings Site, Shiprock, New Mexico*, NRC Division of Low-Level Waste Management and Decommissioning, Washington, D.C.
- NRC (U.S. Nuclear Regulatory Commission), 1990. *Final Technical Evaluation Report for the Proposed Remedial Action at the Shiprock Tailings Site, Shiprock, New Mexico*, NRC Division of Low-Level Waste Management and Decommissioning, Office of Nuclear Material Safety and Safeguards, Washington, D.C.
- TAC (Technical Assistance Contractor), 1993. "Survey of Water Use," conducted in January 1993 by the Technical Assistance Contractor, Jacobs Engineering Group Inc., for the U.S. Department of Energy, UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.

CODE OF FEDERAL REGULATIONS

- 10 CFR Part 40, "Custody and Long-Term Care of Uranium and Thorium Mill Tailings Disposal Sites," Title 10, *Code of Federal Regulations*, Part 40, U.S. Nuclear Regulatory Commission, Washington, D.C.
- 36 CFR Part 1220-1238, "National Archives and Records," Subchapter B - Records Management, Title 36, *Code of Federal Regulations*, Part 1220-1238, Washington, D.C.
- 40 CFR Part 192, "Health and Environmental Protection Standards for Uranium and Thorium Mill Tailings," Title 40, *Code of Federal Regulations*, Part 192, U.S. Environmental Protection Agency, Washington, D.C.
- 41 CFR Part 101, "Federal Property Management Regulations," Title 41, *Code of Federal Regulations*, Part 101, General Services Administration, Washington, D.C.

DOE ORDERS

- Order 1324.2A, *Records Disposition*, September 13, 1988, Office of Information Resource Management, U.S. Department of Energy, Washington, D.C.
- Order 5000.3B, *Occurrence Reporting and Processing of Operations Information*, draft, September 24, 1991, U.S. Department of Energy, UMTRA Project Office, Albuquerque Operations Office, Albuquerque, New Mexico.
- Order 5480.1B, *Environment, Safety and Health Program for DOE Operations*, September 1986, U.S. Department of Energy, Safety Programs Division, Washington, D.C.

FEDERAL REGISTER

52 FR 36000, "Standards for Remedial Action at Inactive Uranium Processing Sites; Proposed Rule," September 24, 1987, *Federal Register*, Washington, D.C.

55 FR 45591, "Custody and Long-Term Care of Uranium and Thorium Mill Tailings Disposal Sites," October 30, 1990, *Federal Register*, U.S. Nuclear Regulatory Commission, Washington, D.C.

UNITED STATES CODE

42 USC §7901 *et seq.*, *Uranium Mill Tailings Radiation Control Act of 1978*, November 8, 1978, Washington, D.C.

ATTACHMENT 1

NRC CONCURRENCE AND
LICENSING DOCUMENTATION



NRC/UMT/0591-0037

UNITED STATES
NUCLEAR REGULATORY COMMISSION
WASHINGTON, D. C. 20555

MAY 09 1991

Mr. Mark Matthews, Project Manager
Uranium Mill Tailings Remedial Action
Project Office
U.S. Department of Energy
Albuquerque Operations Office
P.O. Box 5400
Albuquerque, NM 87115

Dear Mr. Matthews:

The U.S. Nuclear Regulatory Commission (NRC) staff has completed its review of the Certification Report and all associated documentation pertinent to the completed remedial action at the inactive uranium mill tailings site at Shiprock, New Mexico. Our review is documented in the enclosed Completion Review Report (CRR), which discusses the staff's evaluation of the completed remedial action against the previously approved plans and specifications.

Based on its review of the Certification Report and on observations during periodic site inspections, the NRC staff concurs that the Department of Energy (DOE) has performed remedial action at the Shiprock site in accordance with the approved plans and specifications and that this action complies with the Environmental Protection Agency's standards in 40 CFR Part 192, Subparts A-C. With the exception of characterization and cleanup of the floodplain alluvial aquifer, remedial actions are complete for the Shiprock site. DOE has proposed deferral of selection and performance of a groundwater cleanup program at this time, and plans to handle this as part of a separate groundwater restoration program. The NRC staff, therefore, has signed the enclosed signature pages signifying its concurrence in completion of the Shiprock remedial action (other than ground-water restoration).

If you have any questions regarding this review, please contact me at FTS 492-3439 or the NRC Project Manager, Dan Gillen, at FTS 492-0517.

Sincerely,

John Surmeier, Chief
Uranium Recovery Branch
Division of Low-Level Waste Management
and Decommissioning, NMSS

Enclosures: As stated

cc: T. Brazley, DOE Hq
M. Abrams, DOE/A1
K. Feldman, EPA
M. Begaye, Navajo Nation

U.S. DEPARTMENT OF ENERGY
CERTIFICATION SUMMARY
for the
Shiprock, New Mexico, Disposal Site

The Uranium Mill Tailings Remedial Action Project Office and the Contracts and Procurement Division for the U.S. Department of Energy certify that the Shiprock, New Mexico, combined processing and disposal site is complete and meets all design criteria, technical specifications, and the surface Remedial Action Plan required under Public Law 95-604 has been met. The undersigned request that the U.S. Nuclear Regulatory Commission concur with this certification.

Betsy A. Shaw

Betsy A. Shaw
Chief, Program and R & D Branch
Contracts and Procurement Division
Contracting Officer

DATE: 4/29/91

Mark L. Matthews

Mark L. Matthews
Project Manager
Uranium Mill Tailings Remedial
Action Project Office

DATE: 4/26/91

The Chief, Uranium Recovery Branch, Division of Low-Level Waste Management and Decommissioning, U.S. Nuclear Regulatory Commission hereby concurs with the U.S. Department of Energy's completion of surface remedial action at the Shiprock, New Mexico, processing site.

John J. Surmeier

Mr. John J. Surmeier
Chief, Uranium Recovery Branch,
Division of Low-Level Waste
Management and Decommissioning
U.S. Nuclear Regulatory Commission

DATE: 5/9/91

ATTACHMENT 2

SITE OWNERSHIP/CUSTODY DOCUMENTATION

(CUSTODIAL CARE AGREEMENT PENDING)

ATTACHMENT 3
PERMANENT SITE FILE INDEX

LICENSING DOCUMENTATION

- A. Long-term surveillance plan (LTSP) (final)
- B. Prelicensing custodial care
- C. U.S. Nuclear Regulatory Commission acceptance of LTSP
- D. General license takes effect

DOCUMENTATION OF DOE TITLE/CUSTODY

- A. Documentation:
 - State
 - Federal
 - Tribal
- B. Legal description
- C. Custodial care agreements

NATIONAL ENVIRONMENTAL POLICY ACT (NEPA) DOCUMENTATION

- A. Environmental impact statement/environmental assessment
- B. Record of decision/finding of no significant impact
- C. Additional NEPA
- D. Mitigation action plan

REMEDIAL ACTION DOCUMENTATION

- A. Disposal site characterization report
- B. Remedial action plan/remedial action selection report
 - Concurrence pages (signed)
- C. Draft/final technical evaluation report
- D. Final design for construction
- E. Additional design/construction documents/drawings
- F. Final close-out inspection report

G. Site certification report/package

- U.S. Department of Energy certification/summary
- Final completion report
- Final audit report
- Completion report review
- Certification pages (signed)

AS-BUILT CONSTRUCTION

- Drawings and maps

PHOTOGRAPHS

- A. Construction photographs
- B. Aerial photographs
- C. Close-out/inspection photographs
- D. Verification and orientation/initial precicensing inspection photographs

MONITORING DOCUMENTATION

- A. Active monitoring wells
- B. Location of inactive (abandoned) monitor wells
- C. Monitoring station records
- D. Monitoring reports
- E. Programmatic procedures

AGREEMENTS

- A. Interagency
- B. Individual/privat.

PDCC SITE FILE INDEX

ATTACHMENT 4
SITE INSPECTION PHOTO LOG

ATTACHMENT 5

INITIAL SITE INSPECTION CHECKLIST

**SITE INSPECTION CHECKLIST FOR THE SHIPROCK, NEW MEXICO
URANIUM MILL TAILINGS DISPOSAL SITE**

Date of Last Inspection:

Reason for Last Inspection:

Responsible Agency¹: DOE Grand Junction Projects Office

Address: P.O. Box 2567, Grand Junction, Colorado 81502-2657

Responsible Agency Official:

Inspection Start Date and Time:

Weather Conditions at Site:

Inspection Completion Date and Time:

Chief Inspector: _____
Name Title Organization

Assistant Inspectors: _____
Name Title Organization

Name Title Organization

A. GENERAL INSTRUCTIONS

1. All checklist items must be completed and detailed comments made to document the results of the site inspection. The completed checklist is part of the field record of the inspection. Additional pages should be used, as necessary, to ensure that a complete record is made. Attach the additional pages and number all pages upon completion of the inspection.
2. Inspectors are to provide an up-to-date résumé or vitae for inclusion in the inspection report.
3. Any checklist line item marked by an "*" that is checked by an inspector must be fully explained or an appropriate reference to previous reports provided. The purpose of this requirement is to provide a written explanation of inspector observations and the inspector's rationale for conclusions and recommendations. Explanations are to be placed on additional attachments and cross-referenced appropriately. Explanations, in addition to narrative, will take the form of sketches, measurements, and annotated site atlas overlays.

¹Responsibility for site inspections assigned by DOE UMTRA Project Office, Albuquerque, to DOE Grand Junction Projects Office, November 6, 1990.

4. The site inspection is a walking inspection of the entire site, including the perimeter and sufficient transects as specified in Section 6.4.2, to be able to inspect the entire surface and all features specifically described in this checklist. Every monument, site marker, sign, monitoring well, and erosion control marker will be inspected.
5. A set of color print 35-mm photographs is required. Sufficient photographs will be taken to compare to baseline photographs and determine if there are any significant differences in site appearance. In addition, all anomalous features or new features (such as changes in adjacent area land use) are to be photographed. A photo log entry will be made for each photograph taken.
6. Field notes taken to assist in completion of this checklist will become part of the inspection record. No form is specified; the field notes must be legible and in sufficient detail to enable review by succeeding inspectors and the responsible agency.

B. PREPARATION (to be completed prior to site visit)

Yes No

1. Review licenses (including *Long-Term Surveillance and Maintenance Plan*).
2. Obtain site as-built plans with the following information:
 - a. Adjacent off-site features and land use; fences, gates, and signs; access roads and paths.
 - b. Survey monuments, boundary markers, site markers, aerial photo ground controls, ground photo locations.
 - c. Monitoring wells, site drainage, diversion channels.
 - d. Planned inspection transects and vegetation cover.
 - e. Others.
3. Review previous inspection reports.
 - a. Were anomalies or trends in modifying processes detected on previous inspections?
 - b. Was a Phase II inspection conducted?
 - c. Was custodial maintenance performed?
 - d. Was contingency repair work done as a result of the Phase II inspection?

Yes No

4. Review site custodial maintenance and contingency repair records.
 - a. Has site contingency repair resulted in a change from as-built conditions?
 - b. Are revised as-builts available that reflect contingency repair changes?
5. When necessary, obtain entry approval to adjacent property (attach signed access agreement).
6. Review aerial photos if taken since last inspection. For each set, enter date taken, scale, and if interpreted.

| <u>Set</u> | <u>Date</u> | <u>Scale</u> | <u>Interpreted</u> | |
|------------|-------------|--------------|--------------------|----------|
| | | | <u>Y</u> | <u>N</u> |
| 1. | _____ | _____ | ___ | ___ |
| 2. | _____ | _____ | ___ | ___ |
| 3. | _____ | _____ | ___ | ___ |

7. Were any of the following suggested by examination of aerial photographs? (If yes, give photo set date and indicate if item noted by interpreter or inspector):
 - a. Intrusion by man?
 - b. Intrusion by animals?
 - c. Channelized erosion on slopes?
 - d. Change in area drainage?
 - e. Landslides?
 - f. Creep on slopes?
 - g. Obstruction of diversion channels?
 - h. Bank erosion of diversion channels?
 - i. Seepage?

Yes No

- j. Cracking?
 - k. Change in vegetative cover?
 - l. Displacement of fences, site markers, boundary markers, or monuments?
 - m. Change in adjacent land use?
 - n. Evidence of tailings exposure or transport?
8. From as-builts, or subsequent inspection reports, note distance and azimuth from designated site location, such as a monument, to adjacent off-site features that could eventually affect integrity of site.

| <u>Off-site feature</u> | <u>Site monument no.</u> | <u>Distance</u> | <u>Azimuth</u> |
|-------------------------|--------------------------|-----------------|----------------|
| 1. _____ | _____ | _____ | _____ |
| 2. _____ | _____ | _____ | _____ |
| 3. _____ | _____ | _____ | _____ |

9. Assemble and check out the following equipment, as needed, to conduct inspections:
- a. Cameras, film, and miscellaneous support equipment.
 - b. Binoculars.
 - c. Tape measure.
 - d. Optical ranging device.
 - e. Compass.
 - f. Photo scale stick.
 - g. Erasable board.
 - h. Plant press, plastic bags for vegetation.
 - i. Keys to locks.
 - j. Bolt cutters.
 - k. Hand lens.
 - l. Clipboard.
 - m. Others.

Yes No

C. SITE INSPECTION

1. Adjacent off-site features [within 0.25 mile (0.4 km) of site boundary]
 - a. Have there been any changes in use of adjacent areas (grazing, construction, agriculture)?
 - b. Are there any new roads or trails?
 - c. Has there been a change in the position of nearby stream channels?
 - d. Has there been headward erosion of nearby gullies?
 - e. Are there new drainage channels?
 - f. Others?
2. Access roads and paths, fences, gates, and signs.
 - a. Is there a break in the fence?
 - b. Have any posts been damaged or their anchoring weakened?
 - c. Is there evidence of erosion or digging beneath the fence?
 - d. Do any of the gates show evidence of tampering or damage?
 - e. Is there any evidence of human intrusion?
 - f. Is there any evidence of large animal intrusion?
 - g. Have any signs been damaged or removed?
(Number of signs replaced: ____)
 - h. Are access roads and paths passable?
 - i. Others?

Yes No

3. Monuments and other permanent features.
 - a. Have the survey or boundary monuments been defaced or disturbed?
 - b. Have the site markers been disturbed by man or natural processes?
 - c. Do natural processes threaten the integrity of any monument or site marker?
 - d. Others?

4. Crest.
 - a. Is there evidence of uneven settling? (depressions, scarps)
 - b. Is there cracking?
 - c. Has the outer cover layer been breached?
 - d. Is there evidence of erosion?
 - 1) By water? (rills, rivulets)
 - 2) By wind? (pedestal rocks, ripple marks)
 - e. Is there evidence of animal burrowing?
 - f. Others?

5. Slopes.
 - a. Is there evidence of gradual downslope movement (creep)? (terraces, deflection of plants)
 - b. Is there cracking?
 - c. Can depressions or bulges on the slope be seen?
 - d. Has the outer cover layer been breached?

Yes No

- e. Is there evidence of erosion:
 - 1) By water?
 - 2) By wind?
 - f. Has water runoff become channelized?
(rivulets, gullies)
 - g. Is there evidence of seepage? (moisture,
color, vegetation)
 - h. Is there evidence of animal burrowing?
 - i. Is there evidence of deterioration of
riprap or gravel cover?
 - j. Others?
6. Periphery (within site boundaries).
- a. Is there evidence of seepage such as wet
areas or localized change of vegetation?
 - b. Is there evidence of sediment transport
from the tailings pile by water or wind?
 - c. Is the drainage as described in the
as-builts?
 - d. Others? Burrowing animals; erosion.
7. Diversion channels.
- a. Is there evidence of bank erosion?
 - b. Has the integrity of riprap structures been
disturbed by people or natural processes?
 - c. Is there evidence of channel erosion?
 - d. Is there evidence of sedimentation in the
channel?
 - e. Is the channel obstructed in any way?

Yes No

f. Is there any evidence that the diversion channels are not performing their function?

g. Others?

8. Photography.

a. Have all photos required by the site atlas photo overlay been taken?

b. Has a photo log sheet been prepared for each roll of film exposed?

c. Number of rolls of film exposed: ____

d. Number of frames per roll: ____

e. Others?

9. Monitor wells.

a. Have any monitor wells been disturbed by man or natural processes?

b. Does any natural process threaten the integrity of any monitor well?

c. Are all monitor wells capped and locked?

d. Others?

D. FIELD CONCLUSIONS

1. Is there an imminent hazard to the integrity of the tailings pile? (Immediate report required)

Person _____

Agency to whom report made: _____

2. Are more frequent Phase I inspections required?

3. Are existing contingency repair actions satisfactory?

4. Is a Phase II inspection required?

Yes No

- 5. Is a contingency report or custodial maintenance required?
- 6. Rationale for field conclusions are documented as the text of this report.

E. CERTIFICATION

I have conducted a prelicensing inspection of the Shiprock uranium mill tailings site in accordance with the procedures of the license (includes the site surveillance plan) as recorded on this checklist, attached sheets, field notes, photo log sheets, and photos.

Chief Inspector's Signature

Printed Name


Title

Date

(Stamp or Seal)

ATTACHMENT 6

AGENCY NOTIFICATION AGREEMENTS

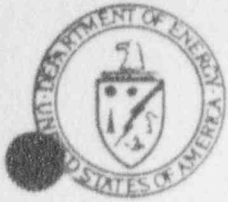

Department of Energy

Albuquerque Operations Office
P.O. Box 5400
Albuquerque New Mexico 87115

NOV 20 1992

Mr. Don Fazzan
Bureau of Reclamation
P.O. Box 640
Durango, Colorado 81302

Dear Mr. Fazzan:

The U.S. Department of Energy (DOE) Uranium Mill Tailings Remedial Action Project Office is requesting notification if a dam failure or a large-scale release, due to a flood event greater than the outflow capacity of the Navajo Dam, is imminent.

The purpose of the notification request is to assist DOE in surveying and maintaining the integrity of its radioactive waste disposal site located approximately one mile south of Shiprock, New Mexico.

If the notification request discussed above is agreeable to you, please sign and return the enclosed reply letter for our records as soon as possible.

Should you have any questions, please contact Mike Abrams of my staff at (505) 845-5758. Thank you for your attention in this matter.

Sincerely,

Albert Chernoff
Project Manager
Uranium Mill Tailings Remedial Action
Project Office

Enclosure

cc w/o enclosure:
J. Virgona, GJPO
C. Jones, GJPO
M. Abrams, UMTRA
F. Bosiljevac, UMTRA
M. Day, TAC
E. Artiglia, TAC

7-15288 74-891
Bureau of Reclamation



United States Department of the Interior
BUREAU OF RECLAMATION
 UPPER COLORADO REGION
 DURANGO PROJECTS OFFICE
 835 E. SECOND AVENUE
 P.O. BOX 640
 DURANGO, COLORADO 81302-0640

IN REPLY
REFER TO:

DEC 1 1 1992

DUR-431
PRJ-13.00

| DATE | SURNAME | COI |
|----------------|---------|-----|
| | | 431 |
| | | 430 |
| | | 400 |
| | | 910 |
| | | |
| | | |
| | | |
| | | 100 |
| Classification | | |
| Project | | |
| Control No. | | |
| Folder I.D. | | |

Mr. Albert Chernoff, UMTRA Project Manager
 Department of Energy
 Albuquerque Operations Office
 P.O. Box 5400
 Albuquerque NM 87115

Subject: Notification of Releases from Navajo Dam, Navajo Unit, Colorado River Storage Project Colorado and New Mexico (Dam)

Dear Mr. Chernoff:

We have received your letter of November 20, 1992 requesting notification of large-scale releases from Navajo Dam. Mr. Mike Abrams of your staff has confirmed that DOE should first be notified when releases in excess of the main outlet works maximum capacity (4,960 cfs) are anticipated.

We have revised our Navajo Dam Standing Operating Procedures (SOP) and associated Emergency Preparedness Plan (EPP) to include notification of DOE under the conditions described.

A signed confirmation letter is enclosed. If you have any questions, please contact Don Pazzan of my staff at (303) 385-6578.

Sincerely,

Jessa A. Miller

Max J. Stodolski
 Projects Manager

ACTING FOR

Enclosure

cc: Regional Director, Salt Lake City UT
 Attention: UC-430 (w/encl)

DFAZZAN:jmt:dur430doenotice.wpl:12-10-92

Albert R. Chernoff
UMTRA Project Manager
Attention: Mike Abrams
U.S. Department of Energy
UMTRA Project Office
5301 Central Avenue, NE, Suite 1720
Albuquerque, New Mexico 87108

Dear Mr. Chernoff:

This letter is to concur with the U.S. Department of Energy (DOE) request for notification as set forth in the DOE's letter of (date) NOV 10 1992. As requested in your letter, this office will contact the DOE's Grand Junction Projects Office if a dam failure or a large-scale release due to a flood event greater than the outflow capacity of the Navajo Dam is imminent.

Sincerely,


Name:

Jessie A. Miller

Title:

ACTING FOR Projects Manager

Bureau of Reclamation
P.O. Box 640
Durango, Colorado 81302

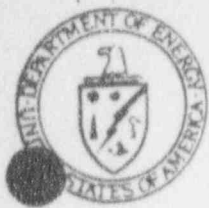

Department of Energy

Albuquerque Operations Office
P.O. Box 5400
Albuquerque New Mexico 87115

NOV 20 1992

Captain Bill Hillgartner
Shiprock Navajo Police
P.O. Box 366
Shiprock, New Mexico 87420

Dear Captain Hillgartner:

The U.S. Department of Energy (DOE) Uranium Mill Tailings Remedial Action (UMTRA) Project Office is requesting notification of any unusual activities or events in or around the uranium tailings disposal cell located approximately one mile south of Shiprock, New Mexico. The purpose of the notification request is to assist DOE in surveying and maintaining the integrity of its disposal cell and to ensure public safety.

If, during the course of routine activities, anything out of the ordinary is observed by your staff or reported to your office, we would appreciate immediate notification to the DOE Grand Junction Projects Office's 24-hour phone line at (303) 248-6070. Additionally, we would appreciate it if you could provide concurrent notification to Bernadine Martin in the Navajo UMTRA Project Office at (602) 871-6359. The enclosed map provides directions to the site if you are not familiar with its location.

If the notification request discussed above is agreeable to you, please sign and return the enclosed reply letter for our records as soon as possible.

Should you have any questions, please contact Michael Abrams of my staff at (505) 845-5758. Thank you for your attention in this matter.

Sincerely,

Albert R. Chernoff
Project Manager
Uranium Mill Tailings Remedial Action
Project Office

2 Enclosures

cc:
See page 2

Captain Bill Hillgartner

-2-

cc w/o enclosures:

J. Virgona, GJPO

C. Jones, GJPO

M. Abrams, UMTRA

F. Bosiljevac, UMTRA

M. Day, TAC

E. Artiglia, TAC


NAV/UMT/0993-0005

Albert R. Chernoff
UMTRA Project Manager
Attention: Mike Abrams
U.S. Department of Energy
UMTRA Project Office
5301 Central Avenue, NE, Suite-4720
Albuquerque, New Mexico 87108

Dear Mr. Chernoff:

This letter is to concur with the U.S. Department of Energy (DOE) request for notification as set forth in the DOE's letter of (date) November 20, 1992. As requested in your letter, this office will contact the DOE's Grand Junction Projects Office if anything out of the ordinary is observed by our staff or reported to our office. We will notify you as immediately as possible at the DOE Grand Junction Projects Office's 24-hour phone line at (303) 246-6070. Additionally, we will provide concurrent notification to Bernadine Martin in the Navajo UMTRA Project Office at (602) 871-6359.

Sincerely,

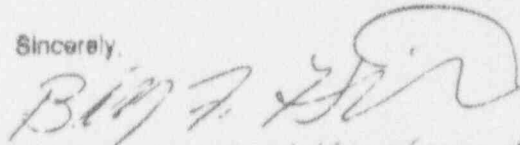

Name: *Billy F. Hillgaster, A/Capt.*

Title: *CRIMINAL INVESTIGATION SUs.
Shiprock, N. M.*

Shiprock Navajo Police
P.O. Box 366
Shiprock, New Mexico 87420

SEP 1993
RECEIVED



Department of Energy
Albuquerque Operations Office
P.O. Box 5400
Albuquerque New Mexico 87115

NOV 24 1992

Mr. Bruce Presgrave
U.S. Geological Survey
National Earthquake Information Center
P.O. Box 25046
Mail Stop 967
Denver Federal Center
Denver, CO 80225

Dear Mr. Presgrave:

The U.S. Department of Energy (DOE) Uranium Mill Tailings Remedial Action Project Office is requesting notification if a seismic event is recorded in San Juan County, New Mexico. The purpose of this request is to assist DOE in surveying and maintaining the integrity of its radioactive waste disposal site located approximately one mile south of Shiprock, New Mexico (Latitude $108^{\circ} 41' 15''$ /Longitude $36^{\circ} 46' 15''$, T30N, R10W, Sections 25 and 36, and T30N, R17W, Section 31).

We would appreciate notification to the DOE Grand Junction Projects Office's 24-hour phone line at (303) 248-6070 if a seismic event(s) occurs that fits any of the following descriptions:

- * Any earthquake centered within a 9-mile radius of the site.
- * Any earthquake of magnitude 4.0 or greater, centered between a 9-mile radius and a 19-mile radius.
- * Any earthquake of magnitude 6.2 or greater, centered between a 19-mile radius and a 40-mile radius.

If the notification request discussed above is agreeable to you, please sign and return the enclosed reply letter for our records as soon as possible.


NOV 24 1992

Mr. Bruce Presgrave

-2-

Should you have any questions, please contact Mike Abrams of my staff at (505) 845-5758. Thank you for your attention in this matter.

Sincerely,

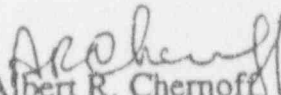
Albert R. Chernoff
Project Manager
Uranium Mill Tailings Remedial Action
Project Office

Enclosure

cc w/o enclosure:

J. Virgona, GJPO

C. Jones, GJPO

R. Edge, UMTRA

F. Bosiljevac, UMTRA

M. Day, TAC

E. Artiglia, TAC



MIS/UMT/1292-0075



National Earthquake Information Center World Data Center A for Seismology

Geological
Research

U.S. Geological Survey
Box 25046, DFC, MS-967
Denver, Colorado 80225 USA
Telex: (WUTCO) 5106014123ESL UD
FAX: (303) 273-2460

Operations
(303) 273-2500
QED
(800) 358-2663

December 14, 1992

Albert R. Chernoff
UMTRA Project Manager
U.S. Department of Energy
Uranium Mill Tailings Remedial Action
Project Office
5301 Central Ave. NE, Suite 1720
Albuquerque, NM 87108

Dear Mr. Chernoff:

This letter is to confirm that the DOE Grand Junction Projects Office has been added to our notification list for earthquakes near the following sites:

| | | |
|------------------|--------|---------|
| Green River, UT | 39.0 N | 110.0 W |
| "Spook" site, WY | 43.2 N | 105.6 W |
| Tuba City, AZ | 36.1 N | 111.1 W |
| Shiprock, NM | 36.8 N | 108.7 W |

We have entered the following selection criteria into our notification program:

1. Any earthquake of magnitude 3.0 or greater, within 0.3 degrees (about 20 miles) of any site shown above, or
2. Any earthquake of magnitude 5.0 or greater, within 1.0 degrees (about 70 miles) of any site shown above.


Note that these criteria are slightly different than the ones you requested, but we believe that they will still meet your needs. It was not possible to include your first criterion (any earthquake centered within a 9-mile radius of a site) for two reasons. First, this office does not work events that have magnitudes less than 2.5 on the Richter scale, unless someone has reported that the earthquake was felt. Since the Richter scale is logarithmic, earthquakes of magnitude 0 or even negative (-1.3, -2.3, etc) are possible, but with the station distribution we have it would not be possible for us to locate them. Second, the 9-mile radius, or about 0.1 degrees, is smaller than the location error which may occur for the preliminary locations we will be reporting to you. In fact, our preliminary locations which will be reported to the Grand Junction Projects Office will be reported only to the nearest tenth of a degree of latitude and longitude.

For the sites shown above, we believe that we can locate earthquakes reliably that are above a threshold of magnitude 3.0. We also suggest that if any of your personnel at any of these sites feel an earthquake, they should call our office at (303) 273-8500 and our duty geophysicists will check the event for them. Note that after normal duty hours, there is a recording on this number giving the home phone numbers of the two geophysicists on duty.

We have reduced the magnitude threshold for the last criterion from 6.2 to 5.0 and have increased the maximum radius from 40 miles to 70 miles because large earthquakes are not point sources, but can have rupture lengths of significant size. For example, the Landers, California earthquake on June 28 (magnitude 7.6) had a rupture length of more than 40 miles and the Great Alaska earthquake of 1964 (magnitude 9.2) had a rupture length of about 400 miles. The location we compute for an earthquake is the hypocenter - the place where the earthquake starts. Usually an earthquake will rupture farther in one direction than others from the hypocenter. This means that a magnitude 8 earthquake with a hypocenter 60 miles away from one of your sites may in fact have ruptured directly through the site, depending on the orientation of the fault.

If you have any questions about these criteria, please give us a call.

Sincerely,

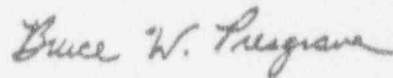

Bruce W. Presgrave
Geophysicist



Department of Energy

Albuquerque Operations Office

P.O. Box 5400

Albuquerque New Mexico 87115

NOV 20 1992

Mr. Charley Liles
National Weather Service
Forecast Office
P.O. Box 90257
International Airport
Albuquerque, New Mexico 87119

Dear Mr. Liles:

The U.S. Department of Energy (DOE) Uranium Mill Tailings Remedial Action Project Office is requesting notification in the event of issuance of flash flood or tornado warnings in San Juan County, New Mexico. We would appreciate notification to the DOE Grand Junction Projects Office's 24-hour phone line at (303) 248-6070 within eight hours of issuance of a warning or episode of warnings.

The purpose of this notification request is to assist the DOE in surveying and maintaining the integrity of its radioactive waste disposal site located approximately one mile south of Shiprock, New Mexico.

If the notification request discussed above is agreeable to you, please sign and return the enclosed reply letter for our records as soon as possible.

Should you have any questions, please contact Michael Abrams of my staff at (505) 845-5758. Thank you for your attention in this matter.

Sincerely,

A handwritten signature in black ink, appearing to read "A. Chernoff".

Albert Chernoff
Project Manager
Uranium Mill Tailings Remedial Action
Project Office

Enclosure

cc w/o enclosure:
J. Virgona, GJPO
C. Jones, GJPO
M. Abrams, UMTRA
F. Bosiljevac, UMTRA
M. Day, TAC
E. Artiglia, TAC



4.13.4.6
U.S. DEPARTMENT OF COMMERCE
National Oceanic and Atmospheric Administration
NATIONAL WEATHER SERVICE

P.O. Box 9025
Albuquerque, New Mexico 87119-9025

December 3, 1992

Mr. Albert R. Chernoff
UMTRA Project Manager
U.S. Department of Energy
UMTRA Project Office
5301 Central Avenue, Suite 1720
Albuquerque, New Mexico 87108

Attention Mr. Mike Abrams

Dear Mr. Chernoff:

Presently, the National Weather Service (NWS) depends on several vehicles for dissemination of severe weather watches and warnings. When we issue a warning for San Juan County, we compose and transmit the warning on the Automation of Field Services (AFOS) computer system. This allows the warning to be disseminated further via the GTE/Contel weather wire service, which also feeds the Associated Press and a host of other dissemination services. Second, we read the warning on the National Oceanic and Atmospheric Administration Weather Radio (NWR). Third, we read the warning on the NAWAS circuit.

Since my staff's workload is especially overbearing during severe weather, and we have lost generally 20 percent of our personnel over the past decade and are expecting to lose more, I would prefer not to add this additional duty to our operations. Additionally, we have no weather station or cooperative weather observer at the Shiprock disposal site. However, I would be glad to help you with your project in another way. I would like to recommend the following possibilities for your operation:

(1) If you require a hard copy of watches, warnings, statements, or forecasts, you can subscribe to the GTE/Contel weather wire. You can obtain a free information package by calling GTE/Contel at 1-800-633-2340.

(2) If you don't need hard copies but want to receive warnings and have access to other weather information, your Shiprock disposal site can purchase a NOAA Weather Radio receiver with a warning alarm feature for about \$40. The radio can be turned off and still sound an alarm whenever a warning has been issued for San Juan County. The alarm would be activated via our transmission from the state microwave network at a frequency of 162.475 MHz.

(3) Anytime you believe that severe weather may have occurred in the Shiprock area, feel free to call us; and we will give you any reports we have.



Presently, San Juan County (like nearly all of New Mexico) has no weather radar coverage. Consequently, severe weather often goes undetected. However, severe weather reports that come to our attention after the fact are included in the "Storm Data" published monthly by the National Climatic Data Center in Asheville, North Carolina. The problem of inadequate radar coverage for San Juan County will be diminished with the advent of the new NEXRAD, WSR-88D doppler system at Albuquerque in 1994. In the mean time, I believe that option number three listed above would offer the best approach.

Please do not hesitate to call if you have questions or would like to discuss this matter further.

Sincerely,

Charlie A. Liles
Area Manager