

LICENSEE EVENT REPORT

CONTROL BLOCK 1 2 3 4 5 6

(PLEASE PRINT ALL REQUIRED INFORMATION)

LICENSEE NAME: 01 I L D R S 2 LICENSE NUMBER: 00-000000-00 LICENSE TYPE: 41111 EVENT TYPE: 03

CATEGORY: 01 REPORT TYPE: L REPORT SOURCE: L DOCKET NUMBER: 050-0237 EVENT DATE: 032576 REPORT DATE: 042376

EVENT DESCRIPTION

02 DURING A REFUELING OUTAGE LOCAL LEAK-RATE TEST, FEEDWATER ISOLATION CHECK VALVES
03 2-220-58BE-62B EXCEEDED THE 29.381 SCFH TECH SPEC LIMIT (695.5 SCFH & 88,846
04 SCFH RESPECTIVELY). "A" FEEDWATER LINE CHECK VALVES PASSED THE LLRT SATISFAC-
05 TORILY (2.8 & 14.1 SCFH RESPECTIVELY). REDUNDANT VALVES WERE AVAILABLE AND OPERABLE
06 DURING OPERATION. THIS IS A REPETITIVE OCCURRENCE. (50-237/1976-18)

SYSTEM CODE: CH CAUSE CODE: E COMPONENT CODE: VALVEX PRIME COMPONENT SUPPLIER: A COMPONENT MANUFACTURER: C1665 VIOLATION: Y

CAUSE DESCRIPTION NA

08 EXAMINATION AND OVERHAULING OF THESE VALVES HAS NOT YET BEEN COMPLETED.
09 AN UPDATE REPORT WILL BE SUBMITTED UPON COMPLETION OF REPAIRS AND RE-TESTING.
10 BOTH VALVES ARE 18-INCH TILTING-DISC, PRESSURE SEAL CHECK VALVES, MODEL 973, MANU-
(CONTINUED BELOW)

FACILITY STATUS: H % POWER: 000 OTHER STATUS: NA METHOD OF DISCOVERY: B DISCOVERY DESCRIPTION: NA

FORM OF ACTIVITY RELEASED: Z CONTENT OF RELEASE: Z AMOUNT OF ACTIVITY: NA LOCATION OF RELEASE: NA

PERSONNEL EXPOSURES

NUMBER: 000 TYPE: Z DESCRIPTION: NA

PERSONNEL INJURIES

NUMBER: 000 DESCRIPTION: NA

OFFSITE CONSEQUENCES

15 NA

LOSS OR DAMAGE TO FACILITY

TYPE: Z DESCRIPTION: NA

PUBLICITY

17 NA

ADDITIONAL FACTORS CAUSE DESCRIPTION (CONTINUED)

18 FACTURED BY CRANE CO.

19 8303310158 760629
PDR ADOCK 05000237
S PDR

NAME: K. D. LEITZELL

PHONE: EXT. 421



Commonwealth Edison
Dresden Nuclear Power Station
R.R. #1
Morris, Illinois 60450
Telephone 815/942-2920

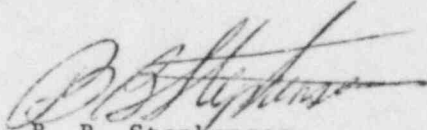
BBS Ltr. #330-76

April 23, 1976

Mr. James G. Keppler, Regional Director
Directorate of Regulatory Operations - Region III
U. S. Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137



Enclosed please find Reportable Occurrence number 50-237/1976-18.
This report is being submitted to your office in accordance with the
Dresden Nuclear Power Station Technical Specifications, Section 6.6.B.


B. B. Stephenson
Station Superintendent
Dresden Nuclear Power Station

BBS: smp

Enclosure

cc: Director of Inspection & Enforcement
Director of Management Information & Program Control
File/NRC

4256