

LICENSEE EVENT REPORT

CONTROL BLOCK

(PLEASE PRINT ALL REQUIRED INFORMATION)

LICENSEE NAME 01 I L D R S 2										LICENSE NUMBER 00-000000-00										LICENSE TYPE 41111				EVENT TYPE 03																	
7	8	9	14	15	25	26	30	31	32	CATEGORY 01 CONT										REPORT TYPE L		REPORT SOURCE L		DOCKET NUMBER 050-0237										EVENT DATE 032476				REPORT DATE 042376			
7	8	9	57	58	59	60	61	68	69	74	75	80	7	8	9	57	58	59	60	61	68	69	74	75	80																

EVENT DESCRIPTION

02 DURING LOCAL LEAK-RATE TESTING, STANDBY LIQUID CONTROL ISOLATION CHECK																																																																															
03 VALVE 2-1101-16 EXCEEDED THE 29.391 SCFH LIMIT WITH A LEAKAGE OF 43.679																																																																															
04 SCFH. VALVE 1101-15, WHICH IS IN SERIES WITH 1101-16, EXHIBITED AN ACCEPTABLE																																																																															
05 LEAK RATE OF 21.314 SCFH. TOTAL THROUGH-LEAKAGE, THEREFORE, WAS WITHIN TECH																																																																															
06 SPEC LIMITS FOR THE PENETRATION. THIS IS NOT A REPETITIVE OCCURRENCE. (50-237/1976-17)																																																																															

SYSTEM CODE 07 SH		CAUSE CODE E		COMPONENT CODE VALVEX				PRIME COMPONENT SUPPLIER N		COMPONENT MANUFACTURER C665				VIOLATION Y	
7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22

CAUSE DESCRIPTION

08 NA - THE VALVE CANNOT BE EXAMINED UNTIL THE REFUELING OPERATION HAS BEEN																																																																															
09 COMPLETED. A FOLLOW-UP REPORT WILL BE SUBMITTED AFTER VALVE REPAIRS HAVE BEEN																																																																															
10 MADE. VALVE 1101-16 IS A 1500 LB. LIP SEAL, 18-8 SMO, STEEL-LIFT CHECK GLOBE VALVE BY CRANE CO.																																																																															

FACILITY STATUS 11 H		% POWER 000		OTHER STATUS NA		METHOD OF DISCOVERY B		DISCOVERY DESCRIPTION NA	
7	8	9	10	11	12	13	14	15	16
FORM OF ACTIVITY RELEASED 12 Z		CONTENT OF RELEASE Z		AMOUNT OF ACTIVITY NA		LOCATION OF RELEASE NA			
7	8	9	10	11	12	13	14	15	16

PERSONNEL EXPOSURES

NUMBER 13 000		TYPE Z		DESCRIPTION NA	
7	8	9	10	11	12

PERSONNEL INJURIES

NUMBER 14 000		DESCRIPTION NA	
7	8	9	10

OFFSITE CONSEQUENCES

15 NA																																																																															
7	8	9	10	11	12	13	14	15	16																																																																						

LOSS OR DAMAGE TO FACILITY

TYPE 16 Z		DESCRIPTION NA	
7	8	9	10

PUBLICITY

17 NA																																																																															
7	8	9	10	11	12	13	14	15	16																																																																						

ADDITIONAL FACTORS

18 NA																																																																															
7	8	9	10	11	12	13	14	15	16																																																																						

19 S		PDR	
7	8	9	10

NAME: K. D. LEITZELL

PHONE: EXT. 421



Commonwealth Edison

Dresden Nuclear Power Station

R.R. #1


Morris, Illinois 60450

Telephone 815/942-2920

BBS Ltr. #331-76

April 23, 1976

Mr. James G. Keppler, Regional Director
Directorate of Regulatory Operations - Region III
U. S. Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

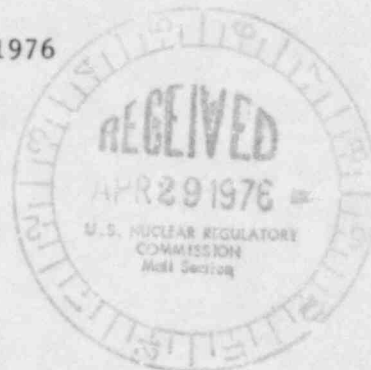

Enclosed please find Reportable Occurrence number 50-237/1976-17.
This report is being submitted to your office in accordance with the
Dresden Nuclear Power Station Technical Specifications, Section 6.6.B.

B. B. Stephenson
Superintendent

Dresden Nuclear Power Station

BBS:smp

Enclosure

cc: Director of Inspection & Enforcement
Director of Management Information & Program Control
File/NRC