

DEC 12 1991

Docket No. 50-443

Public Service Company of New Hampshire
ATTN: Mr. Ted C. Feigenbaum
President and Chief Executive Officer
New Hampshire Yankee Division
Post Office Box 300
Seabrook, New Hampshire 03874

Dear Mr. Feigenbaum:

Subject: NRC Region I Inspection 50-443/91-29

This refers to your letter dated November 27, 1991, in response to our letter dated November 1, 1991.

Thank you for informing us of the corrective and preventive actions documented in your letter. These actions will be examined during a future inspection of your licensed program.

Your cooperation with us is appreciated.

Sincerely,

Original Signed By:
James C. Linville

James C. Linville, Chief
Projects Branch No. 3
Division of Reactor Projects

OFFICIAL RECORD COPY

9112260026 911212
PDR ADOCK 05000443
Q PDR

1201

cc:

L. E. Maglathlin, Jr., President and Chief Executive Officer, PSNH
Senior Vice President and Chief Operating Officer, NHY
J. M. Feschel, Regulatory Compliance Manager, NHY
R. M. Kacich, Manager of Generation Facilities Licensing, NUSCO (w/cy of Licensee's
Response Letter)
J. F. Opeka, Executive Vice President, NU (w/cy of Licensee's Response Letter)
G. Garfield, Esquire (w/cy of Licensee's Response Letter)
D. E. Moody, Station Manager, NHY
T. Harpster, Director of Licensing Services
R. Hallisey, Director, Dept. of Public Health, Commonwealth of Massachusetts (w/cy of
Licensee's Response Letter)
S. Woodhouse, Legislative Assistant (w/cy of Licensee's Response Letter)
Public Document Room (PDR) (w/cy of Licensee's Response Letter)
Local Public Document Room (LPDR) (w/cy of Licensee's Response Letter)
Nuclear Safety Information Center (NSIC) (w/cy of Licensee's Response Letter)
NRC Resident Inspector (w/cy of Licensee's Response Letter)
State of New Hampshire, SLO (w/cy of Licensee's Response Letter)
Commonwealth of Massachusetts, SLO Designee (w/cy of Licensee's Response Letter)
Seabrook Service List (w/cy of Licensee's Response Letter)

OFFICIAL RECORD COPY

DEC 12 1991

Public Service Company of
New Hampshire

3

bcc w/cy of Licensee's Response Letter:
Region I Docket Room (with concurrences)
Management Assistant, DRMA (w/o encl)
J. Joyner, DRSS
W. Lazarus, DRP
N. Dudley - Seabrook (w/concurrences)
J. Linville, DRP
G. Edison, NRR

RI:DRP

MEM
MacDougall/meo
12/12/91

RI:DRP

W
Lazarus
12/12/91

RI:DRP

JL
Linville
12/12/91

OFFICIAL RECORD COPY

A:REP9129.MEO

SEABROOK SERVICE LIST

Thomas Dignan, Esquire
John A. Ritscher, Esquire
Ropes and Gray
One International Place
Boston, Massachusetts 02110-2624

Dr. Mauray Tye, President
Sun Valley Association
209 Summer Street
Haverhill, Massachusetts 01831

Mr. David Rodham, Director
Massachusetts Civil Defense Agency
400 Worcester Road
P. O. Box 1496
Framingham, Massachusetts 01701-0317
ATTN: James Muckerheide

Robert Backus, Esquire
Backus, Meyer and Solomon
116 Lowell Street
Manchester, New Hampshire 03106

Mr. Peter Brann
Assistant Attorney General
State House, Station #6
Augusta, Maine 04333

Mr. T. L. Harpster
Public Service Company of New Hampshire
Post Office Box 300
Seabrook, New Hampshire 03874

Seacoast Air Pollution League
5 Market Street
Portsmouth, New Hampshire 03801

Town of Exeter
10 Front Street
Exeter, New Hampshire 03823

Diane Curran, Esquire
Harmon and Weiss
2001 S Street, N.W.
Suite 430
Washington, D.C. 20009

Regional Administrator, Region 1
U.S. Nuclear Regulatory Commission
475 Allendale Road
King of Prussia, Pennsylvania 19406

Barbara J. Saint Andres, Esquire
Kopel & Paige, P.C.
Counsel for Amesbury, Newburyport,
and Salisbury
101 Arch Street
Boston, Massachusetts 02110

Ashod N. Amirian, Esquire
145 South Main Street
P.O. Box 38
Bradford, Massachusetts 01830

Mr. Alfred Sargent
Chairman
Board of Selectmen
Salisbury, Massachusetts 01950

Office of the Attorney General
One Ashburton Place
20th Floor
Boston, Massachusetts 02108

Durham Board of Selectmen
Town of Durham
Durham, New Hampshire 03824

Chairman, Board of Selectmen
RFD 2
South Hampton, New Hampshire 03827

OFFICIAL RECORD COPY

Gerald Garfield, Esquire
Day, Berry and Howard
City Place
Hartford, Connecticut 06103-3499

Resident Inspector
U.S. Nuclear Regulatory Commission
Seabrook Nuclear Power Station
Post Office Box 1149
Seabrook, New Hampshire 03874

Paul McEachern, Esquire
25 Maplewood Avenue
P. O. Box 360
Portsmouth, New Hampshire 03801

Mr. R. M. Kacich
Northeast Utilities Service Company
P. O. Box 270
Hartford, Connecticut 06141-0270

Jane Spector
Federal Energy Regulatory Commission
825 North Capital Street, N.E.
Room 8105
Washington, D.C. 20426

Mr. George L. Iverson, Director
New Hampshire Office of Emergency
Management
State Office Park South
107 Pleasant Street
Concord, New Hampshire 03301

Mr. Leon Maglathlin
Public Service Company of
New Hampshire
1000 Elm Street
Manchester, New Hampshire 03105

Atomic Safety and Licensing Board
Panel
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Board of Selectmen
Town of Amesbury
Town Hall
Amesbury, Massachusetts 01913

R. Scott Hill-Whilton, Esquire
Lagoulis, Clark, Hill-Whilton and
Rotondi
79 State Street
Newburyport, Massachusetts 01950

Mr. J. F. Opeka
Northeast Utilities
P. O. Box 270
Hartford, Connecticut 06141-0270

Mr. Rob Sweeney
Three Metro Center
Suite 610
Bethesda, Maryland 20814

Adjudicatory File (2)
Atomic Safety and Licensing Board Panel
Docket
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Mr. Jack Dolan
Federal Emergency Management Agency
Region I
J.W. McCormack Post Office and
Courthouse Building, Room 442
Boston, Massachusetts 02109

Mr. J. M. Peschel
Public Service Company of
New Hampshire
P. O. Box 300
Seabrook, New Hampshire 03874

Congressman Nicholas Mavroules
U.S. House of Representatives
70 Washington Street
Salem, Massachusetts 01970

John P. Arnold, Attorney General
G. Dana Bisbee, Associate Attorney
General
Attorney General's Office
25 Capitol Street
Concord, New Hampshire 03301

Stephen G. Burns, Director
Office of Commission Appellate
Adjudication
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

New Hampshire Yankee

Ted C. Feigenbaum
President and
Chief Executive Officer

NYN-91188

November 27, 1991

United States Nuclear Regulatory Commission
Washington, D.C. 20555

Attention: Document Control Desk

References: (a) Facility Operating License No. NPF-86, Docket No. 50-443
(b) USNRC Letter dated November 1, 1991, "NRC Region I Inspection 50-443/91-29 (9/10/91 - 10/14/91)" J. C. Linville to T. C. Feigenbaum

Subject: Response to a Notice of Violation

Gentlemen:

In accordance with the requirements of the Notice of Violation contained in Reference (b), the New Hampshire Yankee response to the cited violation is provided as Enclosure 1.

Should you have any questions concerning this response, please contact Mr. James M. Peschel, Regulatory Compliance Manager at (603) 474-9521, extension 3772.

Very truly yours,

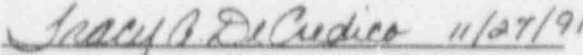

Ted C. Feigenbaum

STATE OF NEW HAMPSHIRE

Rockingham, ss.

November 27, 1991

Then personally appeared before me, the above-named Ted C. Feigenbaum, being duly sworn, did state that he is President & Chief Executive Officer of the New Hampshire Yankee Division of Public Service Company of New Hampshire, that he is duly authorized to execute and file the foregoing information in the name and on the behalf of New Hampshire Yankee Division of the Public Service Company and that the statements therein are true to the best of his knowledge and belief.


Tracy A. DeCredico, Notary Public
My Commission Expires: October 3, 1995

Enclosure
TCF:TGP/acf

New Hampshire Yankee Division of Public Service Company of New Hampshire
P.O. Box 300 • Seabrook, NH 03874 • Telephone (603) 474-9521

SPP

2112060217

cc: ~~Mr. Thomas T. Martin~~
Regional Administrator
U. S. Nuclear Regulatory Commission
Region I
475 Allendale Road
King of Prussia, PA 19406

Mr. Gordon E. Edison, Sr. Project Manager
Project Directorate 1-3
Division of Reactor Projects
U.S. Nuclear Regulatory Commission
Washington, DC 20555

Mr. Noel Dudley
NRC Senior Resident Inspector
P.O. Box 1149
Seabrook, NH 03874

New Hampshire Yankee
November 27, 1991

ENCLOSURE TO NYN-91188

REPLY TO A NOTICE OF VIOLATION

Violation

During NRC inspection from September 10 - October 14, 1991, a violation of NRC requirements was identified in accordance with the "General Statement of Policy and Procedure for NRC Enforcement Actions," 10 CFR, part 2, Appendix C. That violation is listed below:

Technical Specification 6.7.1.a requires that the procedures recommended in Appendix A of Regulatory Guide 1.33, Revision 2, February 1978, be established, implemented, and maintained. Regulatory Guide 1.33, Revision 2, February 1978, Appendix A, Section 1.c specifies in part that procedures be established for equipment control (e.g., locking and tagging). New Hampshire Yankee procedure MA4.2, Equipment Tagging and Isolation, Section 4.9 requires that tagging order boundary components be restored to their proper positions. Procedure ON1055.01, Revision 4 (Change 20), Fill and Vent of Demineralized Water System, specified the normal position of DM-V301 as closed.

Contrary to the above, on about September 30, 1991, demineralized water system valve DM-V301 was aligned in the open position during system restoration following completion of maintenance on the letdown line radiation monitor resulting in contamination of the demineralized water system.

This is a Severity Level IV violation (Supplement 1).

Reason for the Violation

New Hampshire Yankee (NHY) has determined that the root cause of the Demineralized Water System contamination was personnel error. The personnel completing a tagging restoration sheet utilized valve position data from a computerized tagging database which was in the development phase, instead of using a system valve lineup procedure.

On September 18, 1991, Demineralized Water System manual isolation valve, DM-V301, was opened in accordance with an incorrect tagging restoration sheet. The tagging restoration was performed following maintenance on the Chemical and Volume Control System (CVCS) letdown line radiation monitor. The tagging restoration sheet was completed solely by reference to valve position information contained in a computerized tagging database. At this time the database was under development, and not intended to be used to determine system restoration valve position. The appropriate valve lineup procedure should have been used to determine correct valve position.

The mispositioning of DM-V301 did not become evident until September 30, 1991. On that date, an inadvertent flow path from the Reactor Coolant System (RCS) to the Demineralized Water (DM) System was established. This occurred while the steam generators were being filled. The demand for DM reduced the pressure in the DM System below the pressure in the CVCS letdown line to the radiation monitor. The reduction in the DM System pressure allowed a solenoid operated valve, RV-6520-02, to come off its seat enabling RCS flow into the DM System through the mispositioned valve DM-V301.

Corrective Action

Upon discovery of the DM System contamination, a radiation survey of the DM System was performed to determine the exact point of contamination. The contamination path was identified to be through DM-V301 and the valve was immediately closed.

New Hampshire Yankee's immediate corrective actions included the following:

- 1) The DM System Lineup Procedure (ON1055.01) was reviewed to ensure that the DM valves which are required to be closed are included on the Maintained Closed Valve List.
- 2) A complete valve lineup of the DM System was performed to verify that no additional valves were mispositioned. All valves were determined to be properly positioned.
- 3) A review of the tagging restorations produced by the tagging computer database was performed to verify proper valve lineups. All valves were determined to be properly positioned.
- 4) Use of the tagging computer database in the preparation of tagging restorations was discontinued and the Shift Superintendents personnel were counseled on completing tagging restoration sheets using the appropriate system restoration valve lineup.
- 5) Spectacle flanges were installed on three radiation monitoring skids to provide additional assurances that process fluid will not enter the DM System.
- 6) A Safety Evaluation was performed to verify that plant operation would not involve an unreviewed safety question.

Corrective Action to Prevent Recurrence

New Hampshire Yankee's long term corrective actions will include a review of system interfaces between non-contaminated systems and potentially contaminated systems. This review will identify potential system enhancements and will include industry experience in this area. It is anticipated that this review will be completed by December 30, 1991. New Hampshire Yankee will also develop radiation monitoring skid purge procedures for the manipulation of radiation monitor valves. These procedures will include a precaution concerning DM System pressure being lower than the process fluid pressure. It is anticipated that these procedures will be completed by March 1, 1992. New Hampshire Yankee will also validate the computerized tagging database prior to its use in tagging restoration. The database will also be provided with sufficient security to ensure only valid changes/revisions can be made to it. It is anticipated that the enhancements to the computerized tagging database will be completed by May 1, 1992.

Date of Full Compliance

The immediate corrective actions taken by New Hampshire Yankee resulted in compliance with Technical Specification 6.7.1a. Additionally, the long term corrective actions described above will ensure continued compliance with this Technical Specification.