Arkansas Nuclear One - Administrative Services Document Control Friday, June 23, 2000

Document Update Notification

COPYHOLDER NO:	103
TO:	NRC - WASHINGTON
ADDRESS:	DOC CNTRL DESK MAIL STOP OP1-17 WASHINGTON DC 20555
DOCUMENT NO:	OP-1903.065
TITLE:	EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)
REVISION NO:	015-02-0
CHANGE NO:	PC-02
SUBJECT:	PERMANENT CHANGE (PC)
If this box is check in envelope provide	ked, please sign, date, and return transmittal ed. ANO-1 Docket 50-313 ANO-2 Docket 50-368 Signature.

A045

TITLE: Emergency Response Support Center (TSC)	Facility - Technical	PROC/WORK PLAN NO. 1903.065 WORK PLAN EXP. DATE	CHANGE NO. 015-02-0 TC EXP. DATE		
SET # 103		n/a SAFETY-RELATED ⊠YES □NO	n/a IPTE □YES ⊠NO		
,		TEMP ALT □YES ⊠NO			
When you see these <i>TRA</i>	1 <i>PS</i>	Get these TOOLS			
Time Pr	essure	Effective Con	nmunication		
Distracti	on/Interruption	Questioning A	Attitude		
Multiple	Tasks	Placekeeping			
Over Co	nfidence	Self Check			
Vague o	r Interpretive Guidance	Peer Check			
First Shi	ft/Last Shift	Knowledge			
Peer Pre	essure	Procedures			
Change	Off Normal	Job Briefing			
Physical	Environment	Coaching			
Mental S	Stress (Home or Work)	Turnover			
VERIFIED BY	DATE		TIME		
	· · · · · · · · · · · · · · · · · · ·				
	<u></u>				
FORM TITLE: VERIFICAT	ION COVER SHEET	FORM NO. 1000.00			

TITLE:Emergency Re	esponse Facility - Technical	PROCAWORK PLAN 1903.065		: NO. 15-02-0	
Support Cente	· · · · · · · · · · · · · · · · · · ·	n/a		OF 34 6-20-2500	
☑PROCEDURE TYPE OF CHANGE:		100			
NEW	☐ REVISION ☐ PC	□ тс	DELETION		
Procedure or Work Pla		EXP. DATE: n/		to describe	
AFFECTED SECTION: (Include step # if applicable)	DESCRIPTION OF CHANGE: (For each reason for the change.)	ch change made, include	e sumcient detail	to describe	
Table of Contents Step 6.4	Changed Title from "turnover" to "Emer	gency Directio & Contro	ol - TSC Director	•	
Table of Contents Step 6.5					
Table of Contents Re-numbered sections and pages as appropriate.					
Step 6.2.5 Deleted this step because this step is repeated in the following section. Moved appropriate information from this step to step 6.4.3, bolded and highlighted 6.4.3. Renumbered the remaining steps in section 6.2.				appropriate ered the	
Step 6.3.2	The note following step 6.3.1 contained instructions in it. Change this note to a step (6.3.2). Renumbered the remaining steps in this section.				
Section 6.4	Added this section "Emergency Direction previously a step titled "TSC Direction".	on and Controll - TSC D	irector" This sec	ction was	
	6.4.1.A was changed to 6.4.1 and with the following textual changes: deleted "may, as the situation dictates," and replaced it with "shall". Added "if not already done by the EOF Director. ED&C must be transferred from the Shift Superintendent within one hour of an Alert or higher emergency classification."				
	Added step 6.4.2 "To assume ED&C, t notifications communicator in the TSC. Dose Assessor or the Dose Assessme	B Dose Assessment c	apability, may u	se the initial	
	Added step 6.4.3, Bolded and brackets, "(P-10766) The TSC Director SHALL NOT delegate the responsibility for making offsite Protective Action Recommendations (PARs) or for making decisions to notify offsite authorities."				
	6.4.1.B became 6.4.4 with the following textual changes: Added "The TSC Director will perfrom the", Deleted "will be performed by the TSD Director, Deleted "he is" changed to "they are"			ector will perfrom to "they are"	
	6.4.1.b.1 became 6.4.4.A with the following textual changes: Deleted "The TSC Director shall prepare fro a turnover by", Moved "The TSC Director shall notify the Shift Superintendent who he is prepared to assume the responsibility and authority for Emergency Direction and Contro of the incident" to step 6.4.4.B.			enntendent when	
FORM TITLE:	1		FORM NO.	CHANGE NO. 048-00-0	
1	DESCRIPTION OF CHANGE		1000.006C	U40-UU-U	

TITLE:Emergency Re	esponse Facility - Technical	PROC/WORK PLAN NO. CHANGE NO. 1903.065 015-02			
Support Cente	er (TSC)	1903.003		, DAW	
⊠PROCEDURE	□WORK PLAN, EXP. DATE	n/a	PAGE 2	OF 34 1-20-2010	
TYPE OF CHANGE: NEW Procedure or Work Pla	☐ REVISION ☐ PC	☐ TC EXP. DATE: <u>n/</u>	DELETION	I	
AFFECTED SECTION:	DESCRIPTION OF CHANGE: (For each	h change made, include	e sufficient detail	to describe	
(Include step # if applicable)	reason for the change.)				
Section 6.4	Changed step 6.4.1.B.2 to step 6.4.4.C Director shall".	with the following textu	al changes: Del	eted "The TSC	
	Deleted the note that was after 6.4.1.B.	2.			
	Changed step 6.4.1.B.3 to step 6.4.5.				
	Changes step 6.4.1.B.4 to step 6.4.6 with the following textual changes: Added "once assuming responsibility and authority for Emergency Direction and Control (ED&C) of the incident, shall maintain this responsibility unti8l relieved by the EOF Director. In the event of TSC evacuation prior to EOF ability to receive ED&C, ED&C may be returned to the Shift Superintendent." Deleted "must turn over reaponsibilities to a qualified individual before leaving the TSC when he has responsibility for Emergency Directio and Control (i.e., the TSC Director must be available immediately to make Protective Action Recommendations (PARs) and make decisions relating to notification of offsite authories)."				
·	Deleted ste 6.4.1.B.5, "The TSC Director, once assuming responsibility and suthority for Emerency Direction and Control (ED&C) of the incident, shall maintain this responsibility until relieved by the EOF Director. In the event of TSC evacuation prior to EOF ability to receive ED&C, ED&C may be returned to the Shift Superintendent."				
	Changed step 6.4.1.B.6 to step 6.4.7.				
	Changed step 6.4.1.B.7, 6.4.1.B.7.a and 6.4.1.B.7.b to steps 6.4.7.A, 6.4.7.B and 6.4.7.B respectively.				
Section 6.5	Changed step 6.4.2 to section 6.5 "TSG	C STAFF".			
	Added step 6.5.1, "The TSC Director must be available immediately to make Protective Action Recommendations (PARs) and make decisions relating to notification of offsite authorities. Therefore, the TSC Director must turn over responsibility for ED&C to a qualified individual before leaving the TSC when the TSC Director has responsibility for Emergency Direction and Control.				
	Changed step 6.4.2.B to step 6.5.2 and made the following textual changes: Added "the above step" and deleted "section 6.4.1.B.4".				
FORM TITLE:	1		FORM NO.	CHANGE NO.	
	DESCRIPTION OF CHANGE		1000.006C	048-00-0	

TITLE:Emergency Ro Support Cente	1903.065			15-0			
⊠PROCEDURE		n/a		PAGE 3	OF	<i>\$</i> 4	1000 1000
TYPE OF CHANGE: NEW Procedure or Work Pla	☐ REVISION ☐ PC	☐ TC EXP. DATE:		DELETIO	N		
AFFECTED SECTION:	DESCRIPTION OF CHANGE: (For eac	h change made, includ	de suffi	cient deta	l to de	escrib	е
(Include step # if applicable)	reason for the change.)						
Section 6.5 Changed step 6.4.2.A to step 6.5.3, "Whenever a shgift turnover is completed fro any ERO position in the TSC, the oncoming ERO member shall reprot this turnover to the TSC Support Superintendent located in the TSC.							
Section 6.6	Section 6.6 Changed section 6.5 "Secondary TSC" to section 6.6						
Step 6.6.1	Deleted "In the event of the necessity to evacuate the TSC due to radiation or other hazards, a" and added "The", deleted "provided" and added "located", added "room 260"						
Position Guide B, Task Guide B-1 Step 9							
Position Guide C Step 1.f	Added "These personnel normally report to the OSC Assembly Area prior to dispatch. Obtain the floowing personnel by either contacting the OSC Assembly Area coordinator (ext. 6625), use of the Emergency Telephone Directory or via the TSC Support Superintendent."						
Step 1.f.(1)	Deleted "from the OSC Assembly Area" and added "the Operations Support task in the TSC. This person should be used to free the Operations Manager of busy work. Distribute appropriate Task Guide to individual upon arrival to the TSC.", deleted "is task by contacting the OSC Assembly Area coordinator at ext. 6625 or through the use of the Emergency Telephone directory, Section V. Obtain assistance as necessary from the TSC support Superintendent to staff this task if unable to obtain personnel as stated above (e.g. nightime hours)."						
Step 1.f.(2)	Deleted "book"						
Step 1.f.(3)	Deleted step, "Distribute appropriate Tatask positions."	ask Guides (attached)	as indi	viduals ar	rive to	staff	the
	Change step 1.g to step 1.f.(3) with the following textual changes: deleted "as acessary", deleted "Yse sectuibs I and/or V in the Emergency Telephone Directory to select personnel to fill this position."						
Step 1.f.(4)	Changed step 1.h to 1.f.(4) with the following textual changes: Deleted "As" replaced with "If", deleted "Use section V of the Emergency Telephone director."						
Step 1.g and 1.h	Renumber these steps as approprite.						
Pos. Guide F, TG F-6	Step 6, changed "OSC/EOF" to "OSC	and EOF".	TEOF	RM NO.	T CU	NGE	NO.
FORM TITLE:	DESCRIPTION OF CHANGE			00.006C	B.	48-C	

TITLE:Emergency Response Facility - Technical Support Center (TSC)		PROC/WORK PLAN 1903.065	NO.	CHANGE 01	NO. 5-02-0	
☑PROCEDURE ☐WORK PLAN, EXP. DATE			n/a		PAGE 4	_ OF_4
TYPE OF CHANGE: NEW Procedure or Work Pla			☐ TC EXP. DATE:r	n/a	DELETION cient detail	
AFFECTED SECTION: (Include step # if applicable)	reason for the chan	ge.)				
Step 6.2.6	Assessment will not a The responsibility for Assessment will rema Control Room until the incident from the Control for the FOLL transferred to the FOLL	be performed in rospo r or dose assessment wil in in the EOF unless the evacuation is comp to the Room to the EOF France the Dose Asse	th the following textual ensibilities does not affect to in the Control Room an evacuation of the EOD elete. This function may F. However, the dose assessment Team is establish must occur without internal ensible the control of the EOD elete.	et the op a until tr F is dec be trans sessmer aed in or	erability state ansferred to lared and mo aferred at any at function st rder to relieve	the EOF. Dose ay be returned to time during an nould be e the Control
FORM TITLE:					RM NO.	CHANGE NO.
	DESCRIPTION	OF CHANGE		100	00.006C	048-00-0

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

1 of 63

CHANGE:

015-02-0

TABLE OF CONTENTS

SECTIO	Ŋ		PAGE NO.
1.0	PURPOSE		3
2.0	SCOPE		3
3.0	REFEREN	CES	3
4.0	DEFINIT	TONS	4
5.0	RESPONS	IBILITY AND AUTHORITY	5
6.0	INSTRUC	TIONS	6
	6.1	TSC Description	6
	6.2	TSC Activation	6
	6.3	TSC Staffing	7
	[6.4	(P-10766) Emergency Direction & Control - TSC Director	7]
	6.5	TSC Staff	8
	6.6	Secondary TSC	9
	[6.7	(P-16243) Severe Accident Management	
7.0	ATTACHM	IENTS AND FORMS	
	7.1	ATTACHMENTS	
		Attachment 1 - Position Guides and Task Assignments for the TSC Staff	11
		Position Guide A - Engineering Manager	16 17
		Position Guide B - Maintenance Manager	19 23
		Position Guide C - Operations Manager Task C1 - Operations Support Task C2 - OSC Operations Support	. 28
		Position Guide D - Radiation Protection & Radwaste Manager . Task D1 - Dosimetry Task D2 - Radwaste Support	34
		Position Guide E - TSC Director	. 36

PROC./WORK PLAN NO.	PROCEDURE	WORK PLAN TITLE:	PAGE:	2 of 63
1903.065		EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0
	Task Task Task Task Task Task	Guide F - TSC Support Supt	ort	47 48 49 50 51
7.2	FORMS 7.2.1 7.2.2	Form 1903.065A - "TSC Activation Checklist Form 1903.065B - DELETED	st"	55
	7.2.3	Form 1903.065C - "Secondary TSC Activation Checklist"		58
	7.2.4	Form 1903.065D - "TSC Director Status Upguide"		60 63

PROC./WORK PLAN NO.

PROCEDURE/WORK PLAN TITLE:

PAGE:

3 of 63

1903.065

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

CHANGE:

015-02-0

1.0 PURPOSE

The purpose of this procedure is to describe the Technical Support Center (TSC) and the role of this facility when activated during an emergency at ANO.

SCOPE 2.0

This procedure includes the physical description of the TSC along with the instructions for activating and operating the facility. In addition, the responsibilities of each ERO position assigned to this facility are described in the form of position guides and/or tasks.

REFERENCES 3.0

- REFERENCES USED IN PROCEDURE PREPARATION: 3.1
 - Emergency Plan 3.1.1
 - NUREG-0737, Supp. 1 Requirements for Emergency Response 3.1.2 Capability
 - Framatome Technologies, Inc. letter ESC-96-566 dated 3.1.3 October 21, 1996.
 - NEI 91-04, Revision 1 Severe Accident Issue Closure 3.1.4 Guidelines
- REFERENCES USED IN CONJUNCTION WITH THE PROCEDURE: 3.2

Emergency Telephone Directory

3.3 RELATED ANO PROCEDURES:

Procedure 1903.030, "Evacuation"

REGULATORY CORRESPONDENCE CONTAINING NRC COMMITMENTS WHICH ARE 3.4 IMPLEMENTED IN THE PROCEDURE:

NOTE

Throughout procedure commitments are denoted by [BOLD]

- P-4193 (OCAN038313) Response to IR 313/8211; 368/8209: All TSC personnel to have TLDs. Position Guide D, Step 3.4.1 D.2.u
- P-16243 (OCAN129803) Severe Accident Management 3.4.2 Implementation Completion: Sections 4.8, 4.9, 6.6; Position Guide A, step D.3.d; Task A-2, step 7; Task A-3, step 7; Position Guide C, step D.3.e; Position Guide E, section D; Task Guide F-4, step 10.
- P-1457 (OCAN079009) Response to IR 313/9008; 368/9008 Weakness 06 Status Board Communicators: Qualifications and Training. Position Guide E, Task F-6 3.4.3
- P-1460 (0CAN079009) Response to IR 313/9008; 368/9008 3.4.4 Weakness 04 - Radiation Protection and Radwaste Manager relocated to TSC. Position Guide D

PROC./WORK PLAN NO.	PROCEDUR	E/WORK PLAN TITLE:	PAGE:	4 of 63
1903.065		EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0
3	3.4.5	P-1462 (OCAN079009) - Response to IR 313/ Weakness 04 - Engineering Manager has ass responsibility to assist the TSC Director A	igned	
	3.4.6	P-1464 (0CAN079009) - Response to IR 313/ Weakness 01 - EAL Reviewer to support ED& Position Guide F, Task Guide F-4 Step 6 &	C functio	/9008 n in ERO.
. 3	3.4.7	P-4978 (0CAN068104) - Response to IR 313/ Status Board Communicator will be assigned Position Guide F, Task Guide F-6	81-13; 36 d to TSC.	8/81-11 -
3	3.4.8	P-7899 (OCAN058701) - Response to Deficie 01 Turnover of Emergency Direction and C turnover of ED&C, the responsibilities fo and Protective Action Recommendations sha between two facilities. Section 4 Step 4.	ontrol. r Notific ll not be	upon ations
3	3.4.9	P-9459 (OCAN058411) - Offsite monitoring TSC to ADH prior to ECC (STSC) Staffing. Task F-5 Step 8.	data exch Position	ange from Guide F,
3	3.4.10	P-9475 (0CAN048312) - Staff of the TSC wi communications operator and status board Guide F, Task Guide F-5, F-6 and F-7.	ll includ keeper	le Position
3	3.4.11	P-10766 (OCAN068320) - One individual sha to recommend PARs and that this individual highest level of authority. This is the Emergency Direction and Control. Section 6.4.3 and Position Guide E Section D Emer and Control	l shall b individua 4 Step 4.	e the 1 with 2, Step

4.0 DEFINITIONS

- Control Room Either of two facilities (Unit One or Unit Two) which directs and controls emergency actions, as necessary, following the initial declaration of an emergency. The Control Room(s) are staffed in accordance with Table B-1 of the ANO Emergency Plan.
- [4.2 (P-7899, P-10766) Emergency Direction and Control Overall direction of facility response which must include the non-delegable responsibilities for the decision to notify and to recommend protective actions to Arkansas Department of Health personnel and other authorities responsible for offsite emergency measures. With activation of the EOF, the EOF Director typically assumes the responsibility for Emergency Direction and Control. The management of on-site facility activities to mitigate accident consequences remains with the TSC Director in the Technical Support Center. The Shift Superintendent retains responsibility for the Control Room and plant systems operations.]
- Emergency Operations Facility (EOF) The near-site emergency response facility located approximately 0.65 miles northeast of the reactor buildings. This facility serves dually as the training center for ANO personnel.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE:

1903.065

EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC)

PAGE: 5 of 63

CHANGE: 015-02-0

- Initial Response Staff (IRS) The emergency organization primarily composed of plant staff personnel which must be able to augment the onsite plant personnel in accordance with Table B-1 of the Emergency Plan.
- Technical Support Center (TSC) The emergency response facility located on the 3rd floor of the ANO Administration Building. This facility is equipped with the necessary instrumentation and communication systems for monitoring the course of an accident and formulating corrective and recovery action plans. Additional information concerning this facility is included within this procedure.
- 4.6 Operational Support Center (OSC) The emergency response facility located in the ANO Maintenance Facility. This facility provides the support for coordinating the following functions:

Onsite Radiological Monitoring, Maintenance, Nuclear Chemistry, Emergency Medical Support and Fire Fighting Support.

The OSC also serves as the assembly point and briefing area for the rescue/repair and damage control teams.

- Emergency Response Organization (ERO) The organization which is composed of the IRS, the EOF staff, the TSC staff, the OSC staff, and the Emergency Team members. It has the capability to provide manpower and other resources necessary for immediate and long-term response to an emergency situation.
- [4.8 (P-16243) Severe Accident A plant event that can be categorized in one of two ways: 1) An event where it is known with certainty that core damage beyond design basis analysis goals and assumptions has occurred, or 2) An event where there is a significant amount of uncertainty concerning the degree to which the core has been damaged.]
- [4.9 (P-16243) Severe Accident Management Guidelines (SAMG) ANO-specific guidance developed to assist the plant operating and technical staff in implementing strategies for the best use of the existing plant capabilities to diagnose, respond to, and recover from a severe accident.]

5.0 RESPONSIBILITY AND AUTHORITY

- Position Guides and Task Assignments detailing the responsibilities of those ERO positions assigned to the Technical Support Center are provided in Attachment 1. Responsibilities for the Emergency Teams/Groups and the Fire Brigade are listed in the appropriate procedures and are not included within the scope of this procedure. These procedures include:
 - 5.1.1 Procedure 1015.007, "Fire Brigade Organization and Responsibilities"
 - 5.1.2 Procedure 1903.033, "Protective Action Guidelines for Rescue/Repair and Damage Control Teams"
 - 5.1.3 Procedure 1904.010, "Duties of the Initial Dose Assessor"

PROC./WO	RK PLAN NO.	PROCEDUR	E/WORK PLAN TITLE:	PAGE:	6 of 63
190	3.065		EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0
		5.1.4	Procedure 1904.011, "Duties of the Dose A	ssessment	Team"
		5.1.5	Procedure 1903.042, "Duties of the Emerge	ncy Medic	al Team"
		5.1.6	Procedure 1903.043, "Duties of the Emerge Team"	ncy Radia	tion
	5.2	The TSC Di	rector is responsible for ensuring that the with form 1903.065A, "TSC Activation Chec	ne TSC is cklist".	setup in
6.0	6.0 <u>INSTRUCTIONS</u>				
	6.1	TSC DESCRI	IPTION		
		The TSC is located on the 3rd Floor of the Arkansas Nuclear One Administration Building. This emergency response facility is equippe with the necessary instrumentation to monitor the course of an accident. It also serves as the primary location for coordinating the technical support activities in response to an incident. A floor diagram of the TSC is included as a part of Form 1903.065A.			s equipped an nating the
	6.2	TSC ACTIVA	ATION		
		6.2.1	The Emergency Response Organization (ERO) activating following the initial announce Site Area or General Emergency by the Shi	ment of a	n Alert,
		6.2.2	The goal is for the TSC to be operational hour following the declaration of an Alex General Emergency.	within o	ne (1) rea or
		6.2.3	The TSC Director is responsible for ensuris set up in accordance with the guidance Form 1903.065A, "TSC Activation Checklist	e establis	the TSC hed on
		6.2.4	The TSC is considered operational when the positions are staffed:	ne followi	ng
			A. TSC Director		
			B. Operations Manager		
			C. Maintenance Manager		
			D. Engineering Manager		
			E. Radiation Protection and Radwaste Ma	anager	

Notification Communicator

evacuation is complete.

Dose Assessment will not be performed in the TSC. The

responsibility for dose assessment will be in the Control Room until transferred to the EOF. Dose Assessment will remain in the EOF unless an evacuation of the EOF is declared and may be returned to the Control Room until the

F.

6.2.5

ļ	PROC./WORK PLAN NO.	PROCEDURE/WORK PLAN TITLE:	PAGE:	7 of 63
	1903.065	EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0

6.3 TSC STAFFING

- 6.3.1 Position guides and task assignments for the TSC staff are included in Attachment 1.
- 6.3.2 Items on a position guide are not necessarily in sequential order. The user should scan the entire list and prioritize activities as appropriate to the situation, rather than necessarily perform the items in the order listed.

Members of the ERO should not rely upon these position guides alone to determine the items for which they are responsible. These position guides should always be used in conjunction with Emergency Plan Implementing Procedures or other appropriate station procedures.

- 6.3.3 Each position guide details the following:
 - A. Reporting location for the listed position
 - B. Position to which the listed position reports
 - C. Those positions/tasks which the position supervises and coordinates
 - D. Duties for the listed position
- 6.4 EMERGENCY DIRECTION AND CONTROL (ED&C) TSC DIRECTOR

NOTE

ED&C is normally transferred from the Shift Superintendent to the EOF Director. The TSC Director will assume ED&C if the EOF will not be activiated or if the EOF Director is not ready to assume ED&C.

- 6.4.1 The TSC Director shall relieve the Shift Superintendent of the responsibility for Emergency Direction and Control if not already done by the EOF Director. ED&C must be transferred from the Shift Superintendent within one hour of an Alert or higher emergency classification.
- 6.4.2 To assume ED&C, the TSC Director must have the following:
 - A. A notifications communicator in the TSC.
 - B. Dose Assessment capability. May use the Initial Dose Assessor or the Dose Assessment Team.
 - C. TSC is not required to be operable.
- [6.4.3 (P-10766) The TSC Director SHALL NOT delegate the responsibility for making offsite Protective Action Recommendations (PARs) or for making decisions to notify offsite authorities.]

PROC./WORK PLAN NO.	PROCEDURE/WORK PLAN TITLE:	PAGE:	8 of 63
1903.065	EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0

- 6.4.4 The TSC Director will perform the following actions when required to assume responsibility for Emergency Direction and Control:
 - A. Acquire a briefing from the Shift Superintendent and/or designees on the incident and the response tasks being performed.
 - B. Notify the Shift Superintendent when prepared to assume the responsibility and authority for Emergency Direction and Control of the incident.
 - C. Notify the OSC Director and make an announcement to the TSC staff that the transfer of responsibility has occurred.
- 6.4.5 It is the responsibility of the TSC Director to ensure that the Command and Control Status Board in the TSC is updated as turnover occurs.
- 6.4.6 The TSC Director, once assuming responsibility for Emergency Direction and Control (ED&C), shall maintain this responsibility until relieved by the EOF Director. If the TSC is evacuated prior to the EOF Director's ability to assume ED&C, ED&C may be returned to the Shift Superintendent.
- 6.4.7 The EOF Director will notify the TSC Director when they are prepared to assume the responsibility for Emergency Direction and Control of the incident.
 - A. The TSC Director shall promptly turn over responsibility and authority for the overall response as requested by the EOF Director.
 - B. The TSC Director shall make an announcement to the TSC staff of the turnover of ED&C to the EOF.
 - C. The TSC Director shall ensure that the Shift
 Superintendent and the OSC Director are informed of
 the turnover from the TSC Director to the EOF
 Director.

6.5 TSC STAFF

- The TSC Director must be available <u>immediately</u> to make Protective Action Recommendations (PARs) and make decisions relating to notification of offsite authorities. Therefore, the TSC Director must turn over responsibility for ED&C to a qualified individual before leaving the TSC when the TSC Director has responsibility for Emergency Direction and Control.
- 6.5.2 Emergency Response personnel who must leave their assigned location temporarily must inform their immediate superior of their location, destination, and estimated time of return with the exception of the TSC Director as outlined in the above step.

PROC./WORK PLAN NO.	PROCEDUR	E/WORK PLAN TITLE:	PAGE:	9 of 63
1903.065		EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0
(6.5.3	Whenever a shift turnover is completed for in the TSC, the oncoming ERO member shall turnover to the TSC Support Superintendent TSC.	report th	nis
6.6	6.6 SECONDARY TSC			
	6.6.1	The Secondary TSC is located in the Emergency Operations Facility (EOF) room 260.		
1	6.6.2	The Secondary TSC is designed to the same habitability as the onsite Control Rooms.	radiolog:	ical
	6.6.3	The Secondary TSC is also equipped with to monitoring the course of an accident.	he facili	ties for

[6.7 (P-16243) SEVERE ACCIDENT MANAGEMENT

Activation Checklist".

6.6.4

In the event that a <u>Severe Accident</u> is acknowledged, the TSC will take the lead for evaluation and strategies to mitigate the emergency. The TSC Director will be the responsible individual to ensure review of the Severe Accident Management Guidelines (SAMGs), and for implementing the mitigation strategies. The TSC Support Engineers and TSC EAL Reviewer will form a team to review the SAMGs and propose strategies to the TSC Director. The Operations Manager will serve as the team facilitator and will instruct the Shift Superintendent to carry out the recommended actions once approval is given. The Operations Manager and Engineering Manager will provide support to the team, as needed, but will not be directly involved with the SAM team reviews.

TSC is included on Form 1903.065C, "Secondary TSC

A floor diagram and activation checklist for the Secondary

The final decision to carry out recommended SAMG action(s) will rest with the TSC Director (after consultation with the EOF Director and Shift Superintendent). Implementation of the actions will rest with the affected unit's Shift Superintendent.]

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

10 of 63

CHANGE:

E: 015-02-0

7.0 ATTACHMENTS AND FORMS

7.1 ATTACHMENTS

Attachment 1 - Position Guides and Task Assignments for the TSC Staff

Position Guide A - Engineering Manager

Task A1 - Plant Assessment Support

Task A2 - Reactor Engineering Support

Task A3 - TSC Engineering Support

Position Guide B - Maintenance Manager

Task B1 - Team Tracking Board Communicator (TSC)

Position Guide C - Operations Manager

Task C1 - Operations Support

Position Guide D - Radiation Protection and Radwaste Manager

Task D1 - Dosimetry

Task D2 - Radwaste Support

Position Guide E - TSC Director

Position Guide F - TSC Support Supt.

Task F1 - Security

Task F2 - Administrative Services

Task F3 - Computer Maintenance/Software Support

Task F4 - TSC EAL Reviewer

Task F5 - TSC Notifications Communicator

Task F6 - TSC Status Board Communicator

Task F7 - TSC ENS Communicator

7.2 FORMS

7.2.1 Form 1903.065A - "TSC Activation Checklist"

7.2.2 Form 1903.065B - DELETED

7.2.3 Form 1903.065C - "Secondary TSC Activation Checklist"

7.2.4 Form 1903.065D - "TSC Director Status Update Guide"

7.2.5 Form 1903.065E - "TSC Position Staffing Form"

PROC./WORK PLAN NO.	PROCEDURE/WORK PLAN TITLE:		11 of 63
1903.065	EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0

ATTACHMENT 1

POSITION GUIDES AND TASK ASSIGNMENTS

FOR THE TSC STAFF

POSITION GUIDE A

Page 1 of 4

[ENGINEERING MANAGER (P-1462)]

A. Normal Reporting Location

TSC

B. Reports To

TSC Director

- C. Supervises/Coordinates
 - 1. Plant Assessment
 - 2. Reactor Engineering
 - 3. TSC Engineering Support
 - 4. Nuclear Chemistry Manager
 - 5. Accident Assessment Manager

D. Duties

1. Immediate Actions

- a. When notified of an Emergency Plan Activation, report to your assigned facility and, if not already performed, notify CNS (858-3683) that you are staffing your ERO position.
- b. If a plant evacuation is occurring, perform initial accountability by logging "0000" in the TSC security card reader (or any other security card reader) and insert your badge.
- c. Write your name on the TSC Staffing Board under the position that you are staffing.
- d. Verify TSC setup in accordance with the TSC Activation Checklist (Form 1903.065A) located on the front of the door leading into the TSC Switchboard Room.
- e. Notify the TSC Support Superintendent that you are staffing your ERO position.
- f. Obtain available information on emergency classifications and plant conditions. Possible sources include:

NOTE

Do not call the Control Room.

- (1) TSC Director (staff briefing)
- (2) TSC Status Board
- (3) Other TSC staff personnel

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE: 13 of 63 CHANGE: 015-02-0

POSITION GUIDE A

Page 2 of 4

ENGINEERING MANAGER

- g. Ensure task responsibilities under your position are assigned:
 - (1) Plant Assessment Support (Task A-1) Contact personnel from IHEA or Plant Analysis (see Emergency Telephone Directory, Section V).
 - (2) Reactor Engineering Support (Task A-2) Notified by the Computerized Notification System (CNS).
 - (3) TSC Engineering Support (Task A-3) Notified by the Computerized Notification System (CNS).
 - (4) Verify those positions responding via CNS notification by checking the latest CNS printout with the TSC Support Supt.
 - (5) Distribute appropriate Task Guides (attached) as individuals arrive to staff the task positions.
- h. Report current manpower status to the TSC Director.
- i. Obtain all necessary forms for your position from the Emergency Kit:
 - (1) Procedure Forms Form 1903.065D
 - (2) ERO Chronological Logs.

2. On Going Actions

- a. Refer to Procedure 1903.065 for a description on the TSC facility and information relating to TSC activation criteria, TSC staffing, TSC staff turnover and the Secondary TSC.
- b. If a plant evacuation or exclusion area evacuation has occurred, then:
 - (1) Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.
 - (2) Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.

Procedure 1903.030, "Evacuation", may be referenced for definitions and/or instructions.

c. Assure adequate technical and clerical personnel are available to support the Engineering group. Support personnel may be obtained by contacting the TSC Support Superintendent.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

14 of 63

015-02-0

CHANGE:

POSITION GUIDE A

Page 3 of 4

ENGINEERING MANAGER

- d. Ensure adequate office space, equipment, supplies and communications equipment are readily available to the Engineering group.
- e. Provide for the timely collection, retention and transmittal of engineering information to the ERO as requested.
- f. If reactor sump recirc has been established, then refer to your handbook guide for establishing possible filtration on the BWST and/or RWT located at your desk.
- g. Using Form 1903.065D, "TSC Director Status Update Guide", provide current updates to the TSC Director.
- h. Coordinate with the Operations Manager to develop emergency work plans and procedures regarding abnormal systems or equipment operations.
- i. Coordinate with the Nuclear Chemistry Manager in the OSC (ext. 6613) to obtain Post Accident Sampling System (PASS) analytical results for core damage assessment.
- j. Coordinate with the Accident Assessment Manager in the EOF (ext. 7860) to develop potential long-term accident projections that the ERO will have to contend with.
- k. Review recovery efforts on a continuous basis to ensure that job priorities are consistent and accurate.
- 1. Coordinate with the TSC Director to ensure that job priorities are reviewed and revised as necessary.
- m. Oversee plant design modifications to ensure adequate core surveillance and protection is available and all temporary modifications are documented.
- n. Coordinate with the Operations Manager to provide for the timely resolution of NRC questions regarding abnormal operation and/or changes to Technical Specifications and SAR's in accordance with ANO procedures.
- o. Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
- p. Monitor consultant activities where outside assistance is being provided.
- q. Ensure that documentation of all maintenance activities is maintained using the ERO Chronological Logs provided in the Emergency Kit.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

15 of 63

CHANGE:

015-02-0

POSITION GUIDE A

Page 4 of 4

ENGINEERING MANAGER

3. Special Actions to be Implemented as Needed

- a. Consider a shift change to relieve your position to an individual from the affected unit, if applicable. Refer to the Emergency Telephone Directory, Section I, or notify the TSC Support Superintendent for assistance.
- b. If applicable, establish a schedule of working hours to support around-the-clock operations. Notify the TSC Support Superintendent for assistance.
- c. If a TSC evacuation is declared by the TSC Director, relocate to the EOF in accordance with Procedure 1903.030, "Evacuation".
- [d. (P-16243) In the event that a <u>Severe Accident</u> is acknowledged, ensure that the Reactor Engineering Support (Task A-2) and TSC Engineering Support tasks (Task A-3) review the Severe Accident Management Guidelines (SAMG's) for mitigation strategies, and, along with the TSC EAL Reviewer, formulate recovery actions necessary to mitigate the accident. Provide support for the team as necessary.]

4. Shift Change

- a. Upon arrival of your shift replacement, turn over all pertinent documents, forms, and supplies.
- b. Brief your replacement on the current Emergency Classification, status of the plant, information on the Status Boards and ongoing measures that you have been assigned.
- c. Notify the TSC Support Superintendent of the staffing change.
- d. Update your position status on the TSC Staffing Board.

5. Actual Event/Drill Termination

- a. Notify those individuals working under your position that the event/drill has been terminated.
- b. Collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC.
- c. Provide a list of any forms or supplies needing replenishment to Emergency Planning.
- d. Turn over all documentation generated during the drill/emergency to Emergency Planning.
- e. Participate in the post drill/emergency critique to identify weaknesses and strengths.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 16 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE A

TASK A-1

PLANT ASSESSMENT SUPPORT

- 1. Notified of Alert or higher classification, report to the Engineering Manager in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Analyze plant transients and provide recommendations for recovery efforts to the Engineering Manager.
- 5. Provide pertinent information from SER's and SOER's relating to the emergency.
- 6. Identify potential equipment and systems problems that might be encountered.
- 7. Act as the site contact with INPO.
- 8. Inform the Engineering Manager of your location and any change in your location for tracking and accountability purposes.
- 9. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

17 of 63

CHANGE:

015-02-0

POSITION GUIDE A

TASK A-2

REACTOR ENGINEERING SUPPORT

- Notified of Alert or higher classification, report to the Engineering Manager 1. in the TSC.
- Review this task guide. 2.
- If plant evacuation is occurring, perform initial accountability by logging 3. "0000" into the nearest card reader and then insert your badge.
- Monitor the Safety Parameter Display System. 4.
- Monitor reactor core parameters and perform assessments of core damage as necessary by coordinating with the Nuclear Chemistry Manager (ext. 6613).
- Provide input for the development and review of proposed recovery actions. 6.
- (P-16243) In the event that a Severe Accident is acknowledged, work with the [7. EAL Reviewer to review the Severe Accident Management Guidelines (SAMG's) and formulate and recommend recovery actions necessary to mitigate the accident. Make the recovery action recommendations to the Operations Manager.]
- Inform the Engineering Manager of your location and any change in your 8. location for tracking and accountability purposes.
- When notified of the drill/event termination, collect and organize in 9. chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 18 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE A

TASK A-3

TSC ENGINEERING SUPPORT

- 1. Notified of Alert or higher classification, report to the Engineering Manager in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Develop and document temporary modifications required to support Technical Support Center emergency response efforts.
- 5. Coordinate Electrical Engineering, Mechanical Engineering, Drafting and Drawing Control activities during an emergency.
- 6. Provide input for the development and review of proposed recovery action.
- [7. (P-16243) In the event that a <u>Severe Accident</u> is acknowledged, work with the EAL Reviewer to review the Severe Accident Management Guidelines (SAMG's) and formulate and recommend recovery actions necessary to mitigate the accident. Make the recovery action recommendations to the Operations Manager.]
- 8. Inform the Engineering Manager of your location and any change in your location for tracking and accountability purposes.
- 9. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

POSITION GUIDE B

MAINTENANCE MANAGER

Page 1 of 4

A. Normal Reporting Location

TSC

B. Reports To

TSC Director

- C. Coordinates With
 - 1. Operations Manager
 - Engineering Manager
 - 3. OSC Director
 - 4. Maintenance Supt.

D. Duties

1. Immediate Actions

- a. When notified of an Emergency Plan Activation, report to your assigned facility and, if not already performed, notify CNS (858-3683) that you are staffing your ERO position.
- b. If a plant evacuation is occurring, perform initial accountability by logging "0000" in the TSC security card reader (or any other security card reader) and insert your badge.
- c. Write your name on the TSC Staffing Board under the position that you are staffing.
- d. Verify TSC setup in accordance with the TSC Activation Checklist (Form 1903.065A) located on the front of the door leading into the TSC Switchboard Room.
- e. Notify the TSC Support Superintendent that you are staffing your ERO position.
- f. Obtain available information on emergency classifications and plant conditions. Possible sources include:

NOTE

Do not call the Control Room.

- (1) TSC Director (staff briefing)
- (2) TSC Status Board
- (3) Other TSC staff personnel

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 20 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE B

MAINTENANCE MANAGER

Page 2 of 4

- g. Ensure task responsibilities under your position are assigned:
 - (1) Team Tracking Board Communicator (TSC) (Task B-1) Ensure that the Maintenance Superintendent (6615) has dispatched your TSC Team Tracking Board Communicator.
 - (2) Distribute appropriate Task Guides (attached) as individuals arrive to staff the task positions.
- h. Report current manpower status to the TSC Director.
- i. Obtain all necessary forms for your position from the Emergency Kit:
 - (1) Procedure Forms Form 1903.065D
 - (2) ERO Chronological Logs.

On Going Actions

- a. Refer to Procedure 1903.065 for a description of the TSC facility and information relating to TSC activation criteria, TSC staffing, TSC staff turnover and the Secondary TSC.
- b. If a <u>plant evacuation</u> or <u>exclusion area evacuation</u> has occurred, then:
 - (1) Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.
 - (2) Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.

Procedure 1903.030, "Evacuation", may be referenced for definitions and/or instructions.

- c. Refer to Procedure 1903.033 for established guidelines concerning repair and damage control teams being dispatched from the OSC.
- d. Coordinate the development of repair and damage control plans under the direction of the TSC Director.
- e. Advise the OSC Director regarding implementation of Repair and Damage Control plans developed by the TSC.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

21 of 63

CHANGE:

IGE: 015-02-0

POSITION GUIDE B

MAINTENANCE MANAGER

Page 3 of 4

- f. Using Form 1903.065D, "TSC Director Status Update Guide", provide current updates to the TSC Director.
- g. Oversee the investigation of all maintenance related problems and review problem solving alternatives developed as to their adequacy and workability.
- h. Develop and propose alternative means of monitoring and controlling plant parameters to the Operations Manager.
- i. Monitor in-plant maintenance activities and provide technical advice to the Maintenance Superintendent in support of these maintenance activities.
- j. Ensure that the Maintenance Superintendent is cognizant of the fact that Form 1903.033B, "OSC Team Briefing Form", may serve as the emergency RWP and Work Order in order to expedite the dispatch of repair and damage control teams.
- k. Provide the technical expertise in the maintenance area for response to questions and inquiries from various regulatory agencies.
- Coordinate with the TSC RDACS Operator to help track the progress of maintenance activities as it relates to reducing or terminating offsite radiological releases being monitored by the SPINGS.
- m. Coordinate with the Engineering Manager to resolve maintenance related problems involving necessary engineering support.
- n. Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
- o. Monitor consultant activities where outside assistance is being provided.
- p. Ensure that documentation of all maintenance activities is maintained using the ERO Chronological Logs.

3. Special Actions to be Implemented as Needed

- a. Consider a shift change to relieve your position to an individual from the affected unit, if applicable. Refer to the Emergency Telephone Directory, Section I, or notify the TSC Support Superintendent for assistance.
- b. If applicable, establish a schedule of working hours to support around-the-clock operations. Notify the TSC Support Superintendent for assistance.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE: 22 of 63 CHANGE: 015-02-0

POSITION GUIDE B

MAINTENANCE MANAGER

Page 4 of 4

c. If a TSC evacuation is declared by the TSC Director, relocate to the EOF in accordance with Procedure 1903.030, "Evacuation".

4. Shift Change

- a. Upon arrival of your shift replacement, turn over all pertinent documents, forms, and supplies.
- b. Brief your replacement on the current Emergency Classification, status of the plant, information on the Status Boards and ongoing measures that you have been assigned.
- c. Notify the TSC Support Superintendent of the staffing change.
- d. Update your position status on the TSC Staffing Board.

5. Actual Event/Drill Termination

- a. Notify those individuals working under your position that the event/drill has been terminated.
- b. Collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC.
- c. Provide a list of any forms or supplies needing replenishment to Emergency Planning.
- d. Turn over all documentation generated during the drill/emergency to Emergency Planning.
- e. Participate in the post drill/emergency critique to identify weaknesses and strengths.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

23 of 63

CHANGE:

015-02-0

POSITION GUIDE B

TASK B-1

TEAM TRACKING BOARD COMMUNICATOR (TSC)

- Notified of Alert or higher classification, report to the Maintenance Manager in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Establish communications with the OSC Team Tracking Board Communicator located in the Operational Support Center (OSC) using the headset as follows:
 - a. Don the cordless headset.
 - b. Remove handset of associated telephone from cradle and place near telephone.

NOTE

The Team Tracker telephone is set up to auto-dial the TSC or OSC. When you remove the handset from the cradle you will hear ringing until the person at the other end picks up. If the other facility has already performed these steps, you will be on-line as soon as you pick up the handset.

- c. Turn the "on/off" switch, located on the cordless headset stand, to the "on" position. When the OSC Team Tracker completes these same instructions in the OSC, you will be able to communicate with them.
- 5. Obtain OSC team tracking information from the OSC Team Tracking Board Communicator and record this information on the Team Tracking Board.
- 6. Maintain the Team Tracking Board with up-to-date information.
- 7. Maintain a hard copy of information recorded on the Team Tracking Board by completing Form 1903.033F located in the TSC Emergency Kit file.
- 8. Keep the Maintenance Manager informed as information is recorded on the Team Tracking Board.
- 9. Ensure that you obtain periodic mission priorities (example: 1, 2, 3, 4, etc.) from the TSC Director. Communicate these priorities to the OSC via the OSC Team Tracking Board Communicator. **Do not** duplicate priorities on missions. Each mission must have a unique priority.
- 10. Inform the Maintenance Manager of your location and any change in your location for tracking and accountability purposes.
- 11. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 24 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE C

Page 1 of 4

OPERATIONS MANAGER

A. Normal Reporting Location

TSC

B. Reports To

TSC Director

- C. Supervises/Coordinates
 - 1. Operations staff
 - 2. Assistant Operations Manager
 - 3. Operations Support

D. Duties

1. Immediate Actions

- a. When notified of an Emergency Plan Activation, report to your assigned facility and, if not already performed, notify CNS (858-3683) that you are staffing your ERO position.
- b. If a plant evacuation is occurring, perform initial accountability by logging "0000" in the TSC security card reader (or any other security card reader) and insert your badge.
- c. Write your name on the TSC Staffing Board under the position that you are staffing.
- d. Notify the TSC Support Superintendent that you are staffing your ERO position.
- e. Obtain available information on emergency classifications and plant conditions. Possible sources include:
 - (1) Shift Superintendent (Affected Unit)
 - (2) TSC Director (staff briefing)
 - (3) TSC Status Board
 - (4) Other TSC staff personnel

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE: 25 of 63 CHANGE: 015-02-0

POSITION GUIDE C

Page 2 of 4

OPERATIONS MANAGER

f. Ensure task responsibilities under your position are assigned. (These personnel normally report to the OSC Assembly Area prior to dispatch.):

Obtain the following personnel by either contacting the OSC Assembly Area coordinator (ext. 6625), use of the Emergency Telephone Directory or via the TSC Support Superintendent.

- (1) Operations Support (Task C-1) Assign operations person to staff the Operations Support task in the TSC. This person should be used to free the Operations Manager of busy work. Distribute appropriate Task Guide to individual upon arrival to the TSC.
- (2) OSC Operations Support (Task C-2) Assign a Senior Reactor Operator or a Reactor Operator to report to the OSC to assist the OSC Director and provide Technical and Operational expertise. The Task Guide for this position resides with the OSC Director.
- (3) Dispatch an Assistant Operations Manager to the affected units Control Room to help coordinate the information flow from the Control Room to the TSC. There is no task guide for this position.
- (4) If necessary, obtain a Technical Assistant qualified as a SRO to monitor and operate the SPDS in the TSC.
- g. Report current manpower status to the TSC Director.
- h. Obtain all necessary forms for your position from the Emergency Kit:
 - (1) Procedure Forms Form 1903.065D
 - (2) ERO Chronological Logs.

On Going Actions

- a. Refer to Procedure 1903.065 for a description on the TSC facility and information relating to TSC activation criteria, TSC staffing, TSC staff turnover and the Secondary TSC.
- b. If a plant evacuation or <u>exclusion area evacuation</u> has occurred, then:
 - (1) Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

26 of 63

CHANGE:

015-02-0

Page 3 of 4

POSITION GUIDE C

OPERATIONS MANAGER

. . .

(2) Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.

Procedure 1903.030, "Evacuation", may be referenced for definitions and/or instructions.

- c. Interface with the TSC Director to solicit oversight and direction/decision input in recovery efforts.
- d. Review the Emergency Class declared with the EAL Reviewer, located in the TSC, and the Operations staff.
- e. Oversee the implementation of normal and emergency procedures needed to bring the plant to a safe shutdown.
- f. Determine the need for out-of-normal and emergency procedures and supervise the development and implementation of these procedures.
- g. Provide information and recommendations to the TSC Director concerning future operations that could affect the plant or the environment.
- h. Using Form 1903.065D, "TSC Director Status Update Guide", provide current updates to the TSC Director.
- i. Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
- j. Coordinate with the TSC Support Superintendent to request services that may be needed from offsite sources.
- k. Advise the TSC Director regarding relaxation/curtailment of Emergency Organization duties.
- 1. Coordinate with the Engineering Manager and Maintenance Manager to provide for the timely resolution of NRC questions regarding abnormal operation and/or changes to Technical Specifications and SARs in accordance with procedures.
- m. Coordinate with the Engineering Manager and Maintenance Manager to develop emergency work plans and procedures regarding abnormal systems or equipment operations.
- n. Coordinate with the TSC Support Superintendent to obtain Technical Assistants, as necessary.
- o. Monitor consultant activities where outside assistance is being provided.
- p. Ensure that documentation of all operations activities is maintained using the ERO Chronological Logs.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE:

27 of 63

CHANGE:

015-02-0

POSITION GUIDE C

Page 4 of 4 OPERATIONS MANAGER

Special Actions to be Implemented as Needed 3.

- Consider a shift change to relieve your position to an individual a. from the affected unit, if applicable. Refer to the Emergency Telephone Directory, Section I, or notify the TSC Support Superintendent for assistance.
- If applicable, establish a schedule of working hours to support b. around-the-clock operations. Notify the TSC Support Superintendent for assistance.
- If a TSC evacuation is declared by the TSC Director, relocate to the EOF in accordance with Procedure 1903.030, "Evacuation". c.
- Prior to restarting Unit 1 reactor coolant pumps, refer to "TSC d. Guidance for Determining Acceptability of RCP Restart" (contained in Framatome Technologies, Inc. letter ESC-96-566 dated October 21, 1996) which is located in your position guide book in the TSC.
- (P-16243) In the event that a Severe Accident is acknowledged, ſe. act as the facilitator for the team composed of the TSC EAL Reviewer and the Engineering Support task. The team should review the Severe Accident Management Guidelines (SAMG's), and formulate and recommend actions necessary to mitigate the emergency. Recommend these actions to the TSC Director and the person with Emergency Direction and Control. Once approval is given, instruct the Shift Superintendent to carry out these actions.]

4. Shift Change

- Upon arrival of your shift replacement, turn over all pertinent а. documents, forms, and supplies.
- Brief your replacement on the current Emergency Classification, status of the plant, information on the Status Boards and ongoing b. measures that you have been assigned.
- Notify the TSC Support Superintendent of the staffing change. c.
- Update your position status on the TSC Staffing Board. d.

5. Actual Event/Drill Termination

- Notify those individuals working under your position that the a. event/drill has been terminated.
- Collect and organize in chronological order all of your b. documents, logs, procedures, supplies, etc., and help restore the TSC.
- Provide a list of any forms or supplies needing replenishment to С. Emergency Planning.
- Turn over all documentation generated during the drill/emergency d. to Emergency Planning.
- Participate in the post drill/emergency critique to identify e. weaknesses and strengths.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

28 of 63

CHANGE:

015-02-0

POSITION GUIDE C

TASK C-1

OPERATIONS SUPPORT

- 1. Notified of Alert or higher classification, report to the Administrative Building Library (3rd floor) unless directed otherwise by the TSC Operations Manager.
- Review this task guide.
- If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Establish a working level interface with maintenance and with the Control Room of the affected unit.
- 5. Perform problem analyses of the emergency conditions and provide alternatives for corrective action and long term recovery operations to the Operations Manager.
- 6. Research the feasibility of proposed recovery actions.
- 7. Develop procedures and work plans, as necessary, to implement proposed recovery actions.
- 8. Consult available resource material (technical manuals, drawings, procedures, etc.) to provide specific information on equipment and systems to operations.
- 9. Inform the Operations Manager of your location and any change in your location for tracking and accountability purposes.
- 10. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 29 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE C

TASK C-2

OSC OPERATIONS SUPPORT

- 1. Notified of Alert or higher classification, report to the OSC Director in the OSC.
- 2. Obtain your OSC Operations Support Task Book (Task C-2) from the OSC Director and review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Assist the OSC Director.
- 5. Provide input for OSC planning, briefings, debriefings, etc.
- 6. Stay updated on plant status.
- 7. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the OSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE:

1903.065

EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC)

PAGE: 30 of 63

CHANGE: 015-02-0

POSITION GUIDE D

Page 1 of 4

[RADIATION PROTECTION AND RADWASTE MANAGER (P-1460)]

A. Normal Reporting Location

TSC

B. Reports To

TSC Director

- C. Supervises/Coordinates
 - 1. Dosimetry Support
 - 2. Radwaste Support
 - 3. TSC RDACS Operator

NOTE

If contractor HP personnel are utilized during an emergency response, ensure that they are accompanied and supervised by a qualified ERO member.

D. Duties

1. Immediate Actions

- a. If not already performed, notify CNS (858-3683) that you are staffing your ERO position.
- b. If a plant evacuation is occurring, perform initial accountability by logging "0000" in the TSC security card reader (or any other security card reader) and insert your badge.
- c. Write your name on the TSC Staffing Board under the position that you are staffing.
- d. Verify TSC setup in accordance with the TSC Activation Checklist (Form 1903.065A) located on the front of the door leading into the TSC Switchboard Room.
- e. Obtain available information on emergency classifications and plant conditions. Possible sources include:

NOTE

Do not call the Control Room.

- (1) TSC Director (staff briefing)
- (2) TSC Status Board
- (3) Other TSC staff personnel
- (4) Health Physics Supervisor (OSC Ext. 6614)

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE: 31 of 63 CHANGE: 015-02-0

POSITION GUIDE D

Page 2 of 4

RADIATION PROTECTION AND RADWASTE MANAGER

- f. Ensure task responsibilities under your position are assigned:
 - (1) Dosimetry (Task D-1) Contact personnel from Dosimetry (Ext. 7641 or 7642). Obtain assistance as necessary from the TSC Support Superintendent to staff this task if unable to obtain personnel as stated above.
 - (2) Radwaste Support (Task D-2) Contact personnel from Radwaste (Ext. 3540). Obtain assistance as necessary from the TSC Support Superintendent to staff this task if unable to obtain personnel as stated above.
 - (3) TSC RDACS Operator (1904.011 Attachment 5) The Dose Assessment Supervisor (DAS) located in the EOF is responsible for providing a TSC RDACS Operator.
 - (4) Distribute appropriate Task Guides (attached) as individuals arrive to staff the task positions.
- g. If not already available, request via the TSC Support Superintendent that a Dose Assessment Team member be dispatched to the TSC to monitor the RDACS Computer.
- h. Report current manpower status to the TSC Director.

2. On Going Actions

- a. Refer to Procedure 1903.065 for a description on the TSC facility and information relating to TSC activation criteria, TSC staffing, TSC staff turnover and the Secondary TSC.
- b. If a plant evacuation or exclusion area evacuation has occurred, then:
 - (1) Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.
 - (2) Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.

Procedure 1903.030, "Evacuation", may be referenced for definitions and/or instructions.

- c. Coordinate with the Health Physics Supervisor (Ext. 6614) located in the OSC to provide oversight for all Health Physics activities.
- d. Using the guidelines established in Procedure 1903.033, provide an oversight of all entries by Repair and Damage Control Teams to ensure that radiation exposure is held to a minimum.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

32 of 63

CHANGE:

: 015-02-0

POSITION GUIDE D

Page 3 of 4

RADIATION PROTECTION AND RADWASTE MANAGER

- e. If the emergency event has dictated the use of reactor sump recirc, then inform the H.P. Supervisor in the OSC to begin monitoring the BWST and/or RWT outlet and return lines for radioactivity.
- f. Monitor radiation levels in the TSC/OSC and, using the guidelines on Attachment 1 of Procedure 1903.030, recommend any protective actions to the TSC Director.
- g. Using Form 1903.065D, "TSC Director Status Update Guide", provide current updates to the TSC Director.
- h. Using Procedure 1903.035, assess the need for the administration of Potassium Iodide for on-site personnel and advise the TSC Director of any such recommendations.
- i. Develop plans, procedures, and methods for keeping radiation exposure of recovery personnel as low as reasonably achievable (ALARA).
- j. Coordinate with Dosimetry to ensure personnel TLDs are read and updated computer listings are provided.
- k. Ensure that the TSC RDACS Operator monitors the status of any offsite radiological release.
- 1. Coordinate with the Health Physics staff to develop decontamination plans to support the recovery effort.
- m. Provide information and recommendations to the TSC Director concerning future operations that could affect the plant or the environment.
- n. Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
- o. Recommend equipment needed for use in accomplishing radwaste processing and monitoring activities.
- p. Advise the Plant Modifications group as necessary concerning radwaste system additions and modifications.
- q. Coordinate with the TSC Support Superintendent to request services that may be needed from offsite sources.
- r. Coordinate with the TSC Support Superintendent to obtain Technical Assistants, as necessary.
- s. Monitor consultant activities where outside assistance is being provided.
- t. Ensure that documentation of all Radiation Protection activities is maintained using the ERO Chronological Logs.
- [u. (P-4193) Ensure all TSC personnel have a TLD.]

PAGE: PROCEDURE/WORK PLAN TITLE: PROC./WORK PLAN NO. **EMERGENCY RESPONSE FACILITY** 1903.065 **CHANGE: TECHNICAL SUPPORT CENTER (TSC)**

33 of 63

015-02-0

POSITION GUIDE D

Page 4 of 4

RADIATION PROTECTION AND RADWASTE MANAGER

Special Actions to be Implemented as Needed 3.

- If applicable, establish a schedule of working hours to support a. around-the-clock operations. Notify the TSC Support Superintendent for assistance.
- If a TSC evacuation is declared by the TSC Director, relocate to b. the EOF in accordance with Procedure 1903.030, "Evacuation".

4. Shift Change

- Upon arrival of your shift replacement, turn over all pertinent documents, forms, and supplies.
- Brief your replacement on the current Emergency Classification, b. status of the plant, information on the Status Boards and ongoing measures that you have been assigned.
- Update your position status on the TSC Staffing Board. c.

Actual Event/Drill Termination 5.

- Notify those individuals working under your position that the a. event/drill has been terminated.
- Collect and organize in chronological order all of your b. documents, logs, procedures, supplies, etc., and help restore the
- Provide a list of any forms or supplies needing replenishment to c. Emergency Planning.
- Turn over all documentation generated during the drill/emergency đ. to Emergency Planning.
- Participate in the post drill/emergency critique to identify e. weaknesses and strengths.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

34 of 63

CHANGE:

015-02-0

POSITION GUIDE D

TASK D-1

DOSIMETRY

- 1. Notified of Alert or higher classification, report to your assigned location.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Support the ERO by issuing personnel dosimetry.
- 5. Ensure personnel TLDs are read and exposure history files are updated in a timely manner.
- 6. Ensure environmental TLDs are read and accurately logged and this information is supplied to the REAM in the EOF.
- 7. Provide whole body counts for personnel, as necessary.
- 8. Inform the Radiation Protection and Radwaste Manager of your location and any change in your location for tracking and accountability purposes.
- 9. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

35 of 63

CHANGE:

015-02-0

POSITION GUIDE D

TASK D-2

RADWASTE SUPPORT

- 1. Notified of Alert or higher classification, report to your assigned location.
- Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Direct the packaging of radioactive wastes.
- 5. Arrange for transport and disposal of radioactive wastes.
- 6. Ensure all waste shipments are fully authorized and documented.
- 7. Report the status of radwaste handling activities to the Radiation Protection and Radwaste Manager, located in the TSC.
- 8. Inform the Radiation Protection and Radwaste Manager of your location and any change in your location for tracking and accountability purposes.
- 9. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC to its pre-drill/event status. Turn over all documentation generated during the drill/event to Emergency Planning.

36 of 63 PAGE: PROCEDURE/WORK PLAN TITLE: PROC./WORK PLAN NO. **EMERGENCY RESPONSE FACILITY** 1903.065 015-02-0 CHANGE: TECHNICAL SUPPORT CENTER (TSC) POSITION GUIDE E Page 1 of 6 TSC DIRECTOR Normal Reporting Location A. TSC В. Reports To Entergy Operations Corporate Management / EOF Director Supervises/Coordinates C. Operations Manager 1. Maintenance Manager 2. 3. Engineering Manager OSC Director 4. Radiation Protection and Radwaste Manager 5. TSC Support Superintendent D. Duties IMMEDIATE ACTIONS Notify CNS (858-3683) that you are staffing your ERO position. If a plant evacuation is occurring, perform initial accountability by logging "0000" in the TSC security card reader (or any other security

card reader) and insert your badge.

Write your name on the TSC Staffing Board under the position TSC Director.

Verify TSC setup in accordance with the TSC Activation Checklist (Form 1903.065A) located on the front of the door leading into the TSC Switchboard Room.

NOTE

The goal for TSC activation is within 1 hour of an Alert or higher emergency class declaration.

Obtain available information on emergency classifications and plant conditions. Possible sources include:

- Shift Superintendent (Use Ringdown Circuit to the Control Room) (1)
- (2) TSC Status Board
- Other TSC staff personnel (3)

If the affected Unit is in an outage, contact the Outage desk for an update/turnover for outage activities and plant/equipment status. Request the Outage Manager and his outage staff members, e.g. Reactor Building Coordinators, etc., to report to the TSC to assist in mitigating the emergency.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE:

37 of 63

CHANGE:

015-02-0

POSITION GUIDE E

Page 2 of 6

TSC DIRECTOR

that a	already available, request via the TSC Support Superintendent n EAL Reviewer be dispatched to the TSC to review EALs per ure 1903.010.
Determ in Pro	nine operational status of the TSC using the guidelines established ocedure 1903.065, Section 6.2.4.
unit, the EC 1903.0	ring discussions with the Shift Superintendent of the affected assume the responsibility for Emergency Direction and Control if Director is not yet ready to assume this role. See Procedure 65, Section 6.4 for details concerning turnover of Emergency ion and Control.
[EMERGI (P-10766)]	ENCY DIRECTION AND CONTROL ACTIONS
Ensure up-to-	e that a Notifications Communicator is stationed in the TSC and is date on previous notifications to offsite authorities.
Notify	offsite authorities.
(1)	The Arkansas Dept. of Health must be notified within 15 minutes of EACH emergency class declaration using Form 1903.011Y.
(2)	The Nuclear Regulatory Commission must be notified immediately after each notification to the ADH and within 1 hour of each emergency class declaration using the ENS telephone.
(3)	Follow-up notifications to the ADH and NRC should be performed at least hourly or as significant events occur using Form 1903.011Z (ADH) and the ENS telephone (NRC).
Notify (PARs)	y offsite authorities concerning Protective Action Recommendations
(1)	Formulation of PARs based on radiological conditions is under the responsibility of the REAM located in the EOF.
(2)	Formulation of PARs based on plant conditions are developed by the Operations/TSC Staff and the EAL Reviewers
Direct	and control the Emergency Response Organization (ERO) effort the EOF Director assumes this responsibility.
EAL Re	SC Director has the responsibility for event classification. The eviewers in the Control Room, TSC and EOF are responsible for ming you of event classification caused by changing conditions.
Follow	wing an <u>Alert</u> declaration, complete Forms 1903.011N, 1903.011BB and 011Y.

Following a <u>Site Area Emergency</u> declaration, complete Forms 1903.011Q, 1903.011BB and 1903.011Y.

PROC./WORK PLAN NO.

PROCEDURE/WORK PLAN TITLE:

1903.065

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

38 of 63

CHANGE:

015-02-0

POSITION GUIDE E

TSC DIRECTOR

Page 3 of 6

Following a General Emergency declaration, complete Forms 1903.011T, 1903.011BB and 1903.011Y.

ON GOING ACTIONS

 _Inter	face w	ith NRC/ADH/local officials on the status of the emergency.
 _Inter: recom	face wa	ith NRC/ADH/local officials on dose assessment and offsite protective actions.
_Conti	nuously	y review the status of the overall emergency effort.
 _Keep :		y Operations Management informed of the status of the
 Evalu	ate and	d approve/disapprove requests for additional personnel om offsite entities.
 _infor	mation	ocedure 1903.065 for a description on the TSC facility and relating to TSC activation criteria, TSC staffing, TSC staff d the Secondary TSC.
 _Estab the O	lish co SC Dire	ommunications with the OSC. Either communicate directly with ector or delegate as appropriate.
 _Condu	ct per	iodic updates with the OSC Director on:
(1)	Statu	s of in-plant response
	a.	Priority code 1 mission status and prognosis
	b.	Actual in-plant radiological conditions
	c.	Nuclear Chemistry status as appropriate
(2)	Provi rescu	de direction and oversight to the OSC Director regarding e/repair and damage control operations
(3)	OSC m	anpower status
 Team perio	missio dicall	riorities (example: 1, 2, 3, 4, etc.) for Damage and Control ns. Direct the TSC Team Tracking Board Communicator to y communicate these priorities to the OSC. (Assign each own unique priority number)
 _Condu	ct per	iodic updates to the EOF Director on:

- Status of in-plant response (1)
 - Status of ongoing repair and damage control operations Nuclear Chemistry data as appropriate a.
 - b.
 - Recommendations regarding Emergency Classifications
- (2) TSC manpower status

PROC./WORK PLAN NO.

PROCEDURE/WORK PLAN TITLE:

1903.065

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

39 of 63

Page 4 of 6

CHANGE:

015-02-0

POSITION GUIDE E

TSC DIRECTOR

	If necessary, approve emergency exposure limits exceeding 10CFR20 exposure limits, for in-plant emergency teams.
	Upon the recommendation of the RP & RW Manager, approve the usage of Potassium Iodide (KI) for onsite personnel using Form 1903.035A "Potassium Iodide Administration"
	Review the habitability of the Control Room, OSC, TSC and Admin. Bldg.
	Review recovery efforts with the Engineering Manager to ensure that they have been adequately prioritized.
	Coordinate and promulgate mitigation plans and corrective actions with the TSC staff.
	If a radiological release is involved, consider using Reactor Building Spray to reduce containment radioactivity levels and containment pressure, thus lowering the release rate to the offsite environment.
	Using Form 1903.065D, "TSC Director Status Update Guide", request frequent updates from the TSC Staff.
	Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
	Coordinate with the TSC Support Superintendent to obtain Technical Assistants, as necessary.
	Ensure that consultant activities are being monitored when outside assistance is being provided.
<u> </u>	Ensure that documentation of all TSC activities and decisions are recorded and maintained using the ERO Chronological Logs.
	As appropriate, give periodic briefings of events using the plant page (dial 197). Repeat briefings using the page to EOF (dial 199 and pause approximately 15 seconds).
	If applicable, establish a schedule of working hours to support around-the-clock operations. Notify the TSC Support Superintendent for assistance.
EVA	CUATION
 	If necessary, declare localized, plant and exclusion area evacuation per the criteria of Procedure 1903.030.
	Complete the Plant Evacuation section of Form 1903.011Q or 1903.011T as conditions warrant.
	Ensure that the entire TSC Staff provides initial accountability by reporting to the nearest security card reader, inserts their security badge and enters "0000" into the card reader.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

40 of 63

CHANGE:

: 015-02-0

POSITION GUIDE E

TSC DIRECTOR

Page 5 of 6

NOTE

The goal of initial accountability is to ascertain the names of missing individuals no later than 30 minutes after the decision has been made to evacuate non-essential personnel.

 Review initial accountability with the TSC Support Superintendent.
 _Initiate search and rescue efforts as necessary to account for missing individuals following a plant evacuation.
 Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.
 Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.
 _Following discussions with the Radiation Protection and Radwaste Manager, declare an OSC/TSC evacuation or precautionary evacuation in accordance with the criteria of Procedure 1903.030.
 _If the TSC is to be relocated to the Secondary TSC due to adverse conditions, refer to Form 1903.065C, "Secondary TSC Activation Checklist".
 _Ensure that NRC/ADH officials are advised of any relocation of the TSC/OSC and the operational status of the Secondary OSC/TSC.
 _Following an Exclusion Area Evacuation, approve/disapprove requests by Security to grant access to personnel through established roadblocks.

NOTE

Review of the Severe Accient Management Guidelines (SAMG) and data gathering by the SAM team may be started prior to the implementation of Severe Accident Management.

[SEVERE ACCIDENT MANAGEMENT (SAM)

(P-16243)

If the incident has progressed to a point where the Control Room has determined that the EOP's are no longer effective, implement Severe Accident Management. Utilize the SAM checklist located in your position box.]

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

41 of 63

CHANGE:

015-02-0

POSITION GUIDE E

TSC DIRECTOR

Page 6 of 6

C	HT	FT	CHAI	JCE
_				104

Upon arrival of your shift replacement, turn over all pertinent documents, forms, and supplies.
Brief your replacement on the current Emergency Classification, status of the plant, information on the Status Boards and ongoing measures that you have been assigned.
Notify the TSC Support Superintendent of the staffing change.
Update your position status on the TSC Staffing Board.
ACTUAL EVENT/DRILL TERMINATION
Notify those individuals working under your position that the event/drill has been terminated.
Collect and organize in chronological order all of your documents, logs procedures, supplies, etc., and help restore the TSC.
Provide a list of any forms or supplies needing replenishment to Emergency Planning.
Turn over all documentation generated during the drill/emergency to Emergency Planning.
Participate in the post drill/emergency critique to identify weaknesses and strengths.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE:

42 of 63

CHANGE:

015-02-0

POSITION GUIDE F

Page 1 of 5

TSC SUPPORT SUPERINTENDENT

Normal Reporting Location Α.

TSC

В. Reports To

TSC Director

- Supervises/Coordinates C.
 - ANO Security 1.
 - Administrative Services 2.
 - Computer Support
 - Coordinate continuous accountability function following a plant 4. evacuation
 - Support Manager 5.
 - TSC Emergency Action Level Reviewers 6.
 - TSC Notifications Communicator 7.
 - TSC Status Board Communicator 8.
 - TSC ENS Communicator 9.

D. Duties

Immediate Actions 1.

- When notified of an Emergency Plan Activation, report to your a. assigned facility and, if not already performed, notify CNS (858-3683) that you are staffing your ERO position.
- If a plant evacuation is occurring, perform initial b. accountability by logging "0000" in the TSC security card reader (or any other security card reader) and insert your badge. Refer to Step 3.a below for instructions on your responsibilities as they relate to accountability.
- Write your name on the TSC Staffing Board under the position that c. you are staffing.
- Verify TSC setup in accordance with the TSC Activation Checklist d. (Form 1903.065A) located on the front of the door leading into the TSC Switchboard Room. Setup should be completed within 1 hour of TSC operability.
- Obtain available information on emergency classifications and e. plant conditions. Possible sources include:

NOTE

Do not call the Control Room.

- (1) TSC Director (staff briefing)
- (2) TSC Status Board
- (3) Other TSC staff personnel

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 43 of 63 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE F

Page 2 of 5

TSC SUPPORT SUPERINTENDENT

- f. Ensure task responsibilities under your position are assigned:
 - (1) Security (Task F-1) contact personnel from Security using Section V of the Emergency Telephone Directory.
 - (2) Administrative Services (Task F-2) Contact personnel from Administrative Services using Section V of the Emergency Telephone Directory. Additionally, Administrative Services will be called by CNS during off-hours.
 - (3) Computer Maintenance/Software Support (Task F-3) Contact personnel from Computer Maintenance/Software Support using Section V of the Emergency Telephone Directory.
 - (4) $\frac{\text{TSC EAL Reviewer (Task F-4)}}{\text{CNS printout.}}$ Contacted via CNS. Refer to
 - (5) TSC Notifications Communicator (Task F-5) Contacted via CNS. Refer to CNS report.
 - (6) $\frac{\text{TSC Status Board Communicator (Task F-6)}}{\text{CNS. Refer to CNS report.}}$ Contacted via
 - (7) $\underline{\text{TSC ENS Communicator (Task F-7)}}$ Contacted via CNS. Refer to CNS report.
 - (8) Distribute appropriate Task Guides (attached) as individuals arrive to staff the task positions.
- g. Complete the TSC Staffing Board. Refer to the Computerized Notification System (CNS) printout to ascertain those ERO positions that are enroute.
- h. Report current manpower status to the TSC Director.
- i. Obtain Form 1903.065E "TSC Position Staffing Form", complete the required information and FAX the completed form to the EOF Support Superintendent at FAX Number 6957.
- j. Obtain all necessary forms for your position from the Emergency Kit:
 - (1) Procedure Forms Form 1903.065D
 - (2) Form 1903.065E
 - (3) ERO Chronological Logs

NOTE: If Emergency Direction and Control is transferred directly from the SS to the EOF Director, the TSC Notifications Communicator will report to you to assist you with your responsibilities.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: 1903.065 EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC) PAGE: 44 of 63 CHANGE: 015-02-0

POSITION GUIDE F

Page 3 of 5

TSC SUPPORT SUPERINTENDENT

On Going Actions

- a. Refer to Procedure 1903.065 for a description on the TSC facility and information relating to TSC activation criteria, TSC staffing, TSC staff turnover and the Secondary TSC.
- b. If a <u>plant evacuation</u> or <u>exclusion area evacuation</u> has occurred, then:
 - (1) Maintain continuous accountability of those individuals working under your position that are remaining within or returning to the evacuated area.
 - (2) Ensure that the OSC tracks any personnel working under your position that are remaining within or returning to the evacuated area.

Procedure 1903.030, "Evacuation", may be referenced for definitions and/or instructions.

- c. Maintain the TSC Staffing Board as changes occur. Coordinate changes to staffing boards with the Support Manager in the EOF.
- d. Using Form 1903.065D, "TSC Director Status Update Guide", provide current updates to the TSC Director.
- e. Coordinate Security activities:
 - (1) Coordinate the deployment of security roadblocks to minimize radiation exposures. Obtain radiological release information and information concerning the placement of roadblocks from the Radiation Protection and Radwaste Manager.
- f. Coordinate office services and other administrative duties requested by ERO personnel.
- g. Coordinate requests for Computer Maintenance/Software Support assistance during ERO operations.
- h. Coordinate Communicator needs within the ERO.
- i. Coordinate requests for Technical Assistants. Refer to Section V of the Emergency Telephone Directory when filling these requests.
- j. Coordinate with collocated NRC officials and ensure that an open communications dialogue is maintained throughout the event.
- k. Coordinate with the Support Manager in the EOF at ext. 7854 to request services that may be needed from onsite/offsite sources.
- 1. Monitor consultant activities where outside assistance is being provided.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 45 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE F

Page 4 of 5

TSC SUPPORT SUPERINTENDENT

m. Ensure that documentation of all TSC activities in which you are involved are maintained using the ERO Chronological Logs.

Special Actions to be Implemented as Needed

a. Accountability

- (1) Initial Accountability Following a plant evacuation, obtain a Security printout to determine those individuals that are missing. In accordance with Procedure 1903.030, Section 6.3.1.D, this list must be available no later than 30 minutes after the declaration of a SAE or higher emergency class.
 - (a) Inform the TSC Director of any personnel determined to be missing.
- (2) Continuous Accountability Following a plant evacuation, complete the following actions:
 - (a) Verify that Security has obtained continuous accountability clipboards and signs, which contain Form 1903.030A, from the TSC Emergency Kit.
 - (b) Contact the Control Room Status Board Communicator and instruct him/her to hang the accountability clipboards and signs on the Control Room doors of both Units (inside of door). Instruct the Communicator to periodically review and monitor the Control Room accountability logsheets and report their status to you.
 - (c) Continuous accountability of personnel assembled outside the Control Rooms, TSC and OSC is the responsibility of the person staffing the ERO position to which they report. (Example: Engineering Manager is responsible to account for Engineering personnel).
 - (d) Direct requests for continuous accountability information on specific individuals to the responsible ERO member. A printout of all onsite personnel may be obtained from Security for use as an aid in routing these requests. This printout will include the company and/or department for each person listed and the individual responsible for them while onsite.
- b. Following an NRC request, coordinate with the Health Physics Supervisor in the OSC to ensure that a technically qualified HP is prepared to staff the Health Physics Network (HPN) telephone in the OSC and the EOF.
- c. If applicable, establish a schedule of working hours to support around-the-clock operations for your ERO position as well as others when requested.

PROC./WORK PLAN NO.	PROCEDURE/WORK PLAN TITLE:	PAGE:	46 of 63
1903.065	EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)	CHANGE:	015-02-0

POSITION GUIDE F

Page 5 of 5

TSC SUPPORT SUPERINTENDENT

d. If a TSC evacuation is declared by the TSC Director, relocate to the EOF in accordance with Procedure 1903.030, "Evacuation".

Shift Change

- a. Upon arrival of your shift replacement, turn over all pertinent documents, forms, and supplies.
- b. Brief your replacement on the current Emergency Classification, status of the plant, information on the Status Boards and ongoing measures that you have been assigned.
- c. Record staffing changes due to shift replacements on the TSC Staffing Board.
- d. Update your position status on the TSC Staffing Board.

5. Actual Event/Drill Termination

- a. Notify those individuals working under you position that the event/drill has been terminated.
- b. Collect and organize in chronological order all of your documents, logs, procedures, supplies, etc., and help restore the TSC.
- c. Provide a list of any forms or supplies needing replenishment to Emergency Planning.
- d. Turn over all documentation generated during the drill/emergency to Emergency Planning.
- e. Participate in the post drill/emergency critique to identify weaknesses and strengths.

PROC./WORK PLAN NO.

PROCEDURE/WORK PLAN TITLE:

1903.065

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

47 of 63

CHANGE:

015-02-0

POSITION GUIDE F

TASK F-1

SECURITY

- 1. Notified of Alert or higher classification, report to your assigned location.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Organize staff and have them report to their assigned location.
- 5. Establish a schedule of working hours to support around the clock operation.
- 6. Report manpower status to the TSC Support Superintendent.
- 7. Coordinate plant evacuation as needed in accordance with Procedure 1903.011 and/or 1903.030.
- 8. Upon declaration of a Plant Evacuation, ensure that Security personnel obtain the continuous accountability clipboards and signs, which contain Form 1903.030A, from the TSC Emergency Kit and post them at the following Administration Building locations:

First Floor - Door leading to Turbine Building

- East and West exits

- Entry and exit points to Main Guard House

Second Floor - Door leading to Turbine Building

9. Following a plant evacuation, report initial accountability results to the TSC Support Superintendent.

NOTE

Coordinate with the Radiation Protection and Radwaste Manager in the TSC to help ensure Security Personnel radiation doses are tracked and monitored.

- 10. Following a plant evacuation of non-essential personnel, maintain continuous accountability of Security personnel remaining onsite.
- 11. Coordinate local law enforcement activities as appropriate.
- 12. Set up roadblocks and control points to control access to ANO, the EOF, and the alternate EOF (if activated). Consider radiological release information (obtained from TSC Support Superintendent) in determining locations of roadblocks and control points.
- 13. Establish working area in the EOF and the alternate EOF (if activated) to issue plant access identification.
- 14. Reduce security precautions at termination of emergency.
- 15. Notify staff upon termination of the ANO emergency response.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 48 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE F

TASK F-2

ADMINISTRATIVE SERVICES

- 1. Notified of Alert or higher classification, report to the TSC library.
- Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Organize staff and have them report to their assigned location.
- 5. Establish a schedule of working hours to support around-the-clock operation.
- 6. Report manpower status to the TSC Support Superintendent.
- 7. Relocate/procure Administrative Services' supplies and equipment as necessary.
- 8. Inform the TSC Support Superintendent that you are performing this task and perform accountability tasks in accordance with procedure 1903.030, "Evacuation".
- 9. Following a plant evacuation of nonessential personnel, maintain continuous accountability of Administrative Services personnel remaining onsite.
- 10. Notify staff upon termination of the ANO emergency response.
- 11. As appropriate, periodic status reports should be generated which include the following items:
 - a. Current status of the emergency
 - b. Chronological summary of the event and response actions (listing).
 - c. Organizations currently involved in this response to the event.
 - d. Narrative discussion of the plan of action to address the event.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 49 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

POSITION GUIDE F

TASK F-3

COMPUTER MAINTENANCE/SOFTWARE SUPPORT

- 1. Notified of Alert or higher classification, report to your assigned location.
- Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Establish line of communication with the TSC Support Superintendent.
- 5. Provide computer hardware and software support for the Emergency Response Organization.
- 6. Inform the TSC Support Superintendent of location and of any changes in location for tracking purposes.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

50 of 63

CHANGE:

015-02-0

POSITION GUIDE F

TASK F-4

TSC EMERGENCY ACTION LEVEL REVIEWER

- 1. Notified of Alert or higher classification, report to the TSC Support Superintendent in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Ensure that the TSC Director is aware of your presence upon arrival.
- 5. Obtain a copy of Procedure 1903.010 and 1903.011 from the TSC Bookcase or the Administration Building Library.
- [6. (P-1464) Review Procedure 1903.010, "Emergency Action Level Classification", on a continuous basis to ensure adequate classification of the event. Log and maintain applicable EAL's for TSC tracking.]
- [7. (P-1464) Review Procedure 1903.011, "Emergency Response/Notifications", Attachment 6,7 and 8 on a continuous basis to ensure that appropriate Protective Action Recommendations have been implemented.]
- 8. Report all information concerning classification and Protective Action Recommendations to the TSC Director and ensure that the individual responsible for Emergency Direction and Control is informed.
- 9. As time permits, review conditions to identify <u>all</u> Emergency Action Levels that apply to current conditions.
- [10. (P-16243) In the event that a <u>Severe Accident</u> is acknowledged, work with support engineers in the TSC to review the Severe Accident Management Guidelines (SAMG's) and formulate and recommend recovery actions necessary to mitigate the accident. Make the recovery action recommendations to the Operations Manager.]

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

51 of 63

CHANGE:

015-02-0

POSITION GUIDE F

TASK F-5

Page 1 of 2

[TSC NOTIFICATIONS COMMUNICATOR (P-9475)]

- 1. Notified of Alert or higher classification, report to the TSC Support Superintendent in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Upon arrival, report to the TSC Director and determine if Emergency Direction and Control will be transferred to the TSC or EOF.
- 5. If Emergency Direction and Control will be transferring directly from the Shift Superintendent to the EOF Director, stop here and assist the TSC Support Superintendent as requested. Otherwise, proceed immediately with step 6.
- 6. Obtain Procedure Forms 1903.011BB, 1903.011CC, 1903.011Y and 1903.011Z from the TSC Notifications Communicator Position Book.
- 7. Establish communications with the Notifications Communicator located in the Control Room (the Shift Engineer from the unaffected Unit typically fills this position).

Unit One Communicator - Ext. 3102 Unit Two Communicator - Ext. 3202

- [8. (P-9459) Assume notification responsibilities from the Control Room as directed by the TSC Director.
 - A. Obtain a briefing of the current status of any notifications previously performed by the Control Room.
 - B. Review fax copies of any notification forms which have been sent to the ADH.
 - C. Determine when the next notification is due. If you can not complete this notification on time, inform the TSC Director]
- 9. Complete Forms 1903.011BB and 1903.011CC as directed by the TSC Director.
- 10. Notifications to Offsite Authorities
 - A. Notifications should be performed only upon authorization from the TSC Director.

PROC./WORK PLAN NO. PROCEDURE/WORK PLAN TITLE: PAGE: 52 of 63

1903.065 EMERGENCY RESPONSE FACILITY
TECHNICAL SUPPORT CENTER (TSC) CHANGE: 015-02-0

TASK F-5

Page 2 of 2

TSC NOTIFICATIONS COMMUNICATOR

(Step 10 Cont.)

- B. Make notifications to the Arkansas Department of Health (ADH) within 15 minutes of any declared emergency class using Form 1903.011Y.
 - (1) Radiological/Meteorological information should be obtained from:
 - a. The Nuclear Chemist assigned to TSC RDACS.
 - b. The Initial Dose Assessor in the Control Room if Dose Assessment has not been transferred to the EOF.

Unit One Dose Assessor - Ext. 3102 Unit Two Dose Assessor - Ext. 3202

- c. The REAM (Ext. 6406/6482) located at the EOF if Dose Assessment has been transferred to the EOF.
- (2) Protective Action Recommendation (PAR) data should be obtained from:
 - a. The Initial Dose Assessor in the Control Room if Dose Assessment has not been transferred to the EOF.
 - b. The REAM, located at the EOF, if Dose Assessment <u>has</u> been transferred to the EOF.
- (3) All 1903.011Y Forms should be telefaxed to the ADH in Little Rock until the ADH TOCD arrives at the EOF to collocate with the ANO staff.
- C. Obtain the information necessary to adequately describe the plant status then make notifications to the NRC <u>immediately</u> after notifying the ADH using the ENS telephone.
 - (1) Provide the NRC with, at a minimum, the same information that was supplied on the notification form telefaxed to the ADH.
- D. Telefax copies of the completed Emergency Notifications Forms (Forms 1903.011Y and 1903.011Z) to the EOF and Control Room. If using the DEF/VS for notifications this is done automatically.
- E. Provide hourly follow-ups to the ADH (Form 1903.011Z) and NRC (ENS telephone). Follow-up notifications should be provided within one hour of the latest notification or more frequently as directed by the TSC Director.
 - (1) Follow-ups should also be provided when significant changes occur.
 - (2) All 1903.011Z Forms should be telefaxed to the ADH in Little Rock until the ADH TOCD arrives at the EOF to collocate with the ANO staff.

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

53 of 63

CHANGE:

015-02-0

POSITION GUIDE F

TASK F-6

[TSC STATUS BOARD COMMUNICATOR (P-1457, P-4978, P-9475)]

- 1. Notified of Alert or higher classification, report to the TSC Support Superintendent in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Upon arrival, begin helping with the setup of the TSC using Form 1903.065A, "TSC Activation Checklist".
- 5. Obtain a party-line headset and erasable markers from the TSC Emergency Kit.
- 6. Set up at Station 16 in the TSC. Connect the headset and ensure that an openline communication link via the party line is established with the Control Room Status Board Communicator. The OSC and EOF Status Board Communicators will join the party line as they report in to their respective facilities.

NOTE

The ring-down circuit may be used to establish the initial contact with the Control Room Status Board Communicator, however, release the ring-down for the facility director's use as quickly as possible.

- 7. Complete and maintain the TSC Status Board.
 - A. Status Board entries should be made in chronological order, starting at the top, with the time entry on the left side.
 - B. When the Status Board becomes full, start again at the top by erasing the oldest entry and begin making new entries with a different color marker.
 - C. Ensure that the TSC Director is made aware of significant information that is reported across the party line and being logged onto the Status Board (e.g., Release started, equipment failures, etc.).

PROCEDURE/WORK PLAN TITLE:

EMERGENCY RESPONSE FACILITY TECHNICAL SUPPORT CENTER (TSC)

PAGE:

54 of 63

CHANGE:

015-02-0

POSITION GUIDE F

TASK F-7

[TSC EMERGENCY NOTIFICATION SYSTEM (ENS) COMMUNICATOR (P-9475)]

- 1. Notified of Alert or higher classification, report to the TSC Support Superintendent in the TSC.
- 2. Review this task guide.
- 3. If plant evacuation is occurring, perform initial accountability by logging "0000" into the nearest card reader and then insert your badge.
- 4. Obtain a briefing on the status of current operational conditions and a briefing on historical events that led up to the event from the Operations Manager in the TSC.
- 5. Establish your station at the SPDS Panel next to the ENS telephone. Obtain all necessary supplies from the TSC Emergency Kit.

Note: If the Control Room is currently manning the ENS telephone, whenever you lift the receiver on the TSC ENS telephone, you will automatically be joined in with the NRC/Control Room ENS circuit.

- 6. Lift the receiver on the TSC ENS telephone. If the Control Room/NRC is already on the circuit, inform the Control Room/NRC that you are taking over the ENS responsibility from the Control Room. If you simply hear a dial tone whenever you lift the receiver, you must then dial any one of the numbers listed on the telephone placard. Whenever the NRC answers, inform them that you are staffing the ENS telephone from the ANO TSC.
- 7. Maintain an open-line with the NRC unless requested otherwise by the NRC Communicator.
- 8. Provide information to the NRC Communicator as requested. The TSC staff, especially the Operations Manager, will serve as your source for obtaining requested information.

9. Drill/Event Termination

- A. When notified of the drill/event termination, collect and organize in chronological order all of your documents, logs, etc., and help restore the TSC
- B. Provide a list of any forms or supplies needing replenishment to Emergency Planning.
- C. Turn over all documentation generated during the drill/event to Emergency Planning.
- D. Participate in the post drill/event critique.

			Page 1 of 3
			Initials
Steps floor	1 and diagra	2 should be performed as soon as possible. Use attached am of the TSC for location of stations.	
1.		on the power to the TSC/OSC PA amplifier (located in the TSC nications room, station 29).	
2.	Put the	ne RDACS key in the RDACS computer (Station 20). Key is ed in the TSC Emergency Kit key box.	
Steps	3 thre	ough 7 may be performed by the RP technician.	
•	comple If a	SC Support Superintendent should ensure that the checklist is eted within approximately 1 hour after the TSC is operable. release is known to exist, then step 3 should be performed as as possible.	
3.	Activ	ate the Continuous Air Sampler as follows: (station 31)	
	Α.	Move the continuous air sampler to a location near the TSC. Due to the noise produced by the air sampler, the air sampler should be moved as close as possible to the TSC without disturbing the TSC operation. (Station 32)	
	В.	Ensure all switches are in the "OFF" position.	
	C.	Plug the NMC into the proper power supply (i.e., 110 VAC outlet).	
	D.	Place the "Master" power switch (located on the front panel, upper left corner) to the "ON" position.	
	Ε.	Check amber warning light (located on top of CAM housing). IF illuminated continue. Protection to check CAM. OTHERWISE, notify Radiation	
	F.	Wait 5 minutes.	
	G.	Place the "Blower" switch (located inside CAM, lift lid switch is on back panel of CAM) to the "ON" position.	
	н.	Place the "High Voltage" switch (located on the front panel, upper left corner) to the "ON" position. Time:	
	I.	Wait approximately 30 minutes. After approximately 30 minutes the amber light should turn off and the rate meters should begin to respond. IF the CAM does not respond as expected, THEN request RP to provide air monitoring.	
4.	Open TSC.	the TSC Emergency Kit located outside the east door of the (Station 18)	

FORM TITLE:	FORM NO.	CHANGE
TSC ACTIVATION CHECKLIST	1903.065A	015-02-0
		1

Place the frisking station stanchion at the north end of the west hallway. (Station 28)

	Page	2	ΟĽ	3	
n					
e e	-			•	

- 6. Obtain the frisker from the kit and place on the frisking station stanchion. Perform a battery check of the instrument and set the monitor on the lowest usable scale (i.e., X1 scale for RM-14).
- 7. Hang the signs provided to direct personnel to the west hallway.
 (Signs and chains are hanging on the frisking station stanchion and are labeled as to which station they are to be located.)
- 8. Submit this completed form to the TSC Director.

TECHNICAL SUPPORT CENTER LEGEND

- 1. TSC Switchboard Operator
- 2. Health Physics Network (HPN) telephone
- 3. Deleted
- 4. TSC Director
- 5. Radiation Protection and Radwaste Manager
- 6. Maintenance Manager
- 7. Deleted
- 8. TSC Notifications Communicator
- 9. NRC Management Counterpart Link
- 10. Engineering Manager
- 11. Deleted
- 12. TSC Support Superintendent
- 13. Emergency Notification System (ENS)
- 14. Operations Manager
- 15. Deleted
- 16. TSC Status Board
- 17. Card Reader
- 18. TSC Emergency Kit
- 19. SPDS
- 20. RDACS
- 21. NRC Local Area Network (Wall Jack)
- 22. NRC Reactor Safety Counterpart Link
- 23. NRC Protective Measures Counterpart Link
- 24. Team Tracking Board
- 25. Computerized Notification System (CNS)
- 26. Emergency Key Box
- 27. Staffing Board
- 28. Frisking Station
- 29. TSC PA Amplifier
- 30. SRO/EAL Reviewer
- 31. Storage location for Continuous Air Monitor (CAM)
- 32. Continuous Air Monitor (CAM) This is a general location, the actual location during drills and emergencies may vary.

The letter designations on the TSC layout represent the location of the hanging signs. Each sign has a corresponding locator to ensure proper placement.




= ANO TELEPHONE STATION



= NRC TELEPHONE STATION

1	FORM TITLE:	FORM NO.	CHANGE
	TSC ACTIVATION CHECKLIST	1903.065A	015-02-0


TSC Layout (NRC Office Space Provided Adjacent To TSC)

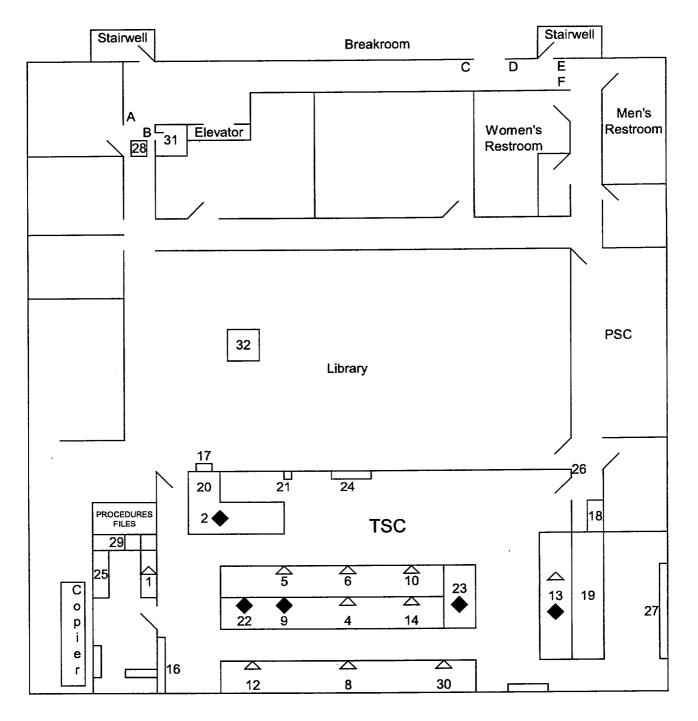

FORM TITLE:	FORM NO.	CHANGE
TSC ACTIVATION CHECKLIST	1903.065A	015-02-0

		Page 1 of 2
		Initials
1.	Notify TSC staff of the necessary relocation to the Secondary TSC.	
2.	Notify the EOF Maintenance Coordinator located at the EOF that the TSC staff is being relocated and that Room 260 should be setup. See page 2 of this form for a floor diagram of the Secondary TSC.	
3.	Ensure that a Communicator is dispatched to the Secondary TSC to aid the EOF Maintenance Coordinator in preparing Room 260.	
4.	Refer to Procedure 1903.030, "Evacuation" for additional details relating to evacuation of the TSC.	
5.	Submit this completed form to the TSC Director.	

SECONDARY TECHNICAL SUPPORT CENTER - ROOM 260 (EOF)

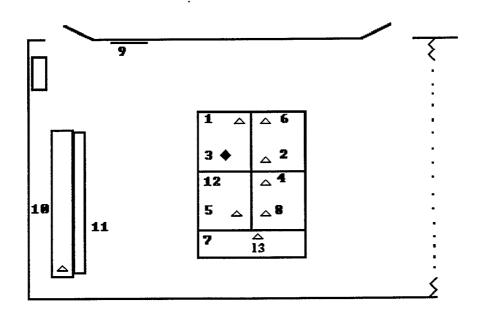

LEGEND

- 1. Secondary TSC Telephone Operator
- 2. TSC Director
- 3. NRC Operations Coordinator/Reactor Safety Coordinator
- 4. Maintenance Manager
- 5. RP&RW Manager
- 6. TSCD Administrative Assistant
- 7. NRC Containment Specialist
- 8. Engineering Manager
- 9. Command and Control Board
- 10. Plant Status Board
- 11. NRC Reactor Safety Specialist
- 12. Operations Manager
- 13. TSC Support Superintendent

 Δ = TELEPHONE STATION (ANO)

◆ = TELEPHONE STATION (NRC)

FORM TITLE:	FORM NO.	CHANGE
SECONDARY TSC ACTIVATION CHECKLIST	1903.065C	015-02-0

٦	Date and Ti	me of Status Update:	Date:	Time:
1.	Date and III	me of beatab opaaro.		
		** 1 to Thomas	(Charle as rowinged):	
2.	_		(Check as reviewed):	
	Α.	Reactor health, core	cooling systems operation	al status
	_	Compainment atatic	current trends production	
	c	Review of accident m	itigation - objectives, pr	norities, and
		strategies		,
	D	Status of engineering	ng evaluations in progress	Control Room
	E	Status of support gi	ven in response to OSC and	Concret Room
	_	Requests	availahle	
	F	Engineering support Problem areas needing	a resolution	
	·	FIODICM areas meetar.	.9 10201	
Notes	:		•	
			(phosis as roughwad):	
3.	Maintenance	Manager update Items	s (check as reviewed):	
	Α.	Plant equipment prob	olems or malfunctions	
	To the second	Chatua of repair and	i damade control efforts li	n progress
	D	Offsite agencies or	consultants giving assista	ance in repair and
		damage control		
	E	Problem areas needing	ng resolution	
Notes	₹ :			
			(shark as marriawad).	
4.	-		(check as reviewed):	
	Α.	Review of Emergency	Class declared based on p	lant conditions
	В.	Cianiticant Items F	rom the SS of the allected	uiiic
	C.	Emergency and/or ab	normal operating procedures	s entered or exited
	D	Operational status,	trends, and forecasts of	olant equipment and
		systems		
	E	_ Planned future opera	ations that could affect the	ne plant
	F	Offsite agencies or	consultants providing ass	istance in the
	_	recovery of the plan	nt 	
	G	Problem areas needi	ng resolution	
Note	s:			

5.	Radiation	Protection and Radwaste Manager Update Items (check as reviewed):
	Α.	Radiological release data available.
	A. <u>1.</u>	_ Radiological lelease data available. Is release source secure?
	2.	Is release from plant secure?
	3.	Update TSCD if one or both have been secured.
	3.	openie I Son II one of both have been secured.
	В	Control Room \OSC\TSC habitability
	<u>c</u>	On-site radiological conditions affecting repair\recovery effort Personnel exposure status, overexposure, contamination, etc Plans for keeping radiation exposure of repair\recovery personnel
	D	Personnel exposure status, overexposure, contamination, etc
	E	_ Plans for keeping radiation exposure of repair (recovery personner
		as low as reasonably achievable.
	F	_ Decontamination work necessary to support the recovery effort
	G	Radwaste processing and monitoring in progress Planned evolutions that could affect the plant environment
	н	_ Planned evolutions that could affect the plant environment
	I	Problem areas needing resolution.
Mata		
NOLE	·s:	
6.	TSC Suppor	t Superintendent Update Items (check as reviewed):
	Α	_ Status of technical and/or administrative support requested by the
		TSC, OSC, or Control Room
	в.	Offsite communications (transmissions in progress) from the TSC
	c	Status of initial\continuous accountability (if plant evacuation
		has occurred)
	D.	_ Security activities in support of emergency response
	E	Problem areas needing resolution
Note	es:	
7.	TSC Direct	or Update Items (check as reviewed):
	A.	_ Current Emergency Class declared and the basis
	В.	On-site protective measures in effect (or planned)
	c	Overall accident mitigation objectives and their priorities
	D	Significant items from the EOF Director
	E	Significant items from the OSC Director
	F	Problem areas needing resolution
	G	_ rioblem areas needing resolution _ Is release source secure?
		_ is release source secure? Is release from plant secure?
	н	_ is release from plant secure:
Note	es:	

1	FORM TITLE:	FORM NO.	CHANGE
	TSC DIRECTOR STATUS UPDATE GUIDE	1903.065D	015-02-0

ļ		NOTE			
	2) TSC manpower status				
	ì	A) Status of in-plant response b) Nuclear chemistry data as appropriate c) Recommendations regarding Emergency Classifications			
	1) 5	Status of in-plant response			
12.	Conduct periodic updates with the EOF Director on:				
		OSC manpower status			
	2) I	Actual in-plant radiological conditions Nuclear chemistry status as appropriate Provide direction and oversight to the OSC Director regarding rescue/repair and damage control operations			
		Status of in-plant response A) Priority code 1 mission status and prognosis			
11. Conduct periodic updates with the OSC Director on:					
10.	Select the time of the next TSC Status Update and announce it in the Technic Support Center.				
9.	. Direct key TSC personnel to update their subordinates with applicable information obtained in the status update.				
	E				
	D				
	c				
	в				
	Α				
8.	Other C	organizations (NRC, etc.) Update Items (list as reviewed):			

Items on these lists are suggested topics for routine updates. Items actually selected for update should be based on existing or projected conditions.

TSC POSITION STAFFING FORM

POSITION	NAME	
SC DIRECTOR		
PERATIONS MANAGER		
NGINEERING MANAGER		
AINTENANCE MANAGER		
AINIENANCE MANAGER		
.P. & R.W. MANAGER		
OTIFICATIONS COMMUNICATOR		
SC SUPPORT SUPERINTENDENT		
AFFECT	ED CONTROL ROOM	
AFFECT POSITION	ED CONTROL ROOM	
POSITION		
POSITION		
POSITION HIFT SUPERINTENDENT		
POSITION HIFT SUPERINTENDENT		
POSITION HIFT SUPERINTENDENT		
POSITION HIFT SUPERINTENDENT HIFT ENGINEER	NAME	abov
POSITION HIFT SUPERINTENDENT HIFT ENGINEER applete the above by listing the name	NAME es of the ERO personnel staffing the	abov
POSITION HIFT SUPERINTENDENT HIFT ENGINEER splete the above by listing the name sitions. FAX this form immediately	NAME	abov. FAX
POSITION HIFT SUPERINTENDENT HIFT ENGINEER splete the above by listing the namesitions. FAX this form immediately	NAME es of the ERO personnel staffing the	abov: FAX
POSITION THIFT SUPERINTENDENT THIFT ENGINEER THIFT ENGINEER	NAME es of the ERO personnel staffing the to the EOF Support Superintendent at	: FAX

FORM TITLE:	F	FORM NO.	CHANGE
TSC POSITION STAFFING FORM		1903.065E	015-02-0