

VIRGINIA ELECTRIC AND POWER COMPANY
RICHMOND, VIRGINIA 23261

November 5, 2001

Director of Nuclear Reactor Regulation
United States Nuclear Regulatory Commission
Washington, DC 20555-0001

Serial No.: 01-668
NLOS/mm
Docket No.: 50-280
License No.: DPR-32

Gentlemen:

VIRGINIA ELECTRIC AND POWER COMPANY
SURRY POWER STATION UNIT 1
STEAM GENERATOR TUBE INSPECTION REPORT

Planned inservice inspection of the Surry Unit 1 "A" steam generator was completed during the Fall 2001 Refueling Outage. In accordance with Surry Power Station Technical Specification 4.19.F.a, this letter provides notification of the number of steam generator tubes that were plugged during the outage.

Steam Generator "A"

Five tubes were plugged based on the review of the current inspection data, evaluations required by the S/G Program Plan, and updated industry information as referenced in the pre-outage assessment. None of the indications exceeded the 40% through-wall plugging limit. One tube (R42 C47) had an anti-vibration bar (AVB) wear indication that was preventively plugged based upon the projected growth rate. Another tube (R10 C44) had a wear indication that is believed to be caused by the tip of the AVB contacting the tube. The remaining tubes (R1 C9, R1 C28 & R1 C67) had wear indications caused by the sludge lance monorail device utilized at the Spring 2000 outage. The following list identifies the tubes that were evaluated and plugged:

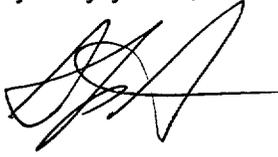
Row/Col	Location	Indication	%Through Wall
R1 C9	TTS CL	%WEAR	<10*
R1 C28	TTS CL	%WEAR	16
R1 C28	TTS HL	%WEAR	28
R1 C67	TTS HL	%WEAR	25
R10 C44	U-Bend	%WEAR	16
R42 C47	AV1	%WEAR	30

*Indication present but signal voltage low and signal poorly formed.

Aspl

No new commitments are being made as a result of this letter. If you have any questions concerning these results, please contact us.

Very truly yours,

A handwritten signature in black ink, appearing to be 'S. P. Sarver', written over a horizontal line.

S. P. Sarver, Director
Nuclear Licensing and Operations Support

cc: U. S. Nuclear Regulatory Commission
Region II
Sam Nunn Atlanta Federal Center
61 Forsyth St., SW, Suite 23T85
Atlanta, GA 30303-8931

Mr. R. A. Musser
NRC Senior Resident Inspector
Surry Power Station