

September 18, 1991

Docket No. 50-368

Mr. Neil S. Carns
Vice President, Operations ANO
Entergy Operations, Inc.
Route 3 Box 137G
Russellville, Arkansas 72801

Dear Mr. Carns:

SUBJECT: ISSUANCE OF AMENDMENT NO. 125 TO FACILITY OPERATING LICENSE
NO. NPF-6 - ARKANSAS NUCLEAR ONE, UNIT NO. 2 (TAC NO. 80121)

The Commission has issued the enclosed Amendment No.125 to Facility Operating License No. NPF-6 for the Arkansas Nuclear One, Unit No. 2 (ANO-2). This amendment consists of changes to the Technical Specifications (TSs) in response to your application dated April 9, 1991, as revised August 30, 1991.

The amendment changes TS 3.1.3.1 and its associated bases to allow continued plant operation for 72 hours for diagnosis and repair, with more than one full length or part length Control Element Assembly (CEA) inoperable due to an electronic or electrical problem in the Control Element Drive Mechanism Control System provided that all affected CEAs remain trippable.

A copy of our related Safety Evaluation is also enclosed. A Notice of Issuance will be included in the Commission's next biweekly Federal Register notice.

Sincerely,

Original signed by

Sheri R. Peterson, Project Manager
Project Directorate IV-1
Division of Reactor Projects III, IV, and V
Office of Nuclear Reactor Regulation

Enclosures:

- 1. Amendment No. 125 to NPF-6
- 2. Safety Evaluation

cc w/enclosures:
See next page

NRC FILE CENTER COPY

DISTRIBUTION:

Docket File	NRC/Local PDR	PD4-1 Reading	S. Peterson (2)
M. Virgilio	T. Quay	P. Noonan	ACRS(10)(MSP315)
OGC(MS15B18)	D. Hagan(MS3206)	G. Hill(4)	RJones(MS8E23)
Wanda Jones(MS7103)	C. Grimes(MS11E22)	PD4-1 Plant File	
GPA/PA(MS2G5)	ARM/LFMB(MS4503)	T. Westerman, RIV	

*See previous concurrence

OFC : PD4-1/LA	: PD4-1/PM	: DRPE/NRR	: *SRXB/NRR	: OGC	: PD4-1/D
NAME : PNoonan	: SPeterson	: CGrimes	: RJones	: JHull	: TQuay
DATE : 9/3/91	: 9/3/91	: 9/6/91	: 06/20/91	: 9/11/91	: 9/18/91

OTSB with comment

OFFICIAL RECORD COPY
Document Name: ANO2 AMEND/80121

OGC concurs based on revisions noted and on checking w/ State + SECT prior to issuance
UF0111

9110020259 910918
PDR ADDCK 0500036B
P PDR

OTSB CONCURRENCE NOTE:

I have concurred in the proposed license amendment because the change is comparable to the requirements approved for other recent plants. During the course of developing the associated model specifications for a generic line-item improvement, the OTSB staff determined that further improvements could be made to eliminate ambiguities associated with the determination of whether immovable rods are trippable, and provide assurance that adequate shutdown margin exists. However, such additional changes would take time to develop and, in my view, may constitute new requirements that should have prior review by the CRGR. Because SRXB has concurred in the proposed license amendment, I have instructed the OTSB staff to pursue the added improvements to these technical specifications in conjunction with the line-item improvement and new standard technical specifications.

CIGuerrier 9/16/91



UNITED STATES
NUCLEAR REGULATORY COMMISSION
WASHINGTON, D. C. 20555

September 18, 1991

Docket No. 50-368

Mr. Neil S. Carns
Vice President, Operations ANO
Entergy Operations, Inc.
Route 3 Box 137G
Russellville, Arkansas 72801

Dear Mr. Carns:

SUBJECT: ISSUANCE OF AMENDMENT NO. 125 TO FACILITY OPERATING LICENSE
NO. NPF-6 - ARKANSAS NUCLEAR ONE, UNIT NO. 2 (TAC NO. 80121)

The Commission has issued the enclosed Amendment No. 125 to Facility Operating License No. NPF-6 for the Arkansas Nuclear One, Unit No. 2 (ANO-2). This amendment consists of changes to the Technical Specifications (TSs) in response to your application dated April 9, 1991, as revised August 30, 1991.

The amendment changes TS 3.1.3.1 and its associated bases to allow continued plant operation for 72 hours for diagnosis and repair, with more than one full length or part length Control Element Assembly (CEA) inoperable due to an electronic or electrical problem in the Control Element Drive Mechanism Control System provided that all affected CEAs remain trippable.

A copy of our related Safety Evaluation is also enclosed. A Notice of Issuance will be included in the Commission's next biweekly Federal Register notice.

Sincerely,

A handwritten signature in cursive script that reads "Sheri R. Peterson".

Sheri R. Peterson, Project Manager
Project Directorate IV-1
Division of Reactor Projects III, IV, and V
Office of Nuclear Reactor Regulation

Enclosures:

1. Amendment No. 125 to NPF-6
2. Safety Evaluation

cc w/enclosures:
See next page

Mr. Neil S. Carns
Entergy Operations, Inc.

Arkansas Nuclear One, Unit 2

cc:

Mr. Donald C. Hintz
Executive Vice President
and Chief Operating Officer
Entergy Operations, Inc.
P. O. Box 31995
Jackson, Mississippi 39286

Mr. Gerald Muench
Vice President Operations Support
Entergy Operations, Inc.
P. O. Box 31995
Jackson, Mississippi 39286

Mr. Jerry Yelverton
Director Nuclear Operations
Arkansas Nuclear One
Route 3 Box 137G
Russellville, Arkansas 72801

Mr. Robert B. McGehee
Wise, Carter, Child & Caraway
P. O. Box 651
Jackson, Mississippi 39205

Mr. Nicholas S. Reynolds
Winston & Strawn
1400 L Street, N.W.
Washington, D.C. 20005-3502

Mr. Charles B. Brinkman, Manager
Washington Nuclear Operations
Combustion Engineering, Inc.
12300 Twinbrook Parkway, Suite 330
Rockville, Maryland 20852

Mr. Robert B. Borsum
Babcock & Wilcox
Nuclear Power Generation Division
1700 Rockville Pike, Suite 525
Rockville, Maryland 20852

Admiral Kinnaird R. McKee, USN (Ret)
Post Office Box 41
Oxford, Maryland 21654

Senior Resident Inspector
U.S. Nuclear Regulatory Commission
1 Nuclear Plant Road
Russellville, Arkansas 72801

Mr. Tom Nickels
Arkansas Nuclear One
Route 3, Box 137G
Russellville, Arkansas 72801

Regional Administrator, Region IV
U.S. Nuclear Regulatory Commission
Office of Executive Director
for Operations
611 Ryan Plaza Drive, Suite 1000
Arlington, Texas 76011

Honorable Joe W. Phillips
County Judge of Pope County
Pope County Courthouse
Russellville, Arkansas 72801

Ms. Greta Dicus, Director
Division of Environmental Health
Protection
Arkansas Department of Health
4815 West Markam Street
Little Rock, Arkansas 72201



UNITED STATES
NUCLEAR REGULATORY COMMISSION
WASHINGTON, D. C. 20555

ENERGY OPERATIONS, INC.

DOCKET NO. 50-368

ARKANSAS NUCLEAR ONE, UNIT NO. 2

AMENDMENT TO FACILITY OPERATING LICENSE

Amendment No. 125
License No. NPF-6

1. The Nuclear Regulatory Commission (the Commission) has found that:
 - A. The application for amendment by Entergy Operations, Inc. (the licensee) dated April 9, 1991, as revised August 30, 1991, complies with the standards and requirements of the Atomic Energy Act of 1954, as amended (the Act), and the Commission's rules and regulations set forth in 10 CFR Chapter I;
 - B. The facility will operate in conformity with the application, the provisions of the Act, and the rules and regulations of the Commission;
 - C. There is reasonable assurance: (i) that the activities authorized by this amendment can be conducted without endangering the health and safety of the public, and (ii) that such activities will be conducted in compliance with the Commission's regulations;
 - D. The issuance of this license amendment will not be inimical to the common defense and security or to the health and safety of the public; and
 - E. The issuance of this amendment is in accordance with 10 CFR Part 51 of the Commission's regulations and all applicable requirements have been satisfied.


2. Accordingly, the license is amended by changes to the Technical Specifications as indicated in the attachment to this license amendment, and Paragraph 2.C.(2) of Facility Operating License No. NPF-6 is hereby amended to read as follows:

2. Technical Specifications

The Technical Specifications contained in Appendix A, as revised through Amendment No. 125, are hereby incorporated in the license. The licensee shall operate the facility in accordance with the Technical Specifications.

3. The license amendment is effective as of its date of issuance.

FOR THE NUCLEAR REGULATORY COMMISSION

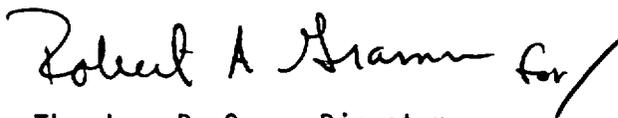

Theodore R. Quay, Director
Project Directorate IV-1
Division of Reactor Projects III, IV, and V
Office of Nuclear Reactor Regulation

Attachment:
Changes to the Technical
Specifications

Date of Issuance: September 18, 1991

ATTACHMENT TO LICENSE AMENDMENT NO. 125

FACILITY OPERATING LICENSE NO. NPF-6

DOCKET NO. 50-368

Revise the following pages of the Appendix "A" Technical Specifications with the attached pages. The revised pages are identified by Amendment number and contain vertical lines indicating the area of change. The corresponding overleaf pages are also provided to maintain document completeness.

REMOVE PAGES

3/4 1-17
3/4 1-18
3/4 1-19
B 3/4 1-3
B 3/4 1-4

INSERT PAGES

3/4 1-17
3/4 1-18
3/4 1-19
B 3/4 1-3
B 3/4 1-4

REACTIVITY CONTROL SYSTEMS

3/4.1.3 MOVABLE CONTROL ASSEMBLIES

CEA POSITION

LIMITING CONDITION FOR OPERATION

3.1.3.1 All full length (shutdown and regulating) CEAs, and all part length CEAs which are inserted in the core, shall be OPERABLE with each CEA of a given group positioned within 7 inches (indicated position) of all other CEAs in its group.

APPLICABILITY: MODES 1* and 2*.

ACTION:

- a. With one or more full length CEAs inoperable due to being immovable as a result of excessive friction or mechanical interference or known to be untrippable, determine that the SHUTDOWN MARGIN requirement of Specification 3.1.1.1 is satisfied within 1 hour and be in at least HOT STANDBY within 6 hours.
- b. With one full length CEA trippable but inoperable due to causes other than addressed by ACTION a, above, and inserted beyond the Long Term Steady State Insertion Limits but within its above specified alignment requirements, operation in MODES 1 and 2 may continue pursuant to the requirements of Specification 3.1.3.6.
- c. With one full length CEA trippable but inoperable due to causes other than addressed by ACTION a, above, but within its above specified alignment requirements and either fully withdrawn or within the Long Term Steady State Insertion Limits if in full length CEA group 6, operation MODES 1 and 2 may continue.
- d. With more than one full length or part length CEA trippable but inoperable due to causes other than addressed by ACTION a, above, restore the inoperable CEA(s) to OPERABLE status within 72 hours, or be in at least HOT STANDBY within the next 6 hours.
- e. With one or more full length or part length CEAs trippable but misaligned from any other CEAs in its group by more than 7 inches but less than or equal to 19 inches, operation in MODES 1 and 2 may continue, provided that core power is reduced in accordance with Figure 3.1-1A and within 1 hour the misaligned CEA(s) is either:
 1. Restored to OPERABLE status within its above specified alignment requirements, or

*See Special Test Exceptions 3.10.2 and 3.10.4.

REACTIVITY CONTROL SYSTEMS

ACTION: (Continued)

2. Declared inoperable and the SHUTDOWN MARGIN requirement of Specification 3.1.1.1 is satisfied. After declaring the CEA inoperable, operation in MODES 1 and 2 may continue pursuant to the requirements of Specification 3.1.3.6 provided:

- a) Within one hour the remainder of the CEAs in the group with the inoperable CEA shall be aligned to within 7 inches of the inoperable CEA while maintaining the allowable CEA sequence and insertion limits shown on Figure 3.1-2; the THERMAL POWER level shall be restricted pursuant to Specification 3.1.3.6 during subsequent operation.
- b) The SHUTDOWN MARGIN requirement of Specification 3.1.1.1 is determined at least once per 12 hours.

Otherwise, be in at least HOT STANDBY within the next 6 hours.

- f. With one full length or part length CEA trippable but misaligned from any other CEA in its group by more than 19 inches, operation in MODES 1 and 2 may continue, provided that core power is reduced in accordance with Figure 3.1-1A and within one hour, the misaligned CEA is either:

1. Restored to OPERABLE status within its above specified alignment requirements, or
2. Declared inoperable and the SHUTDOWN MARGIN requirement of Specification 3.1.1.1 is satisfied. After declaring the CEA inoperable, operation in MODES 1 and 2 may continue pursuant to the requirements of Specification 3.1.3.6 provided:

- a) Within one hour the remainder of the CEAs in the group with the inoperable CEA shall be aligned to within 7 inches of the inoperable CEA while maintaining the allowable CEA sequence and insertion limits shown on Figure 3.1-2; the THERMAL POWER level shall be restricted pursuant to Specification 3.1.3.6 during subsequent operation.
- b) The SHUTDOWN MARGIN requirement of Specification 3.1.1.1 is determined at least once per 12 hours.

Otherwise, be in at least HOT STANDBY within the next 6 hours.

REACTIVITY CONTROL SYSTEMS

ACTION: (Continued)

- g. With one part length CEA inoperable and inserted in the core, operation may continue provided the alignment of the inoperable PLCEA is maintained within 7 inches (indicated position) of all other PLCEAs in its group.
- h. With more than one full length or part length CEA trippable but misaligned from any other CEA in its group by more than 19 inches (indicated position), be in at least HOT STANDBY within 6 hours.

SURVEILLANCE REQUIREMENTS

4.1.3.1.1 The position of each full length and part length CEA shall be determined to be within 7 inches (indicated position) of all other CEAs in its group at least once per 12 hours.

4.1.3.1.2 Each full length CEA not fully inserted and each part length CEA which is inserted in the core shall be determined to be OPERABLE by movement of at least 5 inches in any one direction at least once per 31 days.

REACTIVITY CONTROL SYSTEMS

ACTION: (Continued)

- g. With one part length CEA inoperable and inserted in the core, operation may continue provided the alignment of the inoperable PLCEA is maintained within 7 inches (indicated position) of all other PLCEAs in its group.
- h. With more than one full length or part length CEA trippable but misaligned from any other CEA in its group by more than 19 inches (indicated position), be in at least HOT STANDBY within 6 hours.

SURVEILLANCE REQUIREMENTS

4.1.3.1.1 The position of each full length and part length CEA shall be determined to be within 7 inches (indicated position) of all other CEAs in its group at least once per 12 hours.

4.1.3.1.2 Each full length CEA not fully inserted and each part length CEA which is inserted in the core shall be determined to be OPERABLE by movement of at least 5 inches in any one direction at least once per 31 days.

REACTIVITY CONTROL SYSTEMS

BASES

The boron capability required below 200°F is based upon providing a 5% $\Delta k/k$ SHUTDOWN MARGIN after xenon decay and cooldown from 200°F to 140°F. This condition requires either borated water from the refueling water tank or boric acid solution from the boric acid makeup tank(s) in accordance with the requirements of Specification 3.1.2.7.

The contained water volume limits includes allowance for water not available because of discharge line location and other physical characteristics. The 61,370 gallon limit for the refueling water tank is based upon having an indicated level in the tank of at least 7.5%.

The OPERABILITY of one boron injection system during REFUELING ensures that this system is available for reactivity control while in MODE 6.

The limits on contained water volume and boron concentration of the RWT also ensure a pH value of between 8.8 and 11.0 for the solution recirculated within containment after a LOCA. This pH band minimizes the evolution of iodine and minimizes the effect of chloride and caustic stress corrosion on mechanical systems and components.

3/4.1.3 MOVABLE CONTROL ASSEMBLIES

The specifications of this section ensure that (1) acceptable power distribution limits are maintained, (2) the minimum SHUTDOWN MARGIN is maintained, and (3) the potential effects of CEA misalignments are limited to acceptable levels.

The ACTION statements which permit limited variations from the basic requirements are accompanied by additional restrictions which ensure that the original design criteria are met.

The ACTION statements applicable to a stuck or untrippable CEA or a large misalignment (≥ 19 inches) of two or more CEAs, require a prompt shutdown of the reactor since either of these conditions may be indicative of a possible loss of mechanical functional capability of the CEAs and in the event of a stuck or untrippable CEA, the loss of SHUTDOWN MARGIN. CEAs that are confirmed to be inoperable due to problems other than addressed by ACTION a of Specification 3.1.3.1 will not impact SHUTDOWN MARGIN as long as their relative positions satisfy the applicable alignment requirements.

For small misalignments (< 19 inches) of the CEAs, there is 1) a small effect on the time dependent long term power distributions relative to those used in generating LCOs and LSSS setpoints, 2) a small effect on the available SHUTDOWN MARGIN, and 3) a small effect on the ejected CEA worth used in the safety analysis. Therefore, the ACTION

REACTIVITY CONTROL SYSTEMS

BASES

statement associated with trippable but small misalignments of CEAs permits a one hour time interval during which attempts may be made to restore the CEA to within its alignment requirements. The one hour time limit is sufficient to (1) identify causes of a misaligned CEA, (2) take appropriate corrective action to realign the CEAs and (3) minimize the effects of xenon redistribution. Problems may also cause more than one control rod to be immovable where the control rods continue to be trippable. With trippable but multiple inoperable rods; the alignment limits and the restriction on THERMAL POWER in accordance with the provisions of Specification 3.1.3.6 for insertion limits, assures fuel rod integrity during continued operation. These provisions are sufficient to allow 72 hours to restore the inoperable rods to operable status when it is confirmed that the cause of the immovable rod is an electrical problem in the rod control system or an electrical or mechanical problem with the rod stepping mechanism exclusive of the rod holding coil that must function for a reactor trip. In such cases, the control rods will continue to be capable of fulfilling their primary safety function.

The CPCs provide protection to the core in the event of a large misalignment (≥ 19 inches) of a CEA by applying appropriate penalty factors to the calculation to account for the misaligned CEA. However, this misalignment would cause distortion of the core power distribution. This distribution may, in turn, have a significant effect on 1) the available SHUTDOWN MARGIN, 2) the time dependent long term power distributions relative to those used in generating LCOs and LSSS setpoints, and 3) the ejected CEA worth used in the safety analysis. Therefore, the ACTION statement associated with the large misalignment of a CEA requires a prompt realignment of the misaligned CEA.

The ACTION statements applicable to trippable but misaligned or inoperable CEAs include requirements to align the OPERABLE CEAs in a given group with the inoperable CEA. Conformance with these alignment requirements brings the core, within a short period of time, to a configuration consistent with that assumed in generating LCO and LSSS setpoints. However, extended operation with CEAs significantly inserted in the core may lead to perturbations in 1) local burnup, 2) peaking factors and 3) available SHUTDOWN MARGIN which are more adverse than the conditions assumed to exist in the safety analyses and LCO and LSSS setpoints determination. Therefore, time limits have been imposed on operation with inoperable CEAs to preclude such adverse conditions from developing.

Operability of at least two CEA position indicator channels is required to determine CEA positions and thereby ensure compliance with the CEA alignment and insertion limits. The CEA "Full In" and "Full Out" limits provide an additional independent means for determining the CEA positions when the CEAs are at either their fully inserted or fully withdrawn positions. Therefore, the ACTION statements applicable to inoperable CEA position indicators permit continued operations when the positions of CEAs with inoperable position indicators can be verified by the "Full In" or "Full Out" limits.

Therefore, the staff finds the Technical Specification proposed changes to be acceptable.

3.0 STATE CONSULTATION

In accordance with the Commission's regulations, the Arkansas State official was notified of the proposed issuance of the amendment. The State official had no comments.

4.0 ENVIRONMENTAL CONSIDERATION

The amendment changes a requirement with respect to installation or use of a facility component located within the restricted area as defined in 10 CFR Part 20. The NRC staff has determined that the amendment involves no significant increase in the amounts, and no significant change in the types, of any effluents that may be released offsite, and that there is no significant increase in individual or cumulative occupational radiation exposure. The Commission has previously issued a proposed finding that the amendment involves no significant hazards consideration, and there has been no public comment on such finding (56 FR 27043). Accordingly, the amendment meets the eligibility criteria for categorical exclusion set forth in 10 CFR 51.22(c)(9). Pursuant to 10 CFR 51.22(b) no environmental impact statement or environmental assessment need be prepared in connection with the issuance of the amendment.

5.0 CONCLUSION

The Commission has concluded, based on the considerations discussed above, that: (1) there is reasonable assurance that the health and safety of the public will not be endangered by operation in the proposed manner, (2) such activities will be conducted in compliance with the Commission's regulations, and (3) the issuance of the amendment will not be inimical to the common defense and security or to the health and safety of the public.

Principal Contributor: S. Peterson

Date: September 18, 1991