

**From:** "Jones, T. R." <tjones2@entergy.com>  
**To:** "James Noggle" <JDN@nrc.gov>  
**Date:** 10/27/05 8:30AM  
**Subject:** FW: NRC Requested Information

---

From: Lavera, Ron  
Sent: Wednesday, October 26, 2005 4:39 PM  
To: Jones, T. R.; Axelson, William L  
Subject: NRC Requested Information

Mr. Jones

Attached is a copy of the sample log sheet for YOU to pass along to the NRC.

My understanding is that information passed to the NRC is supposed to be going through you.

Thanks

Ron

<<FSB\_Sample\_Log.xls>>

RLaVera@entergy.com <mailto:RLaVera@entergy.com>  
914-736-8433  
914-736-8419 FAX  
Indian Point 3  
Entergy Nuclear Northeast  
Entergy Nuclear Operations, Inc.  
Indian Point Energy Center  
295 Broadway, Suite 3  
P.O. Box 308  
Buchanan, NY 10511-0308

Information in this record was deleted  
in accordance with the Freedom of Information  
Act, exemptions 4  
FOIA- 2006-0019


B/8

<u>Date</u>	<u>Sample of Hole Drilled in North</u> <u>FSB Wall</u>	<u>pH</u>	<u>Co-60 uCi/gm</u>	<u>Cs-134uCi/gm</u>
09/07/05	(1) Base line	11.74	ND	ND
09/07/05	(2) First 2"	10.7	8.31E-05	2.65E-05
09/07/05	(3) Second 2"	11.46	4.04E-05	1.39E-05
09/07/05	(4) Third 2"	11.75	1.02E-05	ND
09/07/05	(5) Fourth 2"	11.79	ND	ND


Exempt 4

<b>Cs-137 uCi/gm</b>	<b>Iron ppm leachate</b>	<b>Boron-ppm leachate</b>
ND	96	159
1.65E-03	628	72
8.46E-04	640	56
1.27E-04	3285	28
1.75E-05	60	226


### FSB Crack Water Activity

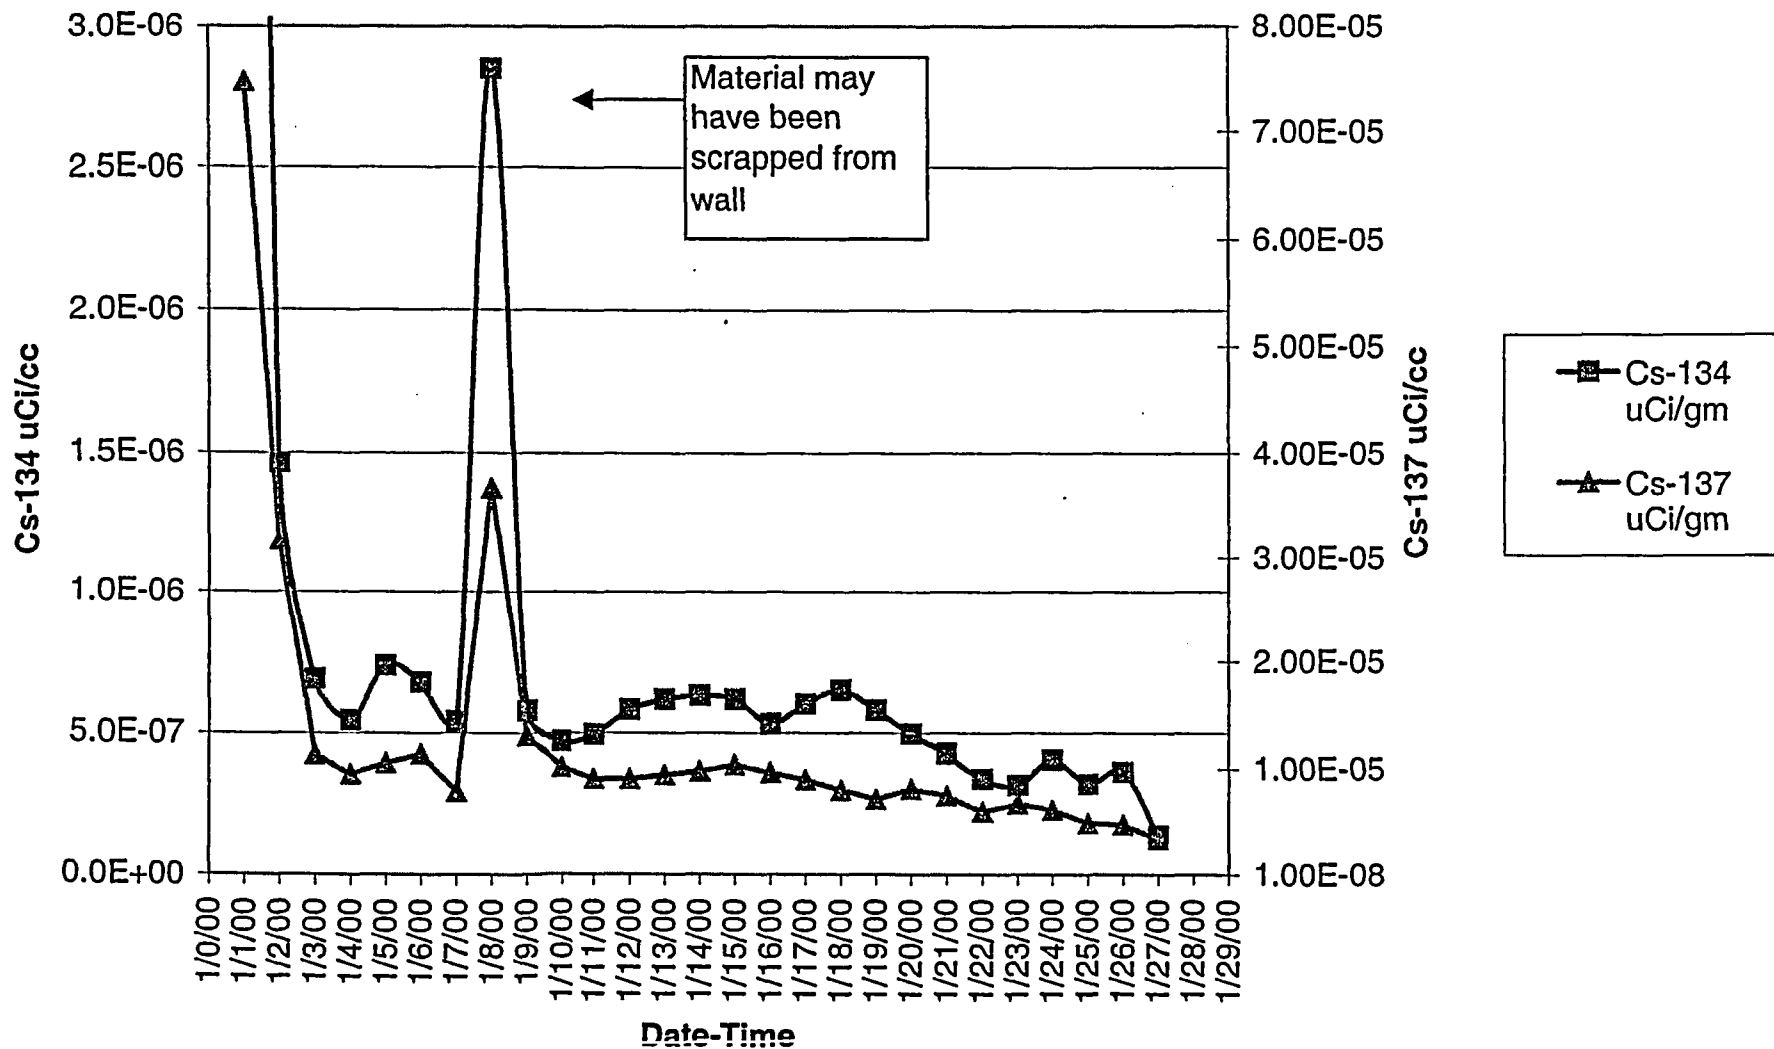

### FSB Crack Water Activity

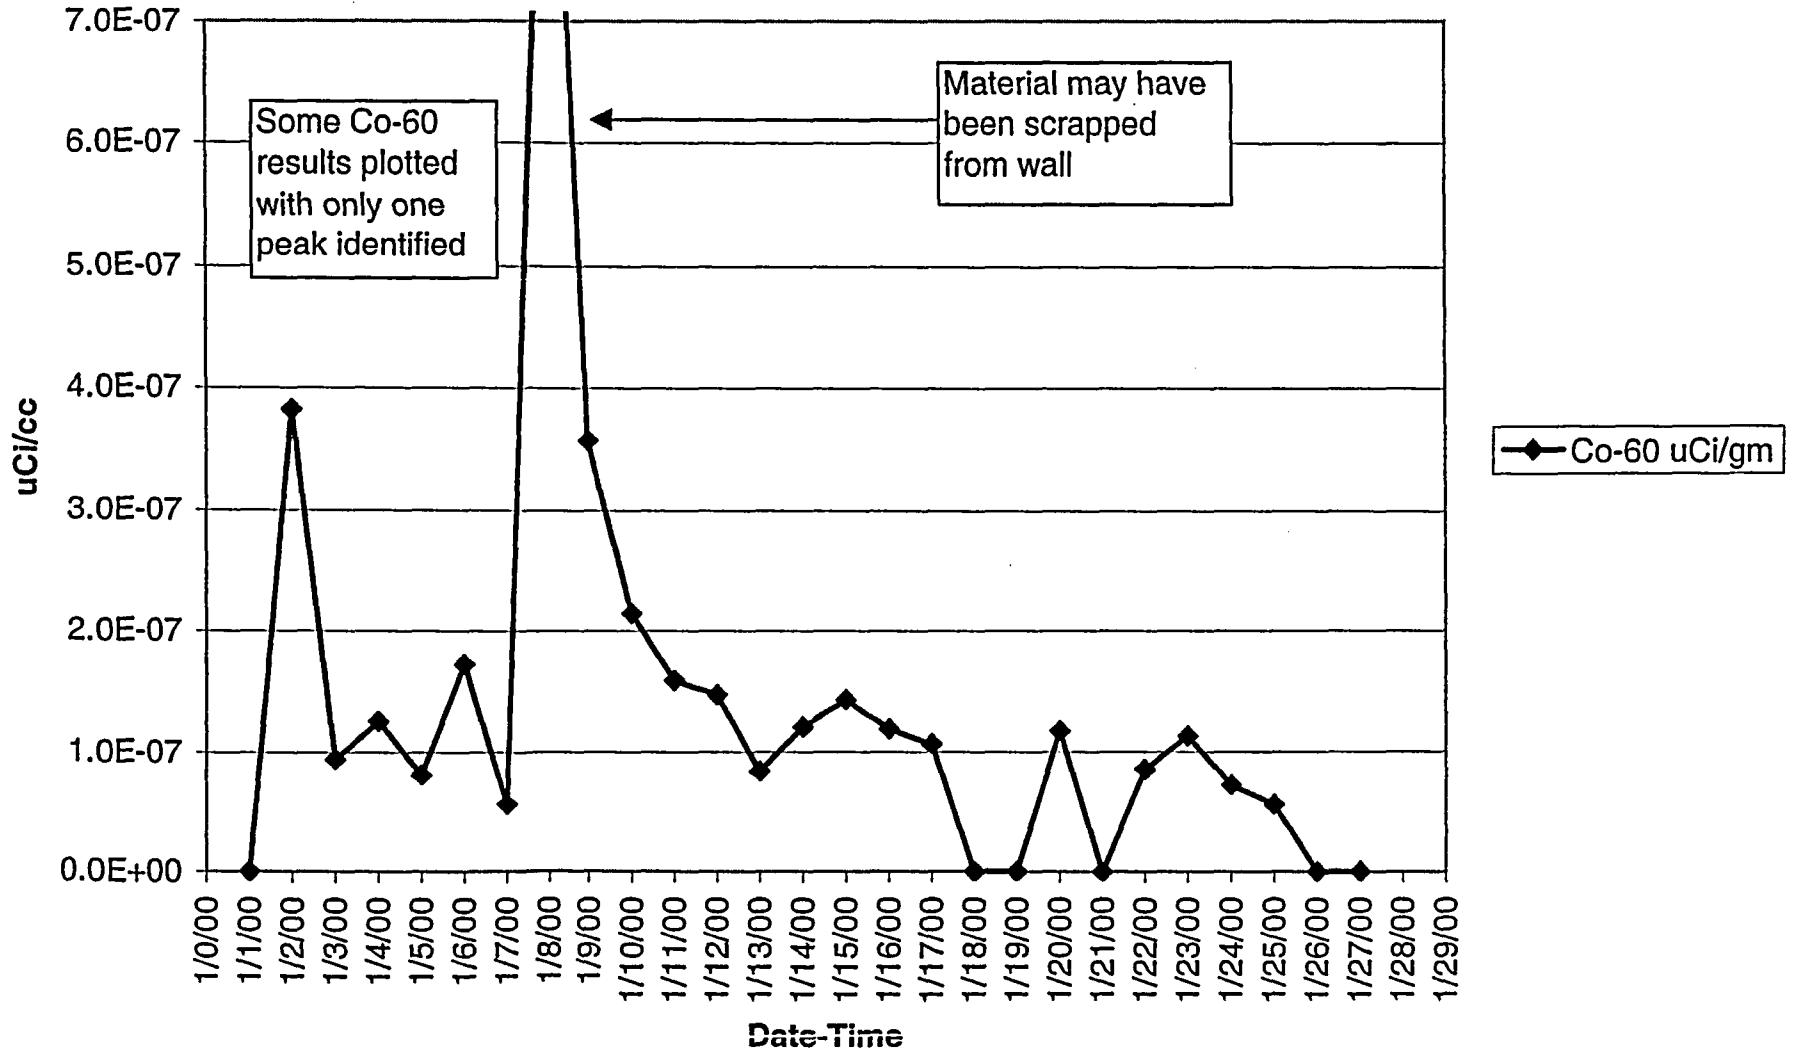


### FSB Crack Water Activity

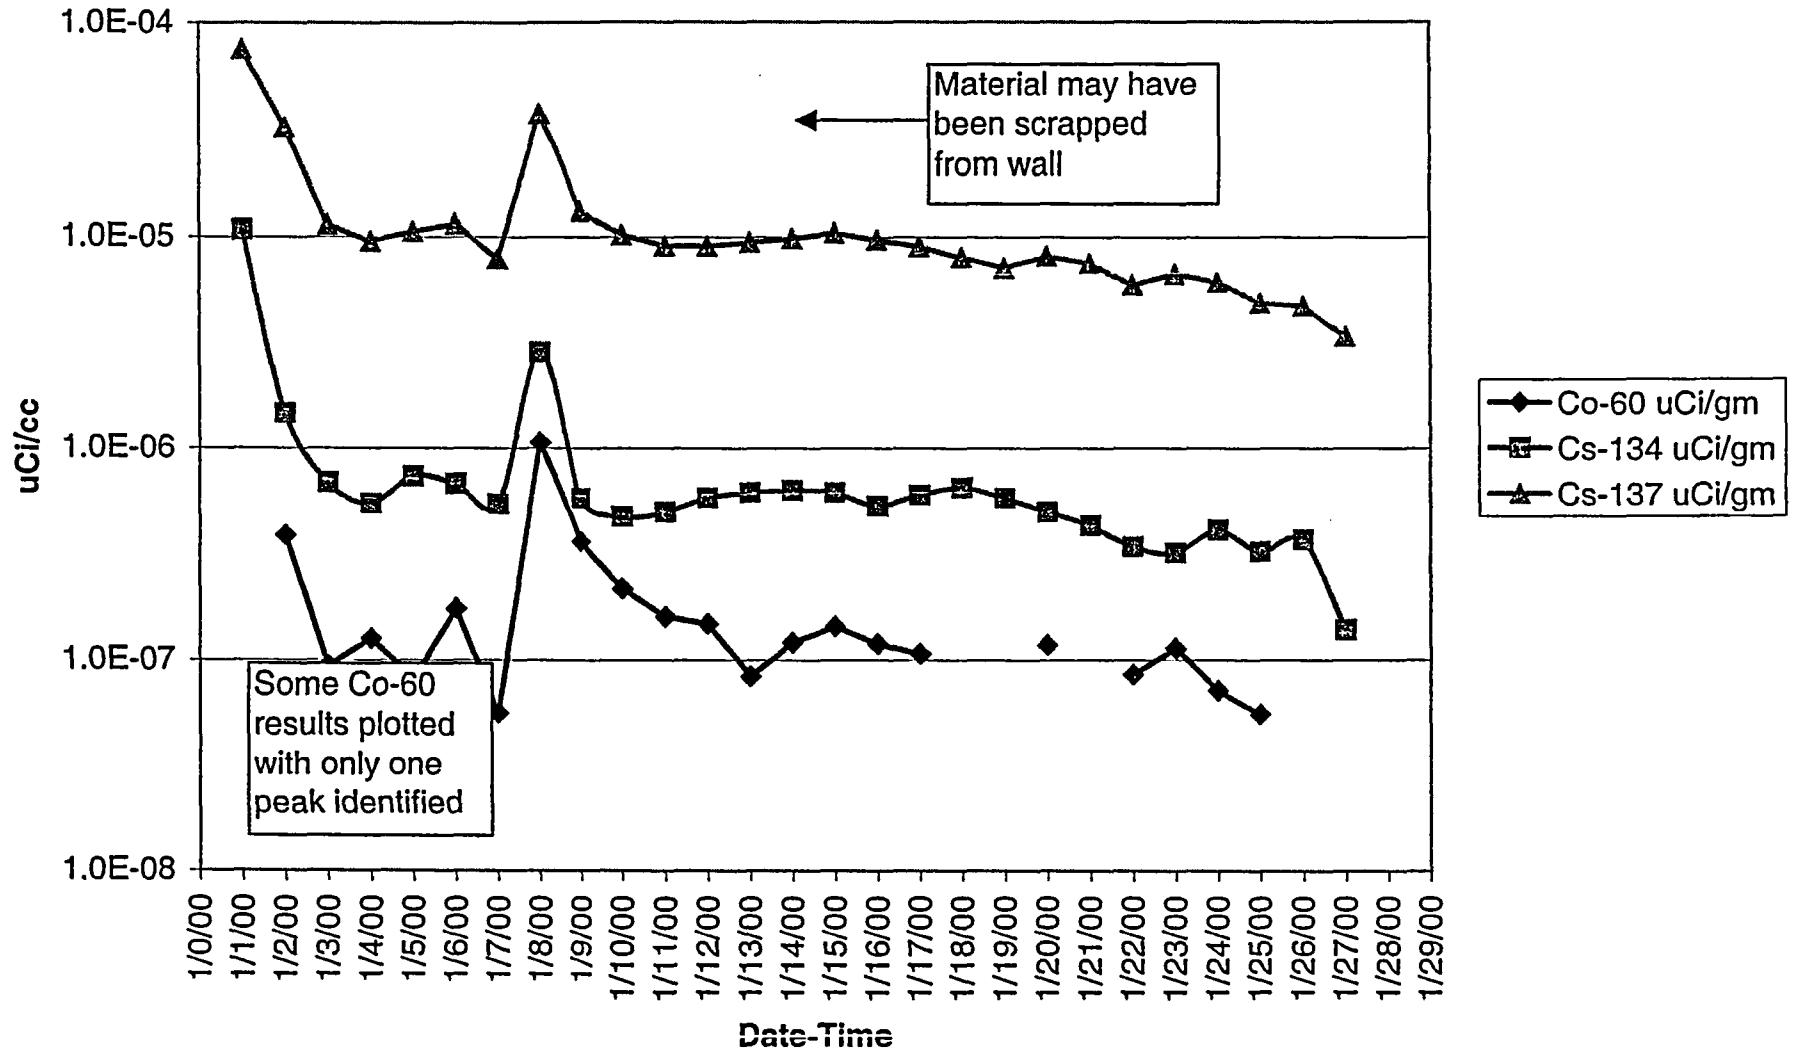


Collection  
may have  
included

### FSB Crack Water Boron

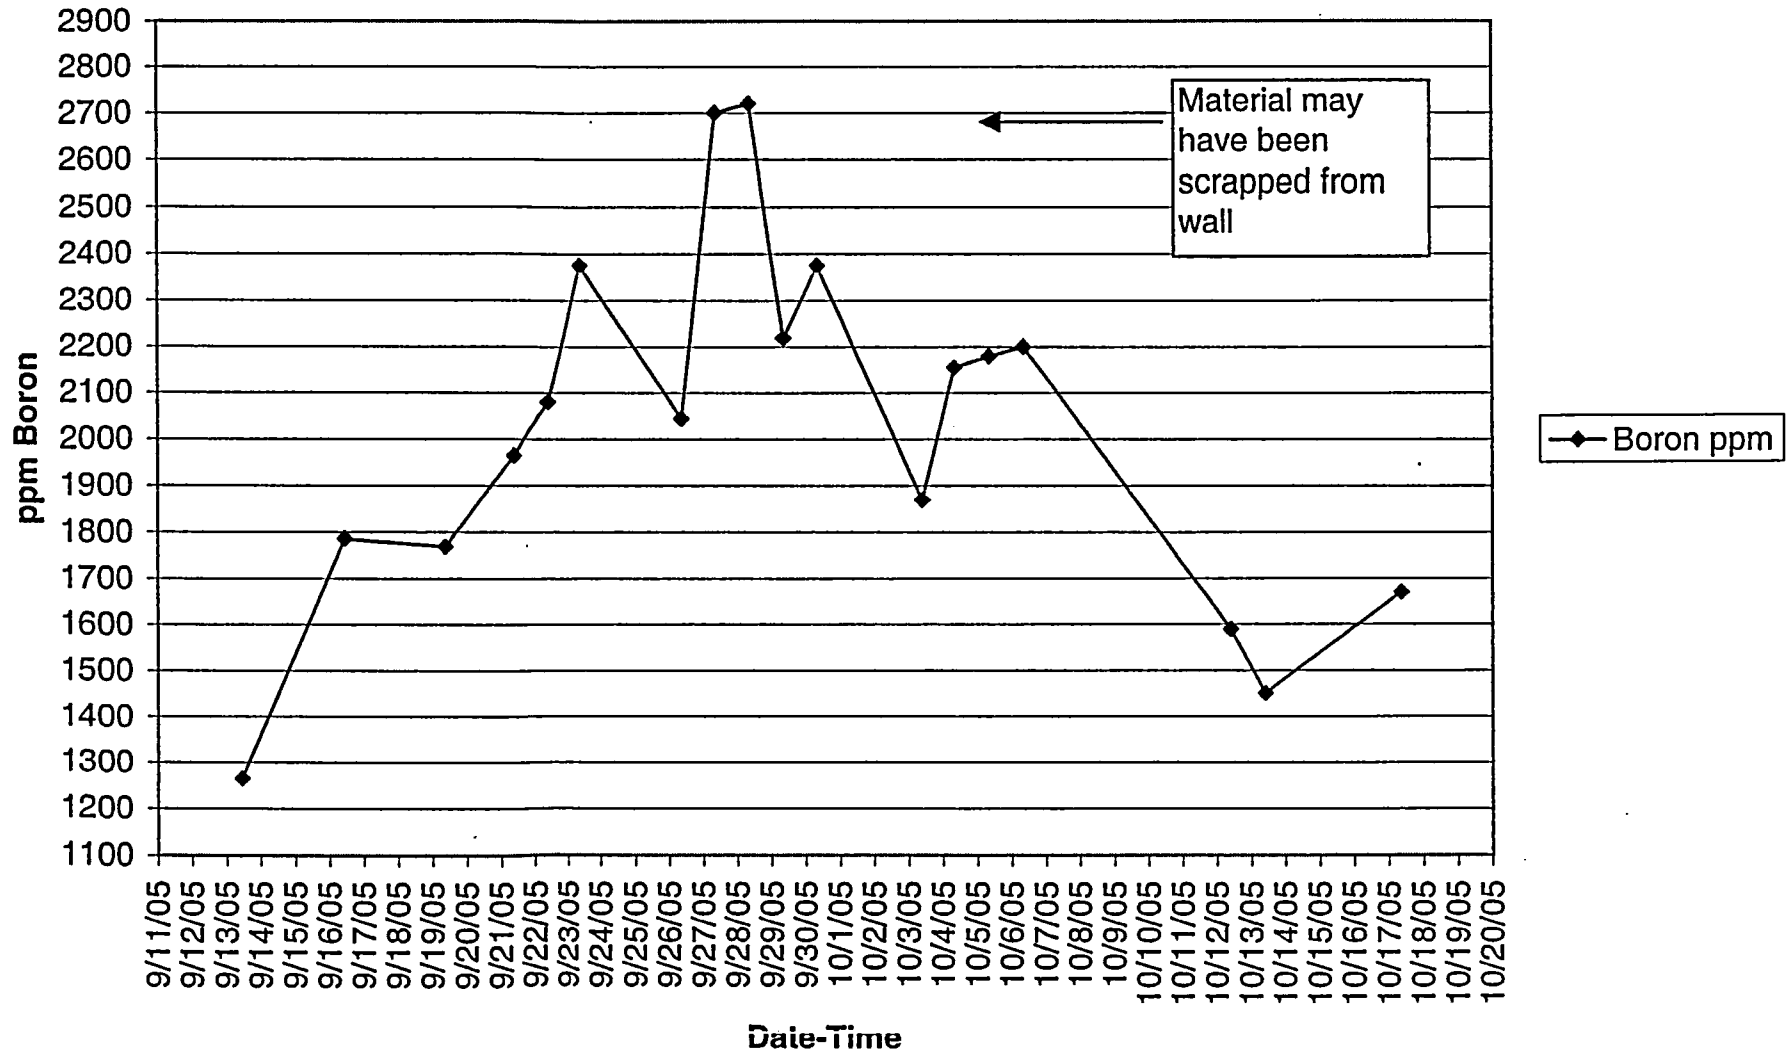


### FSB Crack Water Tritium Activity

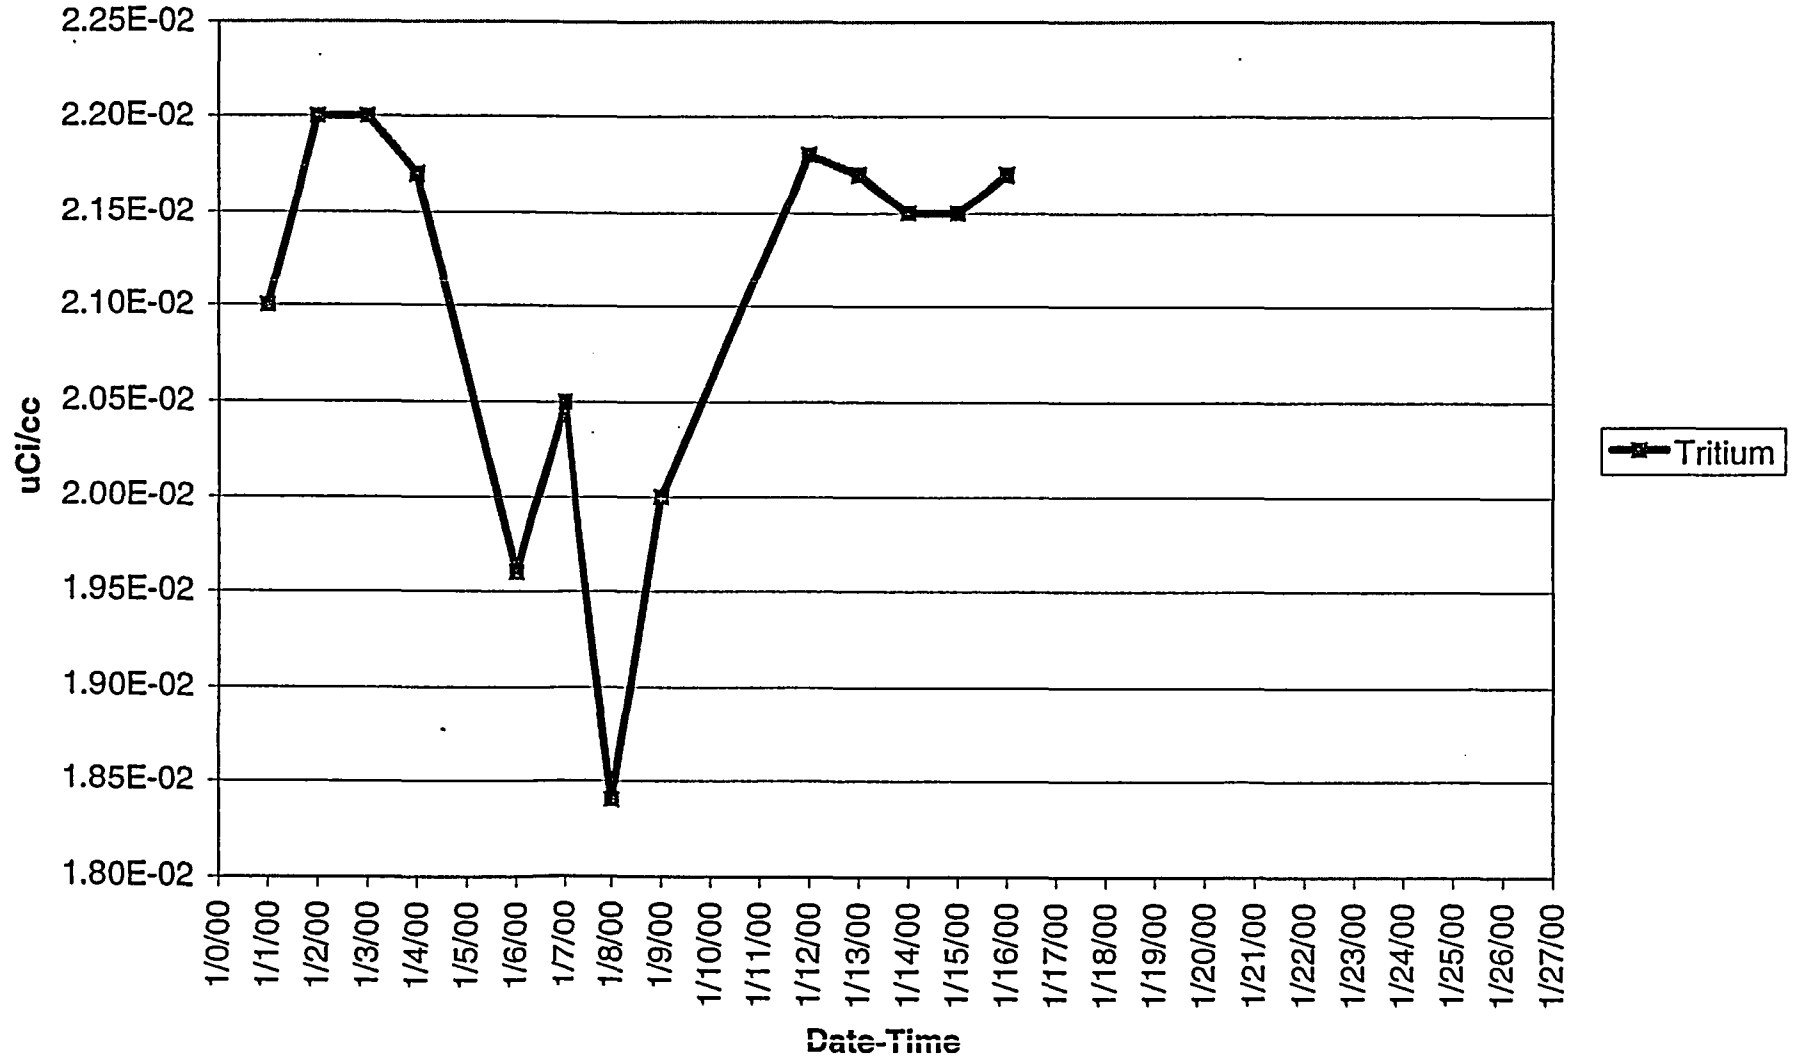





### FSB Crack Water Cs-137/Cs-134 Ratio

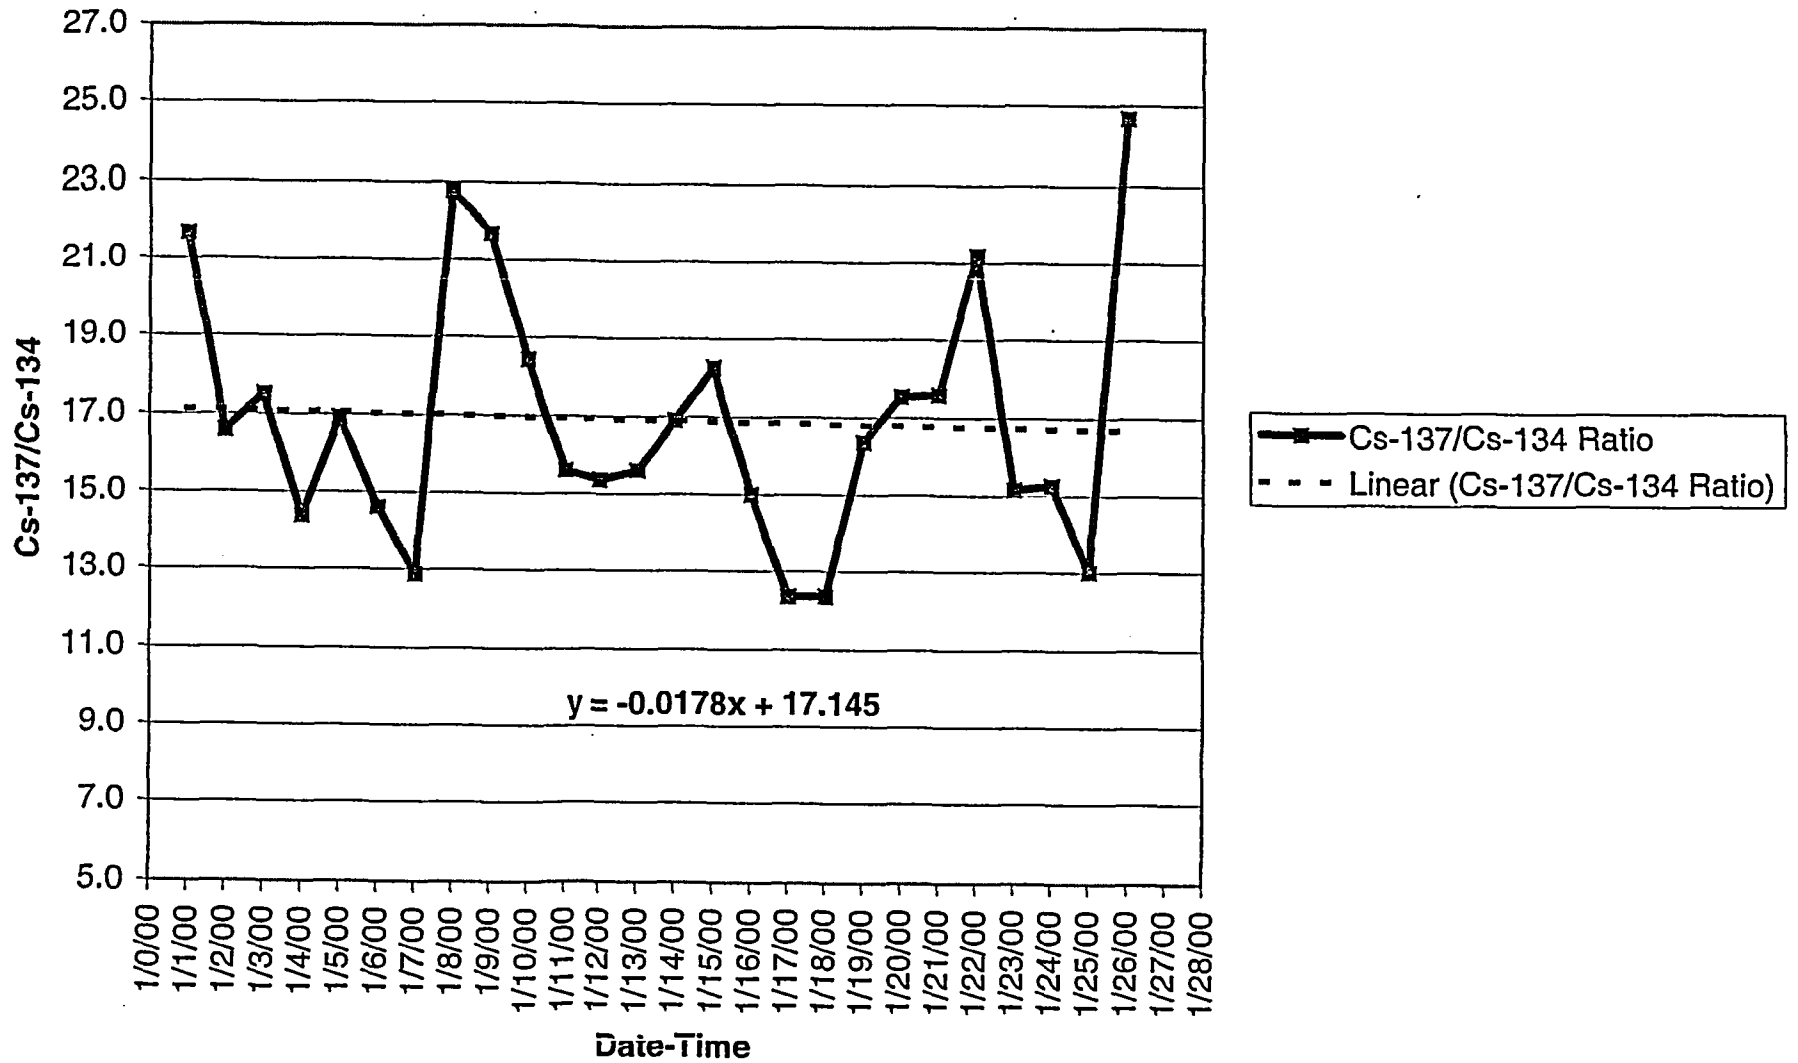

### FSB Crack Water Apparent Age

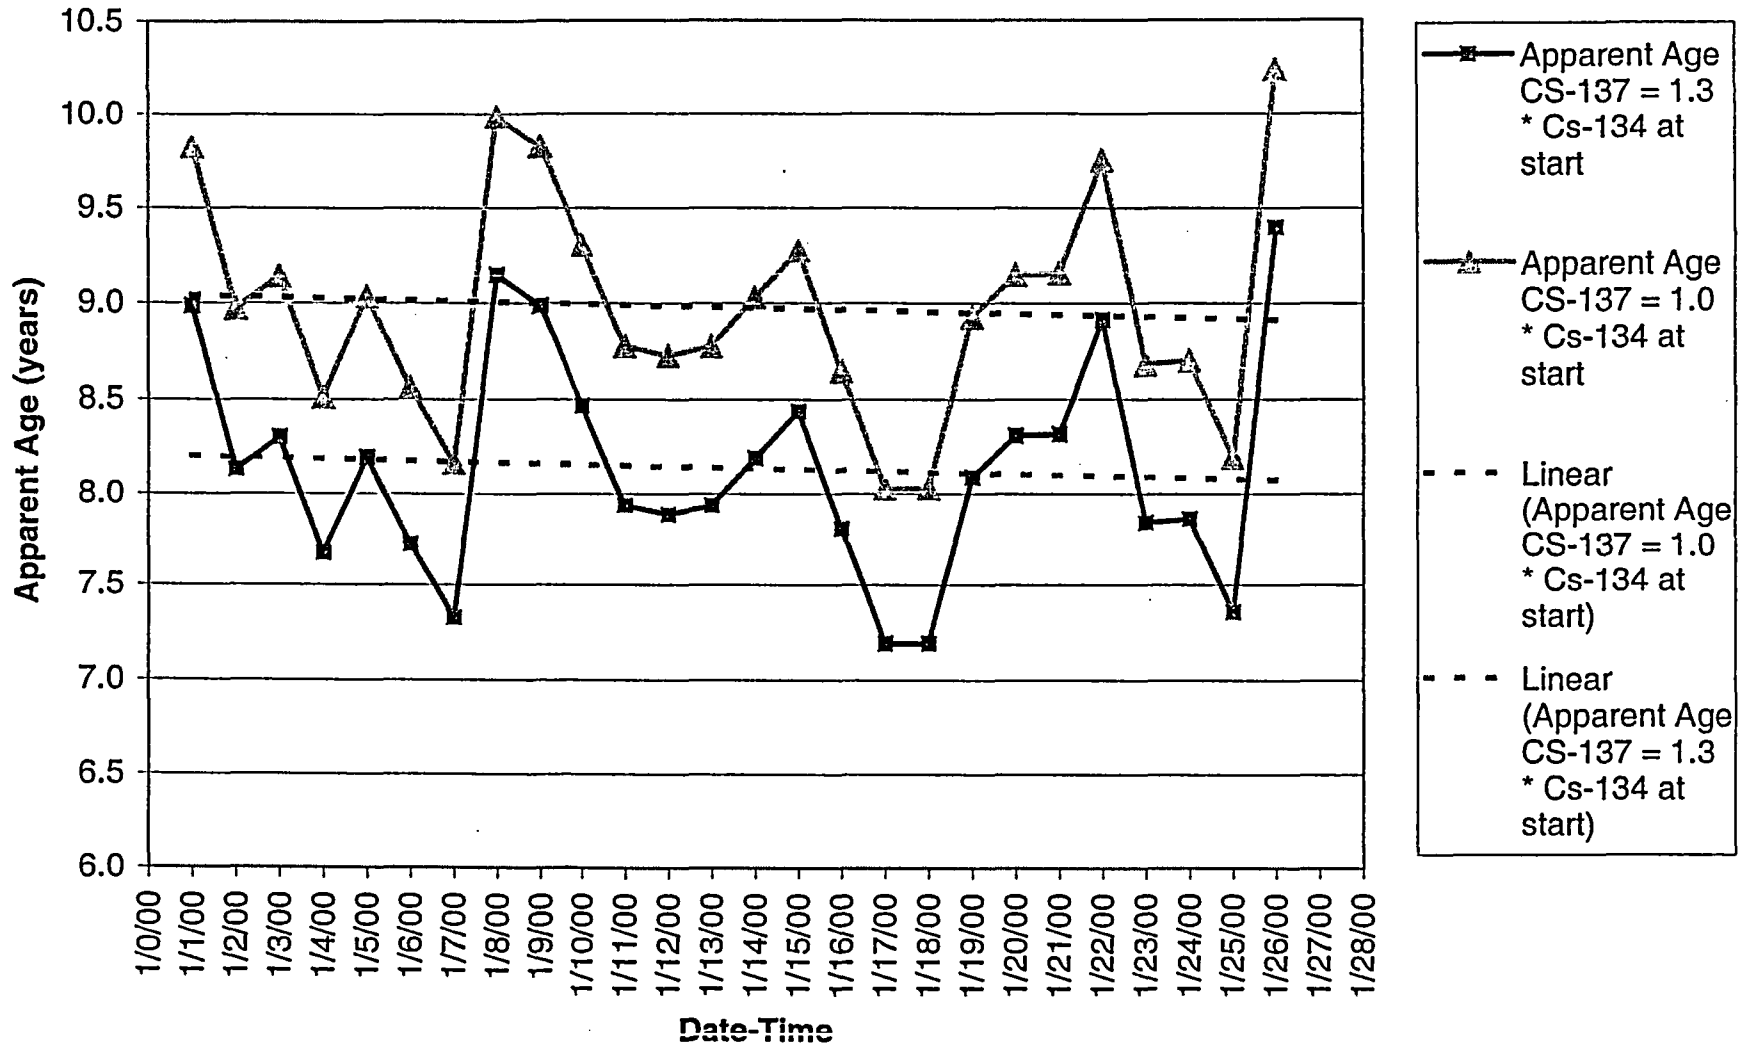

### FSB Crack Leakage Collection Rate Li/Day

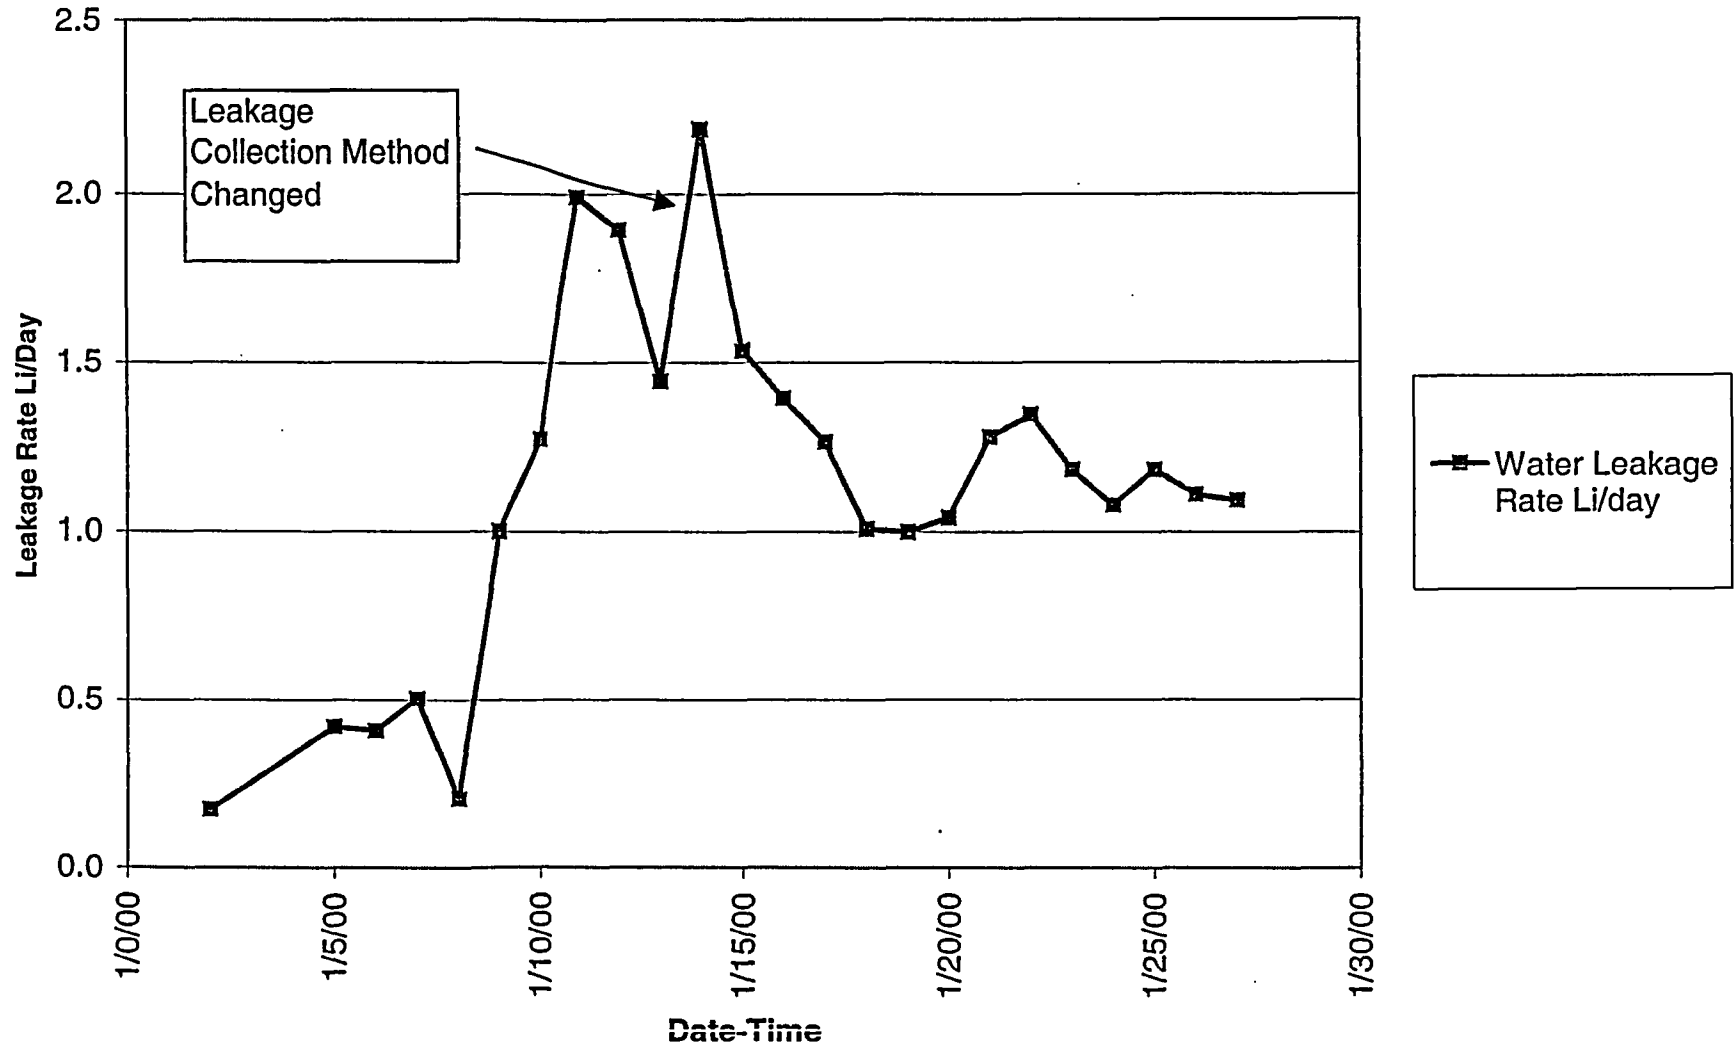

# MW-111 Tritium

