Recommendation:

Strengthen corrective measures to improve the timeliness of material procurement. Consider timely implementation of Nuclear Power Procurement Problems Task Force recommendations and the NSRS report R-84-17-NPS recommendations.

K. CONTROL AND CALIBRATION OF MEASURING AND TEST EQUIPMENT

No findings were noted in this area at any of the sites.

L. MAINTENANCE TOOLS AND EQUIPMENT CONTROLS

Finding L-1

<u>Good Practice: At WBN, a computerized real-time inventory</u> <u>control system has been implemented as an interim correction for</u> <u>identified deficiencies in tracking main tool room inventories</u>. This system has elements which identify the current inventory, the number of tools permanently issued, the number of tools temporarily issued, and reorder points. No problems with availability of tools and equipment from the main tool room were noted during observations.

Finding L-2

At BFN and SQN, the inventory and accountability mechanisms for maintenance tools and equipment do not provide adequate control. As a result, tools and equipment are sometimes unavailable to the craft performing work, and replacement costs are high. At BFN, no inventories are maintained of tools awaiting decontamination or in hot tool storage. At BFN and SQN, some tools confiscated for decontamination are not properly recorded in the tool accountability system. Tools returned by persons other than those who checked them out are also not properly recorded. Current inventories are not maintained in any of the tool rooms. This finding does not apply to tagged tools such as serialized measuring and test equipment. All plants reported that they have initiated plans to install computerized bar code inventory and accountability systems; however, these systems have not been approved.

Recommendation:

Establish and implement uniform methods for inventory and accountability of small tools and equipment at each of the situs to correct the problems noted. Consider implementation of the computerized bar code system. Include in the system real time inventory and accountability for persons and places such as the hot tool room and the decontamination facility.

Finding L-3

At BFN, defective rigging and electric hand tools are not repaired and returned to service in a timely manner. Several barrels of defective rigging and electric hand tools were observed in the outage tool room and hot tool storage areas. Some of the tags on this equipment indicated the defects had existed for nine months.

Recommendation:

Repair defective rigging equipment and electric hand tools promptly to reduce the need for large inventories. Consider assigning responsibility for inspection, repair, replacement, and disposal of rigging equipment and electric hand tools to a dedicated group of workers.

Finding L-4

At BFN, rigging tagged as defective was not segregated from acceptable rigging. This practice could lead to the use of defective rigging if the tag was separated from the item.

Recommendation:

Segregate defective rigging from serviceable rigging and clearly label each storage location.

M. MANAGEMENT INVOLVEMENT

Finding M-1

6

The involvement of maintenance management and supervision in ongoing maintenance activities needs to be strengthened. Most managers and supervisors recognized the value of increased field involvement with maintenance activities, but meetings, administrative duties, and emergent problems were often permitted to interfere. Efforts toward improvement were noted at all three sites.

Browns Ferry

Foremen were at the worksite for some time during most of the activities observed. Higher level supervisory presence was minimal, but appeared to increase during the review period. One of the goals of shifting to the unit organization was to increase supervisory involvement in maintenance activities. Since unitization had begun only two months carlier it was too early to judge its effectiveness.

Although supervision was observed at the work sites, their attention appeared to be focused on the task at hand and housekeeping, safety, or equipment problems in adjacent areas went uncorrected. Upper management stated additional effort had begun to correct that problem and improve housekeeping standards.

Sequoyah

Foremen were at the worksite for some activities, but there was little presence of higher level supervision. Particular interferences cited by managers were emergent problems, administrative duties, and the number/duration of meetings. Some reported management actions to help free line management include limiting meeting attendees to minimize impact on line supervisors, establishing additional positions to perform administrative functions in the craft sections, and establishing positions on the maintenance superintendent's staff to help deal with multi-disciplined and generic site needs such as maintenance program improvements.

Watts Bar

Foremen were at the worksites at some point during most of the activities observed and higher level supervision was present during some of those.

From observations and follow-up interviews with supervisors, there appeared to be a positive attitude toward increased involvement by supervisors in daily activities. Management coaching, establishment of the planning positions, and the personal initiative of foremen have contributed to the present high level of foremen involvement in the field. However, the number and duration of meetings, administrative duties and emergent problems have adversely impacted group and engineering section supervisors' involvement, particularly in electrical maintenance. Reported management actions to help free line management include the issuance of a letter by the plant manager setting aside time blocks which are unavailable for regularly scheduled meetings and establishment of the planning group. Additionally, the maintenance superintendent had the flexibility to establish additional craft supervisory positions as warranted and staff positions to help deal with multi-disciplined or generic maintenance issues.

Recommendation:

Develop and implement stronger actions to increase management and supervisory monitoring of field maintenance activities. Raise the priority of this effort for managers and supervisors and relieve them, where possible, of tasks that inturfere with involvement in and monitoring of day-to-day activities.

Consider the following measures:

- Assign corporate personnel prime responsibility for developing maintenance program improvements needed at the sites. This effort currently requires substantial efforts and is performed nearly exclusively by the sites. Ensure, however, continuing site involvement in these efforts.
- Provide technical and administrative assistants to key maintenance managers such as discipline group supervisors (e.g., electrical, mechanical, and instrumentation and control). Use these assistants to relieve the line managers from unnecessary administrative and program development duties.
- 3. Review the demands placed on supervisor's and manager's time in more detail and eliminate unproductive or unnecessary diversions from line responsibilities. Reduce the number and duration of meetings, especially those with large attendance that do not use attendees' time productively.
- Adjust clerical staffing as necessary to free technical managers and supervisors from clerical tasks.
- 5. Substantially strengthen senior management attention to training and coaching in supervisory involvement, and personal involvement in those efforts in the plant.
- Make supervisory involvement in and monitoring of day-to-day activities a key factor in periodic management performance appraisals.
- N. MAINTENANCE HISTORY

Finding N-1

At all three sites, the maintenance history programs often do not provide meaningful, complete, and useful information. Personnel performing maintenance work often do not completely and accurately describe the activities on the MR forms. Furthermore. At BFN and WBN there is no criteria for determining the types of maintenance and equipment for which documentation and retention of historical data is required, other than CSSC, limited QA, Class 1E, and non-CSSC related to Technical Specification compliance.

History information entered into the maintenance history computer programs is normally derived from completed MR forms. The entries on MRs often lack information needed to make future reference most useful. Personnel often do not completely and accurately describe the equipment on which work was performed. the actual work accomplished, the failure(s) that occurred, causes of the problems, and, for SQN and WBN, the manhours expended. At BFN and WBN, no person or section has been designated as responsible or held accountable for ensuring that information entered into the maintenance history data base is accurate. At SQN, individuals have been assigned to screen MR information for adequacy before entry into the maintenance history data base. Though this has been helpful, additional strention is warranted to further improve the quality of the information entered.

Recommendation:

Establish uniform guidelines for retention of maintenance information on equipment that is important for safe and reliable operation. Include information on such items as man-hours expended, special tools used, causes of failures, and repair techniques or procedures used. Develop methods to improve the usefulness of information entered in maintenance history for future reference. Consider having system engineers prepare history entries from completed MRs and other sources for input into equipment history files by data entry operators. Provide training for maintenance personnel, as appropriate, to improve the quality of information noted on the MR forms during and after maintenance.

Finding N-2

At all three sites, there has been very little use of maintenance history for planning CM and PM activities and for identifying the need for modifications.

Very few of the computer terminals at SQN and WBN have printers convenient to the individuals who need hard copy information; it must be picked up at a remote location. Because of this inconvenience, information needed from historical data bases is normally hand copied from the screer. Handcopying ties up the equipment, is time consuming and is inefficient.

When the need for corrective maintenance is identified, new MR work packages are often generated manually without the benefit of the information contained in past MR work packages. This practice can create errors and inconsistent methods for performing repeated maintenance. It does not foster the use of lessons learned during work and applying these lessons to future activities.

Recommendation:

Provide printers and a copy of microfilmed MRs in each planning section to allow convenient retrieval of previous maintenance request information. Establish a library of selected work instructions used previously so that lessons learned can be carried on reliably. Instruct PAS personnel to use historical information, when possible, to plan and schedule maintenance.

O. QUALITY ASSURANCE

Finding 0-1

At all three sites, PQA review of MRs prior to work is not identifying significant weaknesses.

The NQAM requires review of CSSC MRs by PQA prior to starting work to ensure certain elements are adequately addressed. Examples of these elements are skills of the craft, QC hold points. PHTs, clearances and permits, special processes, fire protection, American Society of Mechanical Engineers (ASME) Section XI, common mode failure, class 1E, and plant Technical Specifications. Single PQA reviewers are normally assigned to review MRs for all disciplines (mechanical, electrical, and instrumentation). The technical background of any assigned reviewer is normally in a single discipline. Because of the technical complexities involved with the disciplines and the elements described in the NQAM, an adequate review is often beyond the technical expertise of the designated PQA reviewer. Based upon interviews with PQA personnel, adequate training in MR-related subjects such as PMT (other than ASME Section XI) has not been provided. Sometimes the time restraints and locations for MR review adversely impact the adequacy and thoroughness of the PQA review.

At all three sites, PQA review did not reliably cause correction of problems such as lack of appropriate PMT and lack of technical information needed by craft workers. In some cases, QC inspectors found the need to stop work in progress because work instructions were inadequate, even after PQA approval.

Recommendation:

Evaluate the need for the broad scope of PQA MR reviews currently required by the NQAM before maintenance is begun. Consider, during this review, methods and potential benefits of strengthening line capability and accountability for MR adequacy, including relevant quality program requirements. Revise the NQAM as appropriate, and ensure that persons assigned MR preparation and approval responsibilities are adequately trained to address equipment and quality program needs.

Finding O-2

At BFN and SQN, corrective actions for some problems identified by PQA have not been effective.

CARs and Discrepancy Reports (DRs) written by PQA identify maintenance problem areas. Though dispositions of several reports indicated that corrective actions would be effective, repeated problems showed they were not.

42

Browns Ferry

Five DRs were written over a period of time for work being performed on a CSSC system without PQA review. The stated corrective action for each-DR did not correct the problem as expected, and a CAR was written to document the lack of corrective action. After this CAR was issued there were two additional DRs written for the same condition.

Sequoyah

Twenty-four DRs were written for a variety of discrepancies; e.g., QC holdpoints, non-QA review of MRs, and use of non-CSSC material on CSSC equipment. After corrective action on those DRs was specified, an additional 41 MRs were found with the same problems. As a result, a CAR was issued in April of 1986 to document the ineffectiveness of the corrective action.

Recommendation:

At BFN and SQN increase management attention in the corrective action process to ensure actions taken to correct identified problems are centered on root causes, not symptoms, and have long-term solution potential. Strengthen line management appreciation for, and attention to, quality program requirements. Establish improved mechanisms to evaluate the effectiveness of corrective actions in preventing recurrence. Escalate repetitive problems to higher management levels for action.

Finding 0-3

Inconsistencies in NQAM requirements have created unnecessary work, delayed work and created inconsistencies in site implementation of quality program requirements. Two examples are discussed below:

First, the NQAM, Part II. Section 2.1. Paragraph 4.1.1 states "Maintenance shall be initiated and/or documented by the use of a maintenance request (MR) form." Contrary to paragraph 4.1.1. paragraph 4.3.3 permits preventive maintenance to be performed either by the use of an MR or an implementing instruction. At SQN and BFN, regularly scheduled maintenance instructions are referenced in PM instructions and these PMs are initiated by an automated scheduling system without MRs. At VBN, MRs are required to initiate many regularly scheduled MIs and some other PMs, adding significantly to the effort required and apparently providing little added benefit.

Second, portions of the NQAM, Part II, section 2.1, require prior PQA review of MRs that initiate PORC-reviewed troubleshooting and corrective maintenance instructions. Another portion of the NQAM permits performance of an MR that initiates a Preventive Maintenance Instruction (PMI) already approved by PQA without separate PQA approval of the MR. This is permitted even though the operability of a system or component may be affected. Since the NQAM has recognized that only one PQA review is necessary for PMIs, that logic also appears applicable to an MR that uses only PQA approved procedures that encompass all aspects of the job. including appropriate PMT requirements. It is not clear that PQA review of an MR is needed when the MR uses only PQA approved instructions. Such redundant reviews add unnecessarily to work and delays.

Recommendation:

Revise the NQAM to clarify requirements for advance PQA approval of maintenance work and implement uniform application of the requirements at all sites. Eliminate redundant PQA reviews such as those discussed in the finding. Consider a more comprehensive review of NQAM requirements relevant to maintenance to identify and eliminate inconsistencies and necessary requirements that can impede timely processing of maintenance work without adding significantly to quality. Involve maintenance and QA personnel in the review.

Finding 0-4

Surveillance of maintenance activities by PQA at BFN and WBN is unnecessarily limited in scope and depth.

The surveillance program is intended to provide feedback to management on the implementation of applicable procedures and requirements through observation of activities in progress. At SQN, the surveillance program appears to be working effectively. At BFN and WBN, however, surveillance activities are often limited to review of paperwork and programmatic matters. Surveys have not been completed on an appropriate variety of maintenance activities to permit a meaningful overall assessment.

Browns Ferry

The 57 maintenance surveys done in 1985 were final data package reviews, workplan reviews and programmatic reviews. No surveys were performed on work activities. One survey, however, performed in 1986 did cover several actual work activities.

Watts Bar

Fourteen maintenance surveys were performed in 1985. Eleven of those were limited to reviews of completed MRs or EQ related programmatic issues. One was to document a condition noted during a rework activity. Two were field surveys of activities that included document checks and the actual performances of work. Seven of eleven identified review guidelines for surveillance have not yet been written. They cover the following areas:

- o Welding
- o Equipment history/trending
- o EQ implementation
- o Preventive maintenance
- o Housekeeping
- o Maintenance of cranes and hoists
- o Preventive maintenance instructions

Recommendation:

Strengthen the BFN and WBN PQA surveillance programs to place primary emphasis on surveillance of maintenance activities in progress. Strengthen surveillance expertise in the activities being observed and in observation techniques. Train PQA surveillance personnel in observation methods using the POTC course based on INPO techniques. At WBN, complete the surveillance review guidelines identified in the finding.

Answers to Questions Contained in S. A. White's Memorandum of April 10, 1986

A. 1 Are there procedures which clearly describe the entire process of accomplishing corrective maintenance?

With some exceptions, the administrative procedures for corrective maintenance provide adequate guidance.

Weaknesses in these administrative procedures include: (1) lack of guidance for specifying postmaintenance testing (see Finding I-1) and (2) lack of instructions and guidance for documenting maintenance history (see Finding N-1).

In addition, numerous instructions exist for specific corrective maintenance activities. These instructions sometimes do not clearly or completely describe the activities necessary. Examples include inadequate lubricant specification and excessive instruction referencing (see Finding F-2).

A. 2 Do the originators of MRs describe the problem area accurately, clearly, and in sufficient detsil?

For the most part, yes. At each site, MRs can be initiated by any employee. As a result, the detailed problem description varies. Some discrepancies were identified and are discussed in finding N-1.

A. 3 Does the MR process keep the operations personnel informed of plant problems?

At each site the MR process keeps operations personnel informed of most plant maintenance problems. Plant maintenance problems are reported and tracked by the maintenance request system. Each site utilizes senior reactor operator (SRO) qualified individuals in the planning and scheduling unit who review submitted MRs and interface with operations for prioritization of MRs. Daily activity lists are provided to site personnel (including operations) to inform them of plant maintenance problems being actively worked. Also, most maintenance activities that affect plant equipment require that operations authorize starting the work and are notified upon completion of the work.

A. 4 Does the MR process allow for prioritization of work? Is the priority system based on equipment/system availability as well as the safety impact to the plant?

41

44 -

The MR process allows for prioritization and is based upon availability as well as safety impacts. The BFN, SQN and WBN prioritization processes all provide for "emergency", "immediate attention", and "routine" priorities. Emergency maintenance activities are those needed to prevent imminent equipment damage or imminent personal injury; they are worked immediately and interrupt lower priority work. Immediate attention activities are those required to be completed within 24 hours. At WEN, the routine priority is further divided into routine priority 1 for plant process equipment and routine priority 2 for non-process equipment. "Complete by" dates can be assigned to establish further priorities. At SQN, the routine priority for process equipment is divided into three subset priorities to be completed within 7 days, 21 days, and as work load permits. At BFN, there is no further prioritization within the routine category; see Finding H-2 for additional information.

A. 5 Does the MR process identify technical specifications limiting conditions for operation?

The MR process adequately identifies limiting conditions for operation (LCO). An SRO reviews MRs, determines if an LCO has been entered, determines if the needed maintenance will result in an LCO, and determines the actual time that an LCO was entered. The SROs are trained in the technical specification requirements and are qualified to make such decisions and judgements. At WBN, LCO requirements will not be fully implemented until an operating license is received.

A. 6 Is the work well planned and job stepped in a manner that is clearly understood in the field?

Maintenance work is planned and job stepped in a manner generally understood in the field. However, a number of weaknesses in implementation were observed which substantially and adversely impact the quality of the final work package. The principal weaknesses observed are: (1) more reliance is placed on the "skill of the craft" than appropriate in some detailed work "skills of all assigned instructions and clear descriptions of the skills of all assigned craft workers do not exist, (2) generic work instructions chat do not address the important details of the job are frequently referenced in work packages (see Findings F-1 and F-2), (3) interdisciplinary craft work and support activities are often not well coordinated and unnecessary delays in performing maintenance result (see Finding G-1).

A. 7 Is the work scheduled in conjunction with other work to minimize equipment and system downtime?

Some attempts are made to schedule related corrective maintenance MRs on the same piece of equipment together. At BFN, means have been established to identify all outstanding work on any given equipment as that scheduling can be coordinated. "Ith this exception, however, all three sites rely heavily on personnel in the planning and scheduling sections to recognize the opportunity to coordinate scheduling to minimize downtime. As expected, this system is only marginally effective (see Finding G-4).

A. 8 Is the process from problem recognition to corrective action implementation timely and efficient?

No, the process from problem recognition to corrective action is often neither timely nor efficient. There is a substantial back og of open MRs at the plants. Major contributors to the age of open MRs are the lack of materials (see Finding J-4) and the need for minor modifications (see Finding H-1).

At BFN, there were approximately 4300 open MRs with an average age of six months. At WBN, there were 2,800 MRs open, of these, 35 percent were over sixty days old. At SQN, there were approximately 2,400 open items (MRs and WRs).

Efficiency problems include delays in obtaining parts (see Findings J-1, J-2, and J-4), scheduling (see Findings G-1, and G-4), and manpower utilization (see finding H-4).

A. 9 Are plans/procedures in place to handle repairs and replacements under ASME? Do maintenance personnel understand the requirements for repair and replacement?

> Plans/procedures are in place to handle repairs and procedures under the applicable ASME codes. Personnel responsible for implementation have been given training and appear to be knowledgeable. However, procedures rely heavily on knowledge and interpretations of ASME code requirements by implementing personnel. They indicated that periodic retraining by corporate engineers active in code activities would help ensure that ASME code requirements are properly interpreted.

A.10 Do maintenance personnel understand the other requirements for Section XI such as LLRT [Local Leak Rate Test], ILRT [Integrated Leak Rate Test], and operability? Do they understand the impacts of types of work that will require re-testing under the code?

> Site personnel appear to have a good understanding of what types of work would require retesting under Section XI of the code. However, the following exception was noted. At BFN, electrical work associated with an active valve was conducted without initiation of active valve operability testing.

A.11 Do maintenance personnel have a basic understanding of the plant equipment and systems to ensure they are aware of the importance or safety impacts of their work?

> Maintenance personnel generall, nad an adequate understanding of plant equipment and systems and were adequately aware of the importance and impact of their work.

Maintenance personnel receive training in basic plant systems. Boiling Water Reactor (BWR) or Pressurized Water Reactor (PWR) technology courses, and training courses on specific equipment as appropriate.

A.12 How are code repairs and replacements handled? Do they ensure updating of the design documents, required ANI [Authorized Nuclear Inspector] interfaces, and NIS [Nuclear Inspectors] 2/1 form preparation, approval, and submittal?

> Site administrative instructions or standard practices address the needed programmatic steps for Section XI Pepair and replacement activities. These steps including updating of design documents, inspections, interfacing with the ANI, and providing input data to the corporate office for NIS 2/1 submittals.

> No administrative instructions/standard practices were found which address repair and replacements for American National Standards Institute (ANSI) B31.1 code components (non-safety related).

A.13 Are there processes in place to ensure that environmental or seismic qualifications of equipment are not breached during corrective maintenance? Do maintenance personnel understand EQ and SQ [Seismic Qualification]?

Yes, processes for EQ and SQ are in place with one technical exception noted.

At WBN, the instrument supervisor felt seismic considerations were adequately addressed with the exception of instrument mountings (including torquing requirements). Engineering is presently developing standard drawings to address requirements for instrument mountings. Those were expected to be in place by July 1, 1986.

Maintenance personnel appear to understand their respective roles for EQ and SQ applications.

- A.14 a. How are problems handled during the implementation of corrective maintenance?
 - b. Is this process timely?

Minor problems are routinely resolved by the involved foremen, craft or engineers. Examples of minor problems are coordination delays or those not requiring work package revision. Any problems beyond those minor ones result in inordinate work delays from generating new MRs and replanning existing MRs (see Finding H-5).

A.15 Are the corrective actions taken well documented? Do they reflect all steps taken and conditions found as well as left?

Although there is a high degree of variability in the detailed documentation of the corrective action and the steps taken, the general performance in this area needs improvement. If a procedure with step-by-step signoff is used, the work is so documented. The descriptive portions of many completed MRs (work performed and failure cause) do not clearly reflect the work done in a manner that provides meaningful information for maintenance history. See Finding N-1 for additional information.

A.16 Are MRs properly reviewed by supervision to ensure adequacy and accuracy?

Field complete MRs are reviewed to assure that the blanks are filled in and that the data is accurate. However, the reviews were not adequate in: (1) the description of work performed, and (2) the cause of the failure. In addition, there was not sufficient review to conclude that the problem identified by the originator was actually corrected (see Findings H-3 and N-1). SQN, however, showed significant improvement in May in the number of completed MRs (supervisor reviewed) rejected by PQA. This number was down to 3 percent from about 50 percent.

- A.17 Do MRs provide enougn information to allow for trend analysis, traceability to other documents, and spare parts of materials?
 - a. . Trend analysis: No; MRs often do not contain adequate information to perform a useful trend analysis. In order to recognize an adverse trend (i.e. significant repeated problems or failures) from MR data, the evaluator would have to know substantially more than is normally included on MRs (see Finding N-1).
 - b. Traceability to other documents: Yes, references to other documents on MRs are adequate.
 - c. Spare parts or materials: Yes; traceability to Material Requisition Forms (TVA form 575) was consistently included on MRs when parts were used.
- A.13 Is there a trend analysis program? How adequate is it?

Trend analysis programs are being developed for all three sites. As these programs have only been recently implemented at SQN and BFN, judgement on the adequacy of the programs could not be made. Problems with data collection (see Finding N-1) and failure analysis (see Finding A-4) were noted, other information is as follows:

Browns Ferry

An item for which three MRs are written within 90 days in any one unit is flagged by the computer for analysis. This threshold does not include MRT for like items in the other two units.

A5

Sequoyah

The plant procedure identifying the overall program appears to be well defined. However, the current program has only been recently implemented, and its adequacy could not yet be determined.

Watts Bar

There is not an effective trend analysis or equipment history program in use. EQIS and the site maintenance history programs are fully functional but are not frequently used. The vibration group and the instrumentation maintenance unit have trending programs for their specific areas. Repetitive failures and equipment that requires excessive corrective maintenance are not effectively tracked, trended, or flagged.

A.19 What is QA's involvement in corrective maintenance!

At all three sites PQA reviews all CSSC/Safety Related MRs prior to performance of the work. This review checks items such as:

- 1. Identification of the equipment
- 2. Work instructions
- 3. Designation of QC holdpoints
- 4. Postmaintenance testing requirements
- 5. Administrative and section reviews

In addition, PQA at SQN reviews all completed CSSC MRs.

The PQA surveillance groups perform specific and programmatic surveys of randomly selected maintenance activities and related documentation. These surveys are intended to point out the effectiveness of plant procedures and adherence to them. For problems related to PQA surveys, see Finding 0-4.

PQA also reviews and approves maintenance instructions and revisions for technical content, QC holdpoint designation, and clarity prior to use. For problems relating to PQA review, see Findings O-1 and O-3.

PQA also participates directly in the CM process through inspections at designated QC holdpoints.

A.20 Can corrective maintenance be performed by anyone other than personnel assigned to the maintenance group? If so, who and under what conditions and controls?

Corrective maintenance can be performed by organizations other - - than the maintenance group as follows:

.......

The TVA modifications group occasionally has performed corrective maintenance using MRs.

The TVA Service Shop in Huscle Shoals, Alabama, performs maintenance on large equipment and, motors and rebuilds contaminated motors using procedures provided with each job. Huscle Shoals is bound by the requirements in the NQAM. They also filter (Purevac) the oil in transformers and switch gear in the switch yard at the sites.

Contractors, such as Combustion Engineering, perform some CM on site. Their performance is controlled by contractor procedures written to satisfy the contract work specificiation.

Some instruments and electrical components are sent back to the manufacturer for repair in accordance with specifications in the contract.

A.21 Is there an effective system for flagging MR backlogs?

At all three sites, the backlog of MRs (number of MRs) is routinely identified. However, this information does not represent the backlog of corrective maintenance activities. The backlog of MRs may include the following, depending on which site the data is for:

- (a) Corrective Maintenance
- (b) Preventive Maintenance
- (c) Maintenance support for activities such as SIs. refueling activities, and modifications
- (d) Support activity (disconnecting leads, erecting scaffolds, installing temporary lighting) to support the corrective maintenance activity.

Furthermore, the MR backlog is not identifiable in estimated man-hours at SQN or WBN.

B. 1 Are there procedures which clearly describe the entire process of accomplishing preventive maintenance?

Yes. Procedures have been developed for the PM program. Some PM activities, however, are not within the PM program proper and are controlled by other procedural systems. IMIs, some MIs, and predictive maintenance activities are examples of these other activities. Since PM activities are controlled under a variety of different programs, controls over scheduling and performance of activities are different. For example, approval of waivers, deletions, additions or changes in performance frequency are controlled at different management levels. More uniform controls are warranted (see Finding E-2).

B. 2 What mechanism is used to ensure that all equipment has been evaluated for preventative maintenance requirements?

> There is not an adequate mechanism at any of the sites to ensure that all equipment necessary for safe and reliable operation is included in the PM program (see Finding E-1).

B. 3 Are manufacturers' recommendations followed? If not, what process has been used to determine requirements?

> Manufacturers' recommendations are considered in the establishment of PMs. However, vendor PM recommendations have not been uniformly implemented, and variations from these recommendations have not been well documented (see Finding E-1).

B. 4 Has an engineering or plant technical evaluation been performed and documented for deviations from vendors' requirements on safety related equipments?

No, deviations from wendor recommendations have not been well documented (see Finding E-1).

B. 5 Does the PM system satisfy the requirements necessary to maintain equipment's environmental and seismic gualifications?

Yes. Seismic qualification is maintained primarily through configuration control of maintenance activities and use of appropriately qualified replacement parts.

Environmental qualification is maintained through PM activities that replace parts before the end of qualified life, use 50.49 qualified replacement parts, and appropriately update the qualification data when replacement parts are used.

B. 6 How was the frequency for PMs established? Is it based on time or running hours? Does equipment in the plant have installed hour meters?

> The frequency of PMs is established using vendor recommendations, plant specific failure data or engineering judgment. The recent changes in maintenance organizations at WBN and SQN have coupled the responsibility for evaluation of the frequency of PM activities with the responsibility for trend analysis.

Normally the frequencies of PMs are based on time instead of running hours, because run time meters are not installed on most equipment and running times are not tabulated on most equipment.

B. 7 Is there a lubrication manual which describes the type and specification of lubricants for equipment? Is this document controlled and does it follow vendors' requirements? The TVA Lubrication Manual is a controlled document used at each of the plant sites. The TVA Lubrication Manual provides a listing of equivalent lubricants that satisfy specific TVA lubricant requirements. It does not identify the application of lubricants to plant equipment.

Browns Ferry

No lubrication instruction exists that lists the lubricants to be used on specific equipment in the plant. Individual plant instructions control the lubrication program. Lubrication is included in the regular PM program, and PM instructions specify adequately the lubricants to be used.

Sequoyah

No lubrication instruction exists that lists the lubricants to be used on specific equipment in the plant. Lubricants are generally specified in equipment-specific MIs and PMs based on vendor manuals. Operations personnel stated they use a computerized, uncontrolled index dated January 20, 1984 to determine the type of oil to be added to non-CSSC equipment and, on an emergency basis, to CSSC equipment. The computer data base used to generate this index has since been erased.

Watts Bar

WBN Standard Practice WB 7.3.1, "Lubrication," lists the lubrication requirements of plant equipment. Discrepancies were identified between PM packages and the standard practice. In these cases, the PM packages were found to be consistent with vendor recommendations and were followed, as appropriate.

B. 8 Are PMs scheduled in conjunction with other work to minimize equipment and system downtime?

> PMs are generally not scheduled in conjunction with other maintenance work at SQN and WBN. However, a computer-assisted program is used at BFN to identify PM's that can be scheduled with other work. See Finding G-4.

B. 9 How are discrepancies discovered during preventive maintenance identified and corrected?

MRs are prepared to identify the hardware deficiencies discovered during PM and the deficiencies are resolved as CM.

B.10 What is the percentage of PMs that are overdue and are they judged to be mandatory or "nice to do"?

> The percentage of overdue PMs (both CSSC and non-CSSC) for March, April, and May, 1986 is as follows:

> > BFN - 217 SQN - 167 WBN - 167

The overdue PMs represent the number of PMs not performed and not receiving management approval for waiver.

There is no classification at any of the sites which categorizes or prioritorizes the performance of PMs. SQN has a mandatory category for PMs needed to meet regulatory requirements, but this category is not reflected in the PM packages or the tracking system (see related Findings E-5 and H-2).

B.11 What mechanism is used to handle daily PM items such as checking lubricant levels? Is it adequate?

Daily PM activities such as inspections or simple operational activities (checking lubrication levels, cycling drain valves, checking filter cleanliness, etc.) are controlled by section letters. These activities are typically performed by an Assistant Unit Operator on a shift basis. Completion is documented on forms in the applicable section letter. This method appears to be effective.

E.12 Are work descriptions and work performed sections of PHs clear and accurate? Is work reviewed by supervision to ensure adequacy and accuracy?

> The required work descriptions were found to be generally clear and adequate. However, several PHs at SQN lacked needed detail; examples included failures to specify the type of lubricant and method of lubricating. The lack of detail resulted in inefficient performance of the PMs, with craftman's time required to check vendor's manuals.

B.13 Is the scheduling mechanism for PMs adequate and does it ensure jobs will not be forgotten or dropped?

> All three plant sites have adequate scheduling and tracking mechanisms for TMs. Overdue PMs are tracked until performed or waivered.

B.14 Is there a priority system for PMs to ensure that the most critical items are performed first? Is there a system to ensure that PMs associated with safety related equipment are mandatory?

There is no formal priority system established to ensure critical items are performed first. First line supervisors responsible for performing the PHs are allowed to establish daily and/or weekly work priorities utilizing PH work lists provided to them. However, based on the observed completion performance, important PMs are receiving appropriate attention.

There is no formal system established to ensure that performance of PMs associated with safety related equipment is mandatory. The system relies upon review and approval of PM waivers and deferrals by maintenance management to ensure performance of PMs on safety related equipment when appropriate.

B.15 Is there a process in place to perform PMs such as infra-red for electrical hotspots, dobel testing, heat loss through insulation, vibration analysis, lubrication analysis, equip/system efficiency, etc.?

The specific processes identified were found to be in place at the sites with the exception of heat loss through insulation. Additional predictive techniques, such as gas in oil analysis for electrical equipment. MOVATS (Motor Operated Valves Automated Test System) testing of motor operated valves, and motor insulation integrity testing, are also being utilized. However, these are not considered by the sites to be a part of the PM program (see Finding A-3).

B.16 What involvement does QA have in preventative maintenance?

At all three sites PQA reviews and approves SIs and preventative maintenance instructions and revisions prior to work. At WBN, PQA also reviews some MRs which are used to initiate PMs (see Finding F-5).

The PQA surveillance groups perform and programmatic surveys of randomly selected PM activities. Though these surveys are intended to point out the adequacy of plant procedures and procedural adherences, they are not fully effective (see Finding O-4).

Specific PQA involvement at the sites varies as follows:

At BFN, QA reviews of completed SIs and PMs are done on a random basis by the surveillance group.

At SQN, QA reviews all of the the completed PM data packages. They also review all of the completed SIs related to Technical Specifications.

At WBN, QA reviews of completed SIs and PMs are done on a random basis by the surveillance group. However, QC reviews all completed SI data packages. いたないないないないないないない

B.17 Is there an effective system for flagging overdue PMs?

-

•

Yes, each site has an effective system for flagging overdue PMs. BFN and SQN utilize a computer system to identify overdue PMs and provide a management summary. WBN utilizes a word processing for system to identify overdue PMs. Management summaries are developed manually. 一次通知環境になるないのないないないですないとう

Follow-up on Nuclear Safety Review Staff Report R-85-03-NPS, "Review of Nuclear Power Maintenance Program"

The open NSRS items associated with report R-85-03-NPS were reviewed during this maintenance review. Sufficient information was obtained to determine that: (1) the corrective action was adequate and the item is closed or (2) the condition continues to exist. In the latter case, a new finding has been written and included in this report. Only one item, R-85-03-NPS-07 at BFN and WBN, requires additional evaluation to determine whether or not the stated corrective action has been effective. Disposition of the open items from report R-85-03-NPS are as follows:

R-85-03-NPS-02, Improper Identification of CSSC Equipment on Maintenance Requests - Vatts Bar Nuclear Plant (WBN)

Training to meet a commitment to NSRS was completed by WBN on June 28, 1985. Since that date, new planners have been placed in the maintenance sections and are responsible for identifying CSSC vs non-CSSC equipment. Though those planners have not received the structured training recommended in R-85-03-NPS-02, and excessive effort was required to make proper identifications (see finding G-6), no errors were observed in the classification of MRs. This item is closed.

R-85-03-NPS-03, <u>Inadequate Postmaintenance Testing of CSSC</u> Equipment on Maintenance Request (MR) - Browns Ferry Nuclear Plant (BFN)

Although this item has not been satisfactorily resolved, R-85-03-NPS-03 is closed for record purposes. This problem is addressed in finding I-1 of this report.

R-85-03-NPS-05, ASME Section XI Postmaintenance Valve Testing - WBN

Although this item has not been satisfactorily resolved. R-85-03-NPS-05 is closed for record purposes. Postmaintenance testing is addressed in finding I-1 of this report.

R-85-03-NPS-06, Postmaintenance Testing Program - Generic

Although this item has not been satisfactorily resolved. R-85-03-NPS-06 is closed for record purposes. The Postmaintenance Testing Program is addressed in finding I-1.

R-85-03-NPS-07, Common Mode Failure - Generic

٠

At BFN and WBN, procedures changes were made to correct the identified problem. Additional review is necessary to determine the effectiveness of that corrective action. This item remains open pending that review.

At SQN NSRS Review R-86-01-SQN evaluated the adequacy of the corrective action including training provided to foreman. That review identified two additional changes to Mechanical Maintenance Section Letter-A36 needed to fully satisfy the intent of that recommendation. Those changes have been made and this item is closed for SQN.

R-85-03-NPS-08, Quality Assurance Surveillance of Maintenance Program - Generic

At all three sites PQA procedures had been revised to include surveillances of maintenance activities including PMT and common mode failure.

At BFN checklists were prepared for surveillance; however, no surveys had beer performed. Although this item has not been satisfactorily resolved, R-85-03-NPS 08 is closed at BFN for record purposes. Subsequent action on this item will be tracked through finding 0-4 of this report.

At SQN NSRS Review R-86-01-NPS determined only additional procedural changes need be made. Those changes were made and this item is closed for SQN.

At WBN maintenance surveys were being performed, but were predominately documentation surveys. This item has not been satisfactorly resolved at WBN but R-85-03-NPS-08 is closed for record purposes. Subsequent action on this item will be tracked through finding 0-4 of this report.

ACRONYMS USED IN THIS REPORT

| | Authorized Nuclear Inspector | |
|--------|---|-----------|
| ANI | National Standards Institute | |
| ANSI | American Society of Mechanical Engineers | |
| ASME | Browns Ferry Nuclear Plant | |
| BFN | Boiling Water Reactor | |
| BWR | Corrective Action Report | |
| CAR | Code of Federal Regulations | |
| CFR | Connective Maintenance | |
| CM | Critical Systems, Stuctures, and Components | |
| CSSC | Design Change Request | |
| DCR | Distaion of Nuclear Engineering | |
| DNE | Division of Nuclear Quality Assurance | |
| DNQA | Division of Power System Operations | |
| DPSO | Discrepancy Report | |
| DR | Engineering Change Notice | |
| ECN | Equipment Qualification | |
| EQ | Equipment Information System | |
| EQIS | Essential Raw Cooling Water | |
| ERCW | Field Change Request | |
| FCR | High Pressure Coolant Injection | |
| HPCI | Industrial Engineering | |
| IE | Integrated Lesk Rate Test | |
| ILRT | Testsument Maintenance Instruction | |
| IMI | Institute of Nuclear Power Operations | |
| INPO | In-Service Inspection | |
| ISI | Limited Condition for Operation | |
| LCO | Licensee Event Report | / |
| LER | Local Leak Rate Test | |
| LLRT | Modifications and Additions Instruction | |
| MEAI | Materials Management System | |
| MAMS | Actorials Anagement System | |
| MI | Maintenance Instruction Motor-Operated Valves Automated Test System | |
| MOVATS | Rotor-Operated valves Automotor Control | |
| MR | Maintenance Request | |
| N/A | Not Applicable | |
| NI | Nuclear Inspector | |
| NMRG | Nuclear Manager's Review Group | |
| NPOSS | Nuclear Plant Operational Support Systems | |
| NPRDS | Nuclear Performance Reliability Data System | |
| NQAM | Nuclear Quality Assurance Manual | |
| NRC | Nuclear Regulatory Commission | |
| NSRS | Nuclear Safety Review Staff Nuclear Utility Management and Human Resources | Committee |
| NUMARC | Nuclear Utility Hanagement and materia | |
| ONP | Office of Nuclear Power | |
| PLS | Planning and Scheduling | |
| PM | Preventive Maintenance | |
| PHI | Preventive Maintenance Instruction | |
| PHT | Postmaintenance Testing | |
| PORC | Plant Operating Review Committee | - |
| | | |

C1

Appendir C

ACRONYNS USED IN THIS REPORT

| POTC | Plant Operations Training Center |
|---|--|
| PQA | Plant Quality Assurance |
| PWR | Pressurized Water Reactor |
| A | Quality Assurance |
| QC | Quality Control |
| ECW | Raw Cooling Water |
| RWP | Radiation Work Permit |
| SEE-IN | Significant Event Evaluation and Information Network |
| SI | Surveillance Instruction |
| sq | Seismic Qualification |
| SQN | Sequoyah Nuclear Plant |
| SRO | Senior Reactor Operator |
| TACF | Temporary Alteration Control Form |
| The second se | TVA Item Identification Code |
| TIIC | Tennessee Valley Authority |
| TVA | |
| WBN | Watts Bar Nuclear Plant |

:

,

•,•

CZ

TVA 66 (05 641) (0 MWAS-45) A 02 860410 010

UNITED STATES COVERNMENT

Memorandum

TENNESSEE VALLEY AUTHORITY

TO : R. K. Seiberling, Manager, Nuclear Manager's Review Group, E3 A8 C-K

FROM : S. A. White, Manager of Nuclear Power, LP'6N 38A-C

DATE : April 10, 1986

SUBJECT: TASKS FOR THE NUCLEAR MANAGER'S REVIEW GROUP (NMRG)

I request that the NMRG conduct a comprehensive review of corrective and preventive maintenance at Browns Ferry. Sequoyah and Watts Bar Nuclear Plants.

It is my intent to restructure the maintenance activities throughout TVA's nuclear program. In order to do this effectively, I need an objective assessment of the current practices at the two operating sites and at Watts Bar. Based on the results of this assessment, new procedures will be written, organizational structures may be realigned, and the current effort to rewrite all position descriptions will be significantly affected.

Please have this review completed no later than June 15, 1986, and provide me with a written report of your findings at that time. Because of the importance and magnitude of this task. I expect most of the resources of the NMRG will be required. Please advise me of your assessment of the manpower requirements as soon as possible.

As a mininum, the following questions should be addressed, as appropriate, at all three sites.

A. <u>Corrective Maintenance</u>

- 1. Are there procedures which clearly describe the entire process of accomplishing corrective maintenance?
- 2. Do the originators of MRs describe the problem area accurately, clearly, and in sufficient detail?
- 3. Does the MR process keep the operations personnel informed of plant problems?
- 4. Does the MR process allow for prioritization of work? Is the priority system based on equipment/system availability as well as the safety impact to the plant?
- 5. Does the MR process identify technical specifications (limiting conditions for operation)?
- 6. Is the work well planned and job stepped in a manner that is clearly understood in the field?

Appendix D

Buille Commen Bank D. L. L. M. B. M. B.

R. K. Seiberling April 10, 1986

2

TASKS FOR THE NUCLEAR MANAGER'S REVIEW GROUP (NMRG)

- 7. Is the work scheduled in conjuction with other work to minimize equipment and system downtime?
- 8. Is the process from problem recognition to corrective action implementation timely and efficient?
- 9. Are plant procedures in place to handle repairs and replacements under A.ME? Do maintenance personnel understand the requirements for repair and replacement?
- 10. Do maintenance personnel understand the other requirements for Section XI such as LLRT, ILRT, and operability? Do they understand the impacts of types of work that will require retesting under the code?
- 11. Do maintenance personnel have a basic understanding of the plant equipment and systems to ensure they are aware of the importance or safety impacts of their work?
- 12. How are code repairs and replacements handled? Do they ensure updating of the design documents, required ANI interfaces, and NIS 2/1 form preparation, approval, and submittal?
- 13. Are there processes in place to ensure that environmental or seismic qualifications of equipment are not breached during corrective maintenance? Do maintenance personnel understand EQ and SQ?
- 14. a. How are problems handled during the implementation of corrective maintenance?
 - b. Is this process timely?

- 15. Are the corrective actions taken well documented? Do they reflect all steps taken and conditions found as well as left?
- 16. Are MRs properly reviewed by supervision to ensure adequacy and accuracy?
- 17. Do MRs provide enough information to allow for trend analysis, tracuability to other documents, and spare parts of materials?
- 18. Is there a trend analysis program? How adequate is it?

19. What is QA's involvement in corrective maintenance?

R. K. Seiberling April 10, 1986

3

TASKS FOR THE NUCLEAR MANAGER'S REVIEW GROUP (NMEG)

20. Can corrective maintenance be performed by anyone other than personnel assigned to the maintenance group? If so, who and under what conditions and controls?

D3

21. Is there an effective system for flagging MR backlogs?

B. Preventive Maintenance

- 1. Are there procedures which clearly describe the entire process of accomplishing preventive maintunance?
- 2. What mechanism is used to ensure that all equipment has been evaluated for preventive muintenance requirements?
- 3. Are manufacturers' recommendations followed? If not, what process has been used to determine requirements?
- 4. Has an engineering or plant technical evaluation been performed and documented for deviations to vendors' requirements on safety related equipment?
- 5. Does the PM system satisfy the requirements necessary to maintain equipments' environmental and seismic qualifications?
- 6. How was the frequency for PMs established? Is it based on time or running hours? Does equipment in the plant have installed hour meters?
- 7. Is there a lubrication manual which describes the type and specification of lubricants for equipment? Is this document controlled and does it follow vendors' requirements?
- 8. Are PMs scheduled in conjunction with other work to minimize equipment and system downtime?
- 9. How are discrepancies discovered during preventive maintenance identified and corrected?
- 10. What is the percentage of PMs that are overdue and are they judged to be mandatory or "nice to do"?
- 11. What mechanism is used to handle daily PM items such as checking lubricant levels? It is adequate?
- 12. Are work descriptions and work performed sections of PHs clear and accurate? Is work reviewed by supervision to ensure adequacy and accuracy?

R. K. Seiberling April 10, 1986

TASKS FOR THE NUCLEAR MANAGER'S REVIEW GROUP (NMRG)

- 13. Is the scheduling mechanism for PMs adequate and does it ensure jobs will not be forgotten or dropped?
- 14. Is there a priority system for PMs to ensure that the most critical items are performed first? Is there a system to ensure that PMs associated with safety related equipment are mandatory?
- 15. Is there a process in place to perform PMs such as infra-red for electrical hotspots, dobel testing, heat loss through insulation, vibration analysis, lubrication analysis, equip/system efficiency, etc.?
- 16. What involvement does QA have in preventive maintenance?

17. Is there an effective system for flagging overdue PMs?

A. White

SAW: JM Attachment cc (Attachment): RIMS, MR 4N 72A-C ENCLOSURE 2

A02 861106 030 Nego F VA 64 (05 9-65) (OFWES-85) 144 861110 (03/-"NITED STATES GOVERNMENT Memorandum TENNESSEE VALLEY AUTHORITY 1/20/8/ W. T. Cottle, Assistant Manager of Nuclear Power, LP 6N 38A-C TO C. Mason, Acting Manager of Nuclear Power, LP 6N 38A-C FROM November 7, 1986 DATE NUCLEAR MANAGER'S REVIEW GROUP (NMRG) REPORT R-86-02-NPS: REVIEW OF SUBJECT: MAINTENANCE AT BROWNS FERRY, SEQUOYAH, AND WATTS BAR NUCLEAR PLANTS; SUPPLEMENT TO APPENDIX B

> Appendix B of the subject report documented the disposition of six open items from past Nucles- Safety Review Staff reports. Additional evaluation was required for item R-85-03-NPS-07 to determine if corrective action had been effective.

RIMS, MR 4N 72A-C (Re: QO1 861105 800) H. L. Abercrombie, ONP, Sequoysh (5)

W. R. Brown, 11-127 SB-K W. R. Brown, ONP, WBN

R. W. Cantrell, W12 A12 C-K (5) J. P. Darling, ONP, Bellefonte (5)


H. P. Pomrehn, Browns Ferry (5) C. G. Robertson, LP 55 83E-C R. K. Seiberling, 716C EB-C

C. H. For, Jr., LP 6N 38A-C R. L. Gridley, LP 5N 157B-C W. H. Hannum, BR 1N 76B-C L. L. Jackson, LP 6N 38A-C R. J. Johnson, PGIC-C J. L. McAnally, LP 6N 38A-C R. C. Parker, LP 4N 45A-C R. A. Pedde, ONP, Watts Bar

As a result of additional follow-up, it has been determined that the corrective action was effective and item R-85-03-NPS-07 is closed. Enhancements in the area of post-maintenance testing as related to possible common mode failures will be tracked as part of finding ULINSING previously documented. Therefore, no additional corrective action UPPCRT is required as a result of the attached supplement to Appendix B.

10/11/1000

17125185

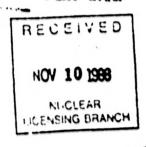

E. K. Sliger, LP 2N 97B-C M. E. Taylor, LP 6N 38A-C

G. Toto, ONP. Watts Bar (5)

B 11 C Cari

CCM: PAP Attachment cc (Attachment):