

AEC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 11248

FILE: _____

FROM: Duke Power Co Charlotte, NC		DATE OF DOC 10-26-74	DATE REC'D 11-2-74	LTR	TWX	RPT	OTHER FACSIMILE
TO: Mr. D Boyd		ORIG NONE SIGNED	CC	OTHER	SENT AEC PDR <u>XXX</u> SENT LOCAL PDR <u>XXX</u>		
CLASS	UNCLASS XXXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-305		

DESCRIPTION:
Ltr re abnormal occurrence # 74-19 on 10-25-74 concerning failure of auxiliary feedwater pump to start.....

ENCLOSURES:

DO NOT REMOVE

PLANT NAME: Kewaunee 1

FOR ACTION INFORMATION! 11-29-74 ehf

BUTLER (L) W/ Copies	SCHWENGER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/ Copies	YOUNGBLOOD (E) W/ Copies	W/ Copies

INTERNAL DISTRIBUTION

REG FILE	TECH REVIEW	DENTON	LIC ASST	A/T IND
REG PDR	SCHROEDER	GRIMES	DIGGS (L)	BRAITMAN
REG GC, ROOM P-506A	ACCARY	GAMMILL	GEARIN (L)	SALTZMAN
MUNTZING STAFF	NIGHT	RASTNER	GOULBOURNE (L)	B. HURT
CASE	AWLICKI	BALLARD	KREUTZER (E)	PLANS
GIAMBUSSO	SHAO	SPANGLER	LEE (L)	MCDONALD
BOYD	STELLO	ENVIRO	MAIGRET (L)	CHAPMAN
MOORE (L) (BWR)	HOUSTON	MULLER	REED (E)	DUBE w/input
DEYOUNG (L) (PWR)	OVAK	DICKER	SERVICE (L)	E. COUPE
SKOVHOLT (L)	ROSS	KNIGHTON	SHEPPARD (L)	
GOLLER (L)	PPOLITO	YOUNGBLOOD	SLATER (E)	THOMPSON (2)
P. COLLINS	TEDESCO	REGAN	SMITH (L)	LECKER
DENISE	LONG	PROJECT LDR	TEETS (L)	EISENHUT
REG OPR	AINAS		WILLIAMS (E)	
FILE & REGION (4)	ENAROYA	HARLESS	WILSON (L)	
MORRIS	COLINER			
STEELE				

EXTERNAL DISTRIBUTION

- | | | |
|---------------------------------------|----------------------------------|---|
| LOCAL PDR Kewaunee, WI | | |
| TIC (ABERNATHY) (1)(2)(10) | 1 - NATIONAL LABS | 1 - PDR SAN LA NY |
| NSIC (BUCHANAN) | 1 - ASLB (E) W. 500, Rm 520 | 1 - BROOKHAVEN NAT LAB |
| 1 - ASLB | 1 - W. PERRYINGTON, Rm E-201 GT | 1 - G. ULRIKSON, ORNL |
| 1 - Newton Anderson | 1 - B&M SWINERBROAD, Rm E-201 GT | 1 - AGMED (RUTH GUSTMAN)
Rm B-127 GT |
| ACRS HOLDING | 1 - CONSULTANTS | 1 - R. D. MUELLER, Rm E-201
GT |
| Sent to Lic Asst. Sheppard | NEW YORK STATE AOBADIAN | |

October 26, 1974

Mr. Dwane Boyd
 Resident Inspector - U. S. Atomic Energy Commission
 Directorate of Regulatory Operations - Region III
 Two Rivers Municipal Hospital
 Two Rivers, Wisconsin

SUBJECT: Docket 50-305
 Operating License DPR-43
 Abnormal Occurrence Report

REGULATORY DOCKET FILE COPY

In accordance with the requirements of Technical Specifications, Paragraph 6.6.2.a and 1.0a.1(d), we submit the following:

Report Number: 50-305/74-19

Occurrence Date: October 25, 1974

Facility: Kewaunee Nuclear Power Plant
 Kewaunee, Wisconsin

Identification of Occurrence:

Failure of Auxiliary Feedwater Pump to start.



Condition Prior to Occurrence:

Reactor Critical
 Reactor Coolant System Temperature 547°F
 Reactor Coolant System Pressure 2220
 Electric Generator Off Line

Description of Occurrence:

The electric generator had been taken off the line and the reactor was critical when a Hi-Hi steam generator level was indicated on 1B steam generator. Main feed water pump 1A tripped off with the Hi-Hi steam generator level. 1B Main feed water pump was off the line due to maintenance and the breaker was tagged open. Upon receipt of the Hi-Hi level Auxiliary Feed Water Pump 1B started, but 1A Auxiliary Feed Water Pump did not start. The switch for 1A Auxiliary Feed Water Pump was put in the START position and the pump started.

The above Abnormal Occurrence was discussed with Dick Knop of Region III at 1015 on October 26, 1974.

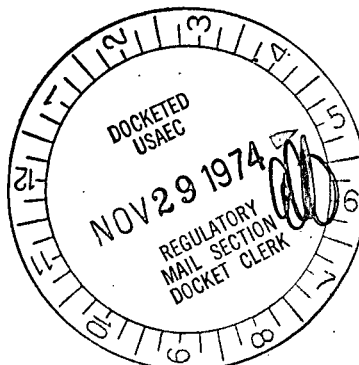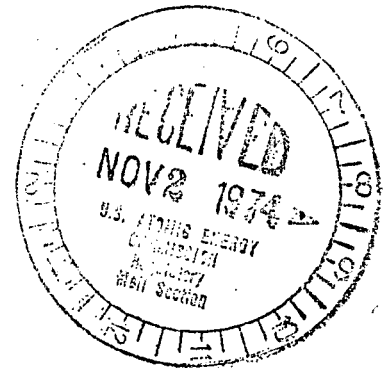

11248