

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 1731

FILE: INCIDENT REPORT

FROM: Iowa Electric Light & Power Co. Cedar Rapids, Iowa G.G. Hunt		DATE OF DOC 2-11-75	DATE REC'D 2-18-75	LTR xxxxx	TWX	RPT	OTHER
TO: Mr. James Keppler		ORIG no	CC 1	OTHER	SENT AEC PDR <u>xxx</u> SENT LOCAL PDR <u>xxx</u>		
CLASS	UNCLASS xxxxx	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-331		
DESCRIPTION: Ltr reporting abnormal occurrence #75-7 on 2-11-75 concerning out-of-specification reactor low pressure switch				ENCLOSURES: ACKNOWLEDGED DO NOT REMOVE			
PLANT NAME: Duane Arnold		FOR ACTION/INFORMATION			2-19-75	JGB	

BUTLER (S) W/ Copies	SCHWENCER (S) W/ Copies	ZIEMANN (S) W/ Copies	REGAN (E) W/ Copies
CLARK (S) W/ Copies	STOLZ (S) W/ Copies	DICKER (E) W/ Copies	PEAR (S) W/4 Copies
PARR (S) W/ Copies	VASSALLO (S) W/ Copies	KNIGHTON (E) W/ Copies	SPEIS (S) W/ Copies
KNIEL (S) W/ Copies	PURPLE (S) W/ Copies	YOUNGBLOOD (E) W/ Copies	W/ Copies

INTERNAL DISTRIBUTION

<u>REG FILE</u> ✓ NRC PDR ✓ OGC, ROOM P-506-A ✓ GOSSICK /STAFF ✓ CASE GIAMBUSSO BOYD MOORE (S) (BWR) DEYOUNG (S) (PWR) SKOVHOLT (S) GOLLER (S) P. COLLINS DENISE REG OPR FILE & REGION T.R. WILSON	<u>TECH REVIEW</u> ✓ SCHROEDER ✓ MACCARRY ✓ KNIGHT ✓ PAWLICKI ✓ SHAO ✓ STELLO ✓ HOUSTON ✓ NOVAK ✓ ROSS ✓ IPPOLITO TEDESCO ✓ LONG ✓ LAINAS ✓ BENAROYA ✓ STEELE ✓ VOLIMER	<u>DENTON</u> GRIMES GAMMILL ✓ KASTNER BALLARD SPANGLER <u>ENVIRO</u> MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR HARLESS	<u>LIC. ASST.</u> DIGGS (S) GEARIN (S) GOULBOURNE (S) KREUTZER (E) LEE (S) MAIGRET (S) REED (E) SERVICE (S) SHEPPARD (S) SLATER (E) SMITH (S) ✓ FEETS (S) WILLIAMS (E) WILSON (S) INGRAM (S)	<u>A/T IND</u> BRAITMAN SALTZMAN B. HURT <u>PLANS</u> MCDONALD CHAPMAN DUBE w/input E. COUPE ✓ R. Hartfield (2) ✓ KLECKER ✓ F. WILLIAMS No (4)
---	---	--	---	---

EXTERNAL DISTRIBUTION

✓ 1-LOCAL PDR Cedar Rapids, Iowa	(1) (2) (10) -NATIONAL LABS	1-PDR SAN/LA/NY
✓ 1-TIC (ABERNATHY)	1-M. PENNINGTON, RM E-201 G.T.	1-BROOKHAVEN NAT LAB
✓ 1-NSIC (BUCHANAN)	1-CONSULTANTS	1-G. ULRIKSON, ORNL
1-ASLB	NEWMARK/BLUME/AGBABIAN	1-AGMED (RUTH GUSSMAN) RM B-127 G.T.
1-NEWTON ANDERSON		1-J. RUNKLES, RM E-201 G.T.
✓ ACRS SENT TO LIC. ASST. TEETS		

E. B. Cow

IOWA ELECTRIC LIGHT AND POWER COMPANY

General Office


CEDAR RAPIDS, IOWA

DUANE ARNOLD ENERGY CENTER

PALO, IOWA

FEBRUARY 11, 1975


DAEC 75 - 43

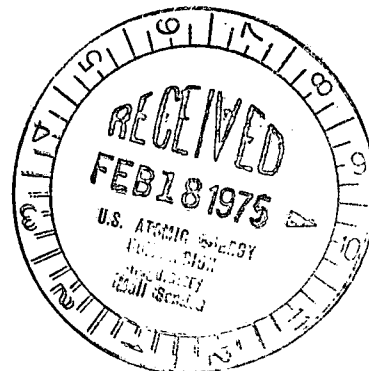

Mr. James Keppler, Director
Office of Inspection and Enforcement
U. S. Nuclear Regulatory Commission
Region III
799 Roosevelt Road
Glen Ellyn, Illinois 60137

SUBJECT: Abnormal Occurrence No. AO-50-331/75-7

FILE: A-118a, A-110

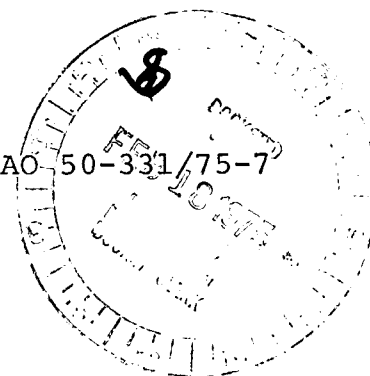

Dear Mr. Keppler:

In accordance with DAEC Technical Specifications, Section 6.11.2A.1, this letter is intended as notification of an abnormal occurrence at the Duane Arnold Energy Center on February 11, 1975. This letter, telecopied to your office, is intended to satisfy the requirements for notification by telegram within 24 hours of an abnormal occurrence.

Identification of Occurrence

Out-of-specification reactor low pressure switch, reportable in accordance with Appendix A, Operating License DPR-49, Specification 1.0.4.b.


Description of Occurrence

During the performance of STP 42B007 - Reactor Low Pressure (CS, RHR) Instrument Functional Test and Calibration, it was determined that contacts 2 and 3 of Pressure Switch 4529 would not trip at any setpoint. The Technical Specification Limit is 456.7 ± 15 psig. (450 psig setpoint + 6.7 psig head correction ± 15 psig design instrument tolerance.

Investigation is continuing.

A formal written report will be submitted to the Office of Directorate of Regulatory Operations within 10 days of the subject abnormal occurrence.

Very truly yours,



G. G. Hunt
Chief Engineer
Duane Arnold Energy Center

DLW/GGH/mg

cc: E. G. Case
C. W. Sandford
J. A. Wallace
G. G. Hunt
B. R. York
D. L. Wilson
R. R. Rinderman
L. D. Root
H. W. Rehrauer - Chairman, Safety Committee
G. A. Cook
B. L. Hopkins