

C 04/05/78

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)
DISTRIBUTION FOR INCOMING MATERIAL

50-263

REC: KEPPLER J G
NRC

ORG: MAYER L O
N STATES PWR

DOCDATE: 03/29/78
DATE RCVD: 04/03/78

DOCTYPE: LETTER NOTARIZED: NO
SUBJECT:

COPIES RECEIVED
LTR 1 ENCL 40

LICENSEE EVENT REPT (RO 50-263/78-003) ON 02/28/78 CONCERNING DURING
SURVEILLANCE TEST, MINIMUM FLOW IN "A" TRAIN SBGTS COULD NOT BE ATTAINED AS
REQUIRED BY TECH SPEC 3.7.B.1...W/ENCL.

PLANT NAME: MONTICELLO

REVIEWER INITIAL: XJM
DISTRIBUTOR INITIAL:

***** DISTRIBUTION OF THIS MATERIAL IS AS FOLLOWS *****

INCIDENT REPORTS
(DISTRIBUTION CODE A002)

FOR ACTION: BR CHIEF LEARN**W/4 ENCL

INTERNAL: REG FILE**W/ENCL
I & E**W/2 ENCL
SCHROEDER/IPPOLITO**W/ENCL
NOVAK/CHECK**W/ENCL
KNIGHT**W/ENCL
HANAUER**W/ENCL
EISENHUT**W/ENCL
SHAO**W/ENCL
KREGER/J. COLLINS**W/ENCL
K SEYFRIT/IE**W/ENCL

NRC PDR**W/ENCL
MIPC**W/3 ENCL
HOUSTON**W/ENCL
GRIMES**W/ENCL
BUTLER**W/ENCL
TEDESCO**W/ENCL
BAER**W/ENCL
VOLLMER/BUNCH**W/ENCL
ROSA**W/ENCL

EXTERNAL: LPDR'S
MINNEAPOLIS, MN**W/ENCL
TIC**W/ENCL
NSIC**W/ENCL
ACRS CAT.B**W/16 ENCL

COPIES NOT SUBMITTED PER
REGULATORY GUIDE 10.1

DISTRIBUTION: LTR 45 ENCL 45
SIZE: 1P+1P

CONTROL NBR: 780950030

***** THE END *****

7




NORTHERN STATES POWER COMPANY

MINNEAPOLIS, MINNESOTA 55401

March 29, 1978

Mr J G Keppler, Director
Office of Inspection & Enforcement
U S Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

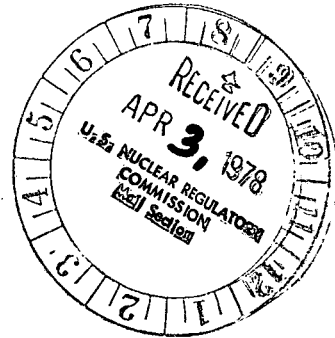

Dear Mr. Keppler:

MONTICELLO NUCLEAR GENERATING PLANT
Docket No. 50-263 License No. DPR-22

SBGTS "A" Train Low Flow

The Licensee Event Report for this occurrence is reproduced on the back of this letter. Enclosed are three copies.

This event is reported in compliance with Technical Specification 6.7.B.2.b since it constitutes operation in a degraded mode for a period of time permitted by the Limiting Conditions for Operation.

Yours very truly,

M L Mayer

L O Mayer, PE
Manager of Nuclear Support Services

LOM/MHV/deh

cc: Director, IE, USNRC (30)
Director, MIPC, USNRC (3)
MPCA

Attn: J W Ferman

REGULATORY DOCKET FILE COPY

780950030

-over-

A002/s *
1/40

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M N M N P 1 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 LICENSEE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 30 57 CAT 58

CON'T
0 1 REPORT SOURCE L 6 0 5 0 0 0 2 6 3 7 0 2 2 8 7 8 8 0 3 2 9 7 8 9
7 8 60 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

0 2 DURING SURVEILLANCE TEST, MINIMUM FLOW IN "A" TRAIN SBGTS COULD NOT BE ATTAINED AS
0 3 REQUIRED BY T.S. 3.7.B.1. "B" TRAIN WAS SHOWN TO BE OPERATIONAL. ALSO ADEQUATE FLOW
0 4 WOULD HAVE BEEN OBTAINED, THROUGH BOTH SBGTS UNDER AUTOMATIC INITIATION CONDITIONS.
0 5 NO EFFECT ON THE PUBLIC HEALTH AND SAFETY. PREVIOUS SIMILAR EVENT REPORTABLE OCCURR-
0 6 ENCE M-RO-77-13 DATE 6-23-77.

0 7
0 8
7 8 9

0 9 SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP. SUBCODE VALVE SUBCODE
S C 11 E 12 B 13 V A L V O P 14 D 15 Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20
17 LER/RO REPORT NUMBER 7 8 21 22 23 24 25 26 27 28 29 30 31 32
ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPRD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER
A 18 Z 19 Z 20 Z 21 0 0 0 0 22 N 23 Y 24 X 25 M 4 3 0 26
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

1 0 DILUTION FLOW FROM COMPRESSED STORAGE NOT ISOLATED BY BV-4 WHEN SBGTS "A" TRAIN
1 1 STARTED. FOREIGN MATERIAL IN BV-4 POSITIONER (MODEL 6608-004, 6" STROKE, DOUBLE
1 2 ACTING). REPLACED POSITIONER AND INSTALLED FILTER IN CYLINDER SUPPLY/RETURN LINE.
1 3
1 4

1 5 FACILITY STATUS 1 0 0 0 28 29 NA 30 METHOD OF DISCOVERY B 31 MONTHLY SURVEILLANCE 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
1 6 ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY 35 NA 36 LOCATION OF RELEASE 36
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
1 7 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION 39 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
1 8 PERSONNEL INJURIES NUMBER DESCRIPTION 41 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
1 9 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION 43 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
2 0 PUBLICITY ISSUED DESCRIPTION 45 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

NAME OF PREPARER D. D. TILLY

PHONE: (612) 295-5151