

Prepared for:
Tronox
Crescent, Oklahoma


Conceptual Site Model (Revision – 01) Cimarron Site, Crescent, Oklahoma October 2006

ENSR Corporation
October 2006
Document No.: 04020-044

TRONOX

ENSR | AECOM

Prepared for:
Tronox
Crescent, Oklahoma

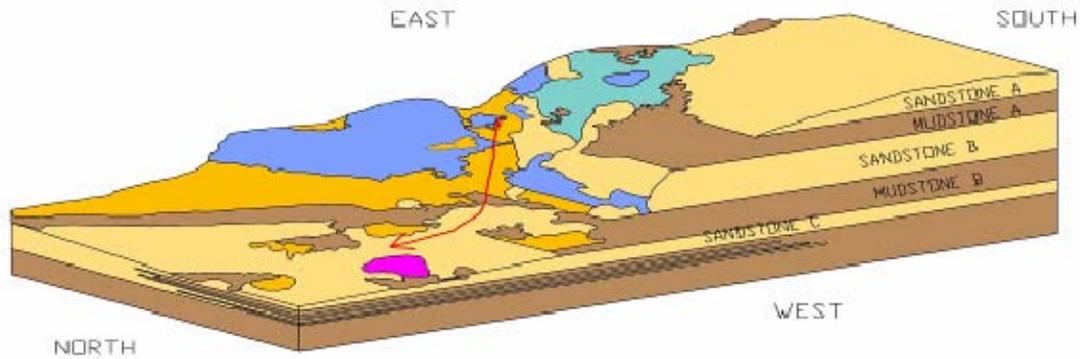

Pictorial Representation of Site Model – Burial Area # 1

Conceptual Site Model, (Revision – 01) Cimarron Site, Crescent, Oklahoma

D. J. Ferguson

Prepared By: D. Joseph Ferguson

Michael K. Meenan

Reviewed By: Michael K. Meenan, PE

ENSR Corporation
October 2006
Document No.: 04020-044

TRONOX

ENSR | AECOM

Contents

- 1.0 Introduction 1-1**
 - 1.1 Role of Conceptual Site Models 1-1
 - 1.2 Existing Cimarron Site Characterization Documents/Models 1-1
 - 1.3 Purpose 1-8
 - 1.4 Technical Considerations 1-8
 - 1.5 Branch Technical Position Options and Groundwater Release Criteria 1-8
 - 1.6 Report Structure 1-9

- 2.0 Geological Conceptual Site Model 2-1**
 - 2.1 Regional Geology of the Cimarron Area 2-1
 - 2.1.1 Topography 2-1
 - 2.1.2 Regional Stratigraphy and Structure 2-1
 - 2.1.3 Cimarron River 2-1
 - 2.2 Stratigraphy of the Cimarron Site 2-2
 - 2.3 Detailed Stratigraphic Correlations at Cimarron 2-3
 - 2.3.1 BA #1 Area 2-4
 - 2.3.2 Western Upland Area 2-5
 - 2.3.3 Western Alluvial Area 2-6
 - 2.4 Summary 2-6

- 3.0 Hydrogeological Conceptual Site Model 3-1**
 - 3.1 General Hydrogeology of the Cimarron Area 3-1
 - 3.1.1 Climate 3-1
 - 3.1.2 Cimarron River Floodplain 3-1
 - 3.1.3 Other Surface Water Features in the Cimarron Area 3-2
 - 3.1.4 Regional Groundwater in the Cimarron Area 3-2
 - 3.2 Groundwater Flow at the Cimarron Site 3-3
 - 3.2.1 Delineation of Water-bearing Units 3-3
 - 3.2.2 Potentiometric Surfaces 3-5
 - 3.2.3 General Groundwater Flow Patterns 3-5
 - 3.2.4 Groundwater/Surface Water Interactions 3-5
 - 3.2.5 Cimarron River Floodplain 3-6
 - 3.3 Groundwater Flow Regimes at the Cimarron Site 3-6
 - 3.3.1 BA #1 Area 3-6
 - 3.3.2 Western Upland Area 3-7
 - 3.3.3 Western Alluvial Area 3-8
 - 3.4 Summary 3-9

Contents, continued

4.0 Geochemical Conceptual Site Model	4-1
4.1 Historical Overview of Sources of Uranium Impact	4-1
4.1.1 Disposal Trenches in BA #1 Area	4-2
4.1.2 Disposal Trenches in the BA #2 and #3 Areas	4-2
4.1.3 West Pipeline	4-2
4.2 General Groundwater Chemistry	4-3
4.2.1 Shallow Sandstone Units	4-3
4.2.2 Deeper Sandstone Unit	4-4
4.2.3 Alluvium	4-4
4.3 Area-specific Geochemical Considerations	4-5
4.3.1 BA #1 Area	4-5
4.3.2 Western Upland Area	4-7
4.3.3 Western Alluvial Area	4-7
4.4 Uranium Impacts to Groundwater	4-8
4.4.1 Geochemistry of Uranium	4-8
4.4.2 BA #1 Area	4-10
4.4.3 Western Upland Area	4-11
4.4.4 Western Alluvial Area	4-12
4.4.5 Surface Water	4-12
5.0 Integrated Conceptual Model	5-1
5.1 BA #1 Area	5-1
5.1.1 Nature and Extent	5-1
5.1.2 Fate and Transport	5-2
5.1.3 Impact to Receptors	5-3
5.2 Western Upland Area	5-3
5.2.1 Nature and Extent	5-4
5.2.2 Fate and Transport	5-4
5.2.3 Impact to Receptors	5-4
5.3 Western Alluvial Area	5-4
5.3.1 Nature and Extent	5-4
5.3.2 Fate and Transport	5-5
5.3.3 Impact to receptors	5-5
6.0 Conclusions and Recommendations	6-1
6.1 Purpose and Objective	6-1
6.2 BA #1 Area	6-1
6.2.1 Conclusion	6-1
6.2.2 Recommendation	6-1

Contents, continued

6.3	Western Upland Area	6-1
6.3.1	Conclusion.....	6-1
6.3.2	Recommendation.....	6-2
6.4	Western Alluvial Area	6-2
6.4.1	Conclusion.....	6-2
6.4.2	Recommendation.....	6-2
7.0	References.....	7-1

List of Appendices

Appendix A Stiff Diagrams for Wells Sampled August/September 2004

List of Tables

Table 2-1	Geologic Units Exposed in Southern Logan and Northern Oklahoma Counties, Oklahoma
Table 4-1	August/September 2004 Groundwater Monitoring Data
Table 4-2	Cimarron River Water Quality Data

List of Figures

- Figure 2-1 Site Location Map
- Figure 2-2 Tectonic Province Map of Oklahoma
- Figure 2-3 Site Map
- Figure 2-4 BA #1 Area Cross-Section Location Map
- Figure 2-5 BA #1 Area Geological Cross-Section A-A'
- Figure 2-6 BA #1 Area Fence Diagram
- Figure 2-7 BA #1 Area Paleochannel in Transitional Zone
- Figure 2-8 Cross-Section Locations for Western Portion of Site
- Figure 2-9 Geological Cross-Section B-B' Western Upland and Alluvial Areas
- Figure 2-10 Geological Cross-Section C-C' Sanitary Lagoon to U-Pond #2 Area
- Figure 2-11 Western Upland and Alluvial Area Fence Diagram

- Figure 3-1 Geology along the Cimarron River from Freedom to Guthrie, Oklahoma
- Figure 3-2 Location of Network Wells, Base-Flow Stream-Measuring Sites along the Cimarron River from Freedom to Guthrie, Oklahoma

- Figure 3-3 Well Locations and Upland/Alluvium Division Map
- Figure 3-4 BA #1 Area Potentiometric Surface Map
- Figure 3-5 Western Upland Area Potentiometric Surface Map
- Figure 3-6 Western Alluvial Area Potentiometric Surface Map

- Figure 4-1 Stiff Diagrams for Sandstone Units
- Figure 4-2 Stiff Diagrams for Alluvium
- Figure 4-3 Distribution of Total Dissolved Solids in BA #1 Area Groundwater
- Figure 4-4 Distribution of Sulfate Ions in BA #1 Area Groundwater
- Figure 4-5 Distribution of Chloride Ions in BA #1 Area Groundwater
- Figure 4-6 Distribution of Bicarbonate Alkalinity in BA #1 Area Groundwater
- Figure 4-7 Distribution of Water Types in BA #1 Area
- Figure 4-8 Piper Diagram of BA #1 Area Water Samples
- Figure 4-9 Water Pattern Distribution in West Alluvial Area
- Figure 4-10 Piper Diagram for Groundwater Samples from Western Portion of Site
- Figure 4-11 Uranium Distribution in BA #1 Area as of August 2004
- Figure 4-12 Uranium Distribution in BA #1 Area as of August 2002
- Figure 4-13 Uranium Distribution Map for Western Portion of Site
- Figure 4-14 Water Type and Uranium (U) Impact Distribution in Western Upland Area
- Figure 4-15 Water Type and Uranium (U) Impact Distribution in Western Alluvial Area

List of Abbreviations and Acronyms

AEC	Atomic Energy Commission
amsl	above mean sea level
Bq/L	Becquerels per liter
BTP	Branch Technical Position
cfs	cubic feet per second
cm/s	centimeters per second
CSM	conceptual site model
DEQ	Department of Environmental Quality
EC	effluent concentrations
MCLs	Maximum Concentration Limits
meq/100g	milliequivalents per 100 grams
meq/L	milliequivalents per liter
µg/L	micrograms per liter
mg/L	milligrams per liter
mL/g	milliliters per gram
mrem/yr	millirem per year
mSv/yr	millisieverts per year
mv	millivolts
NRC	Nuclear Regulatory Commission
NWIS	National Water Information System
ORISE	Oak Ridge Institute for Science and Education
pCi/g	picocuries per gram
pCi/L	picocuries per liter
TC-99	Technetium-99
TDS	total dissolved solids
TEDE	Total Effective Dose Equivalent
UF ₆	uranium hexafluoride
USEPA	United States Environmental Protection Agency
USGS	United States Geological Survey

1.0 Introduction

Cimarron Corporation's site (Cimarron Site) near Crescent, Oklahoma, is a former nuclear fuel manufacturing facility. Since the cessation of operations, the site has been undergoing decommissioning. This decommissioning is being performed by Cimarron Corporation with oversight from the Nuclear Regulatory Commission (NRC) and the Oklahoma Department of Environmental Quality (Oklahoma DEQ). The evaluation presented in this report has been performed to update the understanding of Cimarron Site's geology and hydrogeology based on new data collected since the initial conceptual site model (CSM) was developed. This CSM is focused specifically on areas where impacts remain to be fully remediated: Burial Area #1 (BA #1 Area); the Western Upland Area; and the Western Alluvial Area. Cimarron Corporation completed this evaluation to assist in development of a consensus, among agencies and interested parties, on existing site conditions for use in developing plans for actions to complete remediation of the site.

1.1 Role of Conceptual Site Models

A CSM is defined as a written or pictorial representation of an environmental system, and the biological, physical, and chemical processes that determine the transport of contaminants from sources through environmental media to environmental receptors within the system (ASTM E1689-95(2003) e1).

A CSM is typically used to integrate available site information and to evaluate whether additional information should be collected. The model is used furthermore to facilitate the selection of remedial alternatives and to evaluate the effectiveness of remedial actions. The development of a CSM is normally iterative. Model development should start as early as possible in the site investigation process. In addition, the model should be updated and revised throughout the site investigation process to incorporate additional site data. As part of the ongoing process of updating the CSM as new data becomes available, this current edition of the CSM reflects the addition of data associated with additional field sampling and the development of a groundwater flow model that have occurred since the August 2005 edition (Revision 0) was produced.

1.2 Existing Cimarron Site Characterization Documents/Models

Assessment at the Cimarron Site has been ongoing since the decommissioning process began in 1979. From this period, the following eleven principal characterization documents are integral in the development of the CSM that is being used for the Cimarron Site:

1. Site Investigation Report for the Cimarron Corporation Facility, Logan County, Oklahoma, James L. Grant & Associates, September 1989.
2. Radiological Characterization Report for Cimarron Corporation's Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, Chase Environmental Group, October 1994.
3. Groundwater and Surface Water Assessment for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, Chase Environmental Group, Inc., December 1996.
4. Cimarron Decommissioning Plan Groundwater Evaluation Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, Cimarron Corporation, July 1998.

5. Environmental Assessment by the Office of Nuclear Material Safety and Safeguards of the Proposed Decommissioning Plan and Other Proposals Related to the Cimarron Corporation Former Fuel Fabrication Facility, Nuclear Regulatory Commission Office of Nuclear Material Safety and Safeguards, July 1999.
6. Burial Area #1 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Cimarron Corporation, January 2003.
7. Justification for Utilization of Fully Penetrating Groundwater Monitoring Wells in Shallow Alluvial Aquifer at the Cimarron Facility, Chase Environmental Group, January 2003.
8. Assessment Report for Well 1319 Area for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Cimarron Corporation, December 2003.
9. Technetium-99 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, Chase Environmental Group, Inc., December 2003.
10. Refined Conceptual Site Model, Cimarron Site, Crescent, Oklahoma, ENSR Corporation, August 2005.
11. Ground Water Modeling Report, Cimarron Site, Crescent, Oklahoma, ENSR Corporation, October 2006.

A brief synopsis of each of these eleven reports is presented in the box below.

<p>1. Site Investigation Report for the Cimarron Corporation Facility, Logan County, Oklahoma</p> <p>James L. Grant and Associates September 1989</p>	<p>This report summarizes geological and hydrogeological site investigations conducted at the Cimarron Site and provided the basis for understanding the geological and hydrogeological controls on surface soil, bedrock, and aquifer radiological impacts and the potential movements of impacts. This report provided the first comprehensive CSM and set the stage for determining which areas of the site could have been affected radiologically by former Cimarron facility activities.</p> <p>This report contains the following information:</p> <ul style="list-style-type: none"> • Characterization of the stratigraphy and lithology of the soils and bedrock at the site; • Characterization of aquifer properties including hydraulic conductivity, groundwater flow directions, and gradient; • Characterization of groundwater quality and determination of the effects that facility operations may have had on groundwater quality; and • Determination of the mobility of radionuclides, particularly uranium, in the subsurface and the ability of subsurface materials to retard migration at the Cimarron Site.
--	--

<p>2. Radiological Characterization Report for Cimarron Corporation's Nuclear Fuel Fabrication Facility, Crescent, Oklahoma</p> <p>Chase Environmental Group 1994</p>	<p>This report presents the results of field radiological investigations at the Cimarron Site. It facilitated the subsequent decommissioning of areas potentially affected by previous facility operations. The report also summarizes the site operational history and the decommissioning activities, such as removal of impacted waste and soil up to that date at the Cimarron Site.</p> <ul style="list-style-type: none"> • This report presents results from a combination of scoping surveys, characterization surveys, remediation control surveys, pre-remediation surveys, post-remediation surveys, final surveys, and confirmatory surveys (Oak Ridge Institute for Science and Education (ORISE) and NRC confirmatory survey results are included for some areas and, in some cases, survey results are included for areas that had already been released by the NRC). • Only uranium and plutonium in chemically separated form were used in the production processes at the Cimarron Site. The concentration of daughter radionuclides was negligible. Radium and thorium detected in groundwater and soil samples were at natural background levels and were, thus, not due to the effects of facility operations.
<p>3. Groundwater and Surface Water Assessment for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma</p> <p>Chase Environmental Group, Inc. December 1996</p>	<p>This report reviews background water quality; assesses historical and then-current groundwater data to determine impacts from past operations; and identifies changes to groundwater quality since issuance of the report prepared by James L. Grant and Associates in 1989. This report also reviews existing surface and groundwater data, including data from a comprehensive sampling event performed in 1996. The conclusions of this report are:</p> <ul style="list-style-type: none"> • Background, near-surface groundwater quality is hard to very hard, and contains elevated concentrations of dissolved solids, chlorides, sulfates, and nitrates, thus limiting its potential for usage as a potable supply. • The geology of the site limits the groundwater available for withdrawal for beneficial usage to approximately one gallon per minute or less of sustained pumping. • Shallow groundwater, which is found in Sandstones A and B, flows north-northwest until it is discharged to either the ground surface as seeps along low-lying bluffs and cliffs or to the Cimarron River alluvium. • With source removal and further remediation, substantial improvements in localized groundwater quality had been realized as of the date of this report. Groundwater testing indicated that past operations may have affected the groundwater quality adjacent to one or two former waste management units.

- Only one well location contained groundwater exceeding the uranium effluent concentration (EC) limits presented in 10 CFR 20. Well 1315, located between trenches within the BA #1 Area, showed a total uranium concentration that was twice the EC limit in 1996. However, the 1996 sampling results reflect a substantial reduction in concentration from the 1990 level of 27 times the EC limit. In general, for other wells with slightly elevated uranium, similar downward (improving quality) trends were occurring. Groundwater impacts were contained totally on site.
- The deeper wells, located in Sandstone C, have not shown any affect from former facility operations.

4. Cimarron Decommissioning Plan Groundwater Evaluation Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma

Cimarron Corporation
July 1998

The purpose of this report was to provide information regarding groundwater at the Cimarron Site for inclusion in the Cimarron Decommissioning Plan. This report addresses vicinity and site geology/hydrology, presents a summary of closure activities for areas that had groundwater impact, describes background and affected-area groundwater quality, assesses the trending of environmental data for affected areas, and presents a proposal for additional work at the BA #1 Area. The conclusions of this report were as follows:

- Effective confining mudstone strata are present between each of the groundwater zones of Sandstones A, B, and C on site. These mudstones influence the lateral flow of groundwater and act to limit the potential downward migration of shallow groundwater between the three sandstone units.
- The bluffs overlooking the Cimarron River represent a very large discharge zone that continually drains the upper sandstones. In fact, the upper sandstones were not saturated in those site areas near the bluffs.
- The historical and more-recent groundwater and surface water investigations clearly showed that groundwater radionuclide impacts had abated and continued their decreasing trends from the levels reported in 1989 by J.L. Grant and Associates.
- Shallow groundwater in Sandstones A and B generally discharges to the incised drainage pathways and the seeps in the low-lying bluffs and cliffs that border the floodplain of the Cimarron River.
- Deeper groundwater in both Sandstones B and C discharges to the alluvial deposits that underlie and comprise the Cimarron River bottom and the adjoining floodplain.
- Cimarron Corporation would continue to monitor groundwater in the BA #1 Area on a quarterly basis. Even though Cimarron Corporation believed that groundwater concentrations would continue to decrease, it agreed to conduct additional studies for the purpose of understanding the attenuation mechanisms. These studies were to include additional hydrogeologic evaluations of the general area.

	<ul style="list-style-type: none"> • Cimarron Corporation agreed to retain and control the property areas formerly licensed under NRC Radioactive Material SNM-928 until the proposed groundwater criteria were met. In the unlikely event that the uranium concentrations did not decline sufficiently during the monitoring period, Cimarron Corporation agreed to prepare a corrective action program.
<p>5. Environmental Assessment by the Office of Nuclear Material Safety and Safeguards of the Proposed Decommissioning Plan and Other Proposals Related to the Cimarron Corporation Former Fuel Fabrication Facility</p> <p>Nuclear Regulatory Commission Office of Nuclear Material Safety and Safeguards July 1999</p>	<p>This report assesses the environmental impact of the decommissioning proposed by Cimarron Corporation. It also considers the no-action alternative. This report was prepared and issued pursuant to the National Environmental Policy Act of 1969 (NEPA) and NRC's regulations in 10 CFR 51.</p> <p>NRC staff reviewed both the beneficial and adverse potential impacts of the proposed decommissioning. The staff's conclusions were as follows:</p> <ul style="list-style-type: none"> • Radiation exposures of persons living or traveling near the site because of onsite operations and waste transportation will be well within the limits contained in 10 CFR 20. • Cimarron Corporation proposed a groundwater standard of 6.7 Becquerels per liter (Bq/L) (180 picocuries per liter [pCi/L]) for total uranium, which it demonstrated to equate to the allowable 0.25 millisieverts per year (mSv/yr) (25 millirems per year (mrem/yr) Total Effective Dose Equivalent (TEDE) to the hypothetical individual drinking the water. NRC staff found the proposed groundwater standard of 6.7 Bq/L (180 pCi/L) for total uranium to be acceptable because the 0.025 mSv/yr (25 mrem/yr) dose associated with that standard, when added to the negligible dose from all other pathways is well below the 0.1 mSv/yr (100 mrem/yr) limit in 10 CFR 20.1301 for individual members of the public. In addition, the likelihood of this groundwater ever being used for domestic or agricultural purposes is low. <p>On the basis of this report, NRC staff concluded that the proposed action would not have any significant effect on the quality of the human environment and did not warrant the preparation of an environmental impact statement.</p>
<p>6. Burial Area #1 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility</p> <p>Cimarron Corporation January 2003</p>	<p>This document details the comprehensive investigation of uranium in groundwater in the BA #1 Area. The conclusions presented in this report were as follows:</p> <ul style="list-style-type: none"> • None of the soils within the area of groundwater impact exceed the Option 1 criteria for unrestricted release (30 picocuries per gram [pCi/g] above background) in the NRC Branch Technical Position (BTP), "Disposal or Onsite Storage of Thorium and Uranium Wastes from Past Operations." • Uranium concentrations in Sandstone C ranged from 6 to 34 pCi/L for the locations monitored, which is consistent with background levels of Sandstone C.

- A clay/mudstone lithologic unit underlies a significant portion of the area of uranium impact.
- The shallow groundwater shows a steep gradient in the bedrock area, and flattens considerably as groundwater discharges into the alluvium.
- The geology of the area has been adequately characterized.
- Geotechnical properties of subsurface materials have been quantified.
- The source of licensed material has been removed.
- The disposal trenches extended through the low-permeability materials that covered Sandstone B and the more permeable alluvial material.
- The upland area is characterized by Mudstone A overlying Sandstone B, with a buried escarpment covered by alluvial materials.
- There is a transitional zone characterized by low-permeability material (clay and clayey silts) with depth in the alluvial channel.
- The alluvium typically consists of a layer of fine, well-rounded sands overlain by silts and clays. In a small portion of the area, the sand extends to the surface.
- There is a low-permeability layer (clay and/or shale/mudstone) underlying the alluvial sands in most of the area.

7. Justification for Utilization of Fully Penetrating Groundwater Monitoring Wells in Shallow Alluvial Aquifer at the Cimarron Facility

Chase Environmental Group
January 2003

This technical assessment presents both hydrogeological and future land use information that explains the rationale behind Cimarron Corporation’s decision to install monitor wells that are screened across the full saturated thickness of the alluvial aquifer. This paper addresses the nature of the alluvial aquifer and explains why potential future users of groundwater would install wells screened through the entire saturated thickness.

This technical assessment presents the conclusion that the shallow alluvium downgradient from the BA #1 Area consists of a vertically undifferentiated and unconfined hydrogeologic unit that is formed by a complex mixture of mostly sand with laterally discontinuous alluvial deposits of clay, silt, and gravel.

As a result of the geologic and hydrogeologic characteristics of the shallow alluvial aquifer, the relatively thin and unconfined water-bearing zone of the alluvial deposits cannot practically be separated into an upper and/or lower zone for vertical differentiation of the uranium impact that will require remediation.

<p>8. Assessment Report for Well 1319 Area for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility</p> <p>Cimarron Corporation December 2003</p>	<p>This report summarizes the groundwater evaluation of licensed material in the area of the former Uranium Plant yard near Well 1319. The report presents the following conclusions:</p> <ul style="list-style-type: none"> • Licensed material in the Well 1319 Area was limited to Sandstones B and C. • Sandstone A was unimpacted because the original Well 1319 was not perforated through the Sandstone A interval. • Groundwater in Sandstones B and C exceeding the limit of 180 pCi/L was restricted to a very small area downgradient of the former well 1319. <p>The report demonstrates that groundwater beneath the Uranium Plant yard had been remediated and the area was ready for release.</p>
<p>9. Technetium-99 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma</p> <p>Chase Environmental Group Inc. December 2003</p>	<p>This report presents the results of the Technetium-99 (Tc-99) groundwater assessment performed for the Cimarron Site. This assessment was performed in response to the NRC's March 12, 2002, letter requesting further evaluation of the presence of Tc-99 in groundwater at the Cimarron Site. The source of the Tc-99 at the facility is due to this radionuclide, which is a fission product, being shipped to the facility as a contaminant present in Atomic Energy Commission (AEC) supplied uranium hexafluoride (UF₆) feed material. This report presents the following results:</p> <ul style="list-style-type: none"> • Shallow groundwater within Sandstones A and B downgradient from U-Pond #2 has been impacted by prior site operations and shows elevated concentrations of Tc-99. • Seep 1208 was the only sampling location that has yielded Tc-99 concentrations slightly above the license termination guideline value of 3,790 pCi/L. • Since the original source (i.e., U-Ponds #1 and #2) had been removed, concentrations of Tc-99 in groundwater and at the discharge zones will continue to decrease as well as concentrations of Tc-99 in the alluvium. <p>This report demonstrated that elevated levels of Tc-99 were present downgradient from the two former waste management areas of U-Pond #1 and U-Pond #2 within Sandstone A and at the seep outcrops.</p>
<p>10. Refined Conceptual Site Model, Cimarron Site, Crescent, Oklahoma</p> <p>ENSR Corporation August 2005</p>	<p>This report was written to update the understanding of Cimarron Site's geology, hydrogeology, and groundwater geochemistry based on new data collected since the initial conceptual site model (CSM) was developed. This CSM is focused specifically on areas where impacts remain to be fully remediated: Burial Area #1 (BA #1 Area); the Western Upland Area; and the Western Alluvial Area. Cimarron Corporation completed this evaluation to assist in development of a consensus, among agencies and interested parties, on existing site conditions for use in developing plans for actions to complete remediation of the site.</p>

11. Groundwater Modeling Report, Cimarron Site, Crescent, Oklahoma

ENSR Corporation
October 2006

This report documents the construction and execution of two numerical flow models developed for the BA#1 and Western Alluvium areas in support of groundwater remediation design at the Cimarron site. Details of model setup, calibration, sensitivity analysis, and results are discussed in the report. The models can be used for optimization of well network in pump-and-treat and prediction of oxygen flux in bioremediation.

1.3 Purpose

The purpose of this CSM is to compile and integrate both historical and current information into a comprehensive model of the BA #1 Area and the Western Alluvial Area. The CSM will also be used to facilitate the selection of remedial alternatives and to evaluate the effectiveness of remedial actions in removing licensed material from site groundwater. This CSM is intended to establish a foundation for all parties to share the same understanding of the site characterization, which will enable technical and regulatory personnel to resolve issues concerning the site, and facilitate the decision-making process.

1.4 Technical Considerations

During the course of investigations and assessments of surface water and groundwater at the Cimarron Site since 1990, multiple approaches and methodologies have been discussed and resolved between Cimarron Corporation, NRC, and Oklahoma DEQ. These agreements and understandings have been incorporated into the data acquisition programs at the site. These agreements and understandings, therefore, have a bearing on the information and interpretations outlined in this CSM report. The following is a summary of these technical considerations, agreements, and understandings:

- For the purposes of this CSM report, areas of the Cimarron Site that have continuing groundwater impacts are more extensively considered than areas that have been released and/or areas that are pending release because they currently comply with decommissioning criteria (e.g., Well Area in Subarea K).
- Cimarron Corporation derived a site-specific release criteria limit of 180 pCi/L for uranium in groundwater, which was subsequently approved by the NRC and Oklahoma DEQ.
- NRC stipulated that Tc-99 would have an action limit of 3,790 pCi/L in groundwater at the Cimarron Site.
- Groundwater monitor wells installed in the Cimarron River alluvium are screened across the entire saturated interval.

1.5 Branch Technical Position Options and Groundwater Release Criteria

NRC approved use of the 1981 Branch Technical Position (BTP) as the criteria for decommissioning soils at the Cimarron Site. In their October 5, 1991, letter (SECY 81-576) NRC staff identified five acceptable options for disposal or onsite storage of uranium or thorium. Two of these BTP Options (BTP #1 and BTP #2) have been incorporated into License Condition 27(b) and were utilized at the Cimarron Site during decommissioning activities. These two options are described as follows:

- BTP Option #1 – Allows for the disposal of natural thorium with daughters in secular equilibrium, depleted or enriched uranium, and uranium ores with daughters in secular equilibrium with no restriction on burial method. The concentration limits for natural thorium and depleted or

enriched uranium are set sufficiently low that no member of the public is expected to receive unacceptable radiation under any foreseeable use of the material or property. Material that meets Option 1 limits can be treated as “clean” soil. The BTP Option #1 concentration limit for uranium is 30 pCi/g for enriched uranium and 35 pCi/g for depleted uranium.

- BTP Option #2 – Allows for the disposal of natural thorium with daughters in secular equilibrium and depleted or enriched uranium with no daughters present when buried under prescribed conditions with no subsequent land use restrictions and no continuing NRC licensing of the material. Under this option, burial will be permitted only if it can be demonstrated that the buried materials will be stabilized in place and not be transported away from the site. Acceptability of the site for disposal will depend on topographical, geological, hydrogeological, and meteorological characteristics of the site. At a minimum, burial depth will be at least four feet below the surface. The BTP Option #2 concentration range is up to 100 pCi/g for soluble uranium and up to 250 pCi/g for insoluble uranium.

The release criteria for groundwater at the Cimarron Site is 6.7 Bq/L (180 pCi/L) total uranium. Cimarron Corporation will retain control of the property licensed under NRC Radioactive Material License SNM 928 until the groundwater release criteria are met.

1.6 Report Structure

This report is organized as described below.

Section 1.0 Introduction – Presents a discussion of the role of a CSM, a review of past site characterization efforts and understandings, and the reasons for development of this refined CSM.

Section 2.0 Geological Conceptual Site Model – Presents a discussion of the regional geology of the Cimarron Area, the stratigraphy of the Cimarron Project Site, including detailed stratigraphic correlations, and a summary of the Cimarron Project Geological Model.

Section 3.0 Hydrogeological Conceptual Site Model – Presents a discussion of the general hydrogeology of the Cimarron Area, groundwater flow at the Cimarron Site (including delineation of water-bearing units, potentiometric surfaces, flow patterns, surface water interactions, Cimarron River floodplain), and specific area groundwater flow regimes (i.e., BA #1 Area and Western Plume Area).

Section 4.0 Geochemical Conceptual Site Model – This section presents a discussion of the groundwater geochemistry of the primary water-bearing zones; a discussion of the various geochemical patterns observed in groundwater in the BA #1 Area, Western Upland Area, and Western Alluvial Area; and a discussion of the distribution of licensed nuclear material detected in groundwater in these areas.

Section 5.0 Integrated Conceptual Site Model – This section combines the geological, hydrogeological, and geochemical models for the BA #1 Area, Western Upland Area, and Western Alluvial Area and presents an updated and refined CSM based on site data available as of 2004. The goal is to facilitate an understanding, not only of the nature and extent of uranium impact and the environment in which it is present, but of how the uranium is being transported, and expectations regarding its impact on potential receptors.

Section 6.0 Conclusions and Recommendations – This section presents key conclusions from the previous sections and recommendations for finalizing the CSM and for evaluation of remedial alternatives.

Section 7.0 References – Provides bibliographic citations for references used in development of this report.

2.0 Geological Conceptual Site Model

2.1 Regional Geology of the Cimarron Area

2.1.1 Topography

The Cimarron Site lies within the Osage Plains of the Central Lowlands section of the Great Plains physiographic province, just south of the Cimarron River in Sections 11 and 12, T16N, R4W in Logan County, Oklahoma (Figure 2-1). The topography in the Cimarron area consists of low, rolling hills with incised drainages and floodplains along major rivers. Most drainages are ephemeral and receive water from storms or locally from groundwater base flow. The two major drainages in the project area are Cottonwood Creek, which lies about 7 miles south of the site, and the Cimarron River, which borders the site on the north. Elevations in the Cimarron area range from 930 feet above mean sea level (amsl) along the Cimarron River to 1,010 feet amsl at the former plant site. Vegetation in the area consists of native grasses and various stands of trees along and near drainages. The soil (unconsolidated material) thickness in the project area ranges from about one to eight feet. Three unnamed drainages within the site boundaries were dammed to store water for agricultural and industrial use at the former plant site.

2.1.2 Regional Stratigraphy and Structure

The bedrock geology of the Cimarron Area is dominated by Permian-age clastic sedimentary rocks of the Garber-Wellington Formation as shown in Table 2-1.

These units dip to the west at 30 to 40 feet per mile (Carr and Marcher, 1977). The Permian-age Garber Sandstone and underlying Wellington Formation, which comprise the Garber-Wellington Formation, include lenticular channel and sheet-flood sandstones interbedded with shales and mudstones. The combined thickness of the Garber Sandstone and the Wellington Formation is about 1,000 feet. Because the two formations are difficult to distinguish in drill core and in outcrop and have similar water-bearing properties, they are often treated as a single mappable formation and grouped into a single hydrostratigraphic unit, the Garber-Wellington Aquifer (Wood and Burton, 1968).

Structurally, the Cimarron area is part of the Nemaha Uplift of Central Oklahoma (Figure 2-2). The Nemaha Uplift trends northward across Oklahoma and was formed during a period of uplift, faulting, and erosion that occurred between the Mississippian and Pennsylvanian Periods in the Oklahoma area. The Nemaha Uplift consists of north-northwest trending normal faults and anticlinal structures that influenced early Pennsylvanian-age sedimentation in the Oklahoma region (J.L. Grant and Associates, 1989). By middle Pennsylvanian time, the Nemaha Uplift was not active. During the Permian, when the Garber-Wellington Formation was deposited, Central Oklahoma was part of the eastern shelf of a shallow marine sea. The sandstones and shales of the Garber-Wellington Formation were deposited as part of a westward-advancing marine delta fed by numerous streams flowing to the west and northwest. Thus, the sands of the Garber-Wellington Formation are often sinuous, discontinuous, and exhibit the rapid facies changes typical of a deltaic channel and overbank depositional system. Sand accounts for 35 to 75 percent of the Garber-Wellington Formation (Carr and Marcher, 1977).

2.1.3 Cimarron River

The Cimarron River borders the northern side of the Cimarron Site. Floodplain sediments along the south side of the river in Sections 11 and 12 (Figure 2-1) are within the Cimarron Site boundaries. This river drains 4,186 square miles of Central Oklahoma from Freedom to Guthrie, Oklahoma (Adams and

Bergman, 1995). The Cimarron River is a mature river with a well-defined channel and floodplain. The stream bed is generally flat and sandy and the river is bordered by terrace deposits and floodplain gravels and sands (Adams and Bergman, 1995). The river is perennial with a low-water median flow rate of approximately 100 cubic feet per second (cfs) and a high-water median flow rate of 600 cfs (Adams and Bergman, 1995). In the area of the Cimarron Site, the ancestral Cimarron River has carved an escarpment into the Garber-Wellington Formation. Floodplain alluvial sediments currently separate most of the river channel from the escarpment within the site boundaries.

2.2 Stratigraphy of the Cimarron Site

The stratigraphy of the Cimarron Site is dominated by the Garber-Wellington Formation. The Garber Formation is exposed along the escarpment that borders the Cimarron River. The Wellington Formation was found at depth in a deep drill hole, but is not exposed within the project area. A boring completed in 1969 near the plant site penetrated 2,078 feet of the Garber-Wellington Formation (J.L. Grant and Associates, 1989). Identified in this boring was 200 feet of Garber Formation sandstones underlain by 960 feet of Wellington Formation red shales. Beneath the Wellington Formation, the Stratford Formation was found at a depth of 1,160 feet and consisted of red and gray shales with interbedded anhydrite.

Within the Cimarron Site boundaries, the Garber Formation consists primarily of sandstone layers separated by relatively continuous siltstone and mudstone layers (J.L. Grant and Associates, 1989). The sandstone units frequently have interbedded, but discontinuous, red-brown shale and mudstone lenses. Lateral facies changes are common in the sandstones and represent shifting channel locations in the Garber delta. J.L. Grant and Associates (1989) divided the Garber sandstones found in the Cimarron Site area into three basic sandstone units separated by two relatively continuous and identifiable mudstone layers. The stratigraphic division of the Garber at the Cimarron Site is summarized below from J.L. Grant and Associates (1989) and described in greater detail in Section 2.3:

- Sandstone A: Uppermost sandstone unit, generally red-brown to tan in color and up to 35 feet in thickness. Bottom of this sandstone unit occurs at an elevation of approximately 950–970 feet amsl (see Figures 2-5, 2-9, 2-10).
- Mudstone A: Red-brown to orange-brown, sometimes tan mudstone and claystone that separates Sandstones A and B. Ranges from 6 to 20 feet thick.
- Sandstone B: Second sandstone unit, similar in color and sedimentary features to Sandstone A. Found at elevations between 925 and 955 feet amsl and is up to 30 feet thick. Found below Mudstone A (see Figures 2-5, 2-9).
- Mudstone B: Mudstone and claystone separating Sandstone B and Sandstone C. Similar in color to Mudstone A and ranges from 6 to 14 feet thick.
- Sandstone C: Lowermost sandstone in the Garber-Wellington Formation. Similar in color and sedimentary features to overlying sandstones. This unit varies in thickness from 10 to 25 feet at the site to at least 100 feet thick regionally.

All three sandstone members of the Garber Formation at the Cimarron Site are basically similar lithologically. They are fine to very fine-grained red-brown to tan sandstones with well-sorted subangular to rounded grains and contain variable amounts of silt (J.L. Grant and Associates, 1989). The silt content ranges from 10 to 50 percent and the sandstones with high silt content are difficult to distinguish from siltstone. The sand grains are mostly quartz with minor amounts of feldspar and occasional magnetite and mica. The intergranular porosity varies with the silt content (J.L. Grant and Associates, 1989). The sandstones are weakly cemented and often friable. Cementing agents are calcite and hematite. Locally,

thin intervals can be found that are well cemented with gypsum and barite. These intervals are often conglomeratic. The sandstones exhibit planar cross-stratification with thin, silty laminae (J.L. Grant and Associates, 1989). Conglomeratic intervals are common in most of the borings and they are observed to contain clasts of mudstone and occasionally sandstone in either a sandstone or mudstone matrix. These conglomeratic zones are up to 2.5 feet thick. Vugs found in these conglomerate zones are lined with calcite, gypsum, and barite (J.L. Grant and Associates, 1989). The sandstones of the Garber Formation were deposited in a fluvial deltaic environment, probably as channel sands.

The mudstone layers that separate the sandstones in the Garber Formation at the Cimarron Site are mostly fine-grained, silty to shaley beds with a red-brown to orange-brown and tan color. The mudstones occasionally exhibit desiccation cracks (J.L. Grant and Associates, 1989). The mudstones are poorly consolidated. The mudstone layers are often encapsulated by thin, bluish-gray laminae that range in thickness from 0.1 to 4.0 inches. These "reduction zones" are common in red beds (J.L. Grant and Associates, 1989) and at the site the thickness of these reduction zones is approximately proportional to the thickness of the mudstone layer. These continuous mudstone layers probably represent deltaic overbank deposits formed during flooding of the Garber delta.

A mineralogical analysis of the sandstones and mudstones was conducted by Auburn University using X-ray diffraction, grain-size determinations, and cation exchange capacity measurements (J.L. Grant and Associates, 1989). Quartz and feldspar were found to be the main clastic grains with kaolinite and montmorillonite as the clays in the fine-grained fractions. Illite, smectite, chlorite, hematite, and goethite were also among the minerals detected in the clay fractions according to USGS (Parkhurst et al., 1996). Calcite, iron oxides, and iron hydroxides were identified as the main cementing agents. The clay fraction ranged from 6 to about 20 percent in the sandstones and from about 14 to 50 percent in the mudstones. The mudstones had a cation exchange capacity in the range of 6 to 22 meq/100g. The sandstones had a cation exchange capacity generally below 6 meq/100g. Exchangeable cations were generally calcium and magnesium for both the sandstones and the mudstones. Within the "reduction zones," minerals formed with metals in low oxidation state, including uranium, were identified (Parkhurst et al., 1996).

The Cimarron River floodplain alluvium consists of sand and silt, developed by the erosion of the Garber Formation from the escarpment bordering the river on the south, as well as material transported to the floodplain from upstream within the river system. This alluvium formed gradually over time and contains many buried channels reflective of both transport of the alluvial materials northward toward the river from the escarpment and meandering of the main river channel. Near the present river channel, buried oxbow meanders can be expected. Near the escarpment, buried channels would be expected to be the continuation of present drainages incised into the escarpment sandstones. The alluvium is about 30 to 40 feet thick. Along the present escarpment face, there are local transition zones from the sandstones of the Garber Formation to the coarser alluvial materials. These transition zones can be clay-rich, as is the case with the transitional zone identified with borings in the BA #1 Area.

2.3 Detailed Stratigraphic Correlations at Cimarron

The Cimarron Site has sufficient borings and monitor wells to allow for generalized stratigraphic correlations within specific areas of the site and across the site. Extensive subsurface investigations were performed in the BA #1 Area, Western Upland Area, and Western Alluvial Area (see Figure 2-3). The following sections present a discussion on detailed stratigraphic correlations of these three areas.

2.3.1 BA #1 Area

The BA #1 Area is located in the northeastern corner of the Cimarron Site and includes an upland area and a portion of the floodplain of the Cimarron River (Figure 2-3). Ground surface elevation of the area ranges from 935 feet amsl within the Cimarron River floodplain to 975 feet amsl in the upland area, with a total relief of 40 feet. A buried escarpment separates the upland from the Quaternary alluvial deposits of the Cimarron River floodplain. Four former disposal trenches are situated in the upland near the escarpment. Figure 2-4 shows the location of the geological cross-section presented in Figure 2-5, as well as the location of the former disposal trenches and the monitor wells in the area. Figure 2-5, the geological cross-section of the BA #1 Area, illustrates the lithology and stratigraphy of the area.

The upland is underlain by the Garber Formation. The sandstone units present in the BA #1 Area are mainly Sandstone B and Sandstone C. Sandstone A is eroded from most of the BA #1 Area and was observed to only be approximately 10 feet thick in a borehole (Well 1314) located south of the former disposal trenches. Mudstone A is present in the southern portion of the upland and Sandstone B and Mudstone B appears to be continuous across the upland (Figure 2-5).

The uppermost unit of the Garber Formation exposed in the BA #1 Area is Mudstone A, which is a 10-foot-thick sequence of mudstone and silty mudstone overlying Sandstone B in the southern portion of this area (Figure 2-5).

Sandstone B in the BA #1 Area consists of up to 25 feet of red-to-tan sandstone and silty sandstone. This unit is exposed along the escarpment where it borders the floodplain alluvial sediments.

Mudstone B underlies Sandstone B and separates Sandstone B from Sandstone C. With the exception of areas under the floodplain alluvial sediments, this unit is continuous throughout the BA #1 Area and is considered to be continuous across the entire site.

Sandstone C is the lowermost stratigraphic unit encountered while drilling in the BA #1 Area. It is a sequence of interlayered sandstones and mudstones and underlies the entire site. This unit forms the bedrock beneath the floodplain alluvium (Figure 2-5).

Alluvial sediments in the Cimarron River floodplain consist of sand, silt, and clay. The relative abundance of each material is dependent on the distance relative to the upland, as seen in Figure 2-5. Clay and silt are the dominant lithologic types in areas adjacent to the upland. Farther away from the upland toward the Cimarron River channel, the proportion of sand increases and sand becomes the predominant lithology. Consequently, the alluvium can roughly be divided into two zones: (1) a transitional zone along the buried escarpment; and (2) a sandy alluvial zone forming the bulk of the floodplain sediments. The transitional zone is adjacent to the escarpment and characterized by massive clay and silt deposits while the sandy alluvial zone is farther away from the escarpment and characterized by massive sands. Clay and silt layers are generally thick in the transitional zone and tend to extend vertically to bedrock. In the sandy alluvial zone, however, the clay and silt layers are relatively thin and occur near the ground surface above the sand layer. In addition, the transitional zone mostly overlies Sandstone B or Mudstone B whereas the sandy alluvial zone largely overlies Sandstone C. The approximate division between the two zones appears along the line connecting wells 02W03 and 02W13 where an abrupt change in lithology occurs (Figure 2-4). On this figure, the transitional zone boundary is shown as a solid line on the northeast flank of the upland. The thickness of the alluvium increases from a few feet near the escarpment to 30 feet near the river channel.

The geological model of the BA #1 Area is depicted in a fence diagram (Figure 2-6) constructed using RockWorks 2004 software (RockWare, Inc., 2004). Fences A, B, C, and D show the transitional zone, and Fences E and F the sandy alluvial zone. Note that, in the eastern parts of Fences A and B (transitional zone), there exists a localized body of massive clay and silt. Sand pockets, lenses, and thin layers present between the upland and the clay/silt body may form small preferential pathways and conduits for groundwater entering the alluvium from the former disposal trench area, as indicated by the orange-colored line in Figure 2-6. To the north, these pathways are largely blocked by a clay barrier that lies across the sand channel in the area between TMW-9 and TMW-5 (Fence C). Due to a significant reduction in the thickness of the sand layers, this clay barrier may restrict groundwater flow to the sandy alluvium from the clay-rich transitional sediments. The sand channel ends near Fence D, beyond which there are no significant geological heterogeneities that modify the groundwater movement in alluvium towards the Cimarron River.

In Figure 2-7, Image 2-7A illustrates the surface lithology of the BA #1 Area. A sand channel along the northeastern border of the upland can be observed. If the overburden sand and silt layers in Image 2-7A are electronically “removed,” a paleochannel is revealed as shown in Image 2-7B. The presence of the massive clay and silt in the transitional zone is suspected to divert groundwater from flowing directly to the north into the sandy alluvium. Instead, it forces the groundwater entering the alluvium to flow along the southeast-northwest channel in the transitional zone. Once past the transitional zone, the groundwater flow is towards the river with little modification from the relatively consistent sands of the alluvium.

2.3.2 Western Upland Area

As shown in Figure 2-8, the Western Upland Area is located near the 1206 Seep; the BA #3 Area; and monitor wells 1351, 1352, 1354, 1355, 1356, 1357, and 1358. The Western Upland Area includes the drainage channel between the former Sanitary Lagoons and the BA #3 Area. Figures 2-9 and 2-10 present profiles and stratigraphy of the Western Upland Area (i.e., Seep 1206 and the surrounding areas). Locations of the geological cross-section are shown in Figure 2-8. All three sandstone units (Sandstones A, B, and C) and the two mudstone units (Mudstones A and B) are present in this area. The lithologies of sandstone and mudstone are similar to those described for the BA #1 Area.

The geology of the Western Upland Area is dominated by Sandstone A (Figure 2-9). Sandstone A is 20 to 30 feet thick in this area and is underlain by an approximately 20- to 25-foot-thick section of Mudstone A. Around the upgradient monitor well 1350, a shale layer about 20 feet in thickness occupies the upper part of Sandstone A. Near the BA #3 Area, this shale has been replaced by silty sandstone about 10 feet thick. Beneath the shale and silty sandstone layers, Sandstone A is a thick section of mostly sandstone down to the contact with Mudstone A.

In the area of the 1206 Seep, Sandstone A has no shale or silty zones near the top and is about 20 feet thick. The top of Mudstone A is at an elevation of approximately 968 feet amsl (Figure 2-10). Historically, samples designated as being collected from the 1206 Seep were in fact collected from a pool of accumulated surface water near the escarpment. The Seep 1206 sampling location is identified in Figure 2-3, and can be seen in Figure 2-10.

The stratigraphic correlations of the western half of the Cimarron Site are depicted in a fence diagram in Figure 2-11. In this diagram, fences A, B, and C represent the Well 1319 Area, Seep 1206 Area/U-Pond #1 Area, and the U-Pond #2 Area, respectively. This fence diagram was generated utilizing computer geologic modeling software RockWorks 2004 (RockWare, Inc., 2004). Unlike the BA #1 Area, Sandstone A in the western part of the Cimarron Site is ubiquitous across the upland area.

2.3.3 Western Alluvial Area

The Western Alluvial Area is located in the alluvial floodplain to the north of the upland area near the former BA #3 Area, the 1206 Seep Area, and the area of the former Sanitary Lagoons.

Alluvial sediments in the Western Alluvial Area consist predominantly of sand with minor amount of clay and silt. The clay and silt range from 0 to 10 feet thick and occur mostly near the ground surface (Figure 2-9). The alluvium is underlain by Sandstone B near the escarpment and by Mudstone B and Sandstone C closer to the Cimarron River.

Alluvial sediments in the floodplain were deposited on an erosional unconformity over Sandstone B and near the face of the escarpment on Mudstone A. Sand constitutes the bulk of the alluvial sediments in this area.

In addition to the floodplain alluvium, silt and silty sand are also present in a small area located south of wells T-62 and T-64 and is situated in the drainage way of 1206 Seep near the escarpment. These sediments are underlain by Sandstone A or Mudstone A. The thickness of unconsolidated soils varies from 2 ft at higher elevation to about 14 ft at the escarpment. Groundwater in this area is shallow (about 6 ft below ground surface) and appears to be originated from seeps discharged to the drainage way.

2.4 Summary

The regional geology of the Cimarron area and the site-wide stratigraphic correlations for the project area can be combined into a general geological model for the Cimarron Site. The site consists of Permian-age sandstones and mudstones of the Garber-Wellington Formation of central Oklahoma overlain by soil in the upland areas and Quaternary alluvial sediments in the floodplains and valleys of incised streams. The Garber sandstones dip gently to the west and are overlain to the west of the Cimarron Site by the Hennessey Group. The Wellington Formation shales are found beneath the Garber sandstones at a depth of approximately 200 feet below ground surface in the project area.

The Garber Formation at the project site is a fluvial deltaic sedimentary sequence consisting of channel sandstones and overbank mudstones. The channel sandstones are generally fine-grained, exhibit cross-stratification, and locally have conglomeratic zones up to a few feet thick. The sandstones are weakly cemented with calcite, iron oxides, and hydroxides. The silt content of the sandstones is variable and clays within the fine fraction are generally kaolinite or montmorillonite. The mudstones are clay-rich and exhibit desiccation cracks and oxidation typical of overbank deposits. Some of the mudstones are continuous enough at the Cimarron Site to allow for separation of the sandstones into three main units, designated (from top to bottom) as Sandstones A, B, and C. Correlation of these three sandstone units is based primarily on elevation and the presence of a thick mudstone unit at the base of Sandstones A and B that can be correlated between borings. Within each sandstone unit, there are frequent mudstone layers that are discontinuous and not correlative across the project area.


The Cimarron Site is located on part of an upland or topographic high between Cottonwood Creek and the Cimarron River. The project site is dissected by shallow, incised drainages that drain northward toward the Cimarron River. Groundwater base flow and surface water runoff during storms have been ponded in two reservoirs (Reservoirs #2 and #3) on the project site. The Cimarron River is a mature river that has incised the Garber Formation, forming escarpments that expose the upper part of the Garber sandstones. Within the Cimarron Site, the Cimarron River has developed a floodplain of unconsolidated sands, silts, and clays that separate the Garber sandstones exposed in an escarpment from the main river channel. Surface drainages within the project site flow toward the Cimarron River.

Geological features of each specific area of the Cimarron Site, from east to west, are highlighted as follows:

- BA #1 Area – The upland is underlain by a sequence of sandstone and mudstone units, namely, from top to bottom, Mudstone A, Sandstone B, Mudstone B, and Sandstone C. The alluvium can be divided into a transitional zone located within the erosional drainage area and an alluvial zone located outside the escarpment line. The transitional zone consists predominantly of clay and silt and overlies Sandstone B or Mudstone B. A paleochannel appears to exist in the transitional zone, which may control the flow of groundwater in the vicinity of the upland in this area. The alluvium consists of mainly sand and overlies Sandstone C and, to a lesser extent, Mudstone B.
- Western Upland Area – The upland area that includes the BA #3 Area, the 1206 Seep Area, and the former Sanitary Lagoons is composed primarily of Sandstone A. Sandstone B is exposed near the base of the drainage between the former Sanitary Lagoons and the BA #3 Area at the mouth of the drainage where it opens into the alluvial floodplain of the Cimarron River. In the vicinity of BA #3 Area and also the former Sanitary Lagoons, the upper part of Sandstone A is composed mostly of siltstone and shale, rather than sandstone. A surface drainage extending through the area is incised into Sandstone A and Mudstone A. The remaining members of the Garber-Wellington Formation are present at depth in the area
- Western Alluvial Area – Alluvial sediments in this area consist of predominantly sand with minor amount of clay and silt. Sandstone B and Mudstone B exist beneath the alluvial sediments near the escarpment and Sandstone C underlies the alluvial sediments farther out in the floodplain.

Table 2-1 Geologic Units Exposed in Southern Logan and Northern Oklahoma Counties, Oklahoma

System and Series	Unit	Maximum Thickness (ft)	Lithology
<i>Quaternary</i>			
Holocene	Alluvium	50	Sand, silt, clay, and thin layers of gravel.
Pleistocene	Terrace deposits	50	Lenticular beds of sand, silt, clay and gravel.
<i>Permian</i>			
Hennessey Group	Bison Formation	95	Mostly reddish-brown shale.
	Salt Plains Formation	200	Reddish-brown blocky shale and orange-brown siltstone.
	Kingman Siltstone	30	Orange-brown to greenish-gray even-bedded siltstone, and some fine-grained sandstone and reddish-brown shale.
	Fairmount Shale	30	Reddish-brown blocky shale; grades into Garber Sandstone at base.
	Garber-Wellington Formation	1,000	Mostly reddish-brown to tan fine-grained alluvial sandstones with interbedded red-brown shales and mudstones and local chert and mudstone conglomerates. Formation consists of fluvial/deltaic sands and overbank clays preserved as mudstone layers. Deltaic sands consist of both channel sands and sheet-flood sands.

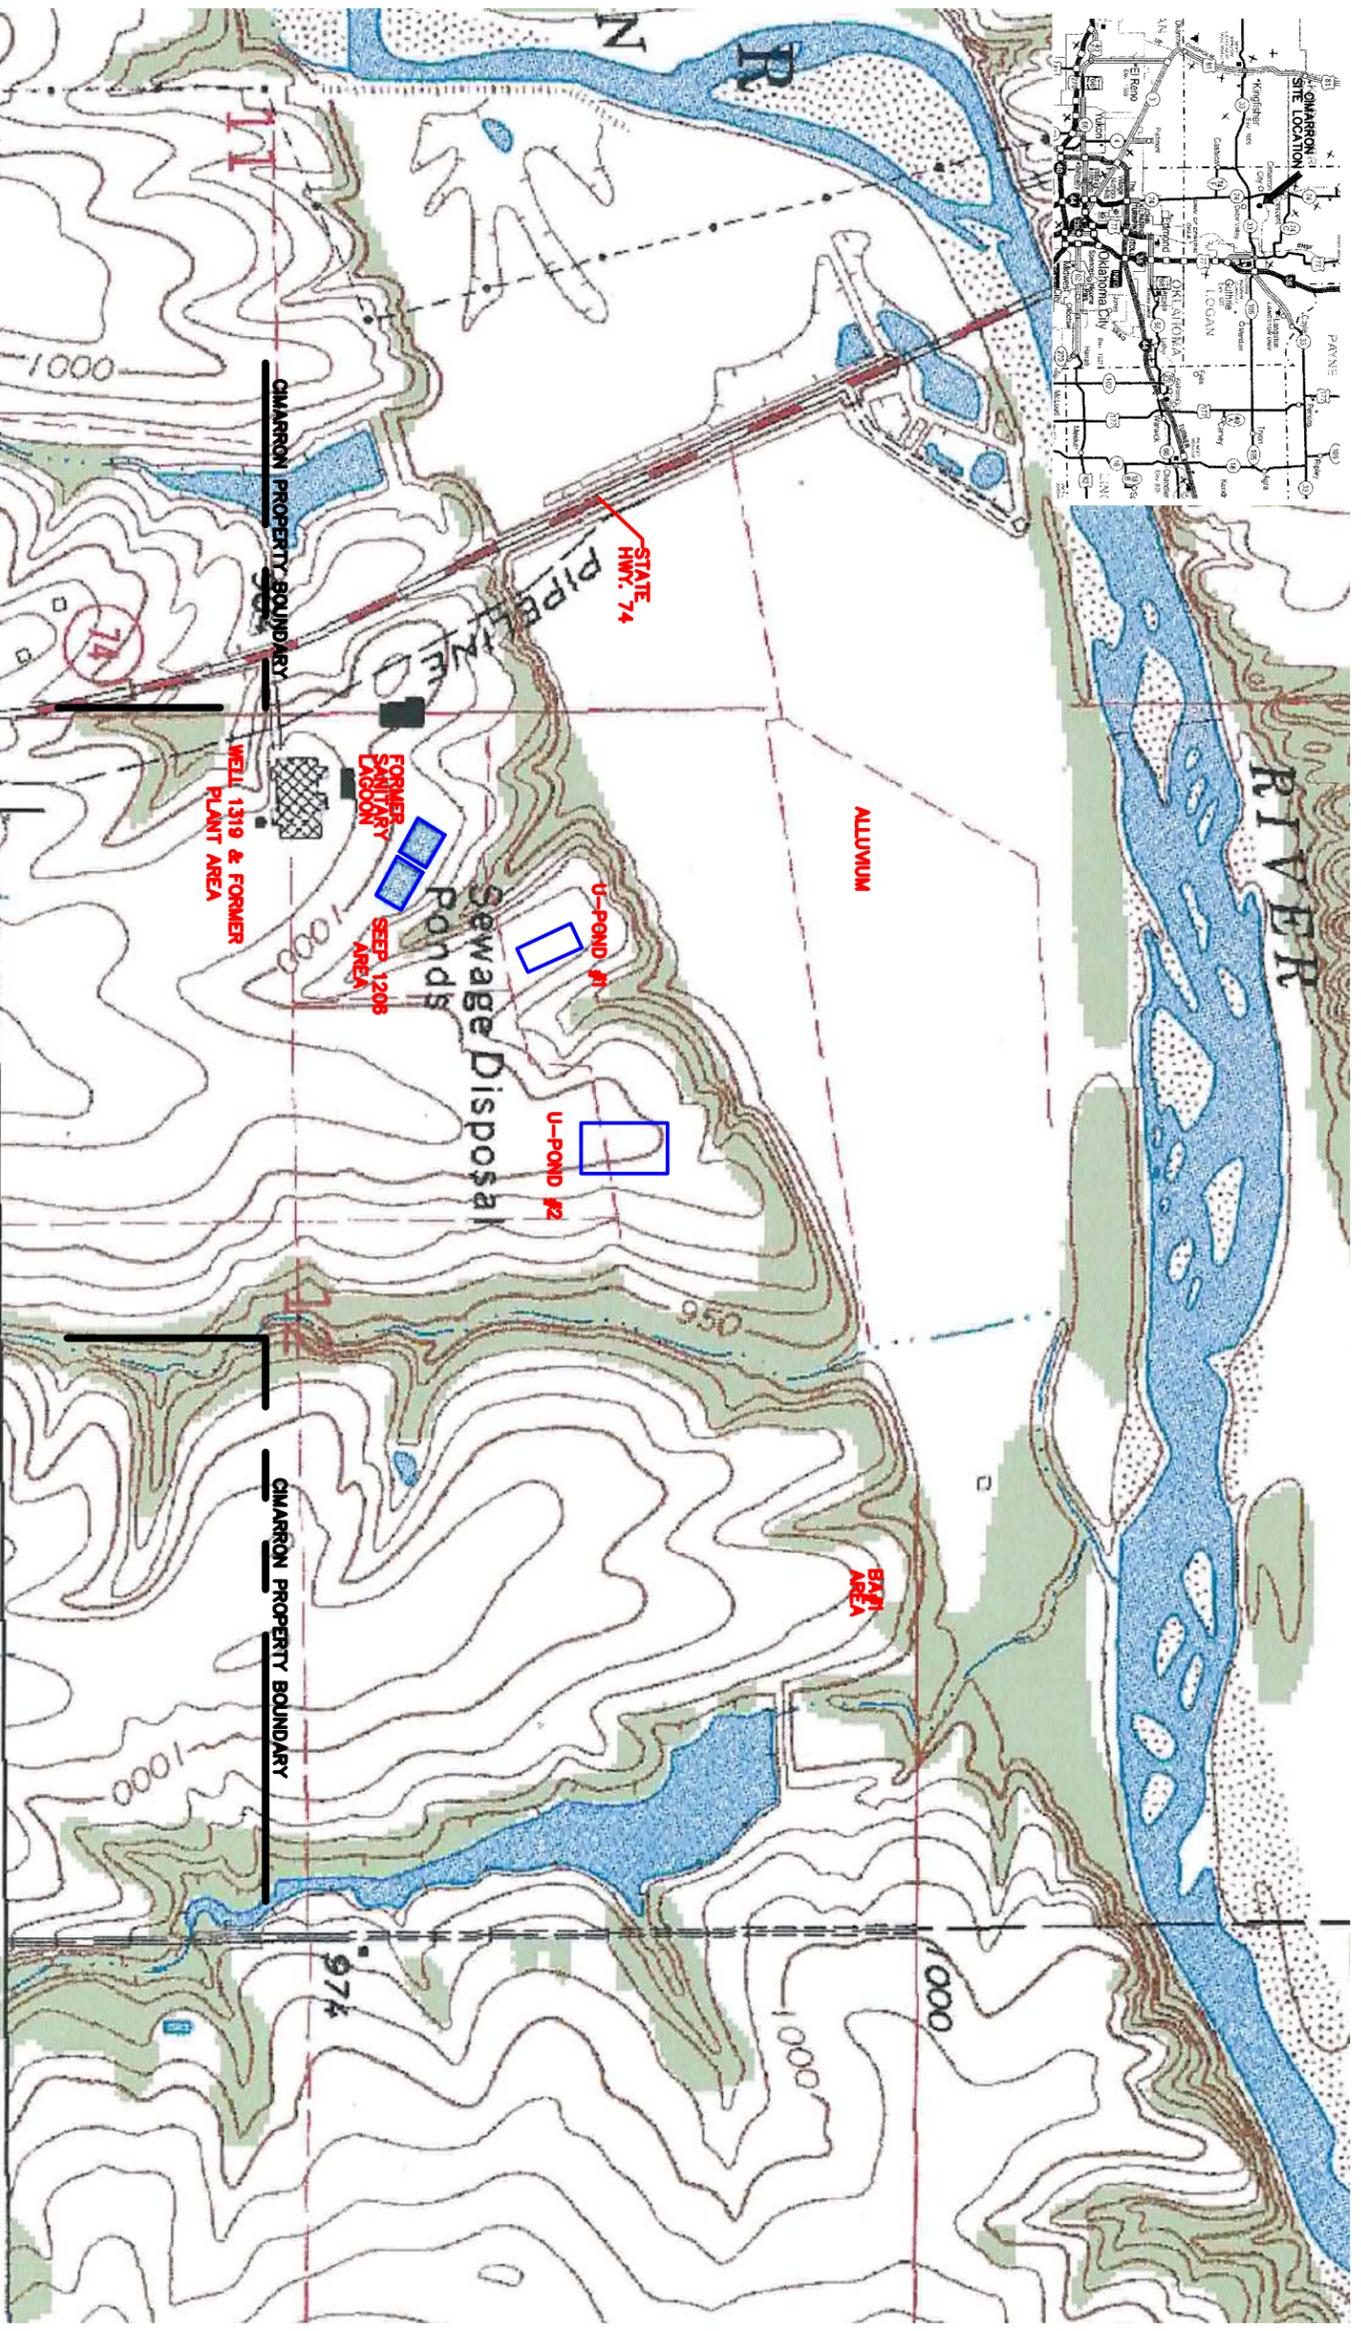

REFERENCE: UNITED STATES GEOLOGICAL SURVEY
CRESCENT QUADRANGLE, OKLAHOMA-LOGAN CO.
7.5 MINUTE SERIES (TOPOGRAPHIC), 1970 (PHOTOINSPECTED 1981).


FIGURE 2-1
SITE LOCATION MAP
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1" = 800'	8/10/05	04020-044-200

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1	DESCRIPTION:	4/01/05	JAS
JAS	2		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

FIGURE NUMBER:	2-1
SHEET NUMBER:	1

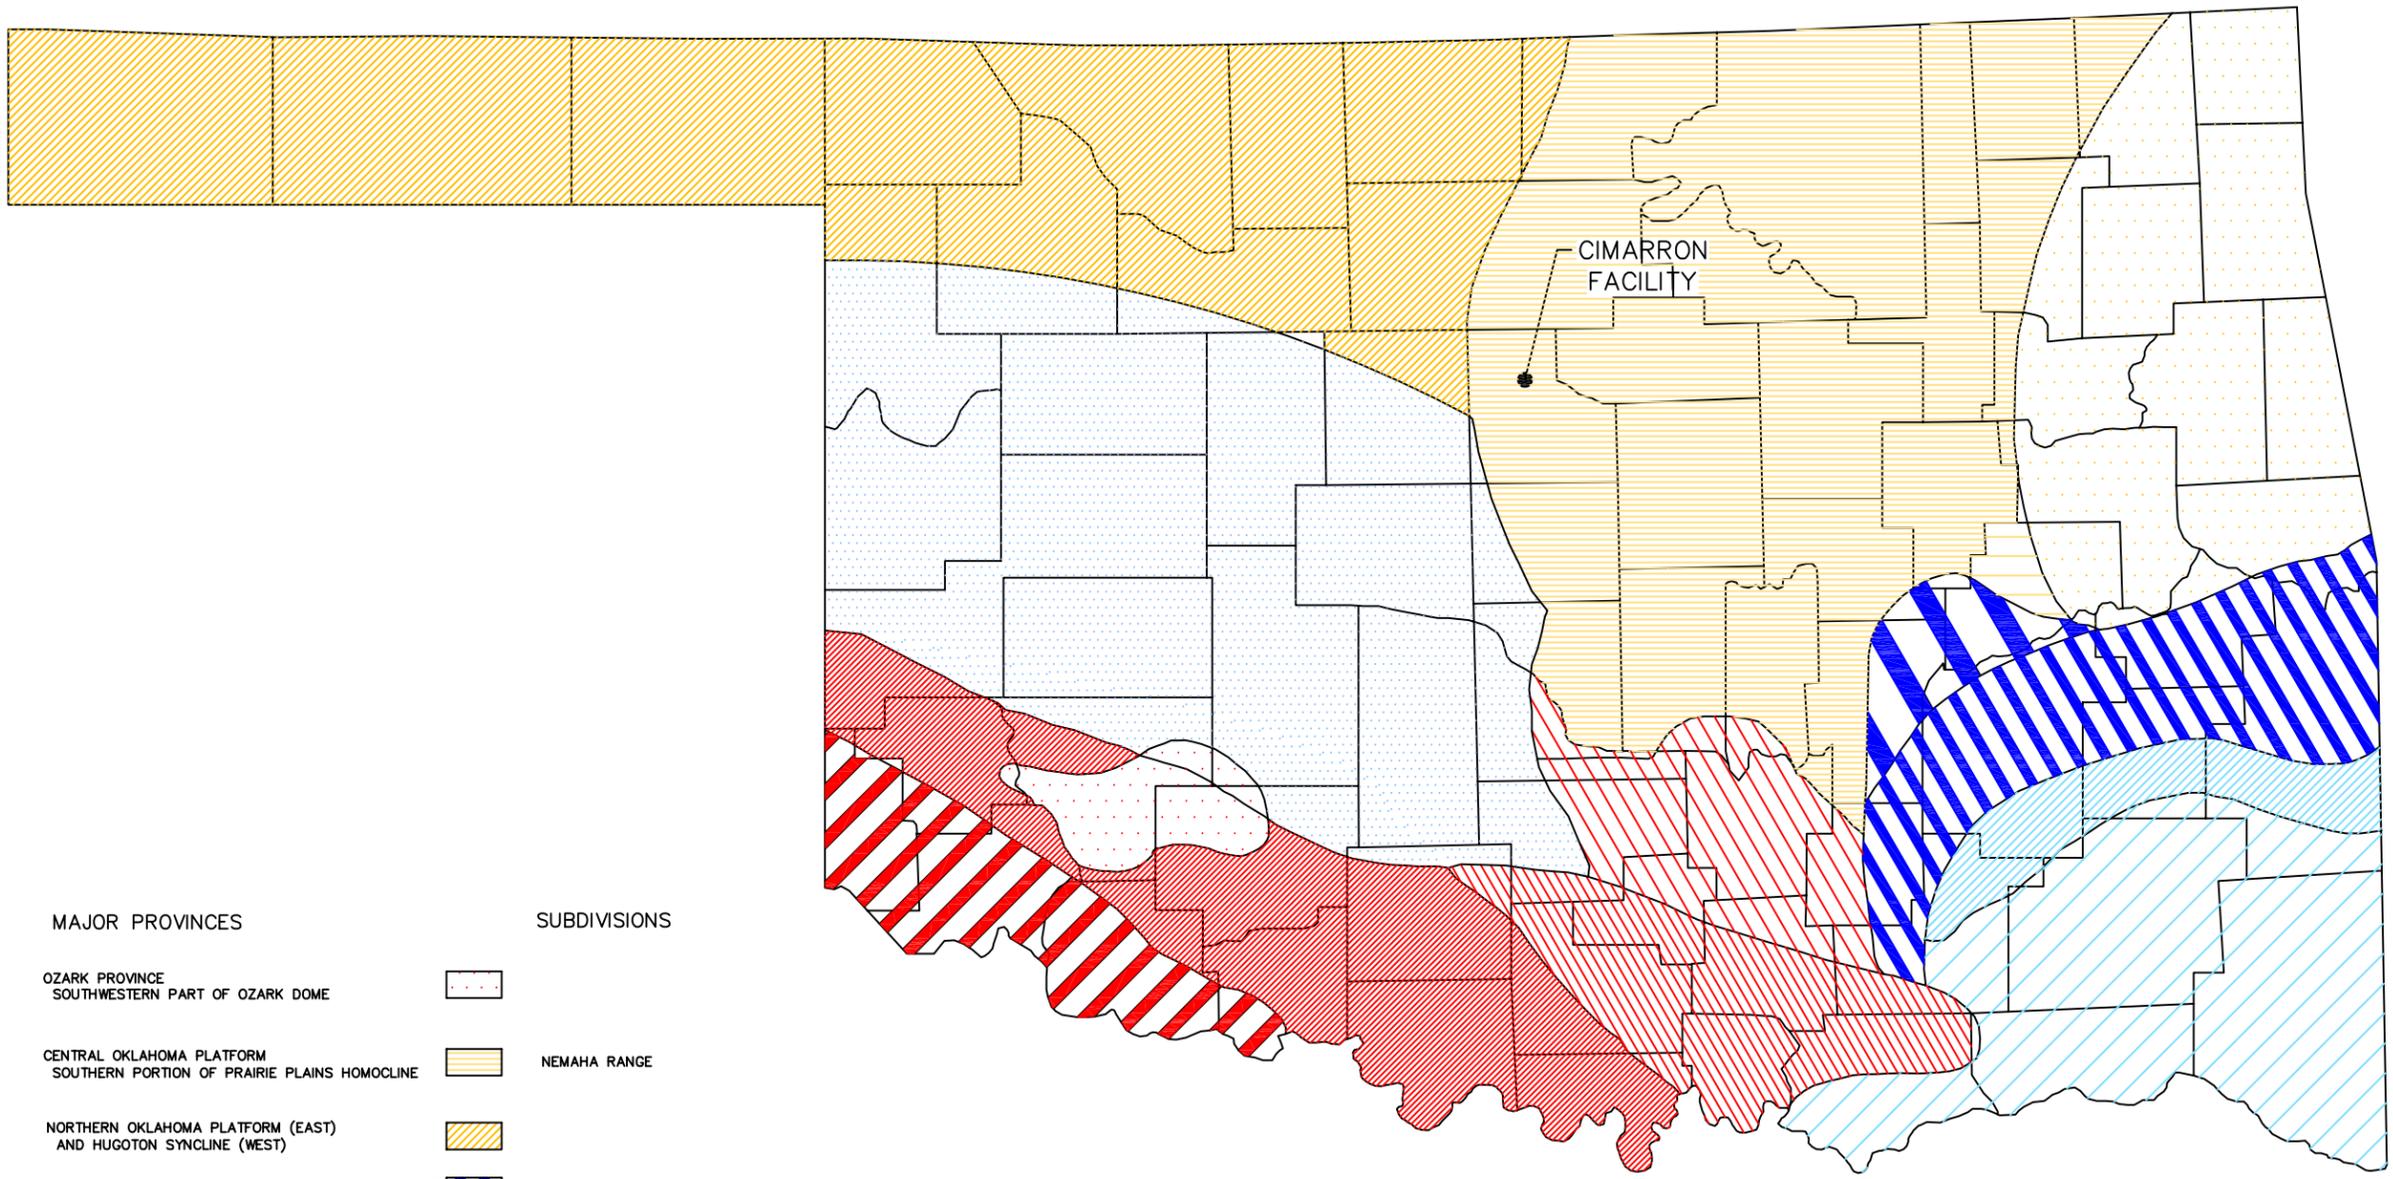

MAJOR PROVINCES

- OZARK PROVINCE
SOUTHWESTERN PART OF OZARK DOME
- CENTRAL OKLAHOMA PLATFORM
SOUTHERN PORTION OF PRAIRIE PLAINS HOMOCLINE
- NORTHERN OKLAHOMA PLATFORM (EAST)
AND HUGOTON SYNCLINE (WEST)
- MCALESTER-ARKANSAS FOREDEEP
- OUACHITA SYSTEM
OKLAHOMA SALIENT
- ANADARKO SYNCLINAL FOREDEEP
- MARIETTA BASIN
- HOLLIS BASIN
- ARDMORE BASIN
- PAUL'S VALLEY UPLIFT

SUBDIVISIONS

- NEMAHA RANGE
- FOLDING AND FAULTING WEAK
- FOLDING AND FAULTING STRONG
- MARGINAL BELT OF INBRICATE THRUSTING
- CENTRAL FOLD AND THRUST SEGMENT

CIMARRON FACILITY

REFERENCE: OKLAHOMA GEOLOGICAL SURVEY

DESIGNED BY:		REVISIONS	
DESIGNED BY:	JAS	NO.:	1
DRAWN BY:	JAS	DESCRIPTION:	
CHECKED BY:	DJF	NO.:	2
APPROVED BY:	DJF	DESCRIPTION:	
		DATE:	4/01/05
		DATE:	6/17/05
		BY:	JAS

ENSR
INTERNATIONAL


4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

FIGURE 2-2
TECTONIC PROVINCE MAP OF OKLAHOMA
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE: 8/10/05
PROJECT NUMBER: 04020-044-200

FIGURE NUMBER:
2-2

SHEET NUMBER:
1

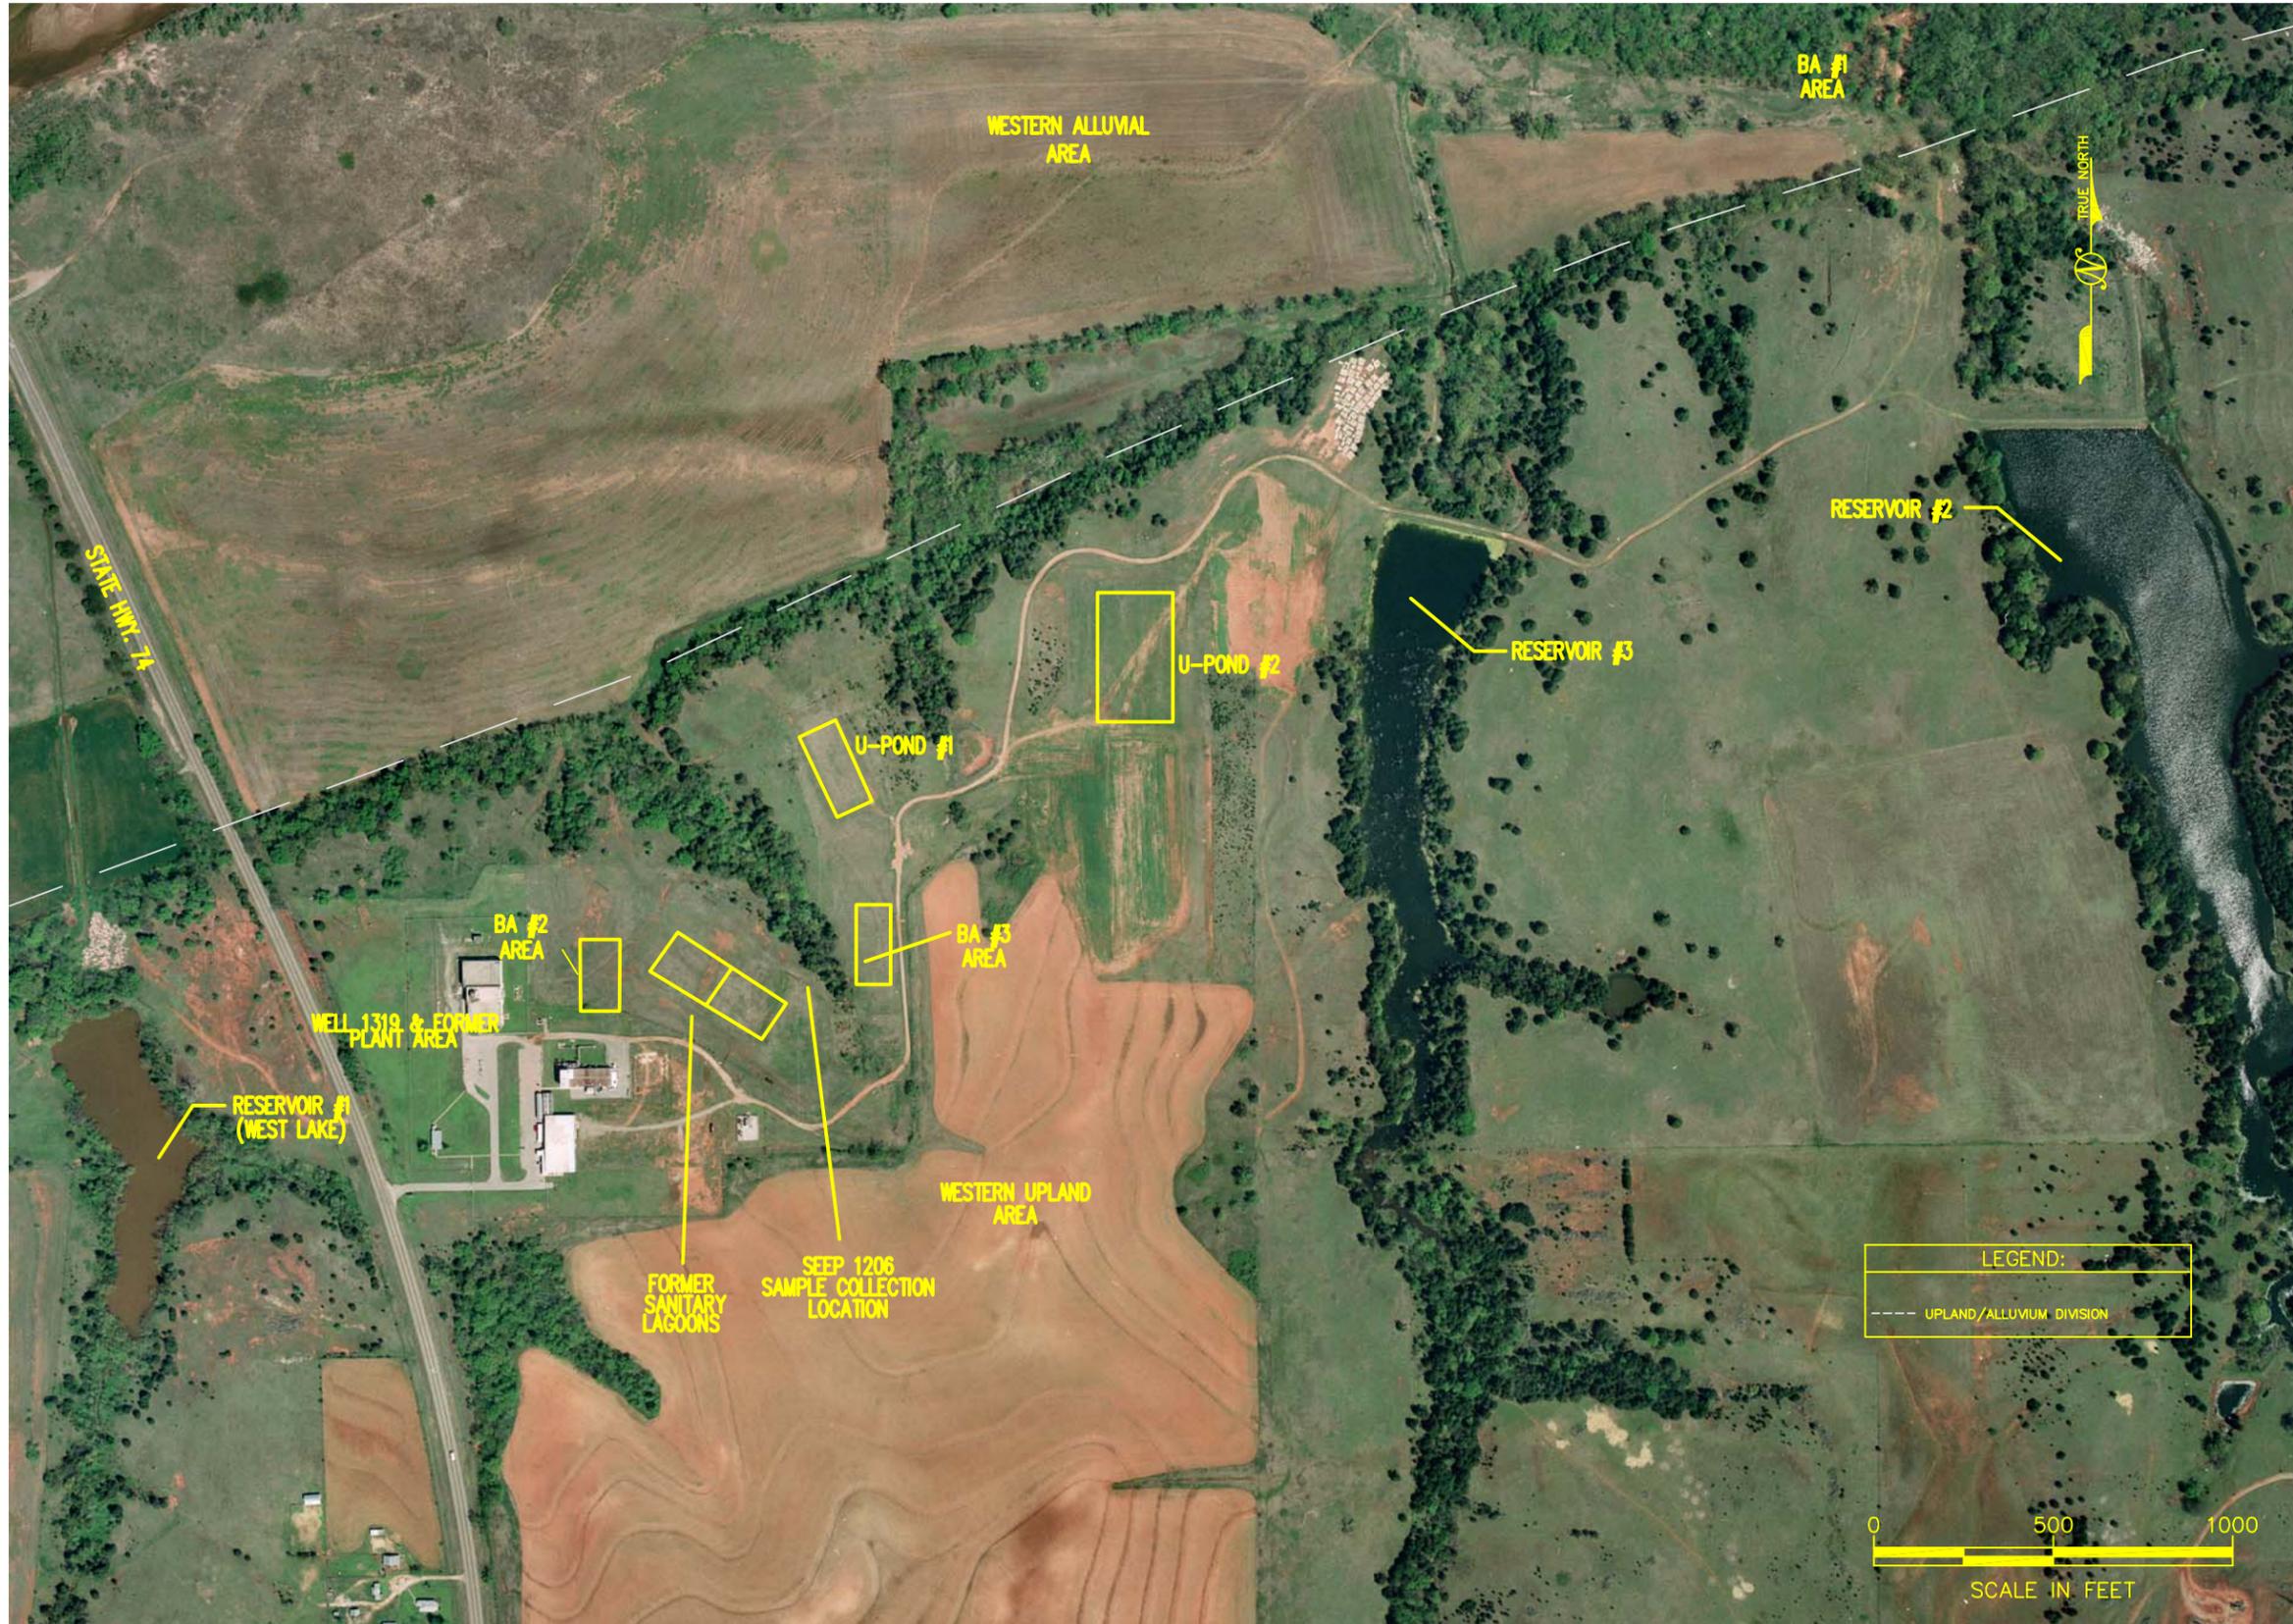

DESIGNED BY:		REVISIONS	
NO.:	DESCRIPTION:	DATE:	BY:
1		4/10/05	
2		6/17/05	

DRAWN BY:	HTP
CHECKED BY:	DJF
APPROVED BY:	DJF


ENSR
INTERNATIONAL

4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-8802
WEB: HTTP://WWW.ENSR.COM

FIGURE 2-3
SITE MAP
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1" = 500'	8/10/05	04020-044-200

FIGURE NUMBER:
2-3
SHEET NUMBER:
1

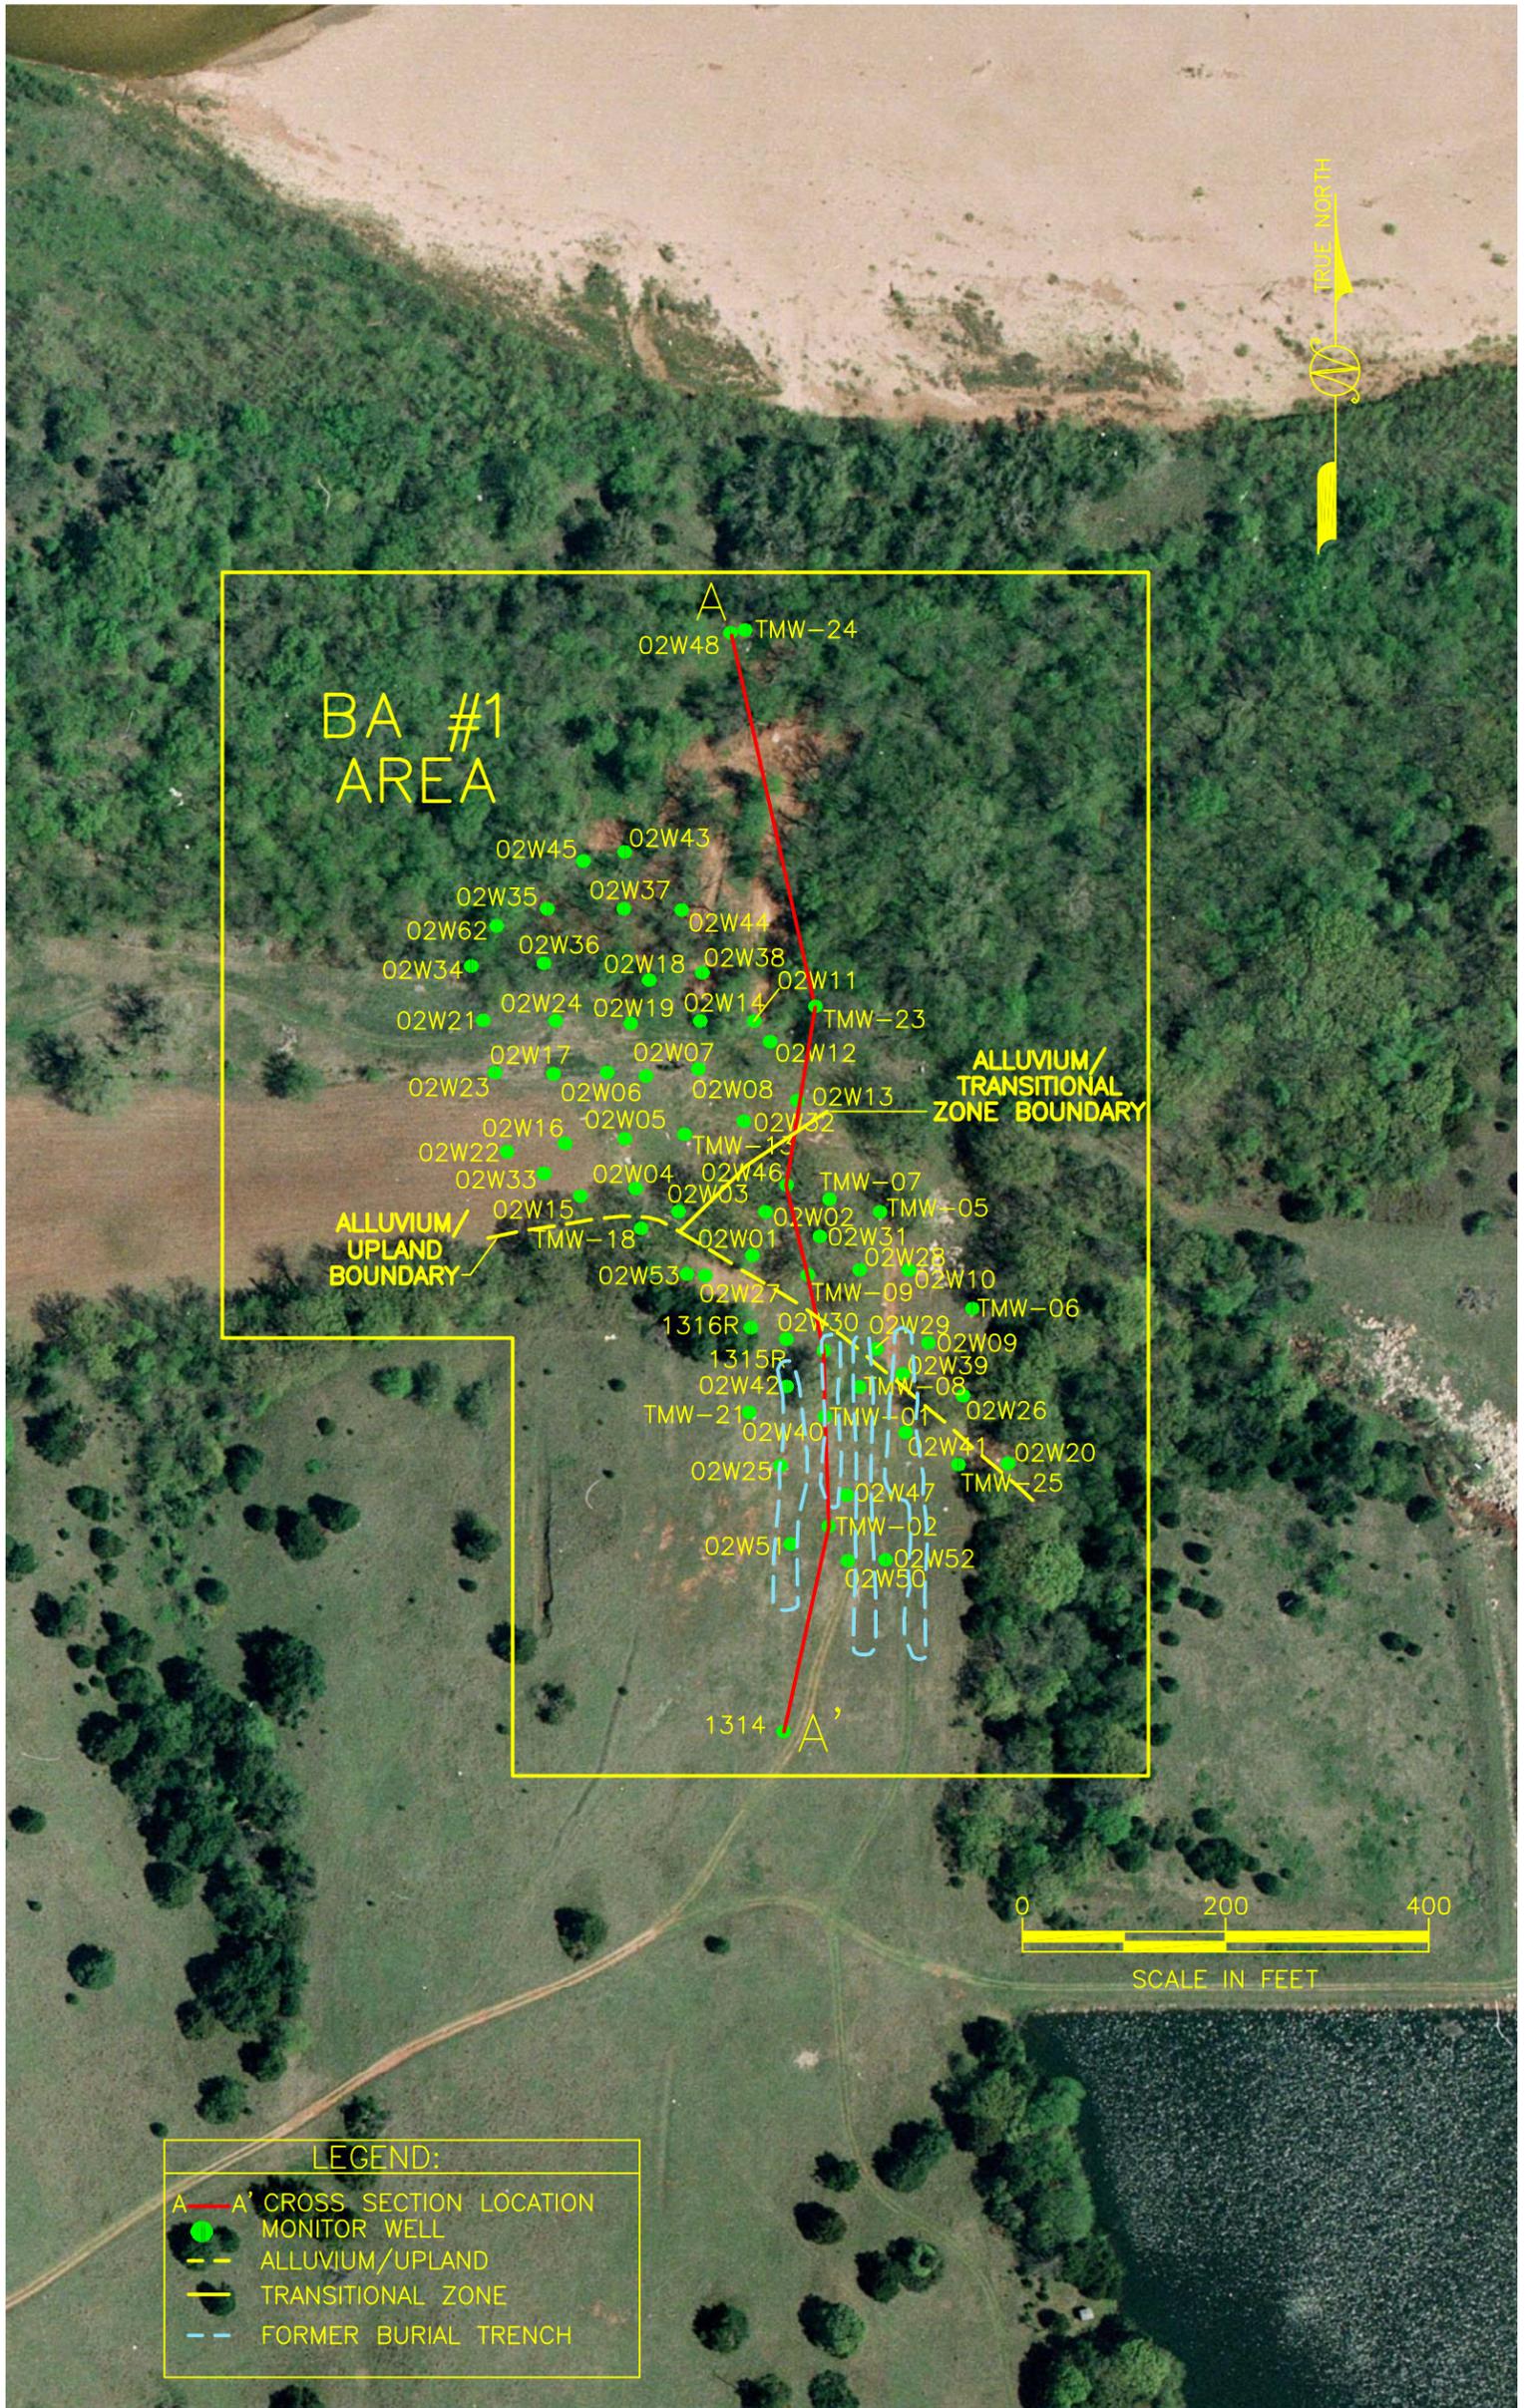

LEGEND:
 A—A' CROSS SECTION LOCATION
 ● MONITOR WELL
 --- ALLUVIUM/UPLAND
 --- TRANSITIONAL ZONE
 --- FORMER BURIAL TRENCH

FIGURE 2-4
 BA #1 AREA
 CROSS SECTION LOCATION MAP
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA



SCALE:	DATE:	PROJECT NUMBER:
1" = 200'	8/10/05	04020-044-200



4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSRCOM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		4/01/05	JAS
JAS	2		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

SHEET NUMBER:	FIGURE NUMBER:
1	2-4

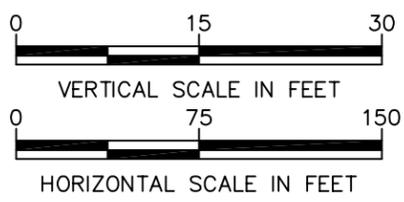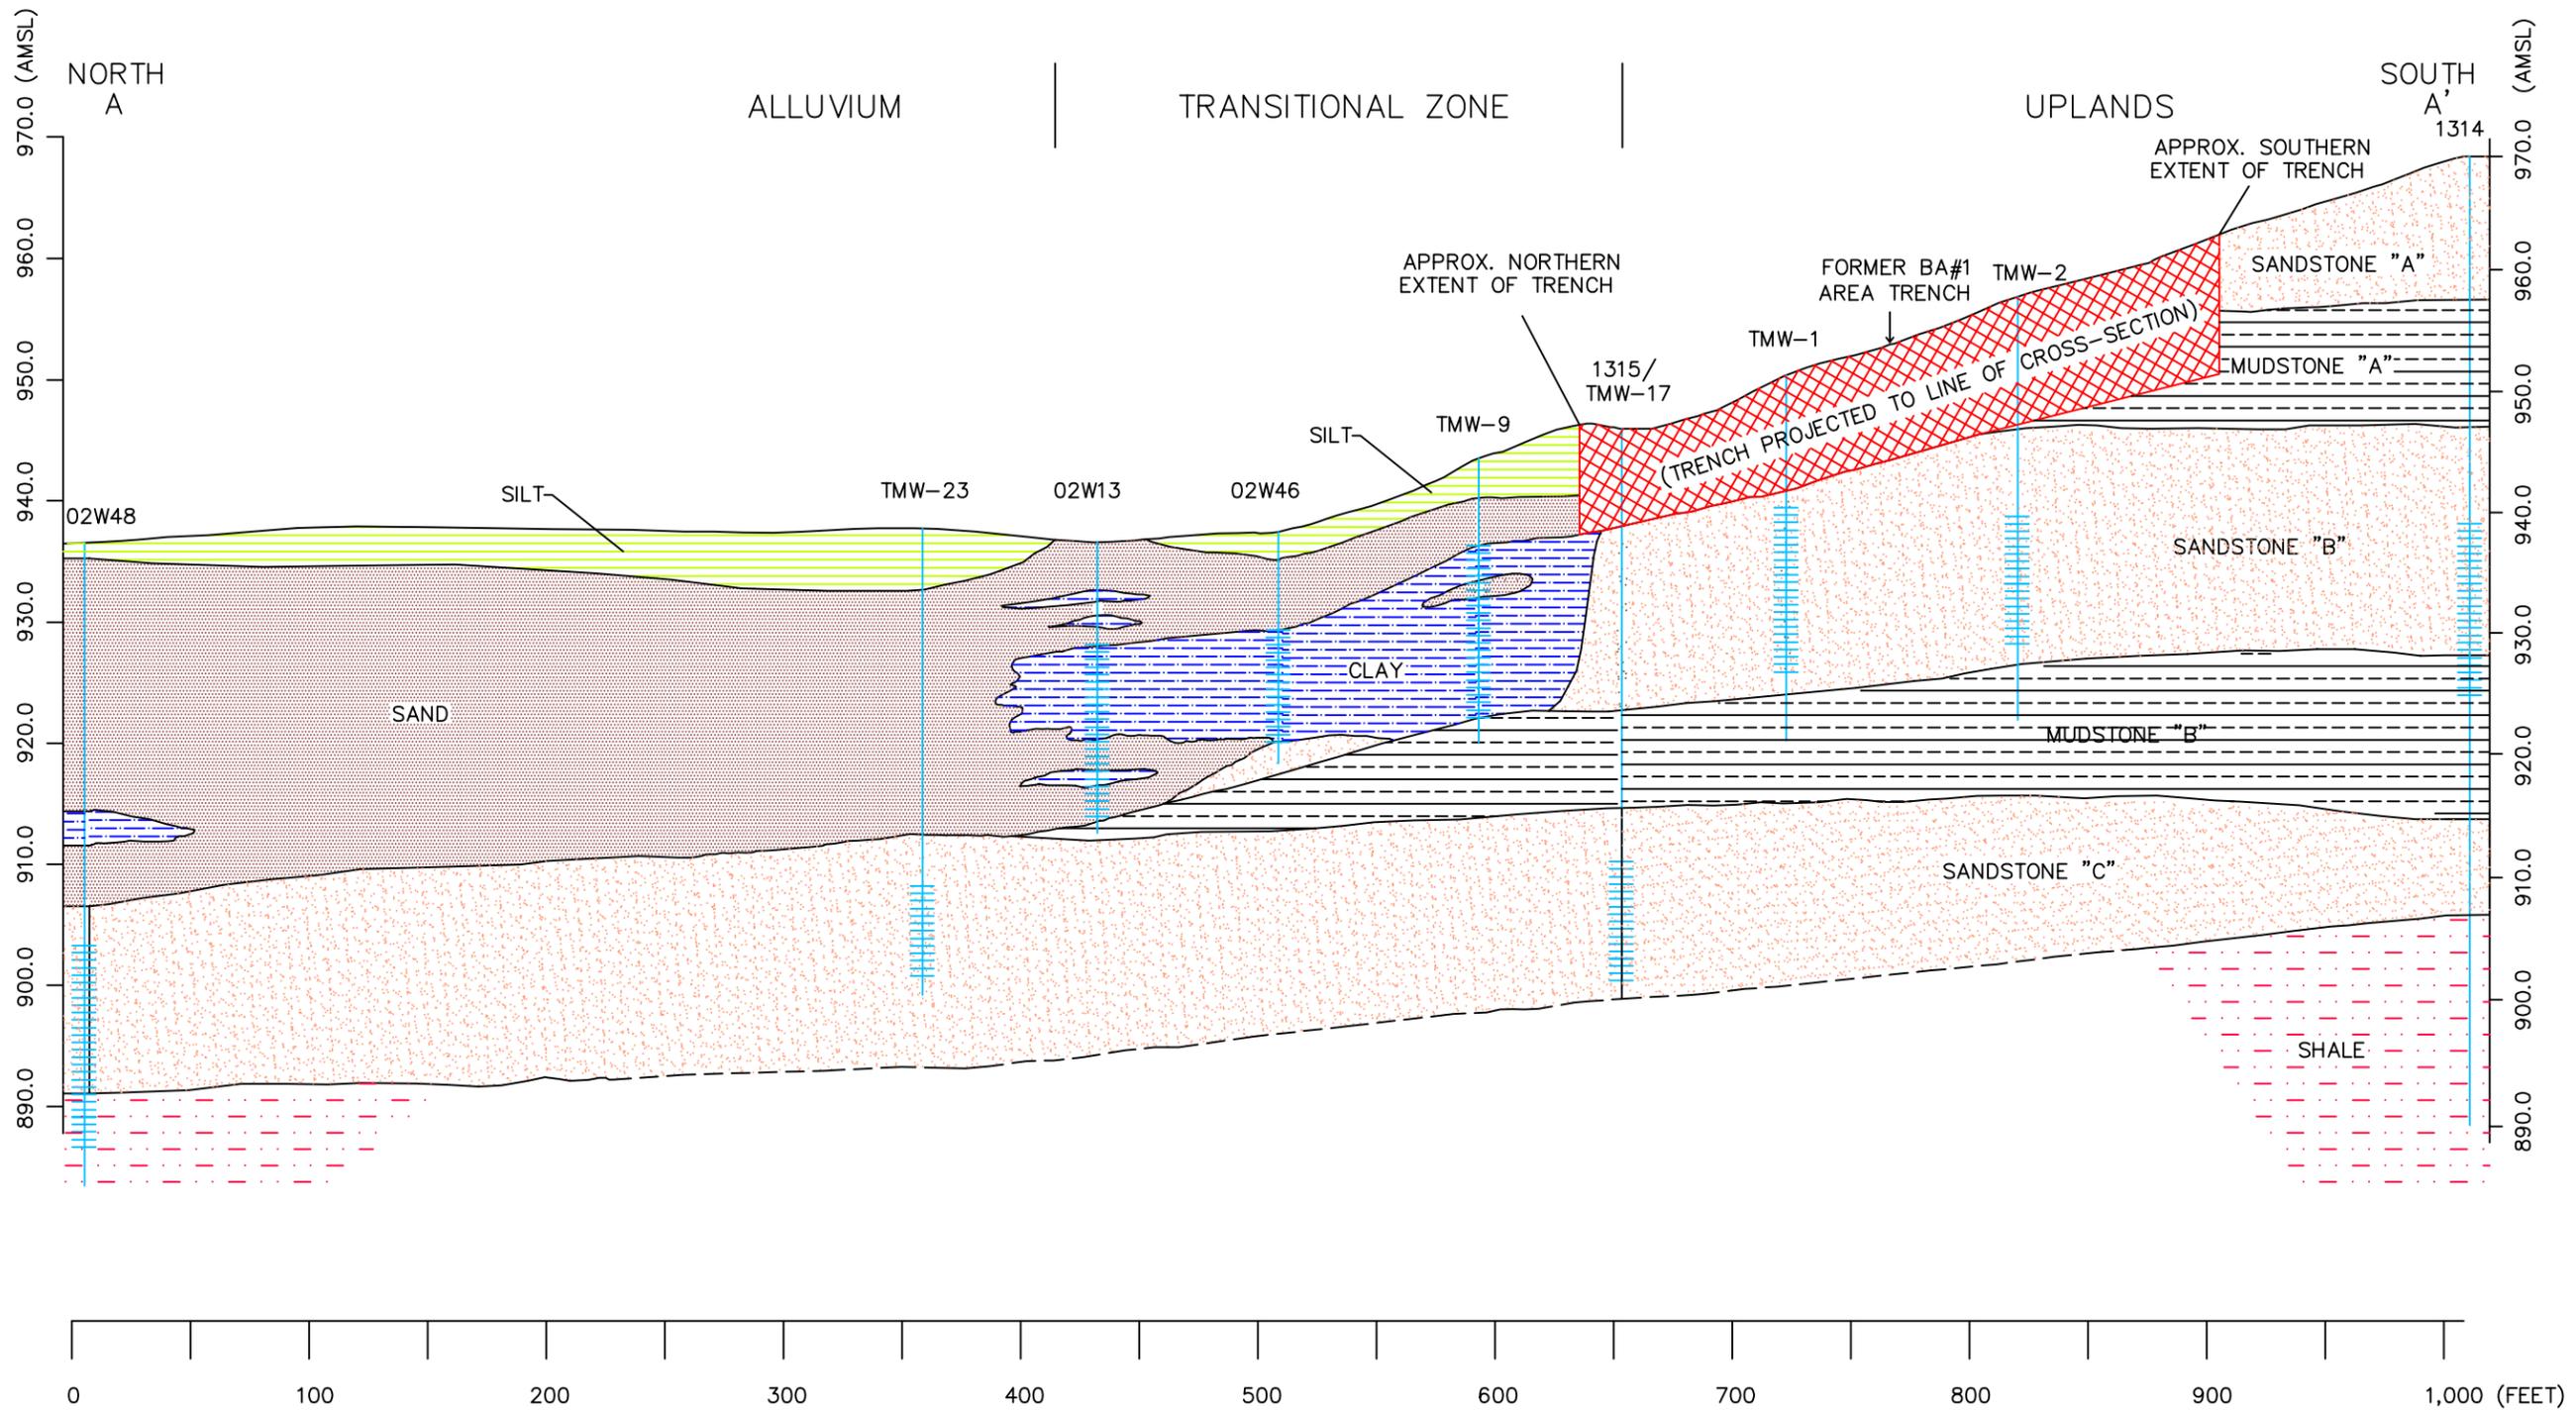

- | | | | |
|----------|------|---------|-----------|
| ALLUVIUM | | BEDROCK | |
| | SAND | | SANDSTONE |
| | CLAY | | MUDSTONE |
| | SILT | | SHALE |

1314 MONITORING WELL
 SCREENED WELL
 INTERVAL

DESIGNED BY:	NO.:	DESCRIPTION:	DATE:	BY:
	1		4/01/05	JAS
DRAWN BY:	2		6/17/05	
CHECKED BY:				
APPROVED BY:				
				DJF


ENSR
 INTERNATIONAL
 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

FIGURE 2-5
 BA #1 AREA
 GEOLOGICAL CROSS-SECTION A-A'
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA


SCALE: 1" = 75'
 DATE: 8/10/05
 PROJECT NUMBER: 04020-044-200

FIGURE NUMBER:
 2-5

SHEET NUMBER:
 1

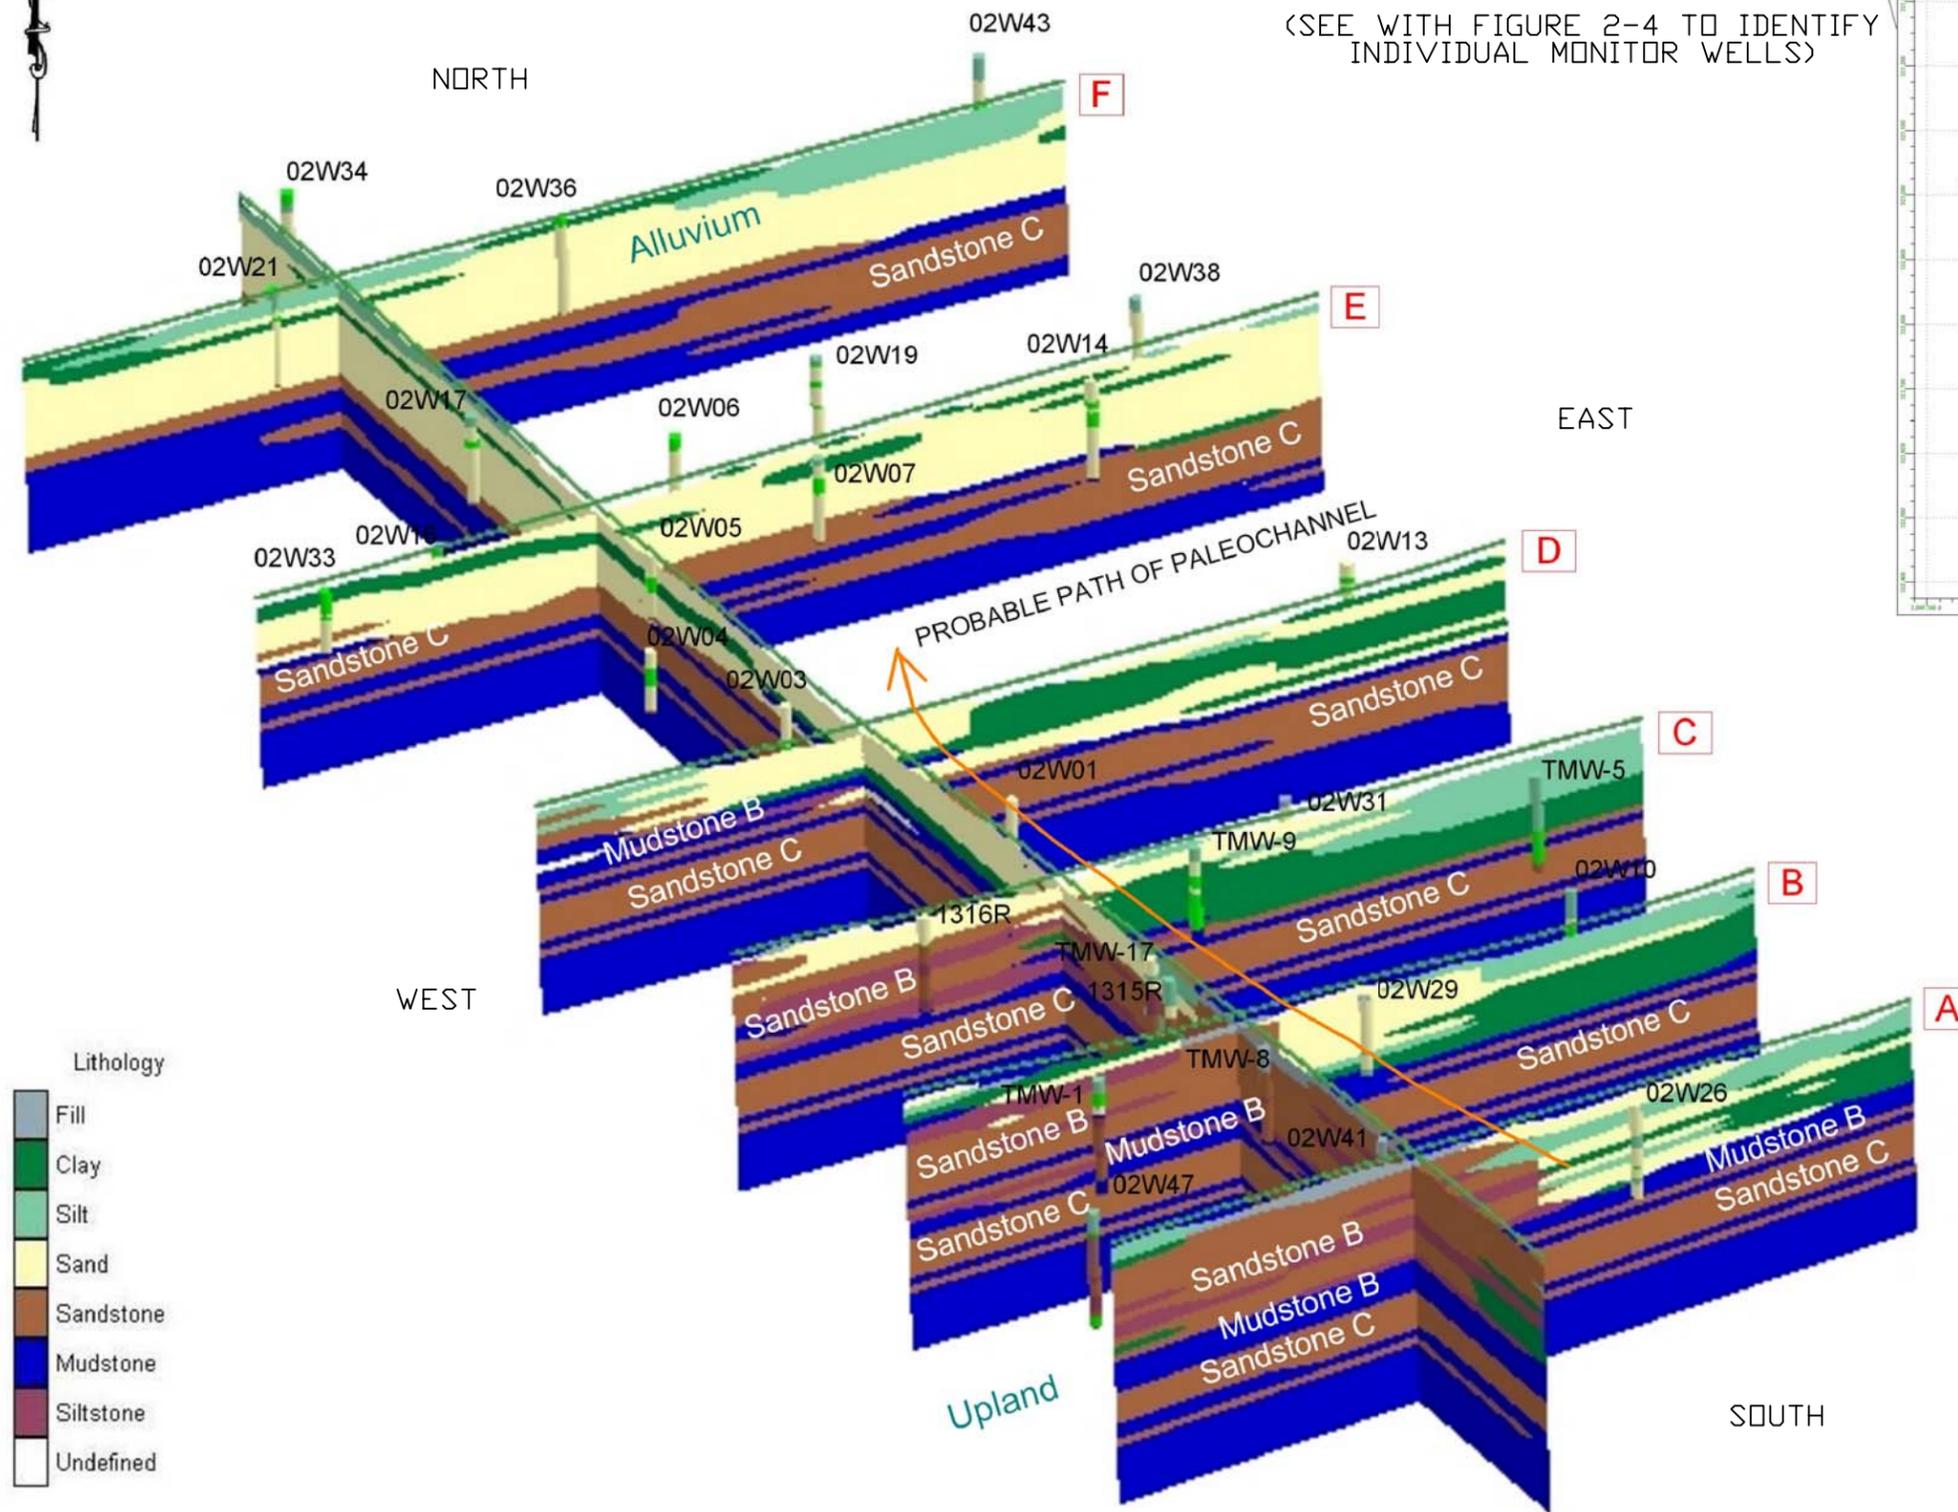

BURIAL AREA #1 FENCE
DIAGRAM LOCATION LAYOUT
(SEE WITH FIGURE 2-4 TO IDENTIFY
INDIVIDUAL MONITOR WELLS)

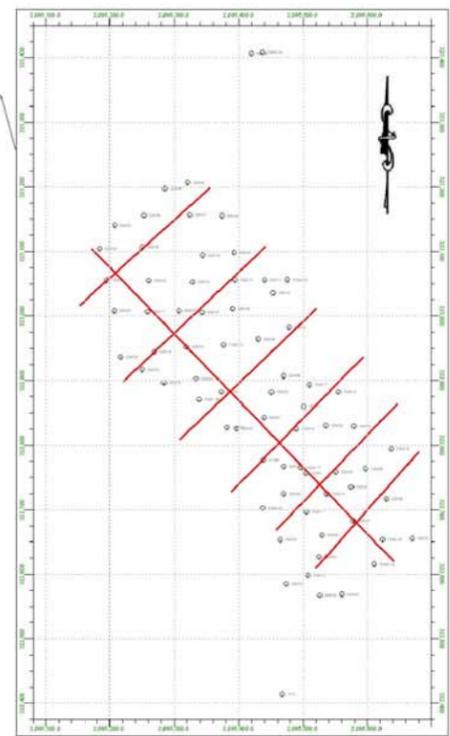

Lithology

Fill
Clay
Silt
Sand
Sandstone
Mudstone
Siltstone
Undefined

VIEW LOOKING NORTHWARD

REFERENCE: ROCKWORKS 2004

NO.	DESCRIPTION	DATE
1		4/01/05
2		6/17/05

DESIGNED BY: _____
DRAWN BY: JAS
CHECKED BY: DJF
APPROVED BY: DJF

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

FIGURE NUMBER:	PROJECT NUMBER:
2-6	04020-044-200
SCALE:	DATE:
	8/10/05

FIGURE NUMBER:
2-6
SHEET NUMBER:
1

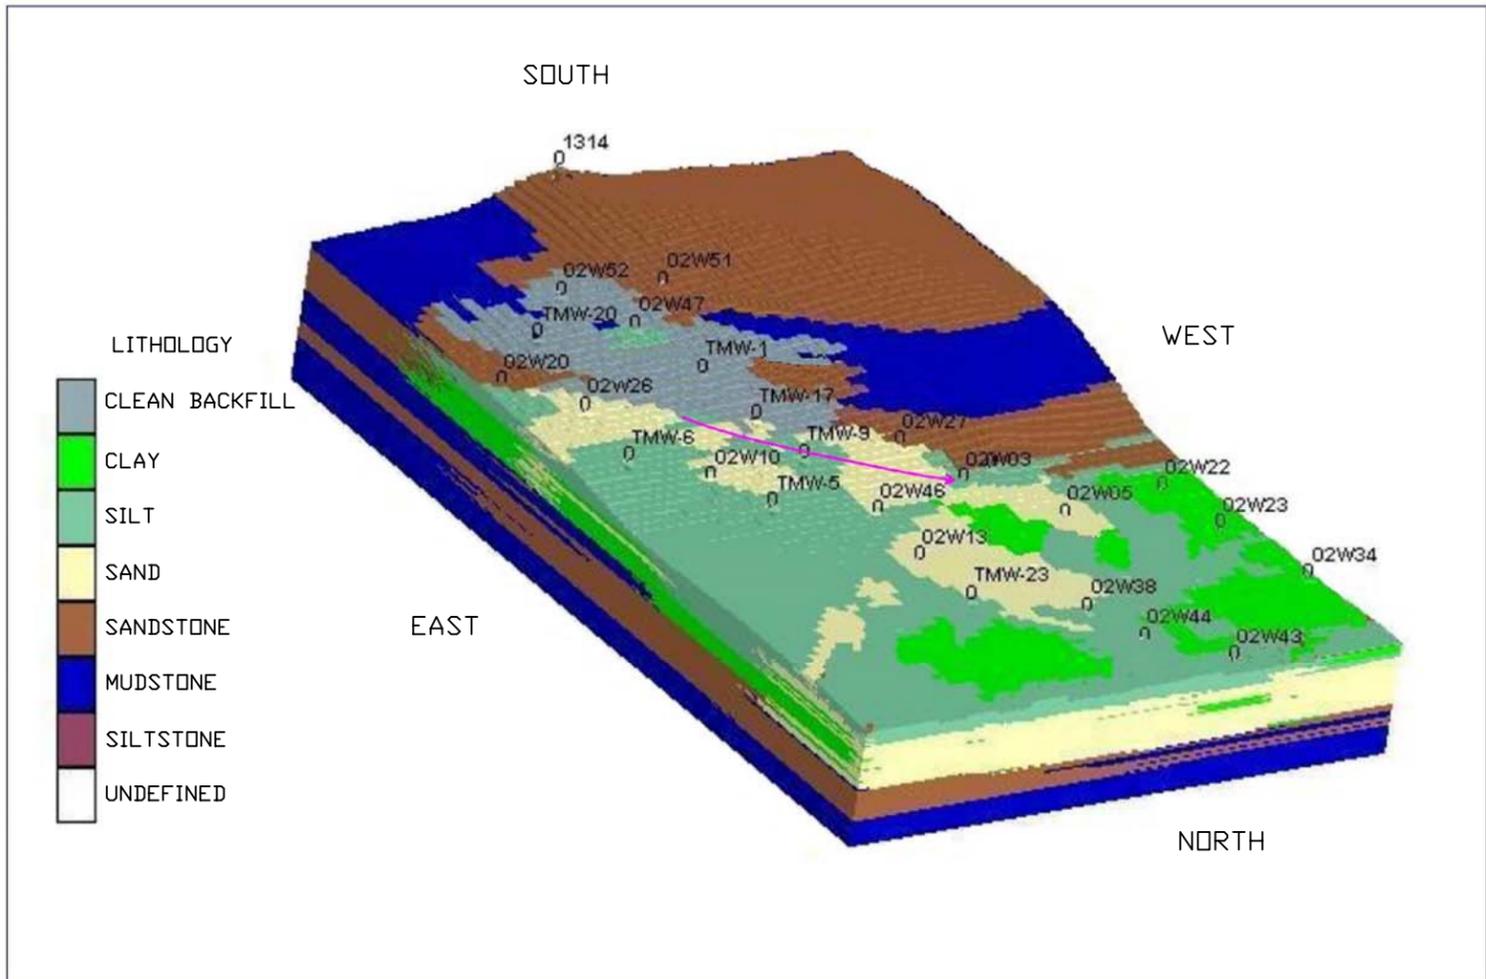


IMAGE 2-7A. Lithologic model of BA #1 Area before overburden sand was "removed". View from northeast.


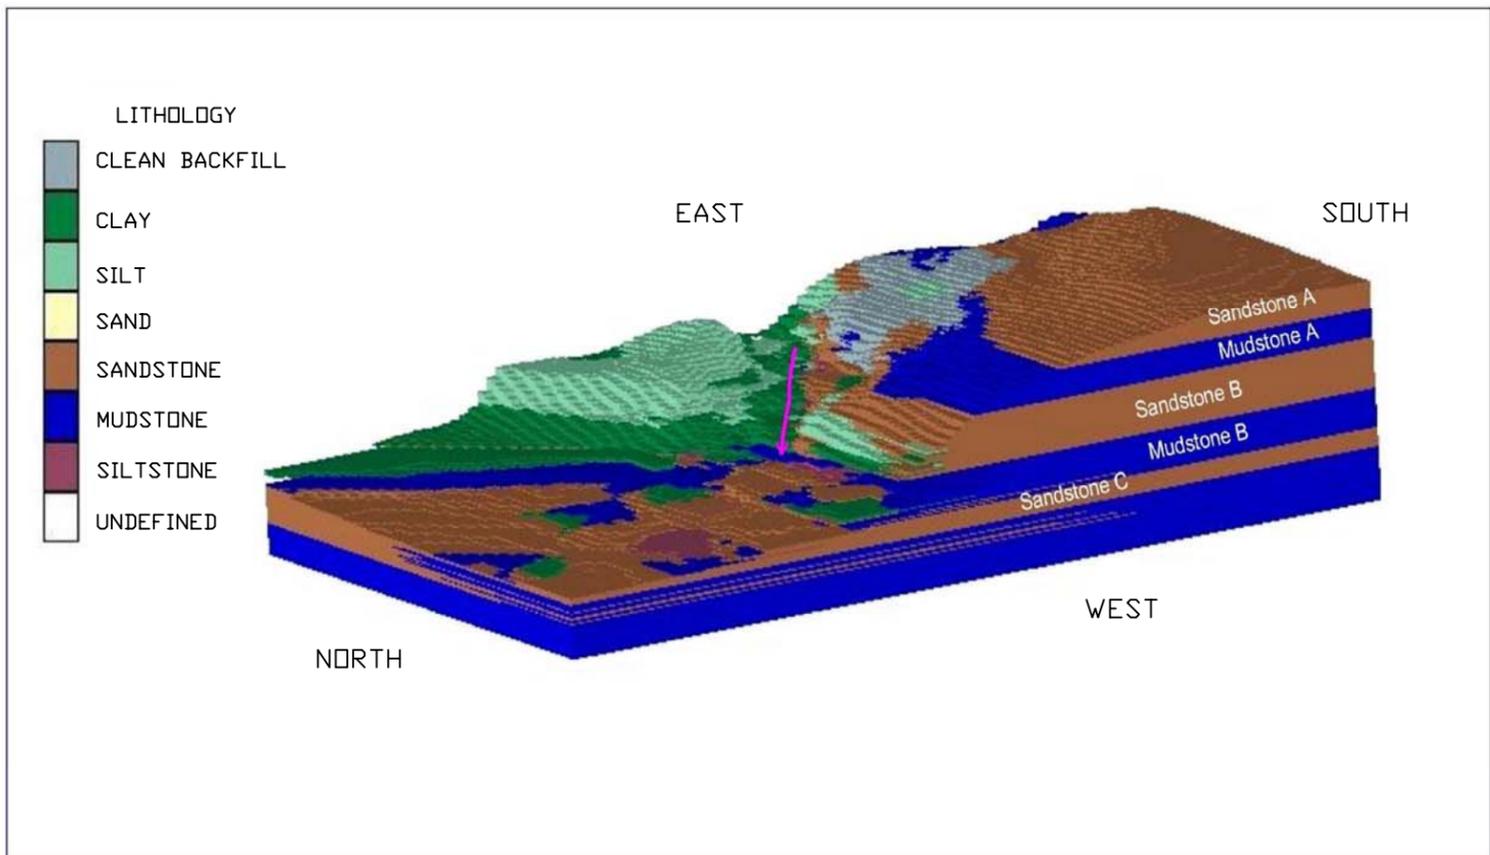


IMAGE 2-7B. Lithologic model of BA #1 Area after overburden sand was "removed", revealing a paleochannel depicted as a valley in the figure. The curve with arrow head indicates probable path of the channel. View from northwest.

SHEET NUMBER 1	FIGURE NUMBER 2-7	FIGURE 2-7 BA #1 AREA PALEOCHANNEL IN TRANSITIONAL ZONE CIMARRON CORPORATION CRESCENT, OKLAHOMA		 4888 LOOP CENTRAL DR. SUITE 600 HOUSTON, TEXAS 77081 PHONE: (713) 520-9900 FAX: (713) 520-6802 WEB: HTTP://WWW.ENSRCOM	DESIGNED BY: JAS	REVISIONS		
		SCALE:	DATE: 8/10/05		PROJECT NUMBER: 04020-044-200	DRAWN BY: JAS	NO.:	DESCRIPTION:
					1		4/01/05	JAS
					2		6/17/05	
					CHECKED BY: DJF			
					APPROVED BY: DJF			

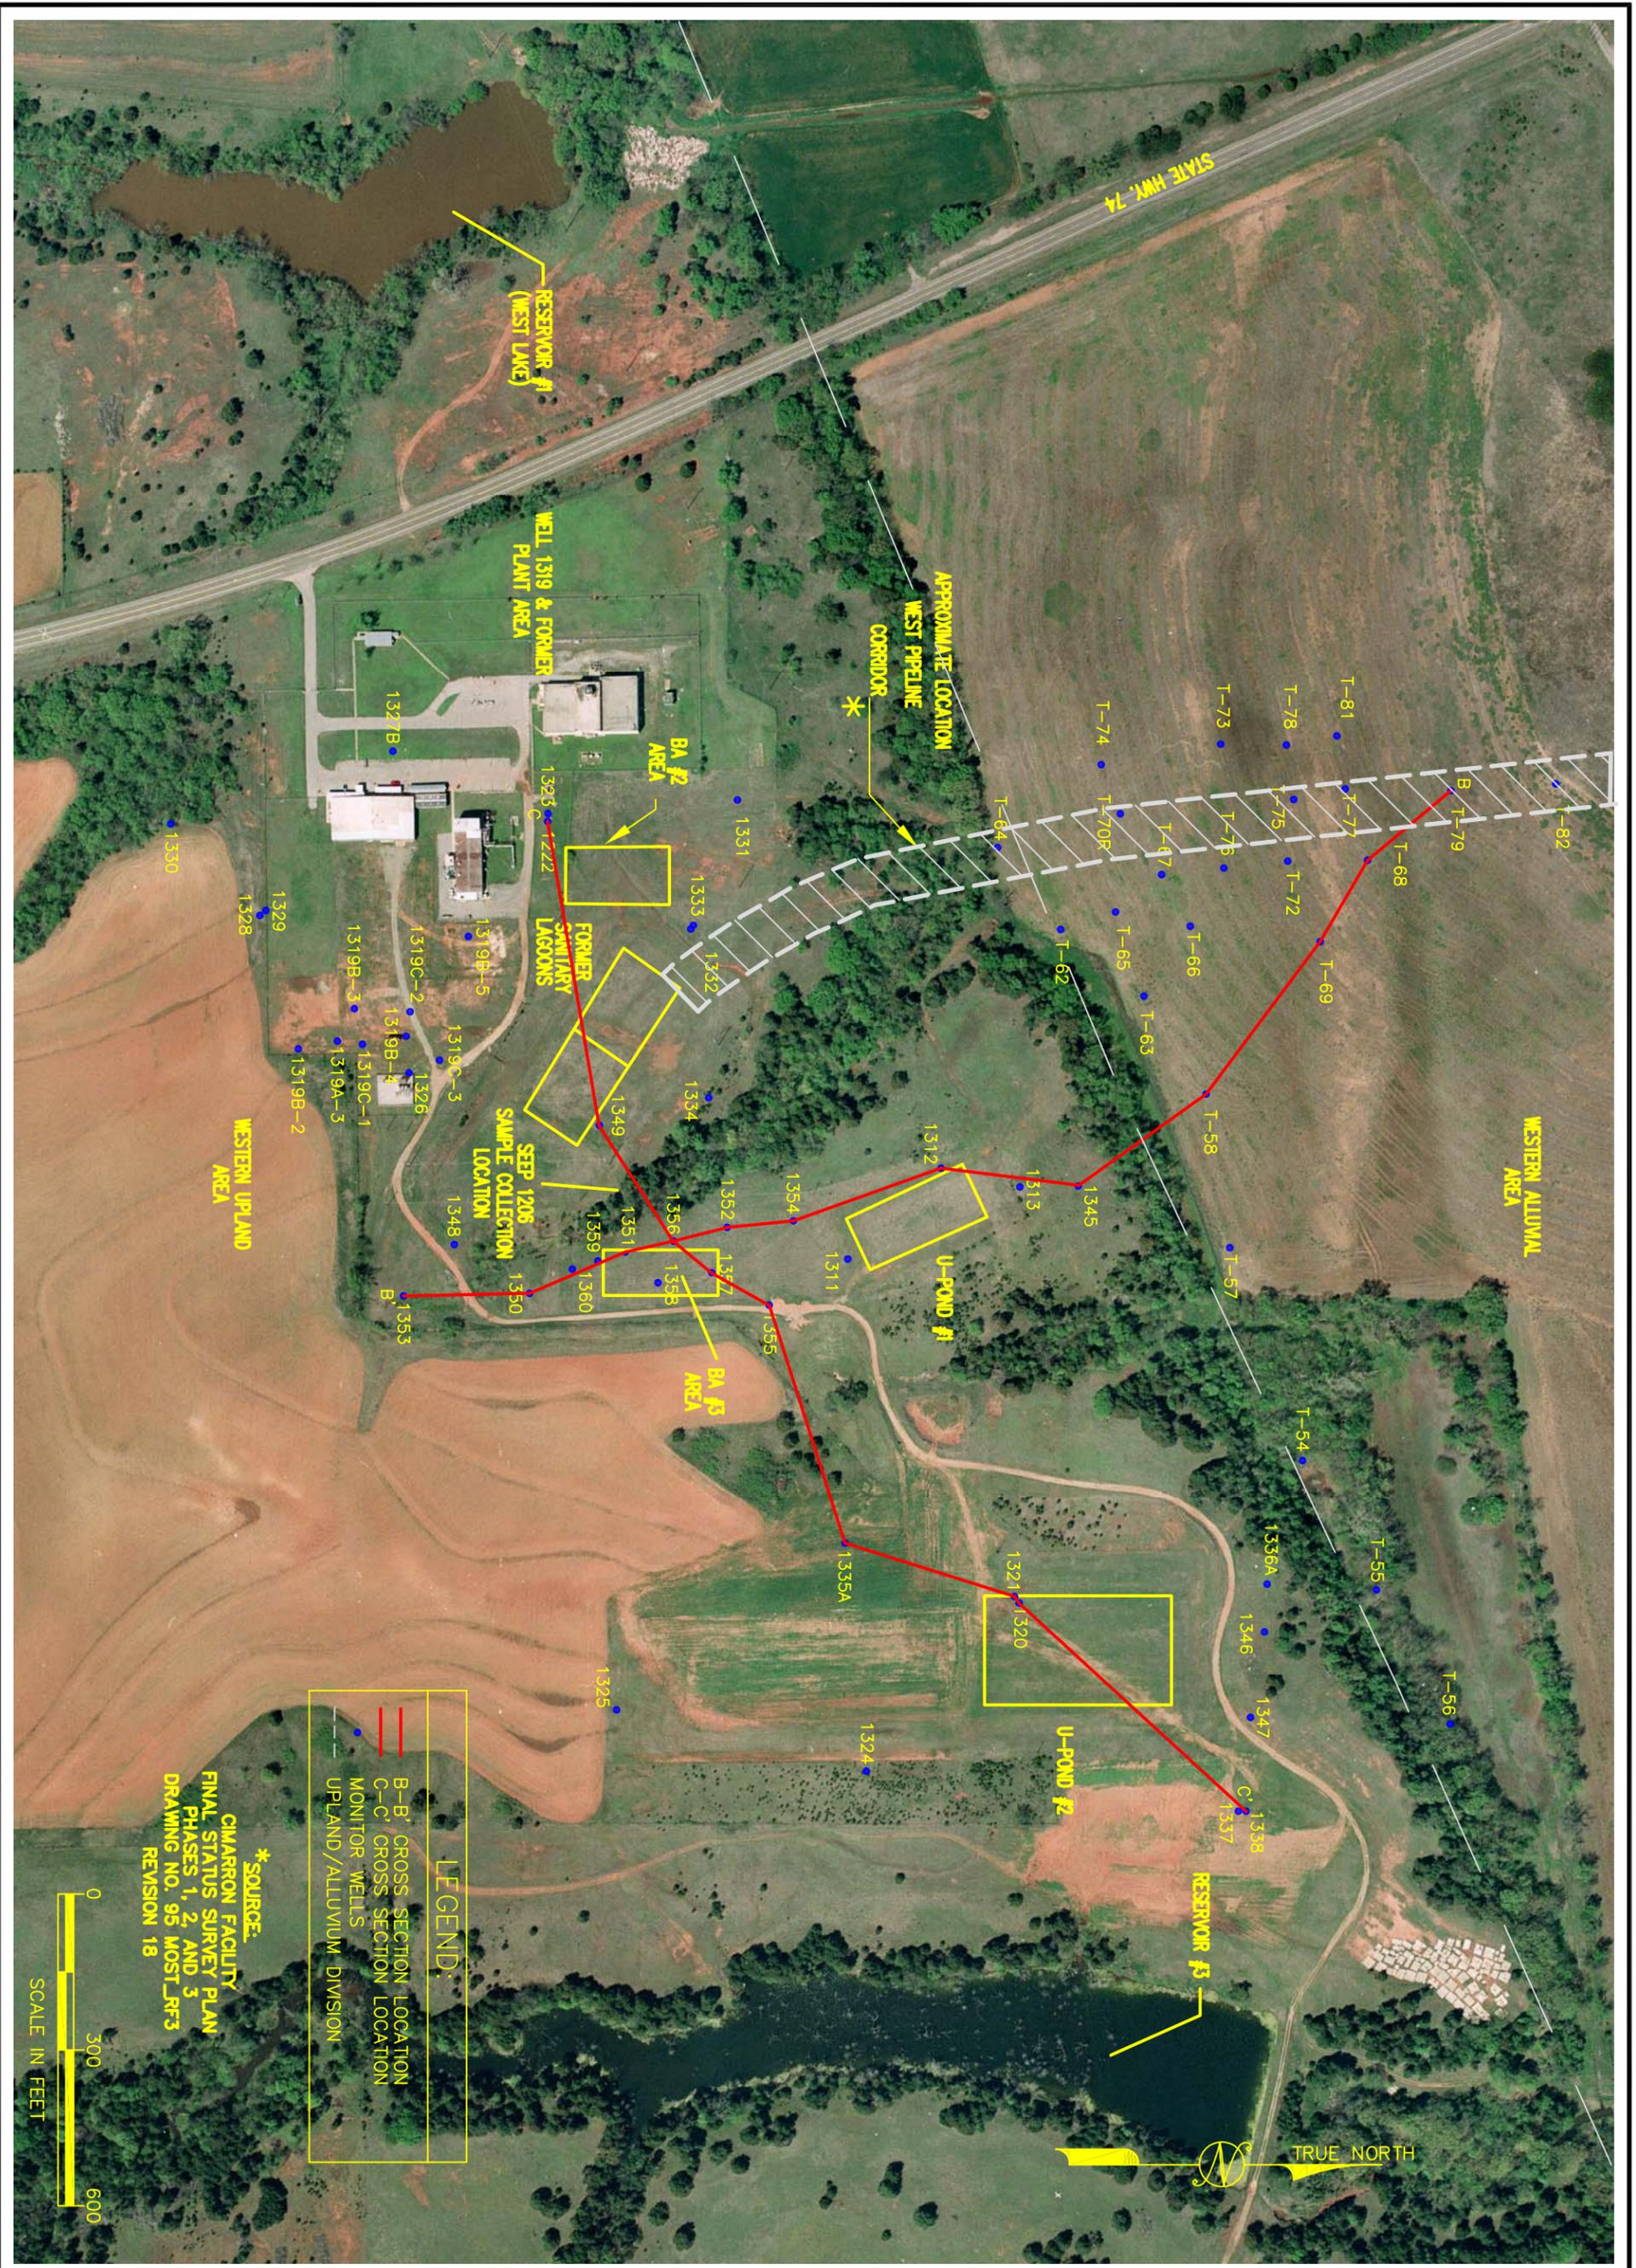

LEGEND:
 B-B' CROSS SECTION LOCATION
 C-C' CROSS SECTION LOCATION
 MONITOR WELLS
 UPLAND/ALLUVIUM DIVISION

*SOURCE:
 CIMARRON FACILITY
 FINAL STATUS SURVEY PLAN
 PHASES 1, 2 AND 3
 DRAWING NO. 95 MOST-RF3
 REVISION 18


SCALE IN FEET
 0 300 600

FIGURE 2-8
 CROSS-SECTION LOCATIONS
 FOR WESTERN PORTION OF SITE
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA


SCALE:	DATE:	PROJECT NUMBER:
1" = 300'	8/10/05	04020-044-200

ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		4/10/05	
HTP	2		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

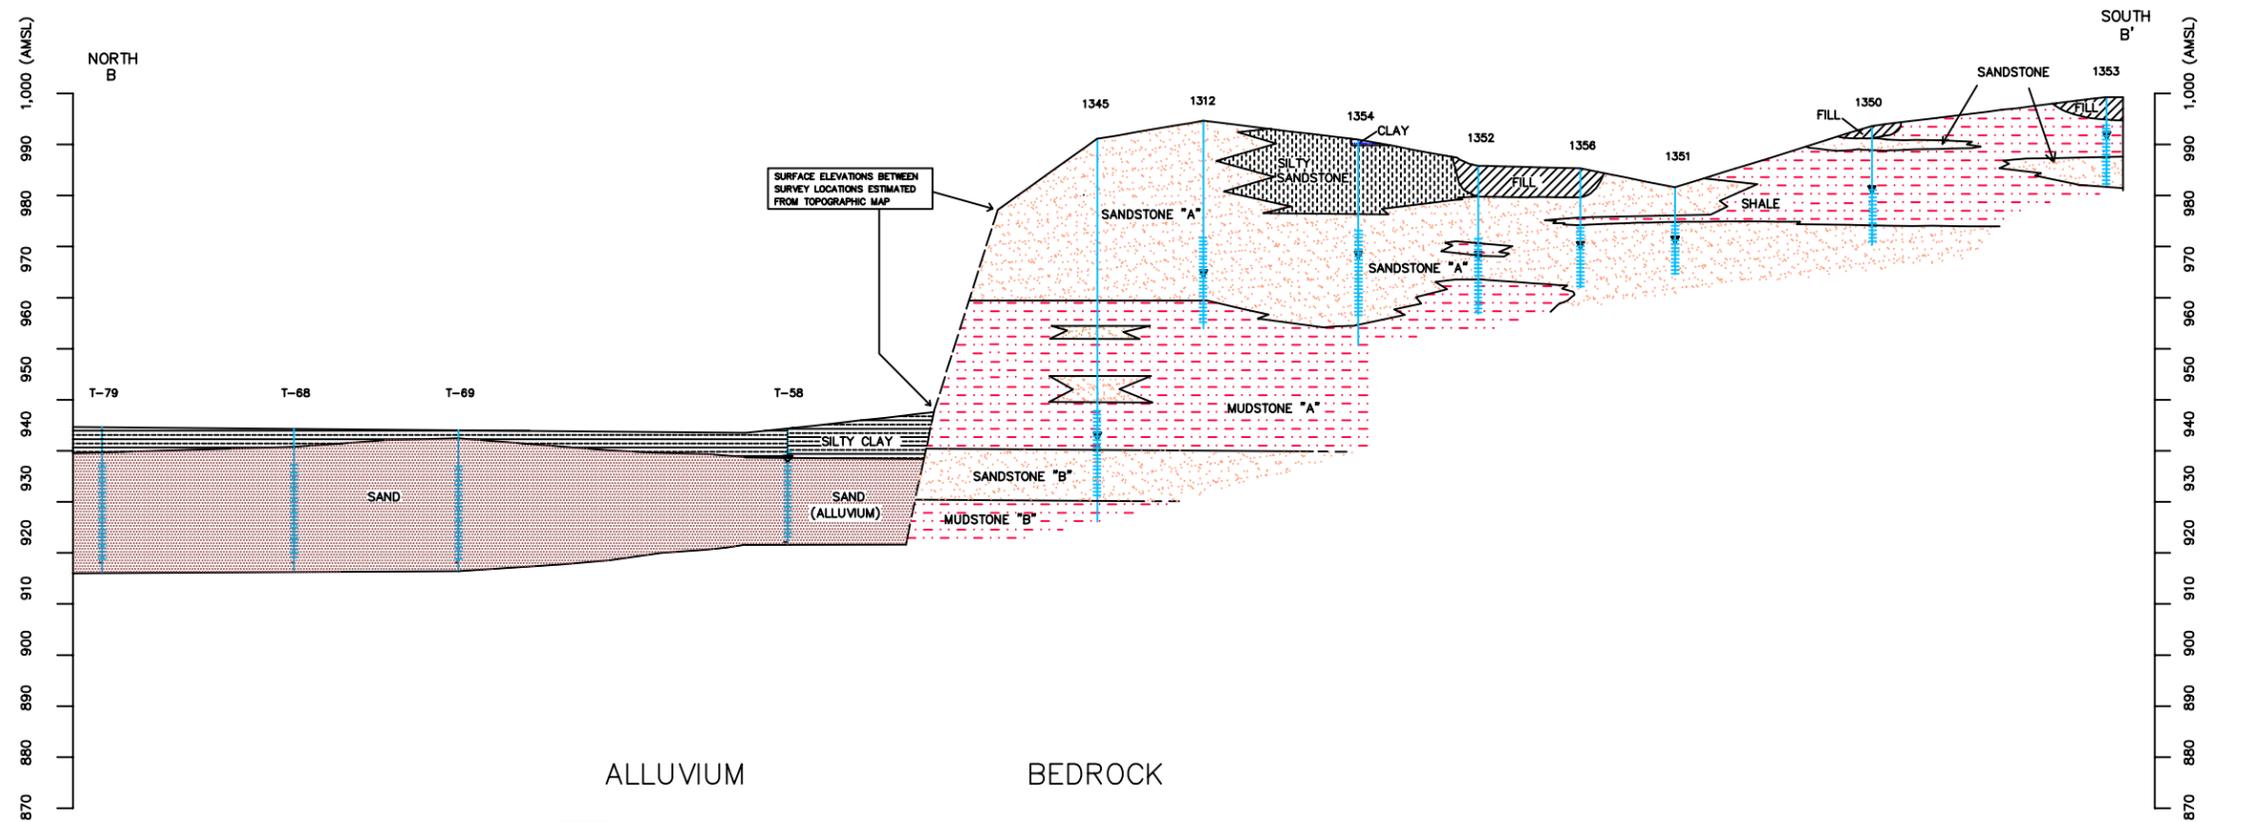

- | | | | | |
|----------|------------|---------|-----------------|------------------------|
| ALLUVIUM | | BEDROCK | | |
| | SAND | | SANDSTONE | |
| | CLAY | | MUDSTONE | |
| | SILTY CLAY | | SILTY SANDSTONE | |
| | | | FILL | 1351 MONITORING WELL |
| | | | | SCREENED WELL INTERVAL |

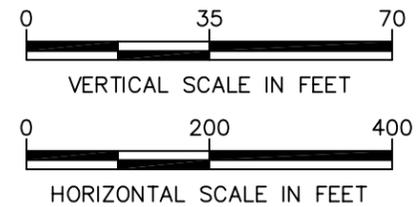




DESIGNED BY:		REVISIONS	
NO.:	DESCRIPTION:	NO.:	DESCRIPTION:
1		1	
2		2	
DRAWN BY: JAS		DATE:	4/01/05
CHECKED BY: DJF		DATE:	6/17/05
APPROVED BY: DJF			

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

FIGURE 2-9
GEOLOGICAL CROSS SECTION B-B'
WESTERN UPLAND AND ALLUVIAL AREAS
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE: 1" = 200'
DATE: 8/10/05
PROJECT NUMBER: 04020-044-200

FIGURE NUMBER:
2-9
SHEET NUMBER:
1

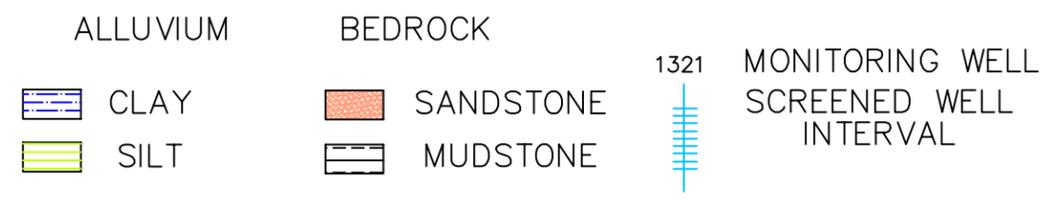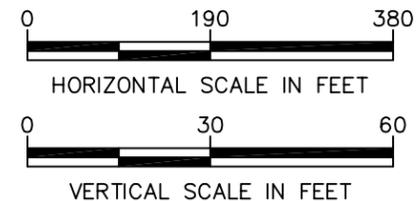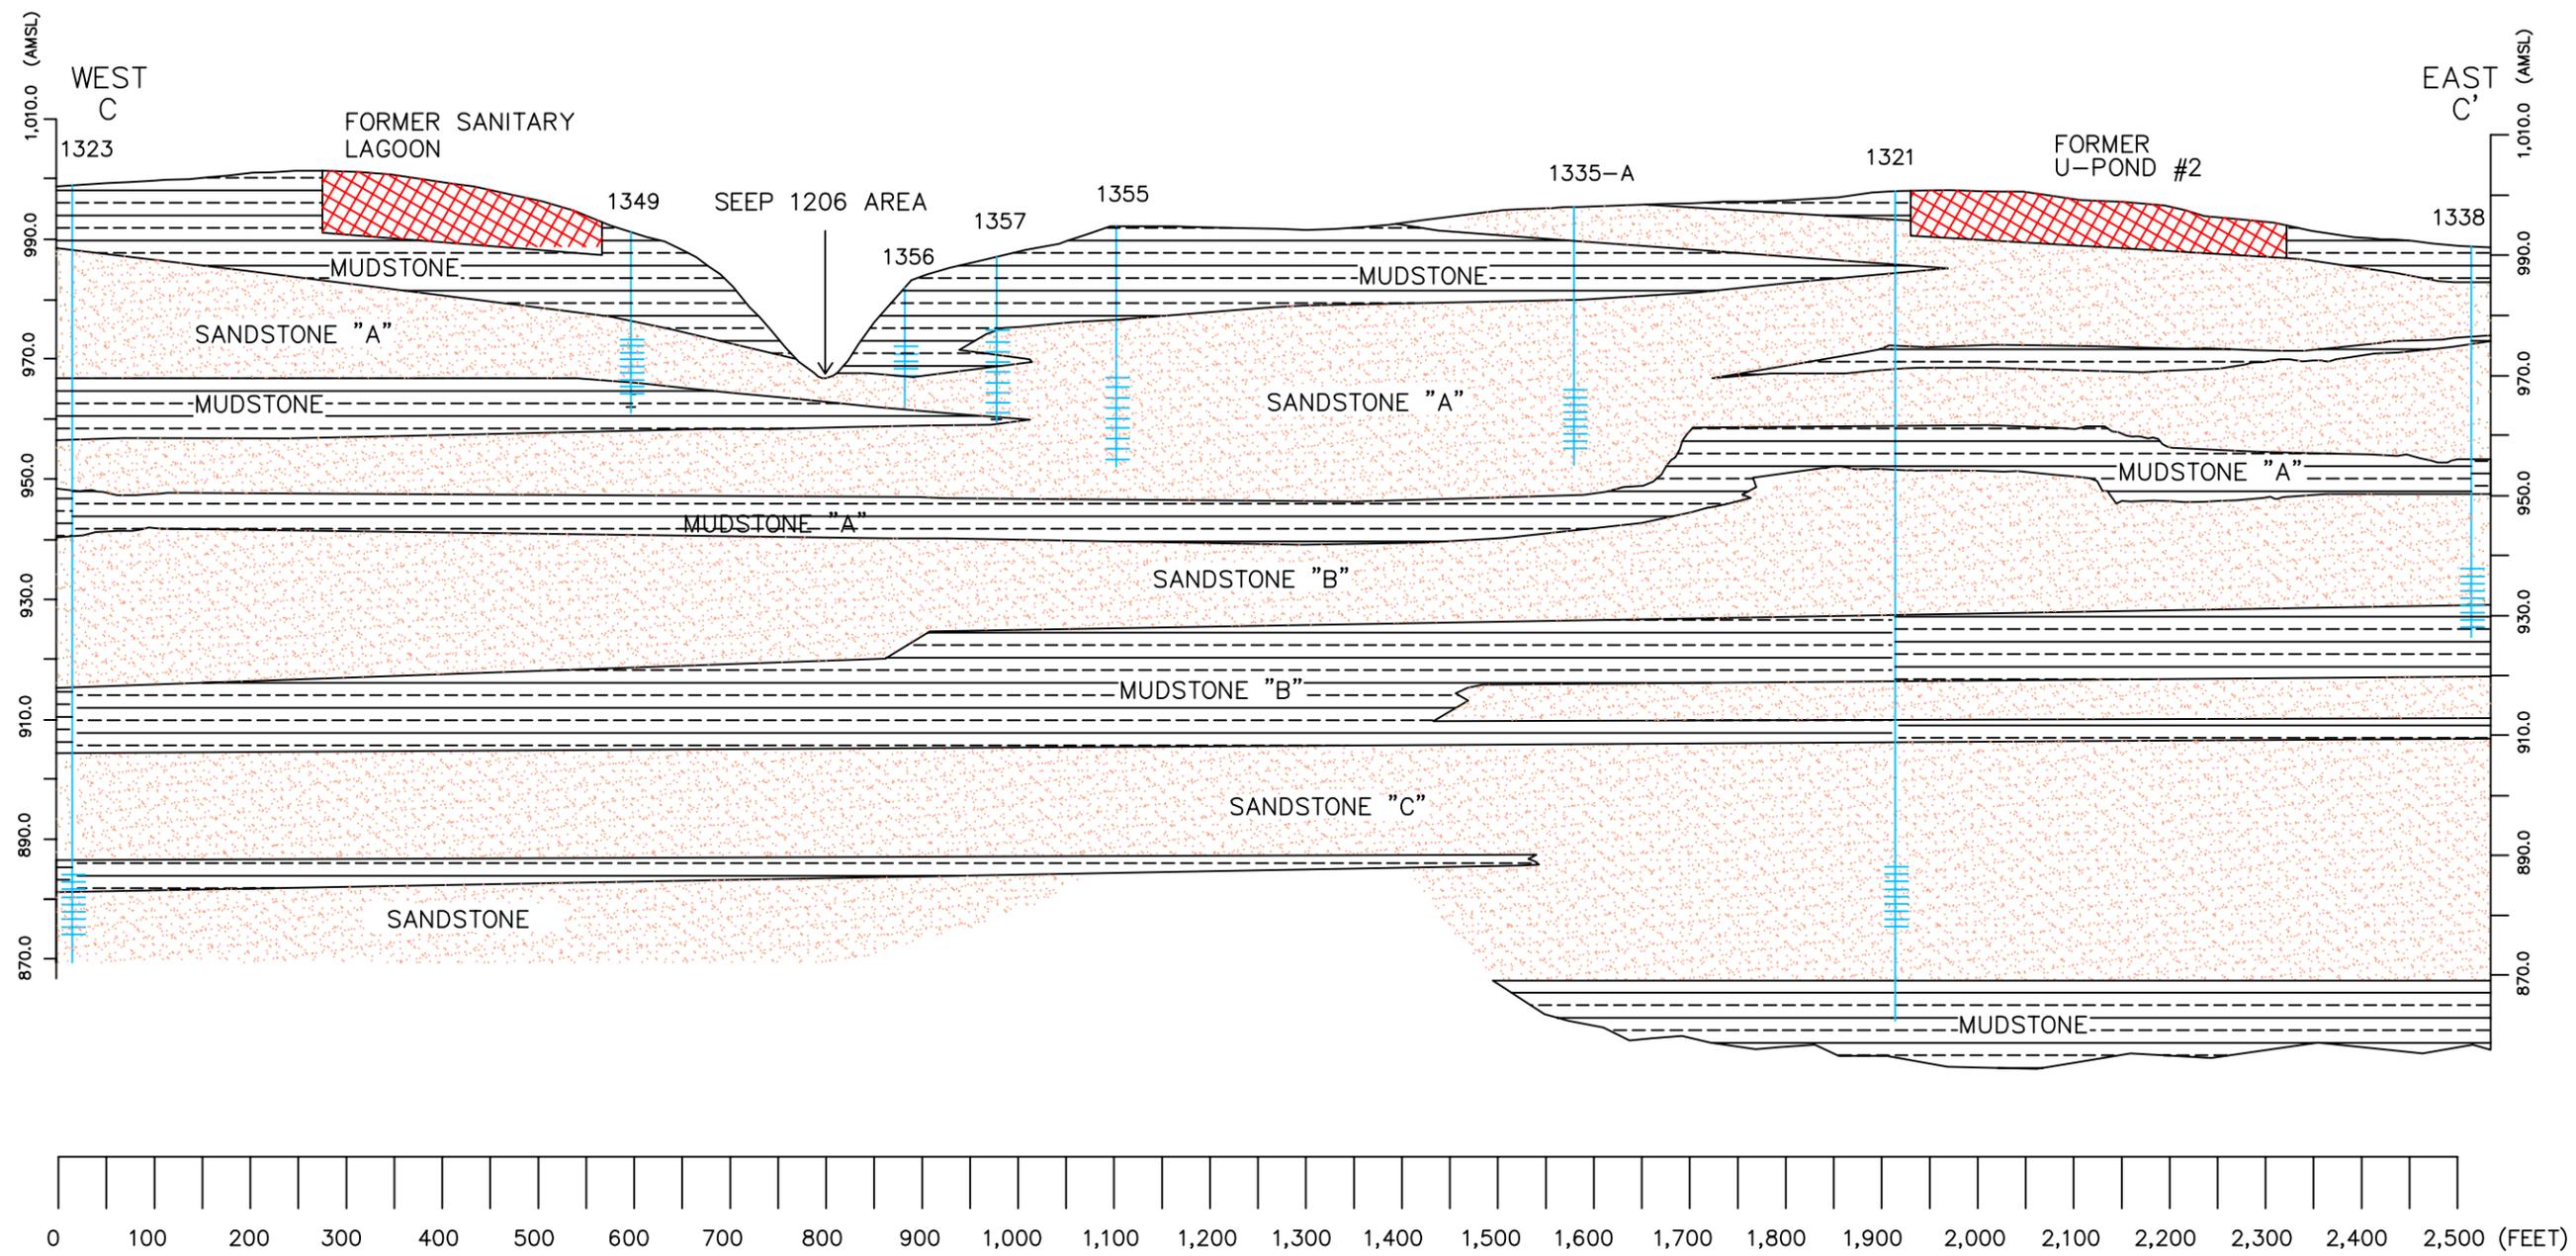

DESIGNED BY:		DRAWN BY:		CHECKED BY:		APPROVED BY:	
		JAS		DJF		DJF	
NO.:		DATE:		DESCRIPTION:		REVISIONS	
1		4/01/05		JAS			
2		6/17/05					

ENSR
INTERNATIONAL

4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6602
WEB: HTTP://WWW.ENSR.COM

FIGURE 2-10
GEOLOGICAL CROSS SECTION C-C'
SANITARY LAGOON TO U-POND #2 AREA
CIMARRON CORPORATION
CRESCENT, OKLAHOMA


SCALE: 1" = 190'

DATE: 8/10/05


PROJECT NUMBER: 04020-044-200

FIGURE NUMBER:
2-10

SHEET NUMBER:
1

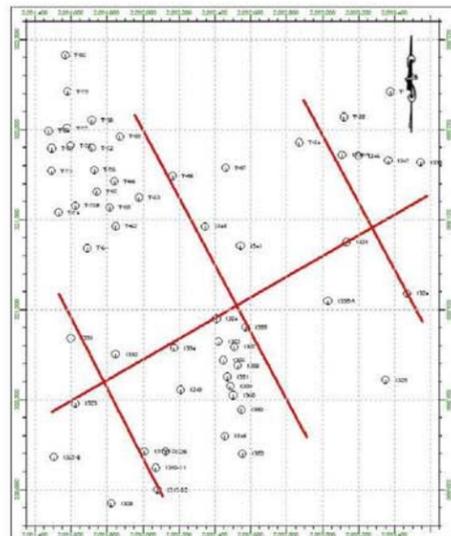

WESTERN UPLAND AND ALLUVIUM
AREA FENCE DIAGRAM LOCATION LAYOUT
(SEE WITH FIGURE 2-8 TO IDENTIFY
INDIVIDUAL MONITOR WELLS)

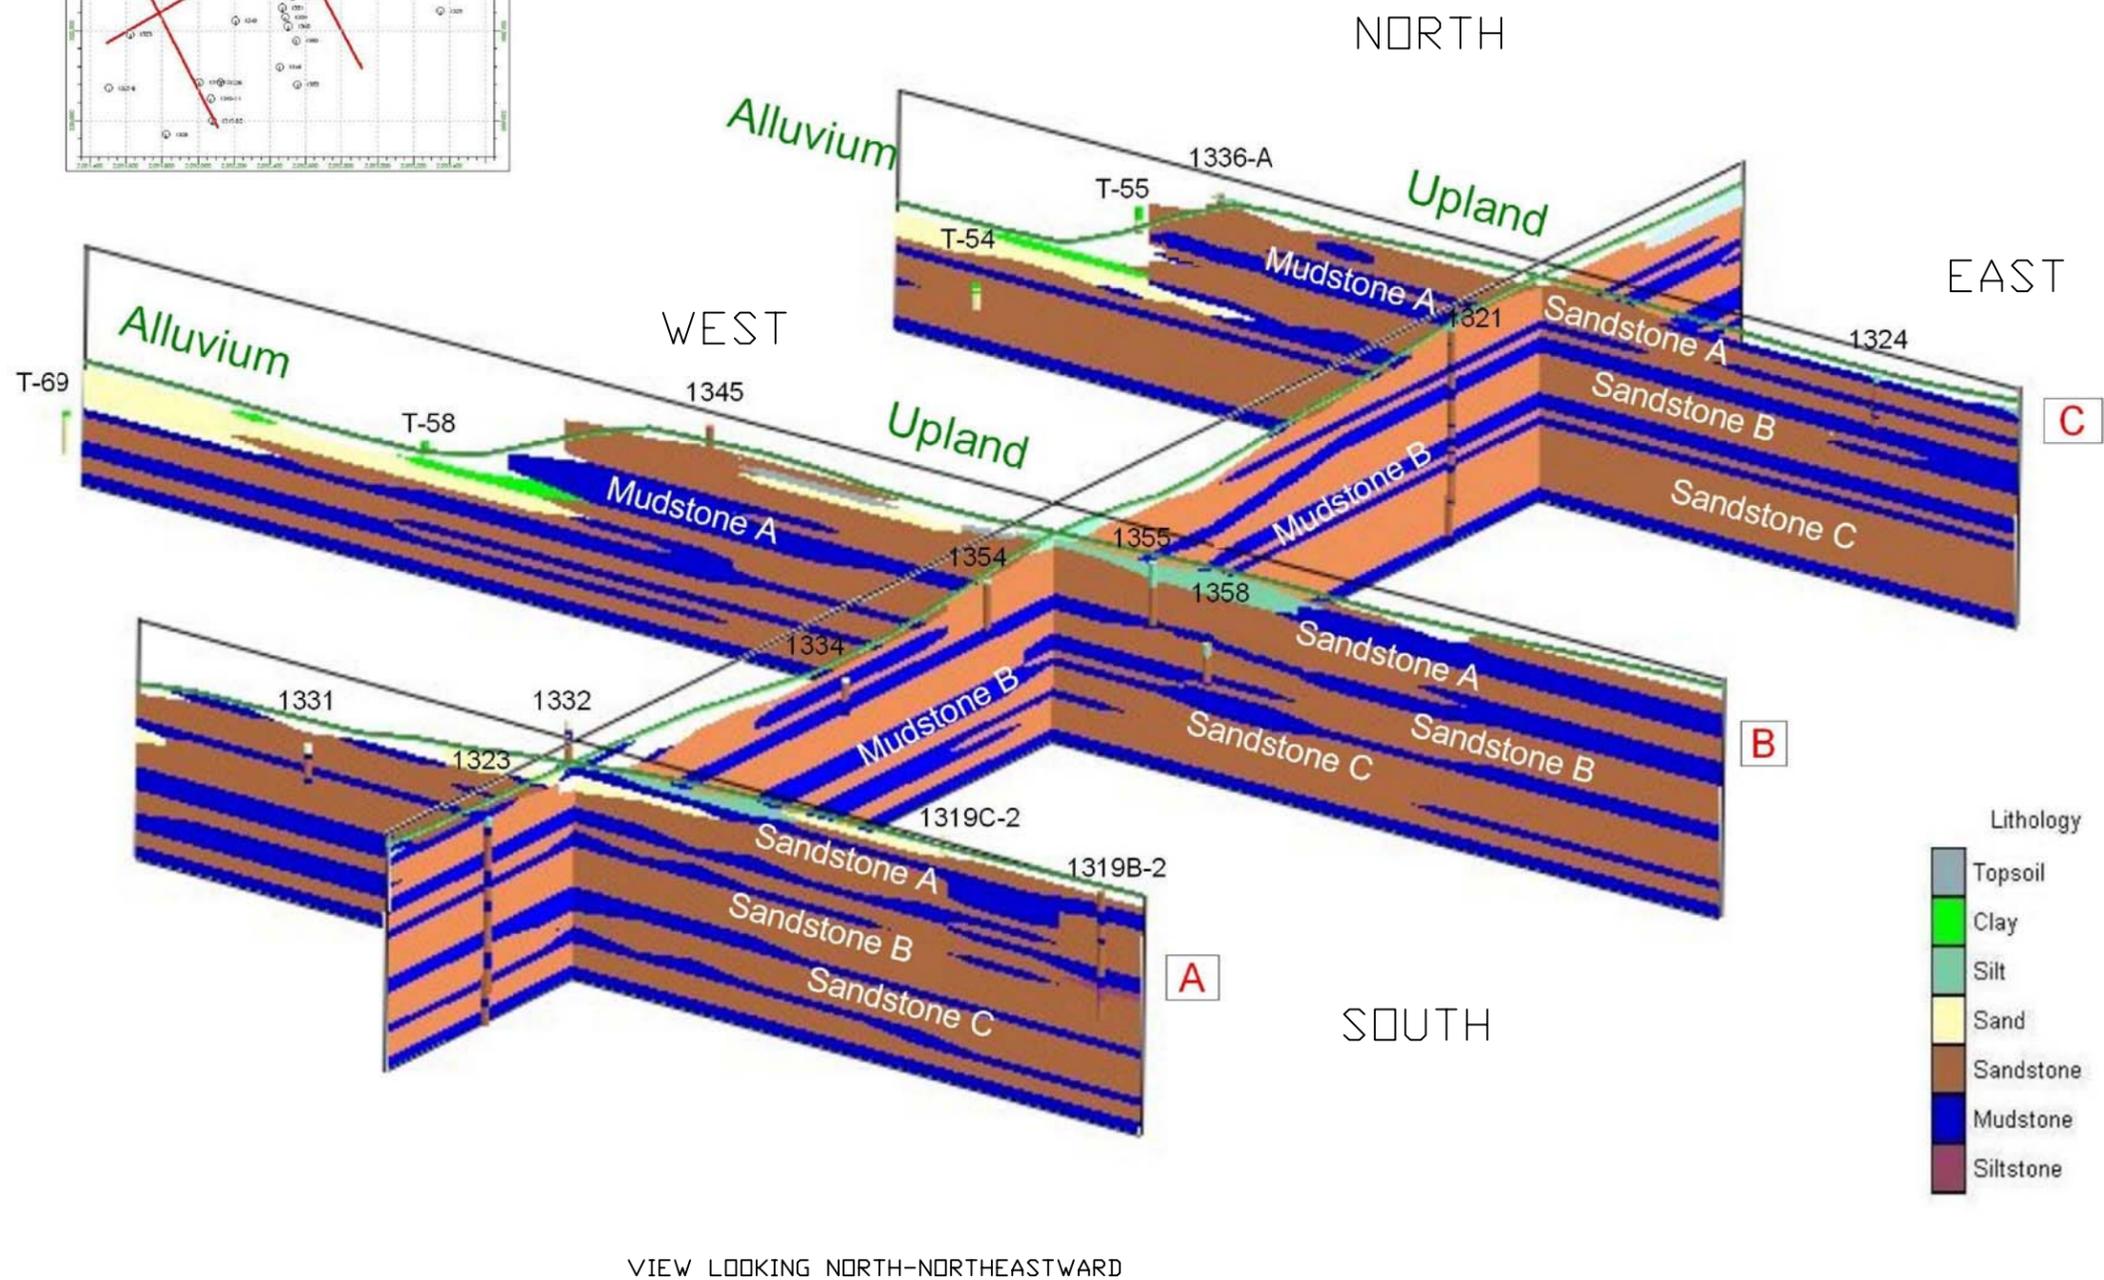

DESIGNED BY:	NO.	DESCRIPTION	DATE:	BY:
DRAWN BY:	1		4/01/05	JAS
CHECKED BY:	2		4/05/05	JAS
APPROVED BY:	3		6/17/05	

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

FIGURE 2-11 WESTERN UPLAND AND ALLUVIAL AREA FENCE DIAGRAM CIMARRON CORPORATION CRESCENT, OKLAHOMA	
SCALE:	DATE: 8/10/05
	PROJECT NUMBER: 04020-044-200

FIGURE NUMBER:	2-11
SHEET NUMBER:	1

3.0 Hydrogeological Conceptual Site Model

3.1 General Hydrogeology of the Cimarron Area

The following sections describe the climate in the region, the general features of the Cimarron River floodplain, surface water features, and groundwater in the area of the Cimarron Site.

3.1.1 Climate

Adams and Bergman (1995) summarized the precipitation for the Cimarron River from Freedom to Guthrie, Oklahoma. Their study showed that precipitation ranges from an average of 24 inches per year near Freedom, Oklahoma, in the northwest part of the Cimarron River floodplain in Oklahoma, to 32–42 inches per year at Guthrie, Oklahoma. Wet years between 1950 and 1991 were in 1973–1975, 1985–1987, and 1990–1991. The wettest months are May through September, while the winter months are generally the dry months. The period from 1973 to 1975 was 23 inches above normal total for the three-year period (Carr and Marcher, 1977).

Precipitation data collected by the National Oceanic and Atmospheric Administration (NOAA) for Guthrie County, Oklahoma, from 1971 to 2000 indicates that the annual average precipitation is 36.05 inches. The minimum monthly average precipitation is 1.33 inches (January) and the maximum monthly average is 5.48 inches (May).

3.1.2 Cimarron River Floodplain

The Cimarron River and its floodplain, consisting of terrace deposits and alluvial floodplain gravels and sands, is the major hydrologic feature at the Cimarron Site. The Cimarron River heads in Union County, New Mexico. It flows through areas of Colorado, Kansas, and Oklahoma and terminates at the Keystone Reservoir on the Arkansas River. Land along the course of the river is used mainly for farming, ranching, and residential development.

The alluvial gravel and sand deposits are up to 50 feet thick and average about 20 feet thick (Adams and Bergman, 1995). Both are reddish brown in color. Dune deposits (loess) can be found along the north side of the river up to 70 feet high and are the result of strong southerly winds blowing the unconsolidated terrace material. The geology of the Cimarron River floodplain is shown in Figure 3-1. The location of key regional stream gages is presented in Figure 3-2.

3.1.2.1 River Flow

The Cimarron River is a gaining river over its entire course from Freedom to Guthrie, Oklahoma. In the vicinity of the Cimarron Site and Guthrie, the flow is perennial. Base flow from the alluvial and terrace aquifers and from the Permian sandstone units that border the river is highest in the winter months due to the higher water tables in these aquifers, which result from decreased evapotranspiration. Base flow is lowest from late summer through early winter because water tables are at their low point during that time. Because the Cimarron River is fed mainly by base flow from groundwater aquifers, flow in the Cimarron River parallels this seasonal fluctuation in groundwater levels.

River flow has not been directly measured at the site because there are no stream gages within the Cimarron Site boundary. From 1990 to 2003, the Guthrie gage, located approximately 10 miles east of the site, recorded from 591 to 3,271 cfs average annual flow rates (United States Geological Survey

[USGS] water data website). Adams and Bergman (1955) reported a low-water median flow rate of approximately 100 cubic feet per second (cfs) and a high-water median flow rate of 600 cfs.

Flood statistics for the Cimarron River have been compiled by the USGS (Tortorelli and McCabe, 2001). Peak flows range from a 2-yr flood with a discharge of 26,700 cfs to a 500-yr flood with a discharge of 237,000 cfs. Floods most typically occur in this area in May-June or October, largely as a function of heavy rainfall in upstream portions of the watershed. The most recent significant flood was 20 years ago in 1986. The extent of flooding for the 100-yr flood includes the entire alluvial valley, but not the upland areas of the site.

3.1.2.2 Alluvial and Terrace Groundwater

Groundwater from alluvial and terrace deposits discharges to the Cimarron River throughout most of the river's course through Oklahoma. Estimates for hydraulic parameters from water well tests gave a median hydraulic conductivity of 221 feet/day (0.078 centimeters per second [cm/s]) for the floodplain alluvium and a median of 98 feet/day (0.035 cm/s) for the terrace deposits. Recharge to the alluvial gravels and the terrace deposits along the Cimarron River was estimated at 8 percent of precipitation based on base flow calculations and the assumption of steady-state equilibrium in the gravels and terrace sands (Adams and Bergman, 1995). Water-level fluctuations in water wells with 10 years or more of records averaged about 3 feet on a seasonal basis.

3.1.3 Other Surface Water Features in the Cimarron Area

Surface water features at the Cimarron Site are shown in Figure 3-3. Besides the Cimarron River, the next major surface water feature is Cottonwood Creek, which is located about seven miles south of the site and flows northeast through Guthrie. Cottonwood Creek, like the Cimarron River, is a gaining stream and drains southern Logan and northern Oklahoma counties. On the north side of the Cimarron River, across from the Cimarron Site, springs can be found at Indian Springs and small lakes are present at Crescent Springs. On the south side of the Cimarron River near the site, Gar Creek on the east and Cox Creek on the west are named drainages that receive most of their flow from groundwater base flow. Most drainages within and near the Cimarron Site are ephemeral in nature and flow only in response to heavy rainfall or from groundwater base flow when groundwater levels are relatively high.

Within the Cimarron Site, three unnamed drainages have been dammed to form small reservoirs, numbered 1 through 3 as shown in Figure 3-3. The maximum water levels in the reservoirs are controlled by spillways. When water levels in the reservoirs exceed the elevation of the spillways, which typically occurs following heavy rainfall, water flows over the top of the spillways into the drainage ways below. Reservoir #1 maintains a surface water elevation of approximately 959.3 feet amsl, Reservoir #2 an elevation of approximately 966.3 feet amsl, and Reservoir #3 an elevation of approximately 959.7 feet amsl (J.L. Grant and Associates, 1989). This placed Reservoirs #1 and #3 below the 1989 groundwater table in the shallow sandstone unit, and Reservoir #2 above the shallow sandstone unit groundwater table. Thus, Reservoir 2 is suspected of acting as a recharge source for groundwater in the eastern part of the site, southeast of the BA #1 Area, while Reservoirs #1 and #3 are groundwater drains that evaporate groundwater at approximately the rate of groundwater influx, on an average annual basis. The pond evaporation rate in this part of central Oklahoma is approximately 60 inches per year.

3.1.4 Regional Groundwater in the Cimarron Area

Groundwater in the Permian-age Garber Formation is found in the Garber Sandstones and the underlying Wellington Formation. Shallow groundwater, defined by Carr and Marcher (1977) as

groundwater at depths of 200 feet or less, is generally fresh and mostly unconfined. Groundwater deeper than 200 feet can be artesian to semi-artesian. The base of fresh groundwater at the Cimarron Site is at approximately 950 feet amsl and the thickness of the fresh water zones has been estimated at 150 feet (Carr and Marcher, 1977). Data from the Cimarron Site shows that groundwater in Sandstone C, which is generally more saline than groundwater in Sandstones A and B, is usually at an elevation around 900 to 920 feet amsl. Thus, at the Cimarron Site, the bottom of fresh water is somewhat lower than estimated by Carr and Marcher (1977) for this part of the Garber Formation and, conversely, the thickness of the fresh water zone is somewhat greater. Following Carr and Marcher (1977), the groundwater in Sandstone C at the Cimarron Site, therefore, represents the top of the saline groundwater zone in the Garber Formation.

Recharge to shallow groundwater in the Permian-age Garber Formation near the Cimarron Site has been estimated at 190 acre-feet per square mile, or about 10 percent of annual precipitation (Carr and Marcher, 1977). Adams and Bergman (1995) estimate a similar recharge of 8 percent of annual precipitation. A regional groundwater high is located south of the Cimarron Site between the Cimarron River and Cottonwood Creek (Carr and Marcher, 1977). The maximum groundwater elevation on this high is around 1,050 feet amsl. Groundwater flows north toward the Cimarron River from this location. Groundwater also flows southward from the high to Cottonwood Creek. The regional northward gradient from the groundwater high to the Cimarron River in the shallow sandstone unit is approximately 0.0021 foot/foot. The gradient to the south to Cottonwood Creek is 0.0067 foot/foot. This groundwater high and the uplands at the Cimarron Site are within a major recharge area for the Garber Formation.

This suggests that vertical groundwater flow in the area of recharge between Cottonwood Creek and the Cimarron River is downward. At the Cimarron River and at Cottonwood Creek, regional groundwater flow in the fresh water zone of the Garber Formation is vertically upward to allow for discharge at these surface water features, which act as groundwater drains in this part of central Oklahoma (Carr and Marcher, 1977). The nature of vertical groundwater flow in the saline water zone of the Garber Formation at the Cimarron River and at Cottonwood Creek is uncertain.

3.2 Groundwater Flow at the Cimarron Site

The general groundwater flow direction at the Cimarron Site is northward from the groundwater high south of the Cimarron Site toward the Cimarron River. Within the Cimarron Site, groundwater flow directions vary locally depending on depth within the Garber Formation.

The conceptual model of the groundwater system at the Cimarron site is based on information collected over many years, as noted in Section 1.4. In addition, to support evaluation of remedial alternatives, a numerical groundwater flow model was recently constructed (ENSR, 2006). The model has also served as a tool in refining the groundwater conceptual model. The model geometry, inputs, calibration process and simulated hydraulic heads are discussed in detail in the Groundwater Flow Modeling Report, Cimarron Site (ENSR, 2006). As appropriate, information from the numerical modeling has been incorporated in the conceptual model discussion below.

3.2.1 Delineation of Water-bearing Units

Geologically, the Garber Formation Sandstones at the Cimarron Site have been divided into Sandstones A, B, and C, as discussed in Section 2.2 (Stratigraphy of the Cimarron Site) of this report. The Garber and Wellington Formations have been grouped into the Garber-Wellington Formation by Carr and Marcher (1977). At the Cimarron Site, the Garber-Wellington Formation can be further divided into water-bearing units because the mudstone layers that separate the three main sandstone units of the

Garber Formation at the site act as semi-confining units. In the upper 200 feet at the Cimarron Site, there are thus four main water-bearing units as follows:

1. Sandstone A;
2. Sandstone B;
3. Sandstone C; and
4. Cimarron River Alluvium.

Each of these four water-bearing units at the Cimarron Site has its own specific flow patterns and hydraulic properties.

For Sandstone A, slug tests completed by J.L. Grant and Associates (1989) gave a geometric mean hydraulic conductivity of 1.03×10^{-3} cm/s with a range from 2.41×10^{-4} cm/s to 5.7×10^{-3} cm/s. The geometric mean for transmissivity was 33.4 square feet/day (ft²/d) with a range from 10.3 ft²/d to 108 ft²/d. For the Sandstone C, the geometric mean hydraulic conductivity was 7.85×10^{-5} cm/s.

Aquifer tests in the BA #1 Area (Cimarron Corporation, January 2003) included slug tests on many of the monitor wells and a pumping test using well 02W56 with observation wells at distances from 16 to 107 feet from the pumping well. For Sandstone B, hydraulic conductivity estimates ranged from 9.97×10^{-4} cm/s to 2.39×10^{-5} cm/s. For the alluvial sediments of the Cimarron River Floodplain, hydraulic conductivity estimates varied from values in the 10^{-2} cm/s to 10^{-3} cm/s range for the coarser sediments (sandy alluvium) to values in the range of 10^{-4} to 10^{-5} cm/s for sediments high in clays and silts (transitional zone). Because the alluvial sediments have higher clay and silt content near the escarpment where Sandstone B is exposed, the slug tests in the alluvial sediments gave lower hydraulic conductivities nearer the escarpment.

A comprehensive summary of site-specific hydraulic conductivity values is provided in the Groundwater Flow Modeling Report. In addition, the numerical modeling included calibration of hydraulic conductivity. The calibrated values for the various geologic materials are presented in the Report.

Depths to groundwater vary across the site, depending on the geologic unit and time of measurement. The following discussion is based on four rounds of water levels collected over various seasons between 2003 and 2005 (Sept 2003, Dec 2003, Aug-Sept 2004, and May 2005).

In general, the highest water levels are found in the spring, with the lowest in the fall. This pattern is typical in temperate areas where plant evapotranspiration intercepts much of the recharge to groundwater during the growing season, with a resulting lowering of groundwater levels.

In the Western Upland area, depths to groundwater range from approximately 20 to 50 feet in Sandstone A, fluctuating up to about 2 feet across the four monitoring events. The depth to water in Sandstone B in the Western Upland Area is approximately 30 feet greater than Sandstone A. The relative groundwater levels suggest there may be some perching of water in Sandstone A, especially to the north, near the escarpment. That is, there may be some portions of Sandstone B that are unsaturated.

In the Western Alluvium Area, the depth to groundwater ranges from approximately 20 to 35 feet, fluctuating approximately 2 feet over time. In the BA#1 Area, depths to groundwater in Sandstone B range from approximately 20 to 35 feet, with fluctuations over time of up to 7 ft. In the alluvium, depths to water range from approximately 20 to 30 feet, with fluctuations of 2 to 3 feet.

In general, changes in water levels are more similar across wells in the alluvium, consistent with its higher permeability and greater storage capacity. This suggests that hydraulic gradients in the alluvium are very consistent, not changing significantly in direction or magnitude over time. In contrast, water level fluctuations are more variable across wells in the bedrock units, although still relatively small, typically on the order of a few feet.

3.2.2 Potentiometric Surfaces

The direction of groundwater flow in each of the four water-bearing units at the Cimarron Site is slightly different, although all four units have a general flow pattern from south to north toward the Cimarron River. Figure 3-4 presents a potentiometric surface map of Sandstone B and the alluvium for the BA #1 Area based on groundwater-level measurements during the August/September 2004 annual sampling of monitor wells at the Cimarron Site. Figures 3-5 and 3-6 present potentiometric surface maps respectively, of Sandstone A in the Western Upland Area and the Alluvial Area based on groundwater level measurements collected during the August/September 2004 annual sampling of monitor wells at the Cimarron Site. As noted in Section 3.2.2, groundwater levels may change seasonally, however, the piezometric surface maps do not change significantly over time.

3.2.3 General Groundwater Flow Patterns

In those areas where Sandstone A is the uppermost water-bearing unit, the hydraulic gradient in Sandstone A mimics local topography. Groundwater in Sandstone A flows from the topographically higher areas to adjacent drainages and reflects local recharge from precipitation events. That is, the hydraulic gradients in Sandstone A are northwards towards the escarpment, with components of flow to the east and/or west towards the drainages in their vicinity. This same pattern is observed in water levels from Sandstone B where it is the uppermost water-bearing unit in the BA#1 area.

Flow in deeper Sandstones B and C is more regionally controlled. Generally, flow in Sandstones B and C is north to northwest toward the Cimarron River. Flow in the alluvium is northward toward the Cimarron River because the river is a gaining stream throughout its reach from Freedom to Guthrie.

Locally, groundwater flow is expected to be affected by local geologic conditions. The occurrence of the paleochannel in the transition zone in the BA#1 area may provide a preferential pathway for groundwater flow in the otherwise lower permeability of the silts and clays. The presence of the mudstones between the sandstone units will affect flow between the units. Similarly, interbedded layers of silts and clays in the sandy alluvial materials can be expected to have some influence on groundwater flow.

In addition to the horizontal groundwater flow, vertical components of the hydraulic gradient are present depending on the groundwater recharge-discharge relations. In the uplands and generally to the south, the vertical component of the gradient is expected to be downward, as this is an area of groundwater recharge, as described in Section 3.1.4. In the alluvium and near the Cimarron River, vertical gradients are expected to be upward, reflecting groundwater discharge to the River.

3.2.4 Groundwater/Surface Water Interactions

The drainages within the Cimarron Site receive flow from precipitation events and from groundwater base flow when groundwater levels are relatively high. Most of the drainages penetrate only the uppermost sandstone (Sandstone A in the Western Alluvial area, Sandstone B in the BA#1 area) and thus act as local drains for shallow groundwater during precipitation events. Sandstone C has no local interaction with stream flow, except regionally with the Cimarron River. The alluvium of the Cimarron River

floodplain drains to the river, except during flood events when the long-term, stable gradient is disrupted and groundwater flow may be at least partially from the river towards the south.

The other surface water bodies present at the site are the three reservoirs (see Figure 2-3). As described in Section 3.1.3, based on the maintained water levels in the reservoirs, shallow groundwater is expected to discharge to Reservoirs #1 and #3, and Reservoir 2 is suspected of acting as a recharge source for groundwater.

3.2.5 Cimarron River Floodplain

Floodplain sediments can receive water from five possible sources in the site's vicinity: 1) precipitation, 2) upward flow from Sandstone B and/or Sandstone C when either lies beneath the alluvium; 3) discharges from Sandstone A and/or Sandstone B at the escarpment; 4) surface water runoff from drainages; and 5) periodic flooding of the Cimarron River. Long-term water supply to the floodplain alluvium comes from upward flow in Sandstone B and/or Sandstone C due to convergence of regional groundwater flow at the Cimarron River (Carr and Marcher, 1977). In areas where Sandstone C directly underlies the alluvium, groundwater in Sandstone C flows upward into the floodplain alluvium as evidenced by site geochemical data (see Sections 4.3 and 4.4 of this report). Vertically upward flow from deeper units at or near the Cimarron River beneath the floodplain alluvial sediments is uncertain because of the density of the more-saline water in these units. Precipitation recharges the alluvial floodplain at a rate of about 8 percent of annual precipitation (Adams and Bergman, 1995). Periodic flooding by the Cimarron River temporarily affects bank storage in the alluvium adjacent to the river channel.

3.3 Groundwater Flow Regimes at the Cimarron Site

Because groundwater flow varies locally across the Cimarron Site, a discussion of groundwater flow for specific areas of interest is presented in this section, with reference to the local groundwater contour maps presented in Figures 3-4, 3-5, and 3-6.

3.3.1 BA #1 Area

Groundwater in the vicinity of the BA #1 Area (Figure 3-4) originates as precipitation that infiltrates into the shallow groundwater unit recharge zones in the area of the former disposal trenches and flows into Sandstone B. Groundwater also enters this area from upgradient. This groundwater then flows across a buried escarpment that acts as an interface for the Sandstone B water-bearing unit and the Cimarron River floodplain alluvium, and finally into and through the floodplain alluvium to the Cimarron River. There is also flow in the BA#1 Area towards the drainage to the east. As shown in Figure 3-4, flow in Sandstone B in the area that is west of the transitional zone is mostly northward, and to the south it is eastward towards the drainage. Between these two areas, the gradient is to the northeast along the interface with the transitional zone. Flow is driven by a relatively steep hydraulic gradient (0.10 foot/foot) in Sandstone B.

Based on their relative elevations, it seems likely that groundwater discharges from Sandstone B into the southern portion of the drainage. However, to the north, the groundwater elevation is well below the stream bed. Therefore, when water is flowing in the northern portion of the drainage, such as following precipitation events, groundwater may be locally recharged. The elevation of Reservoir #2 is well above the groundwater in the BA#1 Area. Whatever hydrologic effect the reservoir has on groundwater is reflected in the measured groundwater levels. It is unlikely that fluctuations in the level of the reservoir would affect groundwater flow.

Once groundwater enters the transition zone of the floodplain alluvium, the hydraulic gradient decreases to around 0.023 foot/foot and flow is refracted to a more northwesterly direction. The decrease in hydraulic gradient is due in part to the much higher overall hydraulic conductivity in the floodplain alluvium compared to Sandstone B (10^{-2} to 10^{-3} cm/s versus 10^{-5} to 10^{-4} cm/s in Sandstone B). The refraction to the northwest may also be due to a paleochannel in the floodplain alluvial sediments. The direction of this paleochannel is to the northwest near the buried escarpment and then is redirected to the north as it extends farther out into the floodplain. This paleochannel is discussed in Section 2.3.1 (Detailed Stratigraphic Correlations at Cimarron – BA #1 Area) of this report and shown in Figure 2-7. When constructing the numerical groundwater flow model (ENSR, 2006), groundwater flow in the transition zone was to the northwest based solely on the site-specific geologic information.

Once groundwater passes through the transitional zone, it enters the sandy alluvial material where the hydraulic gradient is very flat (0.0007 foot/foot). The decrease in gradient is caused by the higher permeability of the sandy alluvium. Groundwater flow in the alluvium is northward, with discharge ultimately to the Cimarron River. Also in the alluvium, there is expected to be upward flow from the underlying bedrock as groundwater in the bedrock is discharging to the River.

There is no evidence of perched groundwater in this area. However, the presence of the mudstones is likely to restrict vertical movement of groundwater in preference to horizontal flow in the sandstones. The presence of the mudstones indicates that vertical hydraulic conductivities across units are significantly smaller than horizontal conductivities within water-bearing units. Gradients within these lower permeability units are expected to be predominantly vertical. However, due to the low permeabilities of the mudstones, flow will be predominantly horizontal in the water-bearing units, with a minor component of flow vertically across units.

Based on measured hydraulic gradients and estimated hydraulic conductivities, groundwater velocities in the various units can be estimated. Average linear groundwater velocities were calculated using the hydraulic properties presented above and assuming porosity for the sandstone of 5%, 20% for the transition zone, and 33% for the alluvium. The calculated velocities are 0.6 ft/day for Sandstone B, 0.03 ft/day for the transition zone, and 0.3 ft/day for the alluvium. Velocities generated by the groundwater model are approximately 5 ft/day for the sandstone, 3 ft/day for the transition zone, and 4 ft/day for the alluvium.

3.3.2 Western Upland Area

As in the BA#1 Area, groundwater in the Western Upland Area (Figure 3-5) also originates as precipitation that infiltrates into the shallow groundwater unit recharge zones and flows into Sandstone A.

In the Western Upland Area, the drainage between the former Uranium Pond #1 and the former Sanitary Lagoons acts as a local drain for groundwater in Sandstone A. Groundwater flows toward this drainage from both the east and west, including the BA #3 Area and the former Sanitary Lagoons. The thick vegetation and groundwater seeps, such as those at the Western Alluvial Area, attest to groundwater base flow entering this drainage (thus becoming surface water) from Sandstone A.

Groundwater gradients steepen along the cliff faces of the drainage. Along the escarpment bordering the Cimarron River floodplain alluvium just north of the former Uranium Pond #1, groundwater flows north to northwest toward the floodplain in Sandstone A and discharges in a myriad of small seeps that are difficult to locate. Groundwater gradients in Sandstone A near the former Uranium Pond #1 are approximately 0.01 foot/foot toward the drainage to the northwest (September 2003 data) and about 0.02 foot/foot toward the north.

To the west of the drainage, groundwater flows northeastward towards the drainage near it, and more northerly to the alluvial floodplain at greater distances. At the western edge of the Upland Area, groundwater flow is to the west, most likely towards Reservoir #1, which is located to the west and maintained at an elevation below the groundwater level.

Groundwater levels in Sandstone A range from around 978 feet amsl at the south end of the 1206 Area near Well 1353 to around 964 feet amsl near the escarpment (Well 1312). Groundwater in Sandstone A surfaces and flows into the drainage to the west of BA#3 from small seeps that commingle with surface water at the 1206 Seep sampling location, which is at an elevation of approximately 971 feet amsl and is situated about three feet above a clay zone in Sandstone A.

Groundwater in Sandstones B and C is present about 30 feet below the groundwater in Sandstone A. The deeper groundwater flows northwest toward the Cimarron River beneath the Western Upland Area. The top of Sandstone B is exposed in the lower part of the escarpment north of the BA #3 Area. In Sandstone B, the groundwater gradient is toward the north-northwest at about 0.023 foot/foot. In Sandstone C, the gradient is also toward the north at about 0.013 foot/foot (J.L. Grant and Associates, 1989). Groundwater flow in Sandstones B and C is below the base of the escarpment in the Western Upland Area, thus Sandstones B and C do not discharge to seeps in the escarpment. These two water-bearing units are not intercepted by the drainages in the area of the BA #3 Area.

The relative groundwater levels suggest there may be some perching of water in Sandstone A, especially to north, near the escarpment. That is, there may be some portions of Sandstone B that are unsaturated. However, the presence of the mudstones between the water-bearing units is likely to restrict vertical movement of groundwater in preference to horizontal flow. Vertical hydraulic conductivities across units are expected to be significantly smaller than horizontal conductivities within water-bearing units. Gradients within these lower permeability units are expected to be predominantly vertical. Due to the low permeabilities of the mudstones, flow will be predominantly horizontal in the water-bearing units, with a minor component of flow vertically across units. This is demonstrated by the appearance of the seeps, representing horizontal flow within Sandstone A. Seepage from Sandstone A into the drainage way does not infiltrate into Sandstone B, but commingles with surface water, flows along Mudstone A, and is discharged into the transition zone from which it discharges in to the alluvium.

Based on measured hydraulic gradients and estimated hydraulic conductivities, groundwater velocities can be estimated. Average linear groundwater velocities were calculated using the hydraulic properties presented above and assuming porosity for the sandstone of 5%. The calculated groundwater velocity is 1.2 ft/day for Sandstone A.

3.3.3 Western Alluvial Area

The water table in the Western Alluvial Area (Figure 3-6) is found in the alluvial floodplain of the Cimarron River. Groundwater flow in the Western Alluvial Area is generally northward toward the Cimarron River, as shown in the groundwater contour map in Figure 3-6. The hydraulic gradient is approximately 0.002 foot/foot. This is significantly lower than in the adjacent uplands, due to the increased permeability of the alluvial materials.

As in the BA#1 area, there is expected to be upward flow from the underlying bedrock into the alluvial material as groundwater in the bedrock is discharging to the Cimarron River.

Average linear groundwater velocities were calculated using the hydraulic properties presented above and assuming porosity for the alluvium of 33%. The calculated groundwater velocity is 0.9 ft/day for the


alluvium in the Western Alluvial Area. The velocity generated by the groundwater flow model (ENSR, 2006) is approximately 1.5 ft/day.

3.4 Summary


In summary, the Cimarron Site is underlain by the Garber-Wellington Aquifer of Central Oklahoma. At the site, the Garber Formation can be divided into three separate water-bearing zones that parallel the geological division of the formation into Sandstones A, B, and C. The uppermost water-bearing zone in the Garber Formation is generally unconfined, although it can be locally semi-confined by mudstone and shale units. The two lower units in Sandstones B and C are confined to semi-confined, depending on the thickness and continuity of the overlying mudstone unit.

Groundwater flow in uppermost water-bearing unit is local in nature and flows from topographic highs, which also act as recharge areas, to topographic low areas such as the drainages. In the Western Upland Area, groundwater in Sandstone A discharges through groundwater seeps into the escarpment that borders the Cimarron River floodplain. In the BA#1 Area, groundwater in Sandstone B flows eastward to the drainage, and northward to the alluvial sediments and the transition zone. In the deeper bedrock units groundwater flow is regionally controlled, with flow predominantly to the north towards the Cimarron River, with a component of upward flow as it ultimately discharges to the River.

The Cimarron Site is within a recharge area for the upper fresh water zone of the Garber-Wellington Formation. Thus vertical hydraulic gradients are generally downward, except at major discharge areas such as the Cimarron River. However, the low permeabilities of the mudstone units results in flow predominantly horizontal in the water-bearing units, with a minor component of flow vertically across units. The Cimarron River is a gaining river and thus receives groundwater from its floodplain alluvium.

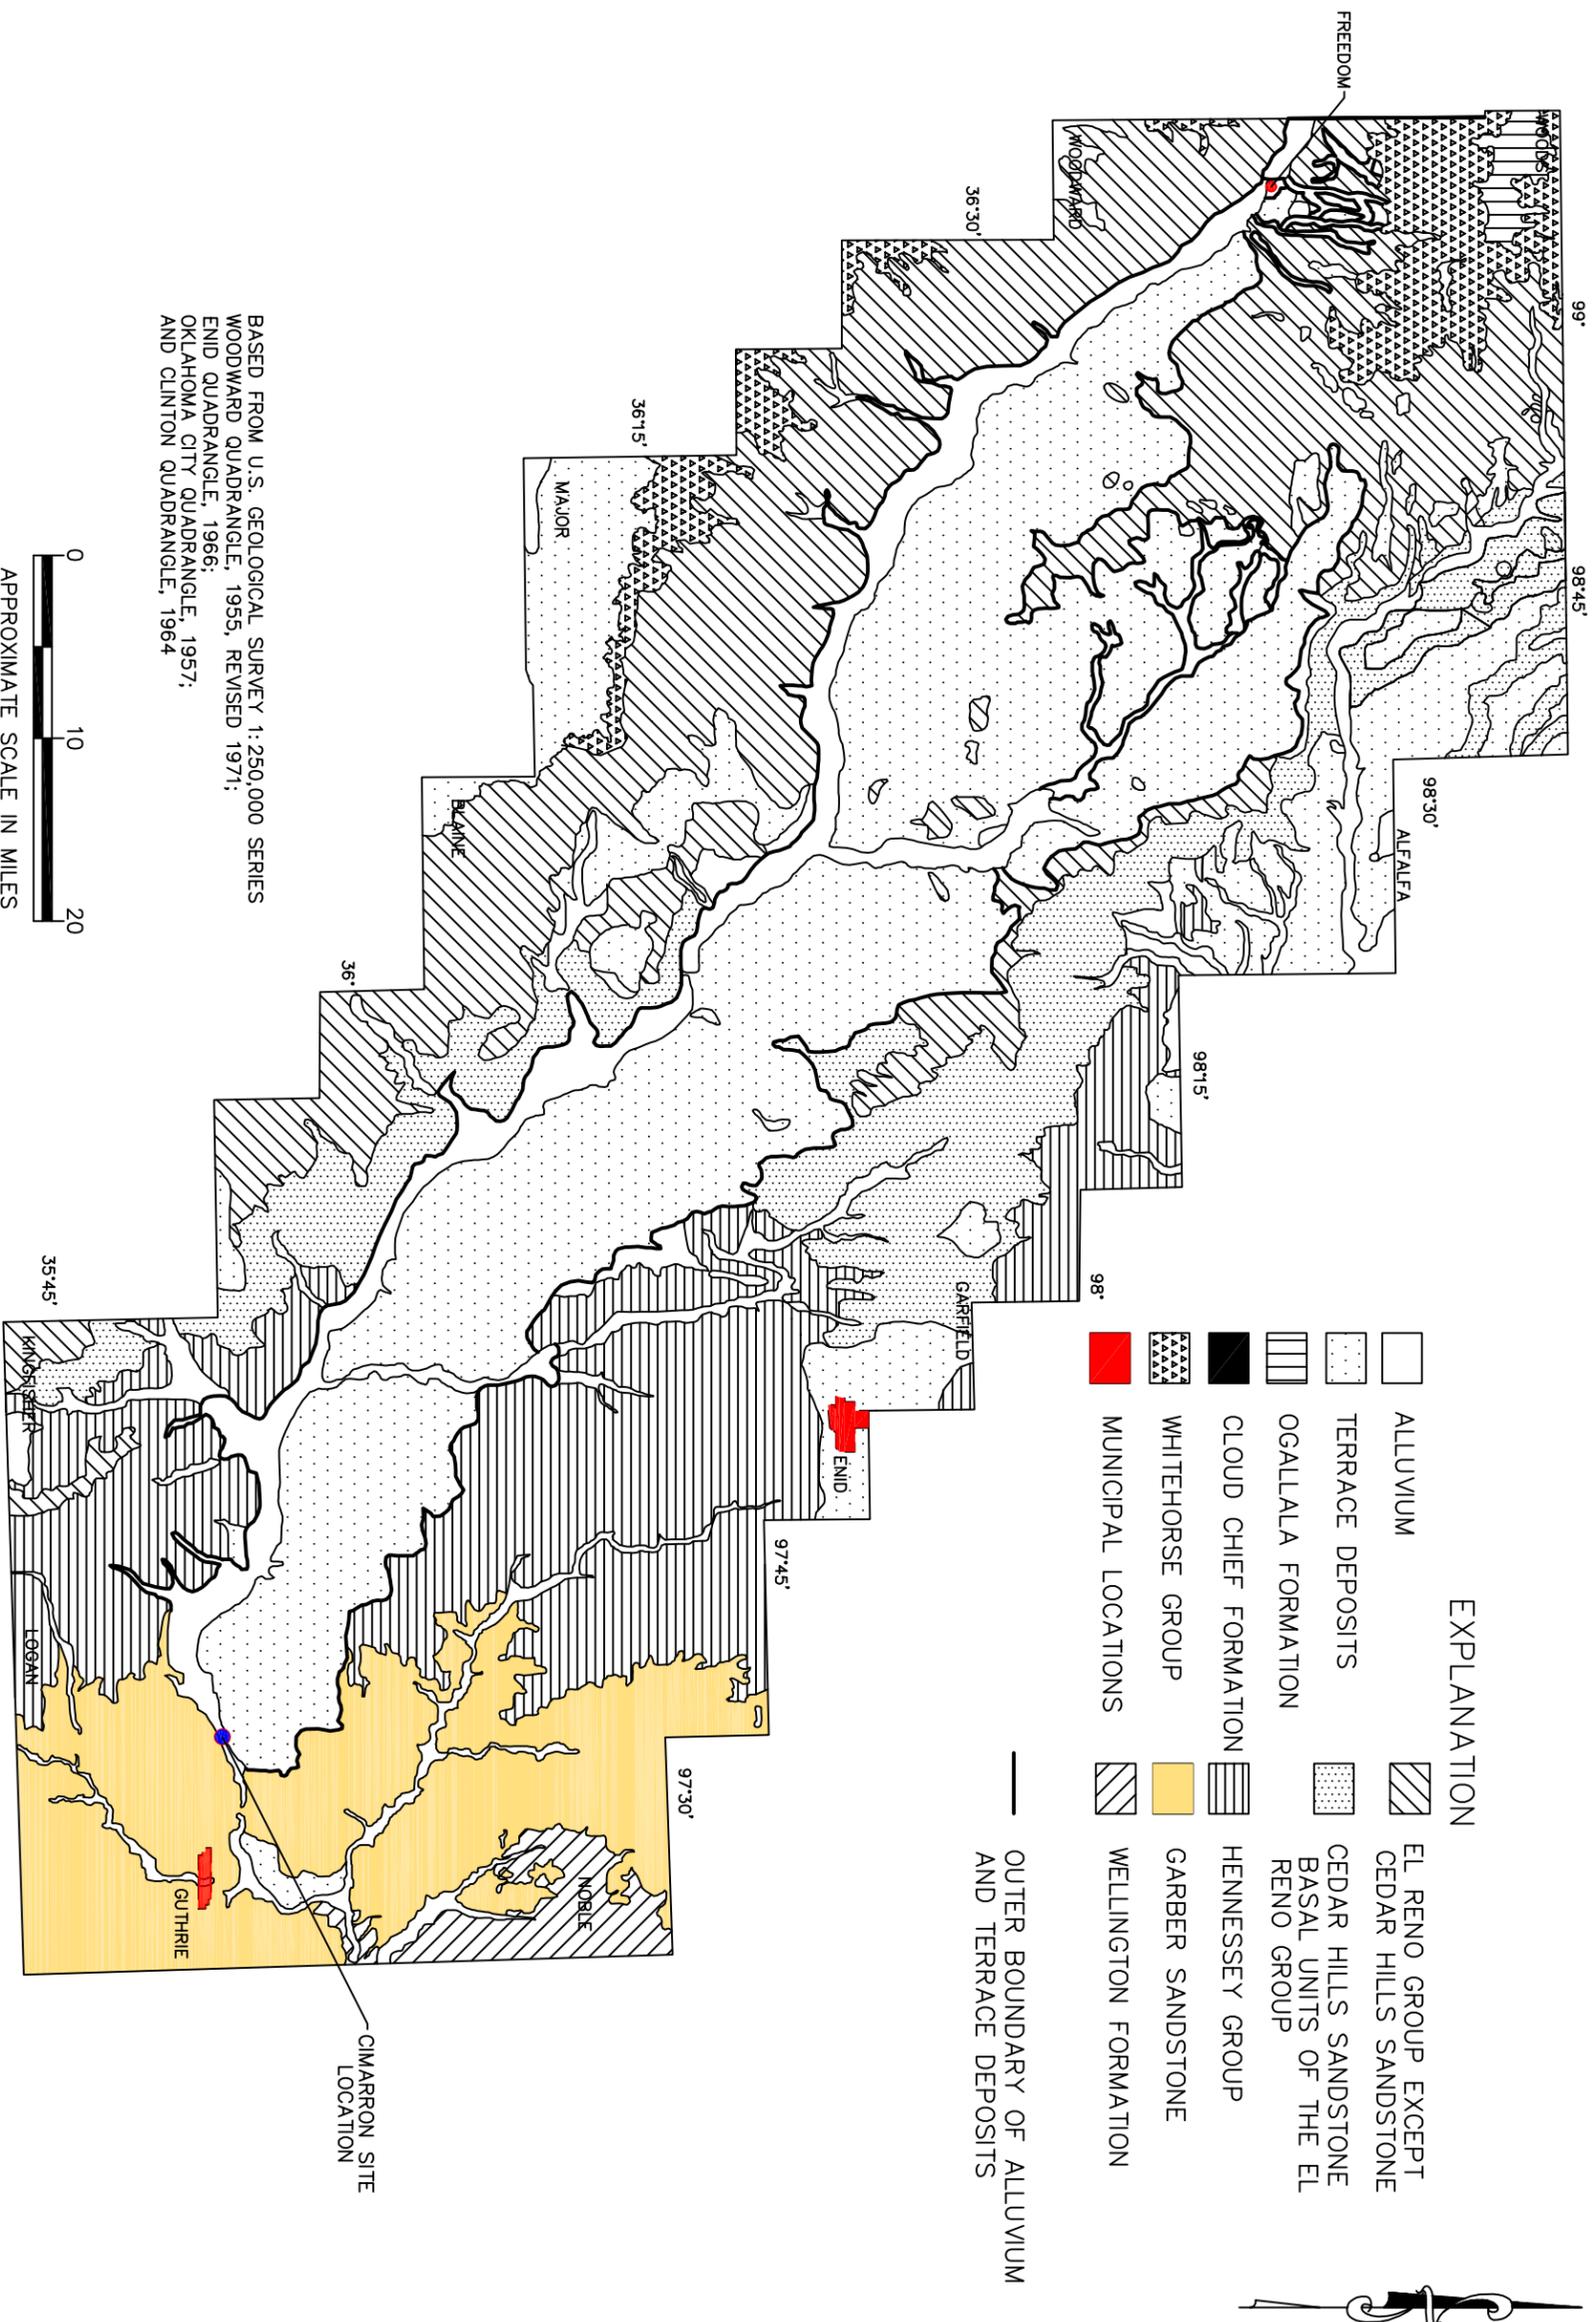

BASED FROM U.S. GEOLOGICAL SURVEY 1:250,000 SERIES
 WOODWARD QUADRANGLE, 1955, REVISED 1971;
 END QUADRANGLE, 1966;
 OKLAHOMA CITY QUADRANGLE, 1957;
 AND CLINTON QUADRANGLE, 1964



EXPLANATION


- ALLUVIUM
- TERRACE DEPOSITS
- OGALLALA FORMATION
- CLOUD CHIEF FORMATION
- WHITEHORSE GROUP
- MUNICIPAL LOCATIONS
- EL RENO GROUP EXCEPT CEDAR HILLS SANDSTONE
- CEDAR HILLS SANDSTONE
- BASAL UNITS OF THE EL RENO GROUP
- HENNESSEY GROUP
- GARBER SANDSTONE
- WELLINGTON FORMATION
- OUTER BOUNDARY OF ALLUVIUM AND TERRACE DEPOSITS

FIGURE 3-1
 GEOLOGY ALONG THE CIMARRON RIVER
 FROM FREEDOM TO GUTHRIE, OKLAHOMA
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

SCALE: 1"=10 miles	DATE: 8/10/05	PROJECT NUMBER: 04020-044-200
-----------------------	------------------	----------------------------------

ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1		4/10/05	
CHECKED BY: DJF	2		6/17/05	
APPROVED BY: DJF				

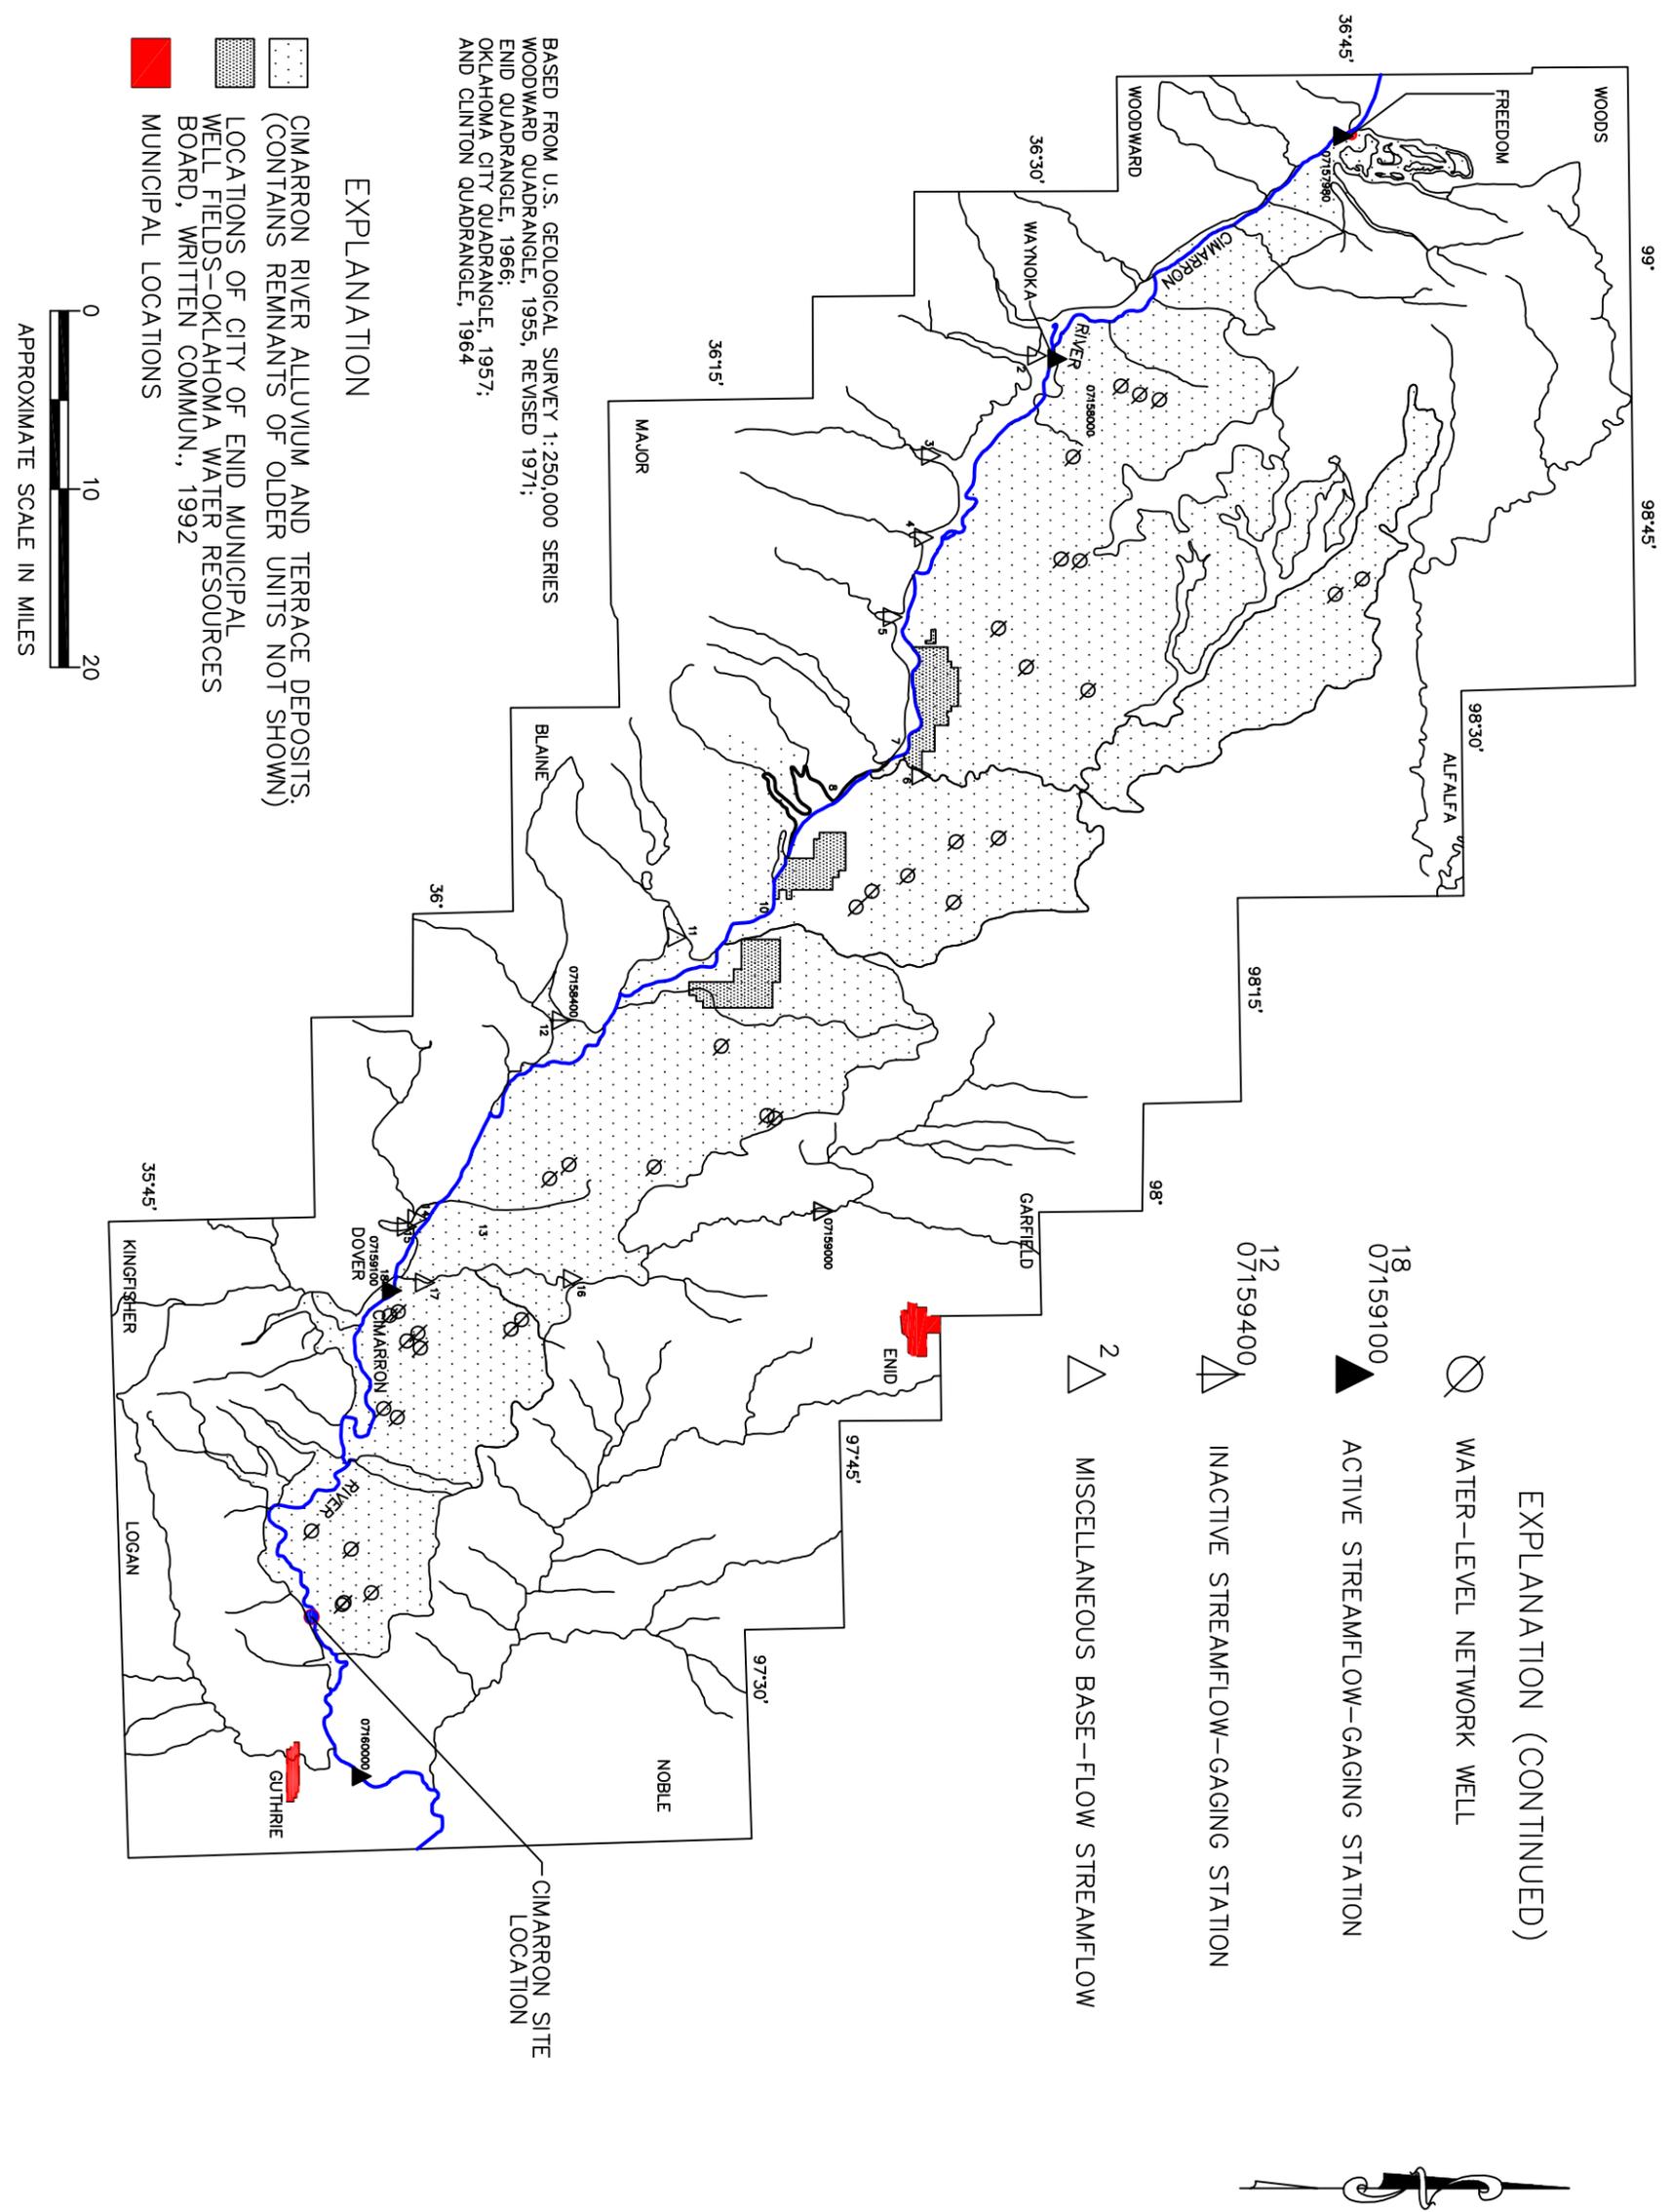

[Symbol: Dotted pattern] CIMARRON RIVER ALLUVIUM AND TERRACE DEPOSITS.
 (CONTAINS REMNANTS OF OLDER UNITS NOT SHOWN)
 [Symbol: Stippled pattern] LOCATIONS OF CITY OF ENID MUNICIPAL
 WELL FIELDS—OKLAHOMA WATER RESOURCES
 BOARD, WRITTEN COMMUN., 1992
 [Symbol: Red square] MUNICIPAL LOCATIONS



BASED FROM U.S. GEOLOGICAL SURVEY 1:250,000 SERIES
 WOODWARD QUADRANGLE, 1955, REVISED 1971;
 ENID QUADRANGLE, 1966;
 OKLAHOMA CITY QUADRANGLE, 1957;
 AND CLINTON QUADRANGLE, 1964

EXPLANATION

- EXPLANATION (CONTINUED)
- [Symbol: Circle with cross] WATER-LEVEL NETWORK WELL
 - [Symbol: Solid black triangle] ACTIVE STREAMFLOW—GAGING STATION
 - [Symbol: Inverted triangle] INACTIVE STREAMFLOW—GAGING STATION
 - [Symbol: Triangle with horizontal line] MISCELLANEOUS BASE—FLOW STREAMFLOW



FIGURE 3-2
 LOCATION OF NETWORK WELLS, BASE-FLOW
 STREAM-MEASURING SITES ALONG THE CIMARRON
 RIVER FROM FREEDOM TO GUTHRIE, OKLAHOMA
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1"=10 miles	8/10/05	04020-044-200

ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1		4/10/05	
	2		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				


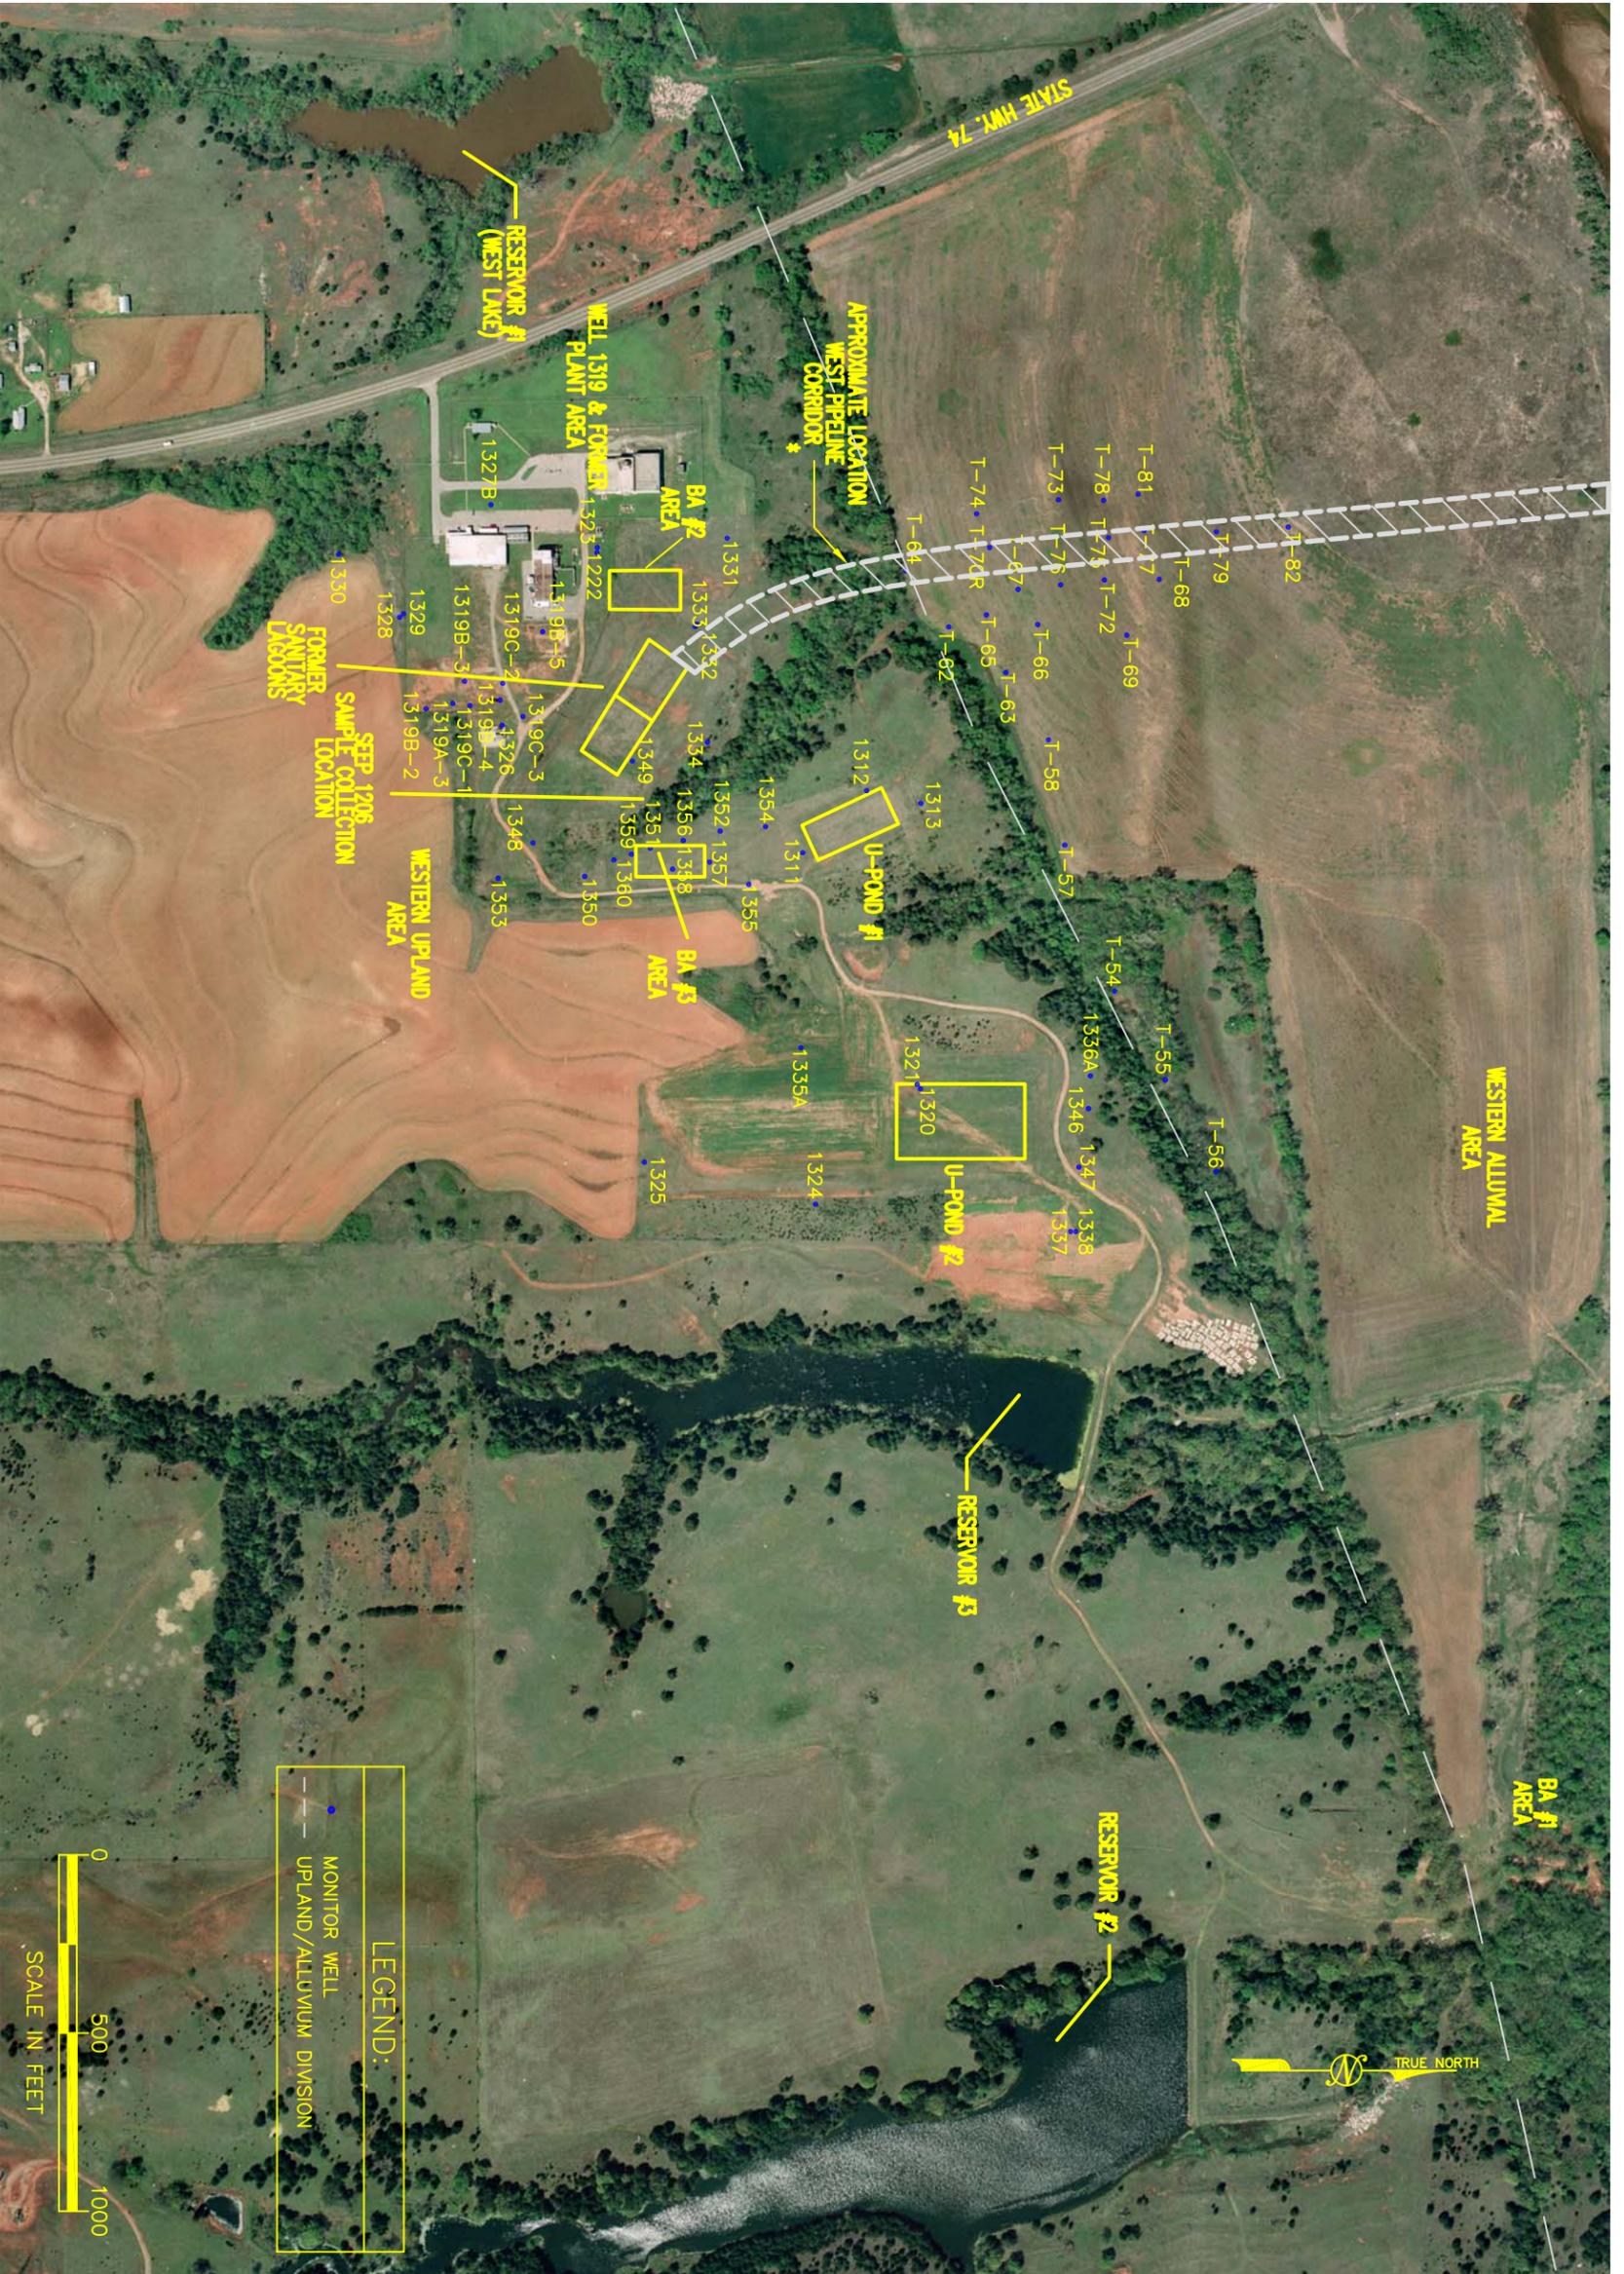


FIGURE 3-3
WELL LOCATIONS AND
UPLAND/ALLUVIUM DIVISION MAP
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1" = 500'	8/10/05	04020-044-200

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: HTP	1		4/10/05	
	2		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				

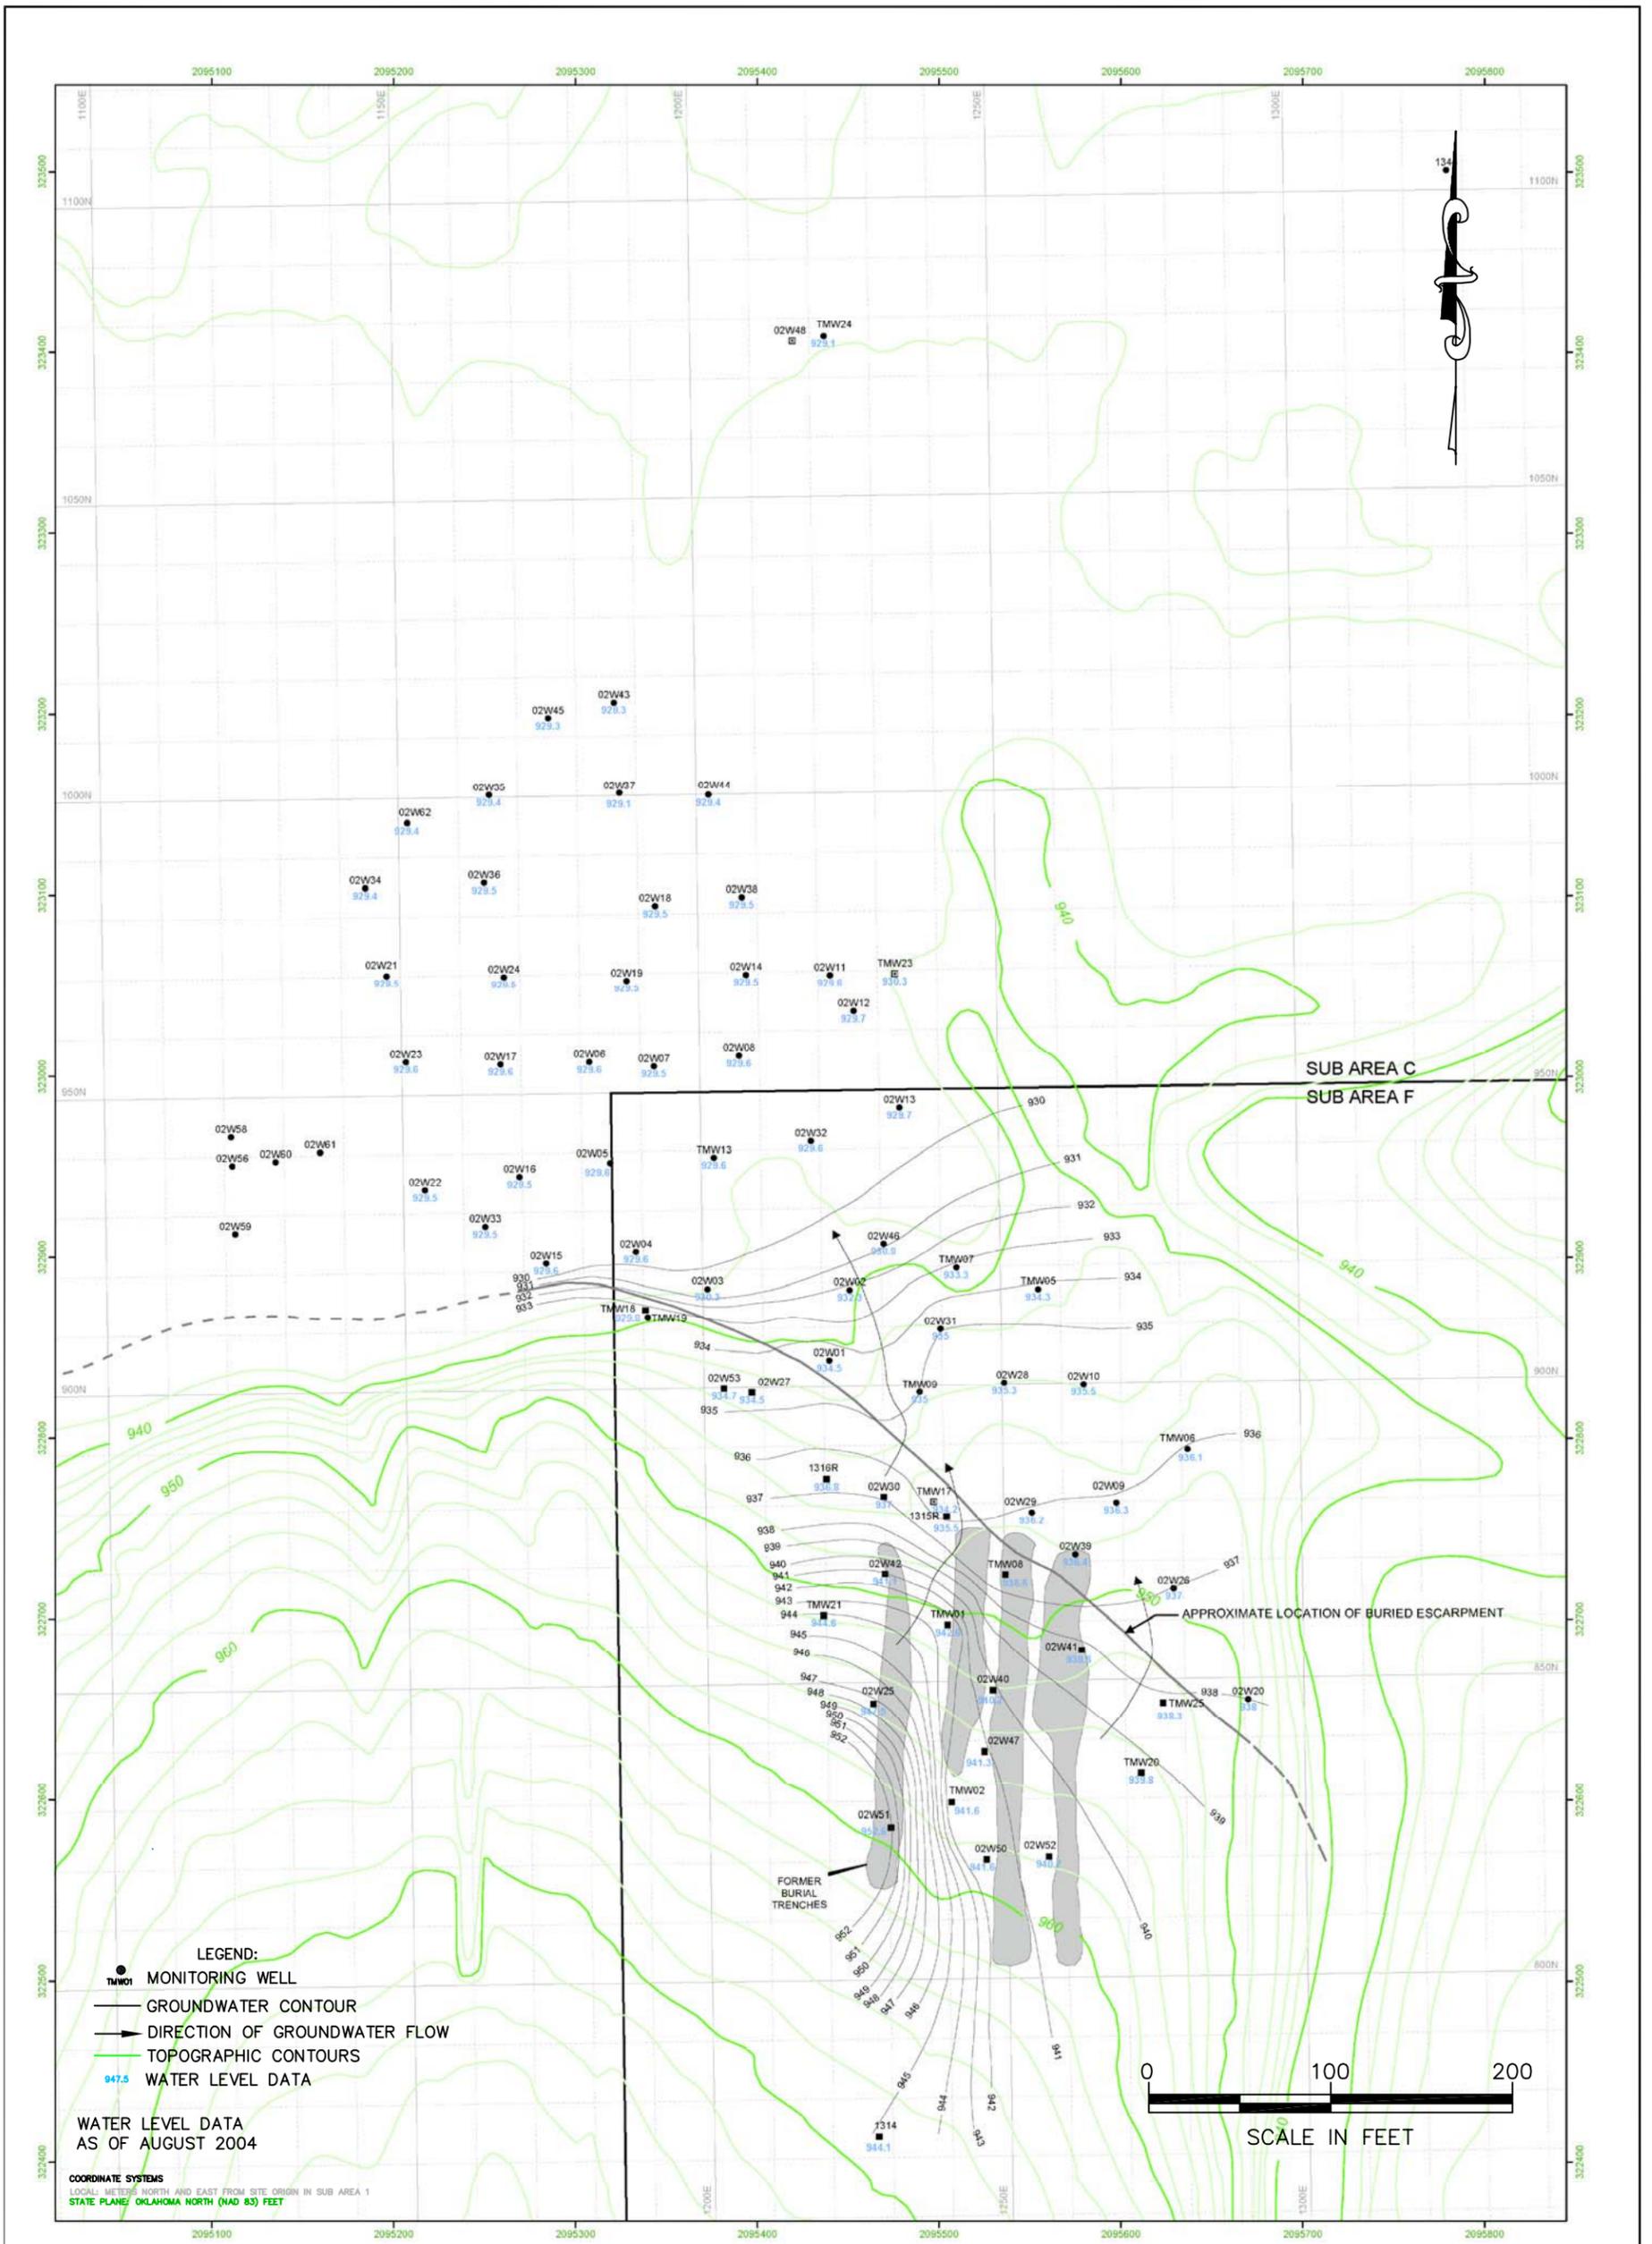

SHEET NUMBER: 1

3-4

FIGURE NUMBER:


FIGURE 3-4
BA #1 AREA
POTENTIOMETRIC SURFACE MAP
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1"=100'	8/10/05	04020-044-200

ENSR
INTERNATIONAL

4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		4/10/05	
JAS	2		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

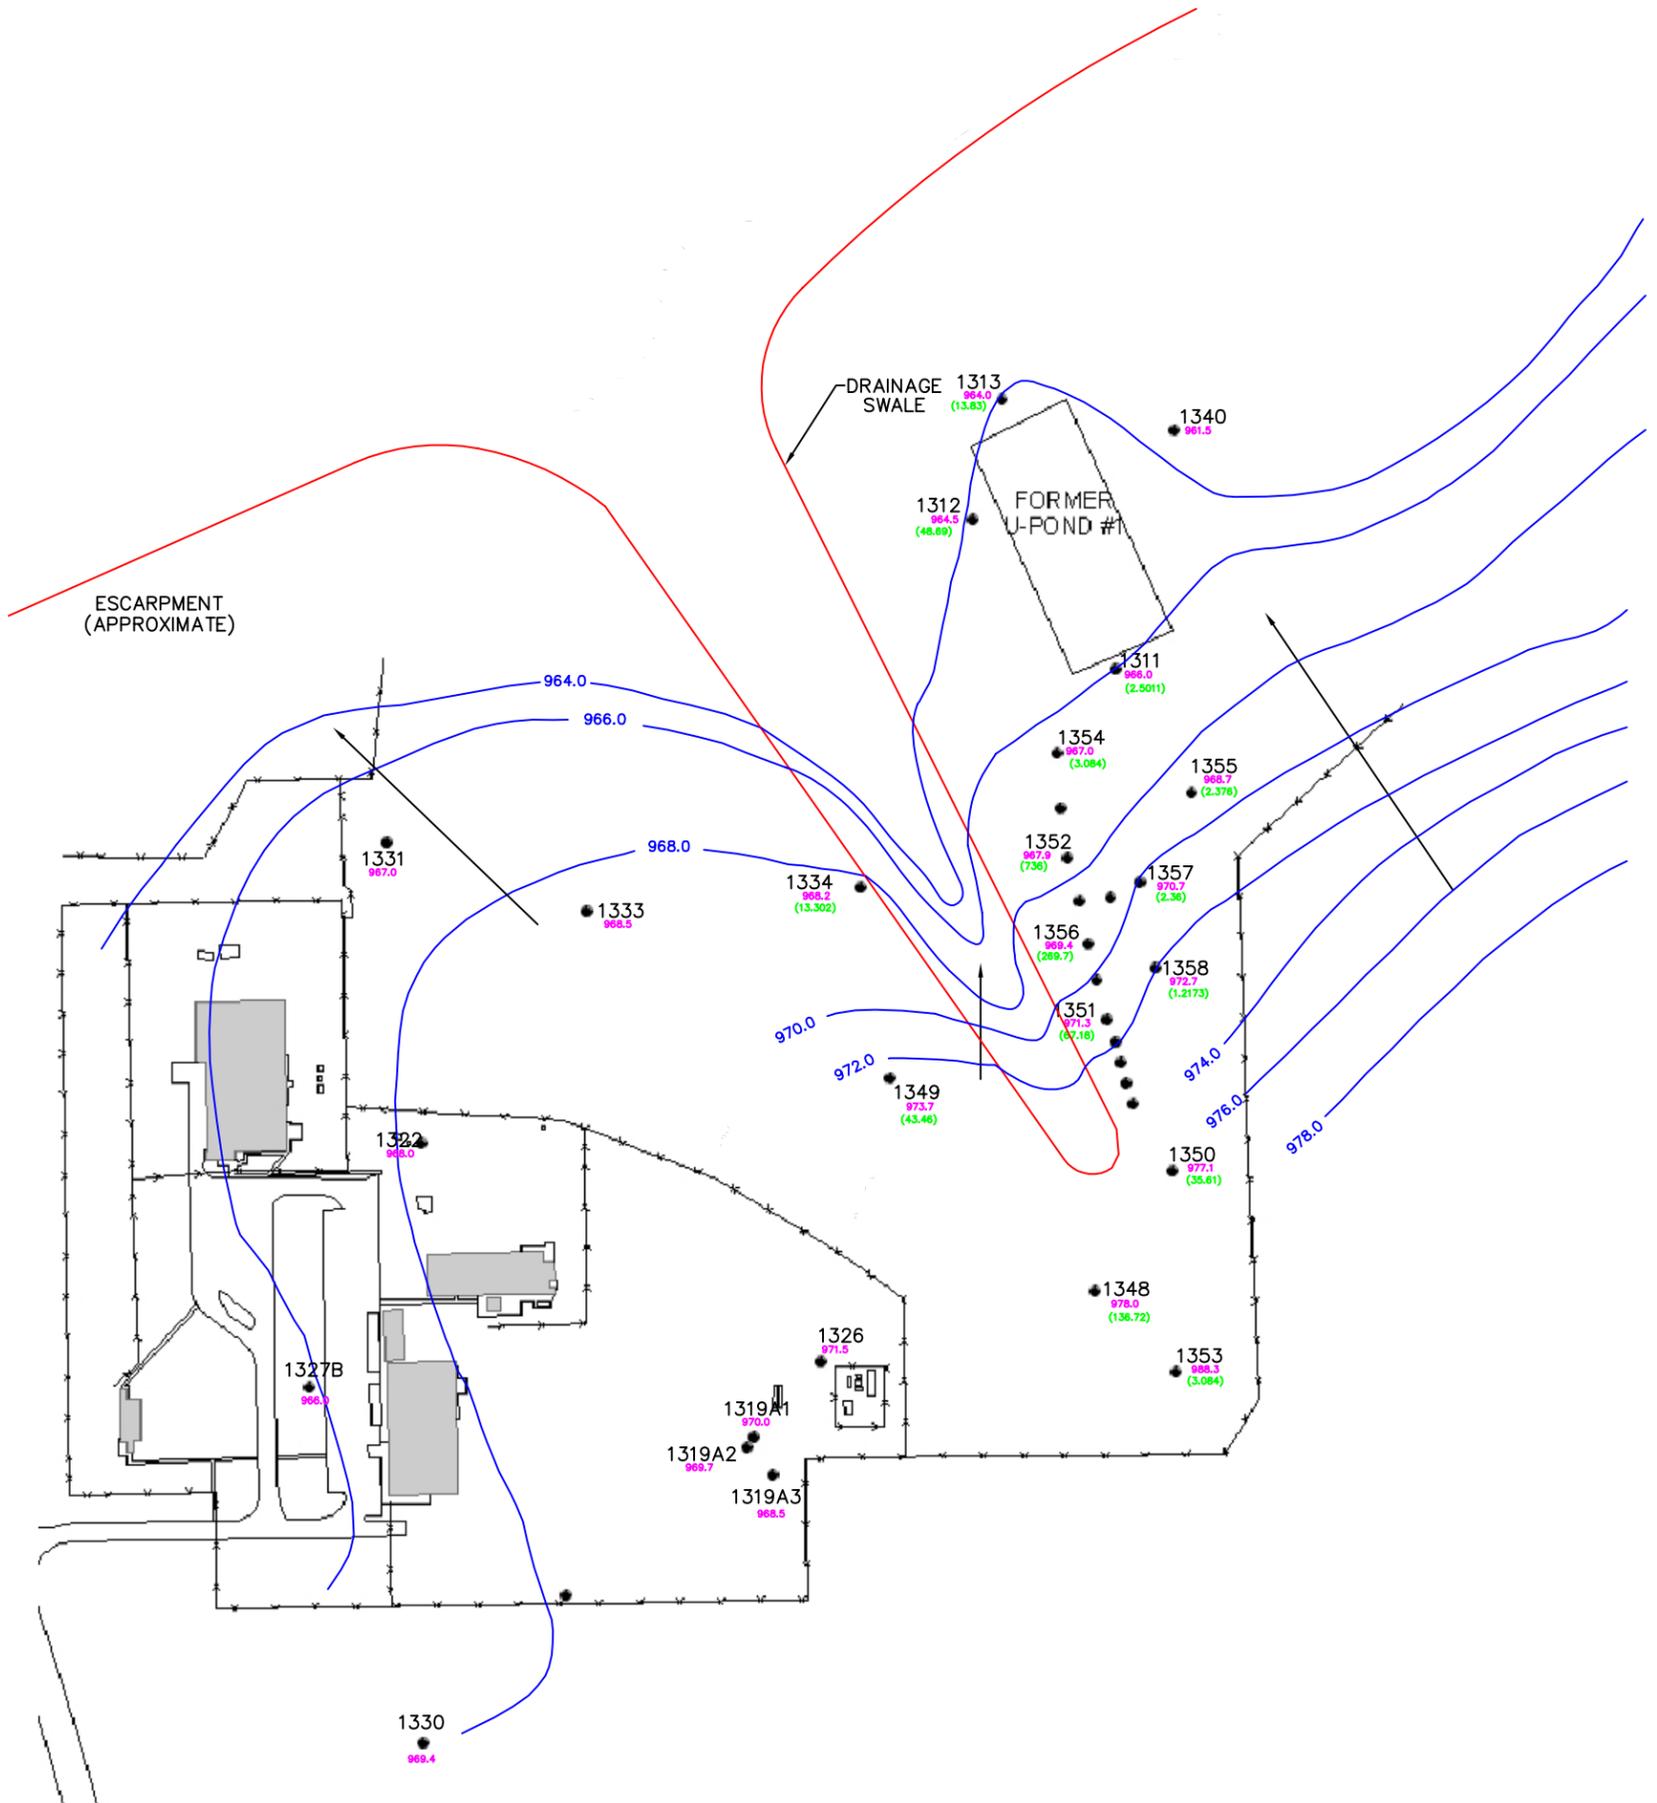

LEGEND:
 ● MONITORING WELL
 — GROUNDWATER CONTOUR
 — DIRECTION OF GROUNDWATER FLOW
 (136.72) URANIUM CONCENTRATIONS (pCi/L)
 947.5 WATER LEVEL ELEVATION (FEET-AMSL)

WATER LEVEL DATA
 AS OF AUGUST/SEPTEMBER 2004

COORDINATE SYSTEM
 STATE PLANE: OKLAHOMA NORTH (540 43) FEET

NOT TO SCALE


SHEET NUMBER: 1	3-5	FIGURE NUMBER:
--------------------	-----	----------------

FIGURE 3-5 WESTERN UPLAND AREA POTENTIOMETRIC SURFACE MAP CIMARRON CORPORATION CRESCENT, OKLAHOMA		
SCALE: N.T.S.	DATE: 8/10/05	PROJECT NUMBER: 04020-044-325

ENSR
INTERNATIONAL

4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1.		10/19/06	JAS
CHECKED BY: DJF				
APPROVED BY: DJF				

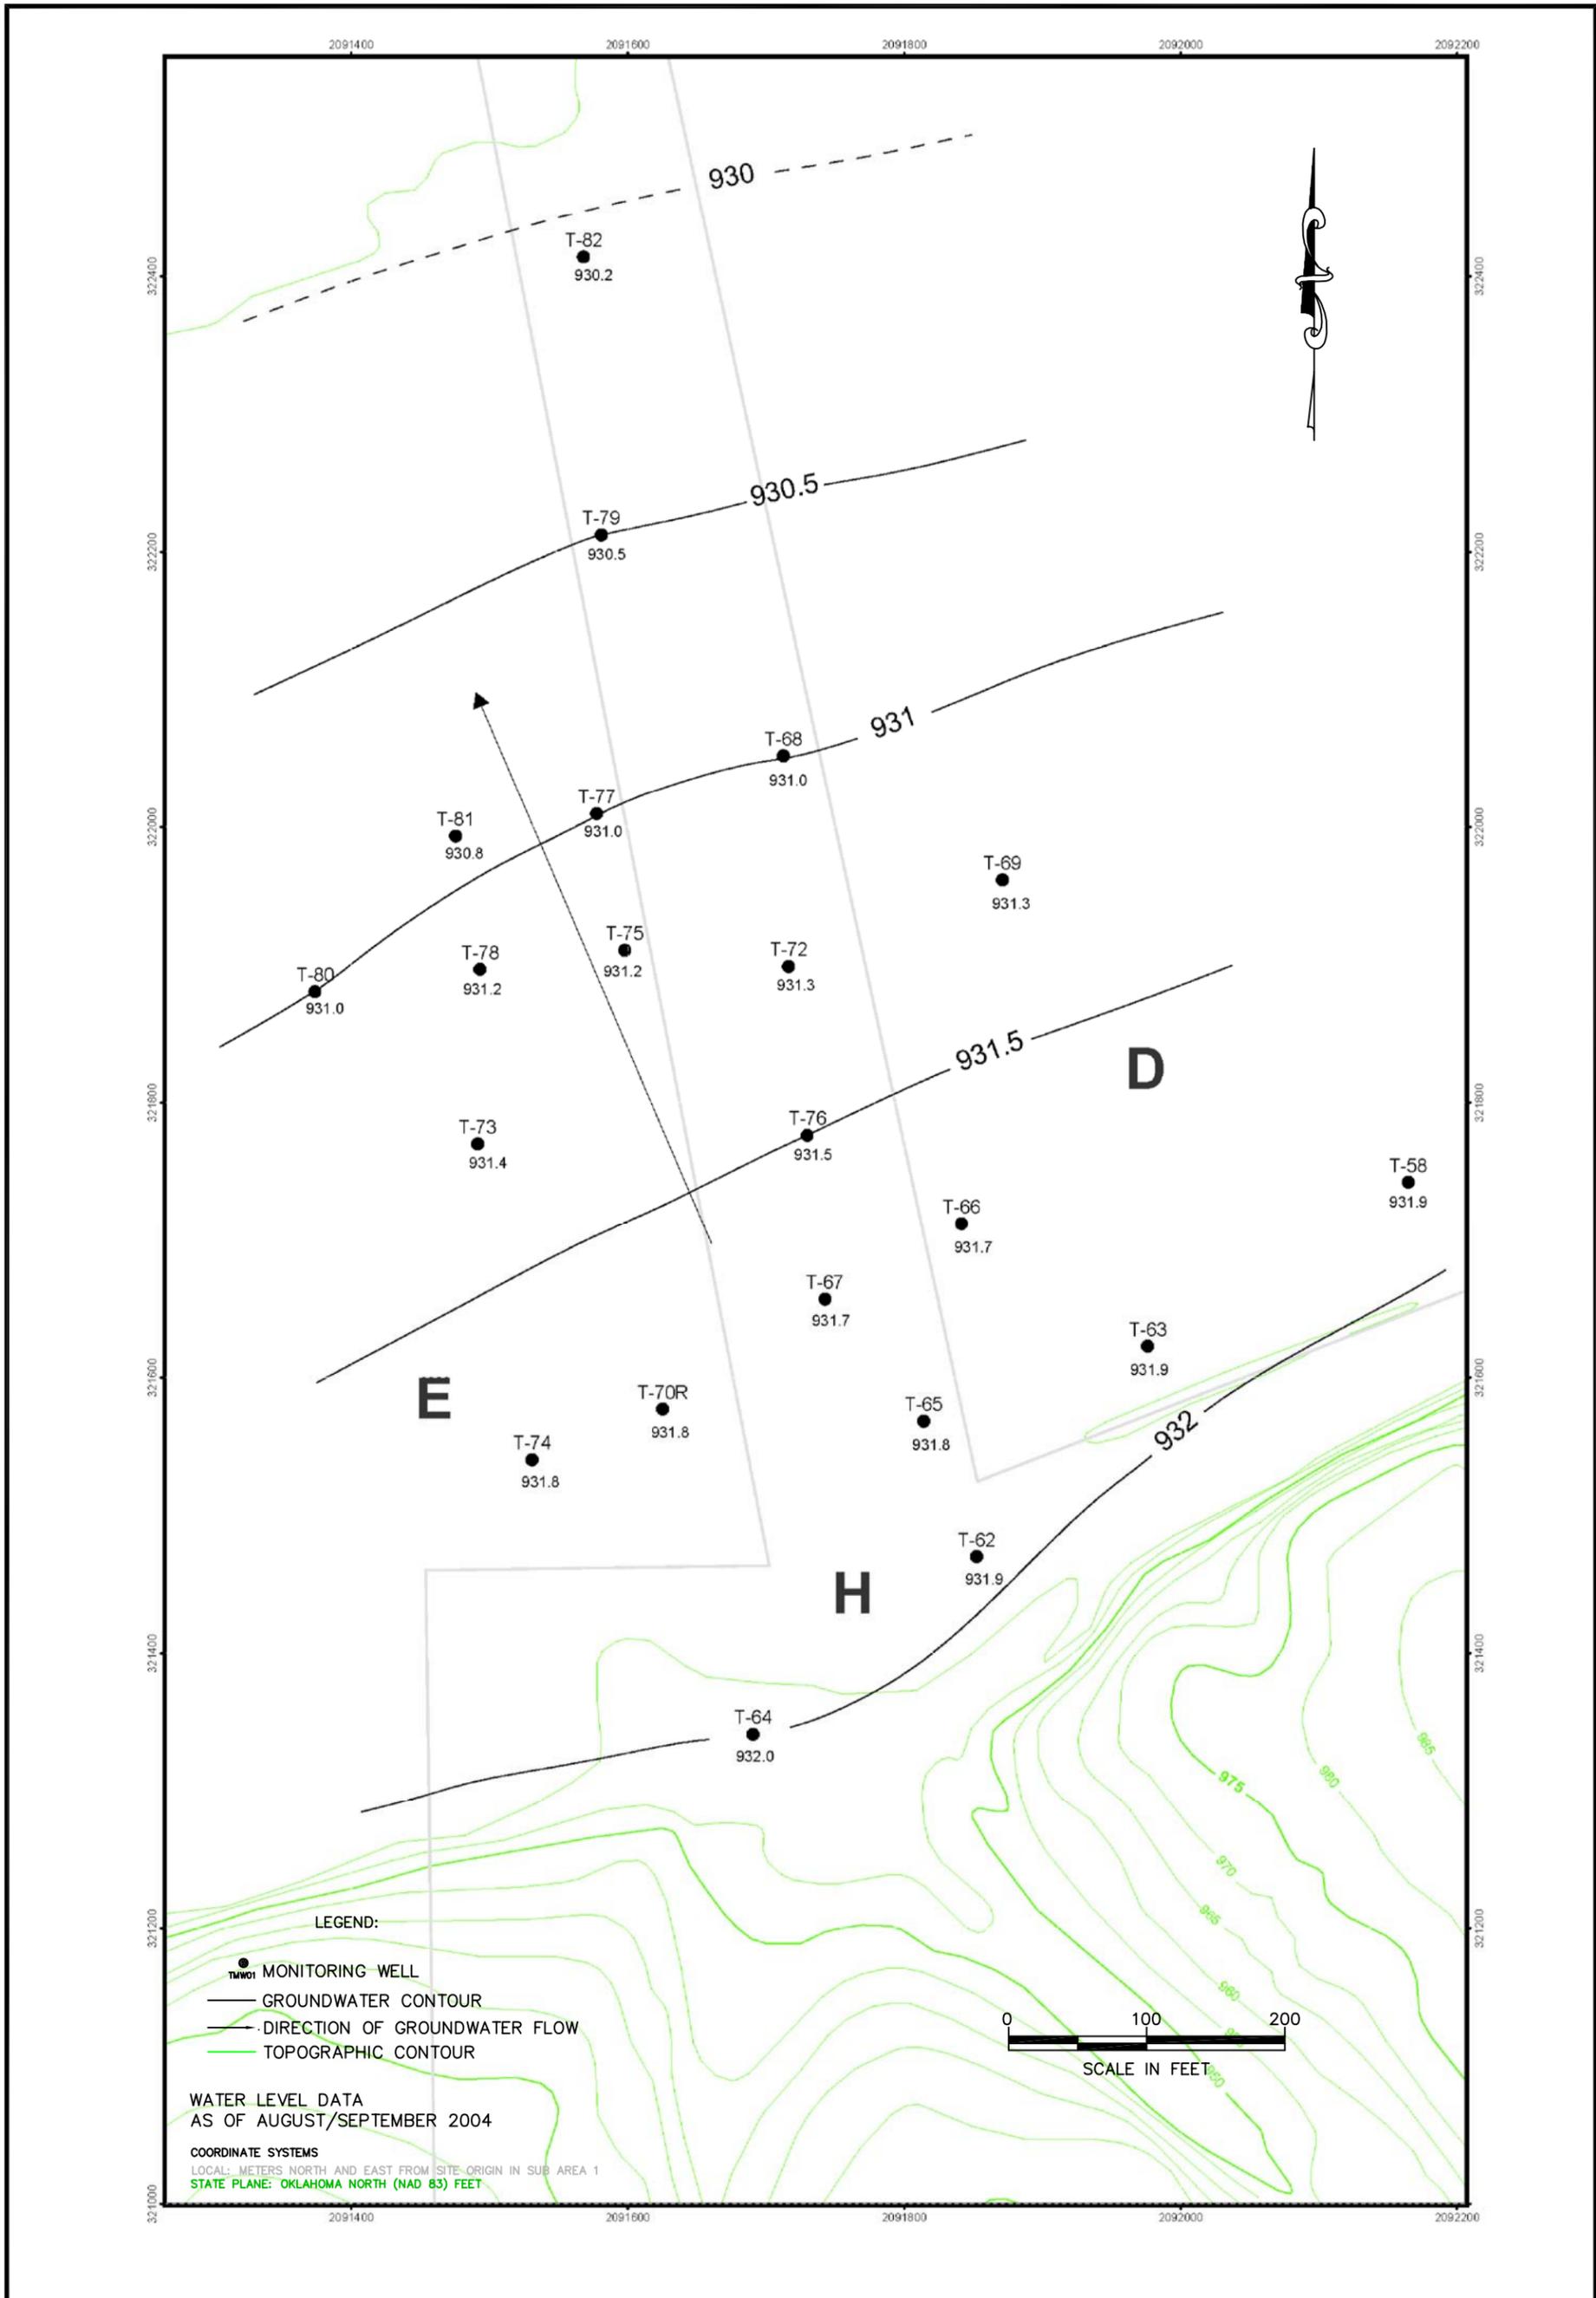

SHEET NUMBER: 1

3-6

FIGURE NUMBER:

FIGURE 3-6
WESTERN ALLUVIAL AREA
POTENTIOMETRIC SURFACE MAP
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1"=100'	8/10/05	04020-044-200

ENSR
INTERNATIONAL

4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		4/10/05	
JAS	2		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

4.0 Geochemical Conceptual Site Model

This section presents a discussion of the groundwater geochemistry of the primary water-bearing zones; a discussion of the various geochemical patterns observed in groundwater in the BA #1 Area, the Western Upland Area, and the Western Alluvial Area; and a discussion of the distribution of licensed nuclear material detected in groundwater in these areas at the Cimarron Site.

4.1 Historical Overview of Sources of Uranium Impact

The Cimarron facility, a Uranium Plant, was formerly known as the Sequoyah Fuels Cimarron Plant, which was operated by Sequoyah Fuels Corporation, a subsidiary of Kerr-McGee Corporation. The facility was operational from 1966 to 1975.

The Uranium Plant utilized two process collection ponds, two sanitary lagoons, and separate disposal trench areas for handling radioactive and non-radioactive waste during its operational period. In addition, Cimarron Corporation has identified drain lines, waste settling ponds, occasional reported releases of radioactive materials within the Uranium Plant yard, and approved disposal of liquid wastes and sanitary wastes to the Cimarron River via shallow subsurface pipelines.

Sanitary wastes from the Uranium Plant were discharged to two adjacent sanitary lagoons, the East and West Sanitary Lagoons, from 1966 to 1985.

Liquid wastes generated during the processing of enriched uranium were passed through an ion-exchange system for removal of uranium before effluent discharge to the Cimarron River during the period from 1966 to 1971. From 1971 to 1975 (when processing terminated), liquid wastes were discharged via shallow subsurface pipelines to onsite uranium disposal ponds for evaporation. These uranium process collection ponds are referred to as Uranium Ponds #1 and #2.

Pipeline leaks were identified during operations and while decommissioning the site. Many of the drain lines were removed and the soil surveyed and removed, as necessary, starting in 1985. Where leaks had occurred, soil exceeding the license criteria was excavated. These areas were documented in Final Status Survey Reports, which were prepared for different onsite areas as decommissioning activities progressed.

The Sanitary Lagoons and the Uranium Ponds were drained, surveyed, decommissioned, and backfilled between 1975 and 1993. When constructed, the Uranium Ponds were lined with asphalt (Uranium Pond #1) or a clay base with rubber side liners (Uranium Pond #2). These liners were left in place when the ponds were backfilled. The Sanitary Lagoons were unlined. Sludge and soil from the Sanitary Lagoons that exceeded Branch Technical Position (BTP) Option 1 criteria were removed prior to decommissioning and backfilling. The three disposal trench areas (BA #1 Area, BA #2 Area, and BA #3 Area) were surveyed following the removal of licensed material and soil exceeding BTP Option 1 criteria. These trenches were then backfilled with clean soil.

A fourth burial area (i.e., Burial Area #4) was developed south of Uranium Pond #2 for the onsite disposal of BTP Option 2 material.

4.1.1 Disposal Trenches in BA #1 Area

Burial Area #1 operated from 1966 to 1970 as an onsite disposal area for radioactive and some non-radioactive solid waste. In addition, drums containing thorium contaminated material from the Cushing, Oklahoma facility were disposed of in this burial area. Four trenches were used for the disposal of waste. Each of these trenches was approximately 8 to 10 feet in width and up to about 200 feet in length. The trenches were closed and capped with soil in 1970. In 1984, Cimarron staff noticed settling of the soil cap and initiated an investigation that included nine soil borings. Groundwater monitoring wells 1314 through 1317 were installed in 1985.

Monitoring wells installed in 1985 detected uranium immediately downgradient (to the north) of the four trenches in the BA#1 Area. The impacted groundwater was found in the Sandstone B (the water bearing unit beneath the trenches) and was subsequently found to continue northward into the alluvial floodplain. The origin of the groundwater impacts was likely the four trenches, but the timing of the migration of uranium from the trenches into the Sandstone B aquifer is uncertain.

The trenches were excavated to depths of 7 to 8 feet during the period from 1986 to 1988. Approximately 65,000 cubic feet of waste was removed and shipped offsite, and 16,000 cubic feet of impacted soil was removed and stockpiled east of the Uranium Plant building for onsite burial as BTP Option 2 material. Following a survey in 1991, the trenches were excavated an additional four feet in depth and an additional 14,000 cubic feet of impacted soil was removed. The four trenches were released in 1992 for backfilling by the NRC with license amendment #9. The trenches were backfilled with clean soil in 1993 and closed, after having remained opened for the time period from 1988 to 1993.

4.1.2 Disposal Trenches in the BA #2 and #3 Areas

Burial Area #2 was formerly located west to northwest from the Sanitary Lagoons (Figures 2-3, 3-3, 2-8, and 4-13). This unlined burial trench was used in the 1970's for the burial of industrial solid waste (Chase Environmental Group, 1994). Groundwater monitoring wells were installed in these areas in the late 1980's. A 10 meter x 10 meter soil survey conducted in May 1990 with soil samples composited to four feet in depth resulted in 15 samples with greater than 30 pCi/g (the highest being 373 pCi/g). A follow-up 5 meter x 5 meter grid soil survey found 4 areas exceeding 1,000 pCi/g and other areas exceeding 30 pCi/g. Remediation began in this area in 1991. Approximately 20,000 cubic feet of waste, averaging 300 pCi/g, was removed from this burial area and shipped offsite. The final soil survey of the Burial Area #2 was conducted in 1994 and the area was backfilled with clean soil.

Burial Area #3 consisted of several trenches south of Uranium Pond #1. Sandstone A lies below this unlined burial area with the water table being approximately 10 to 15 feet below the former burial trenches. A 10 meter x 10 meter soil survey conducted in 1990 with soil sampled to a depth of six feet resulted in 5 samples with greater than 30 pCi/g. A follow-up 5 meter x 5 meter survey in 1992 resulted in additional samples exceeding 30 pCi/g. Excavation in April 1992 removed waste that included drums of resin and scrap metal. Further investigations in 1993 and 1994 identified other areas of soil and materials requiring removal. Approximately 13,600 cubic feet of waste was removed and shipped off site. Monitoring wells 1352 and 1356 and the 1206 Seep collection pool provided samples from Sandstone A in the vicinity of this burial area.

4.1.3 West Pipeline

The West Pipeline carried treated effluent from the facility to the Cimarron River. This 4-inch-diameter steel pipe was removed in 1985. Effluent to the Cimarron River was monitored to ensure compliance with the discharge permit limit specified in 10 CFR 20 Appendix B. A soil radiological survey in 1994 collected

480 samples at 1-foot intervals to a depth of 4 feet along the pipeline alignment. The average uranium concentration in these samples was 8.7 pCi/g. Only 4 samples exceeded the limit of 30 pCi/g and these were in the range of 37 to 59 pCi/g. Pipeline leaks were discovered during removal in 1985. One such leak was north of the Sanitary Lagoons where the pipeline leaves the upland area and enters the alluvial floodplain of the Cimarron River. Monitor wells installed in 2003 near this former leak include T-62 and T-64. In 2006 Cimarron installed an additional twenty shallow (20) soil borings and two (2) monitoring wells in the drainage way located south of monitoring wells T-62 and T-64. The analytical results associated with these sampling locations are discussed in Section 4.4.4 (Western Alluvial Area). These sampling locations are presented on Figure 4-13.

4.2 General Groundwater Chemistry

Concentrations for both radioactive and non-radioactive constituents in groundwater at the Cimarron Site are available from the August/September 2004 annual sampling event. During this sampling event, constituents considered important for evaluation of uranium fate and transport were measured in selected monitor wells. Table 4-1 summarizes this data by area. The geochemical characteristics of the Garber-Wellington Sandstones and the floodplain alluvium, as well as groundwater within each specific area of interest, are discussed in the following sections.

In addition to radionuclides, concentrations of nitrate and fluoride above background have been found in groundwater at the Cimarron Site. These constituents appear to have been associated with some of the processes and the related aqueous wastes. It has been hypothesized that these compounds may be useful as potential indicators of radionuclide impacts. The presence of these constituents in the BA#1 Area, Western Upland, and Western Alluvial Areas, and their suitability as possible indicators, are discussed in Section 4.3 (Area-specific Geochemical Considerations).

4.2.1 Shallow Sandstone Units

The shallow sandstone water-bearing units at the Cimarron Site include Sandstones A and B. Geochemical data available for Sandstone A is mainly from the western portions of the site. Data for Sandstone B is from the BA #1 Area. Because both Sandstone A in the Western Alluvial Area and Sandstone B in the BA #1 Area are unconfined, their water quality is strongly influenced by infiltrating precipitation.

Groundwater in the shallow water-bearing units is relatively fresh when compared to deeper sandstones or the Cimarron River. The total dissolved solids (TDS) content in Sandstone A in the Western Upland Area ranges from 206 to 1,310 milligrams per liter (mg/L). Geochemical data for Sandstone B in the Western Upland and Alluvial Areas was not collected during the August/September 2004 sampling event. Groundwater samples from the BA #1 Area indicated a TDS content ranging from 254 to 911 mg/L for Sandstone B, with the exception of one sample (TMW-18) that has a TDS value of 2,060 mg/L. The chemistry of groundwater in Sandstone B in the Western Alluvial Area is expected to be similar to that in Sandstone A in the Western Upland or Sandstone B in the BA #1 Area.

To evaluate and compare the chemical pattern of groundwater samples from the different water-bearing units, Stiff diagrams (Stiff, 1951) were constructed for all groundwater samples collected during the August/September 2004 annual sampling event. The comparison of Stiff diagrams allows for rapid identification of differences in chemistry among groundwater samples. Ionic concentrations in milligrams per liter (mg/L) were converted to milliequivalents per liter (meq/L). Sodium plus potassium (Na+K), calcium (Ca), and magnesium (Mg) ions were plotted on the left side of the diagram, with chloride (Cl), bicarbonate plus carbonate ($\text{HCO}_3 + \text{CO}_3$), and sulfate (SO_4) ions plotted on the right. The lengths of the

diagram vertices are proportional to the ionic content. The vertices are connected to form a polygonal pattern. The resulting shape of the pattern bears the “signature” of the chemistry of a groundwater sample while the size corresponds to the relative concentration of ions in a water sample.

Figure 4-1 presents representative Stiff diagrams for the sandstone water-bearing units. Stiff diagrams for all wells sampled during the August-September 2004 sampling event can be found in Appendix A. Both Sandstone A and Sandstone B groundwater have similar water patterns and are characterized as calcium bicarbonate water (bicarbonate concentration significantly greater than sulfate and chloride). The water chemistry is apparently influenced by dissolution of calcite cement in shallow sandstones in the Cimarron Site area.

4.2.2 Deeper Sandstone Unit

The deeper unit (Sandstone C) underlies Sandstone B and is separated by Mudstone B. Sandstone C is confined and is more saline than the overlying units. Data representing the general geochemical parameters of typical Sandstone C groundwater was obtained from the “Cimarron Decommissioning Plan Groundwater Evaluation Report, July 1998.” Samples TMW-17 and TMW-23 representing the top of Sandstone C in the BA #1 Area were also collected during the August/September 2004 sampling event.

The TDS concentration in typical Sandstone C water ranges from 2,660 mg/L to 11,000 mg/L based on data reported in previous groundwater sampling events. Wells screened in the shallower portions of Sandstone C are typically lower in TDS concentrations, but still yield brackish water as exhibited in wells 1321, 1323, 1328, and 1332 (TDS concentration range of 2,660–4,090 mg/L). This TDS range, however, represents only the upper portion of Sandstone C, since a deeper Sandstone C well (1339) has previously exhibited a TDS concentration exceeding 11,000 mg/L (the deeper the groundwater within the unit, the higher the TDS content). Samples that represent top of Sandstone C from the BA #1 Area exhibit lower TDS concentrations (830 mg/L and 987 mg/L for TMW-17 and TMW-23, respectively) than typical Sandstone C water.

As is shown in Figure 4-1, Sandstone C groundwater has a distinct water pattern compared to groundwater from the shallow sandstone units both in the shape and the size of its Stiff diagram. In contrast to the bicarbonate type of water associated with the shallow sandstone units, Sandstone C is categorized as a calcium sulfate water (sulfate content significantly greater than bicarbonate and chloride). Its chemistry is apparently influenced by dissolution of gypsum present in deeper sandstone layers.

Compared to typical Sandstone C groundwater in the western portion of the Cimarron Site, the sulfate groundwater in the BA #1 Area has a much lower TDS concentrations due to its shallower depth (40 feet shallower).

4.2.3 Alluvium

Because the three sandstone water-bearing units discharge to the alluvium and mix with groundwater of various sources, there are variations in water quality within the alluvial floodplain.

The TDS content in the alluvium ranges from 391 mg/L to 2,140 mg/L, with the Western Alluvial Area having higher observed TDS concentrations than in the BA #1 Area. Stiff diagrams for representative alluvium well samples are presented in Figure 4-2.

As shown in Figure 4-2, three distinct types of water patterns are present, which represent three distinct types of groundwater. The first type is very similar to that from the shallow sandstone units and is

represented by wells 02W29, 02W01, and 02W44 in the BA #1 Area, and T-64 in the Western Alluvial Area. Groundwater in these wells is characterized by relatively low TDS and high bicarbonate ion concentration ($\text{HCO}_3 > \text{SO}_4 > \text{Cl}$), and is a calcium bicarbonate type water.

The second type of groundwater, which is similar to Sandstone C groundwater, is represented by wells 02W07, 02W23, and 02W36 in the BA #1 Area and wells T-72 and T-74 in the Western Alluvial Area. This groundwater is characterized by its relatively high TDS and sulfate content ($\text{SO}_4 > \text{HCO}_3 > \text{Cl}$), and is categorized as a calcium/magnesium sulfate water. The presence of this Sandstone C groundwater in the floodplain alluvium provides geochemical evidence that Sandstone C discharges to the alluvium close to the Cimarron River.

The third type of groundwater is represented by 02W10 in the transitional zone of the BA #1 Area. This groundwater is characterized by relatively high magnesium content ($\text{Mg} > \text{Ca} > \text{Na}+\text{K}$) and is categorized as a magnesium bicarbonate water. This type of groundwater is isolated in the southeast quadrant of the BA #1 Area where massive clay and silt deposits are present as discussed in Section 2.3.1 (Detailed Stratigraphic Correlations at Cimarron – BA #1 Area) of this report. This groundwater is in essence a bicarbonate water, as in the Sandstone A and B groundwater, but with elevated Mg content that differentiates it from shallow sandstone groundwater. Given the geological setting, this type of groundwater is likely to be in equilibrium with clay minerals.

No groundwater samples from the alluvium exhibited the chemical characteristics of Cimarron River water. Cimarron River water is categorized as a sodium chloride type water with chloride content significantly higher than sulfate and bicarbonate.

As discussed in Section 4.3, there is a spatial correlation between water type and geological setting within the alluvium.

4.3 Area-specific Geochemical Considerations

4.3.1 BA #1 Area

The spatial distribution of TDS, sulfate, chloride, and bicarbonate alkalinity in Sandstone B and the alluvium within the BA #1 Area are illustrated in Figures 4-3 through Figure 4-6.

Low TDS (less than 500 mg/L) groundwater was observed in the southern portion of the uplands in Sandstone B and several wells in the transitional zone immediately adjacent to the uplands (Figure 4-3). From southeast to northwest, groundwater TDS concentration increases from less than 500 mg/L to more than 1,000 mg/L.

The spatial distribution of sulfate in the BA #1 Area (Figure 4-4) is similar to that of TDS, with groundwater from Sandstone B in the uplands having the lowest sulfate content (less than 10 mg/L). Higher sulfate concentration (greater than 300 mg/L) groundwater is predominantly in the northwest quadrant of the BA #1 Area. The higher observed sulfate concentrations are apparently associated with groundwater from Sandstone C.

The chloride concentration is low (less than 20 mg/L) in most Sandstone B groundwater and the alluvium in the southeastern portion of the BA #1 Area (Figure 4-5). Most of the wells have chloride concentrations less than 80 mg/L. Compared to the chloride content of the Cimarron River, which was reported as 3,600 mg/L in 1986 at the Guthrie Gage, the alluvium has less than 5 percent of the chloride concentration of the river, suggesting that the impact of the river on the alluvium is not significant in the areas where groundwater samples were collected.

The alkalinity in groundwater ranges from 192 mg/L to 677 mg/L in the BA #1 Area. There is no clear trend in the distribution of alkalinity throughout the area and localized high concentrations (greater than 500 mg/L) were observed at multiple locations (Figure 4-6). In general, the alkalinity content in the northeastern half of the area appears to be higher than in the southwestern half. Alkalinity will be an important factor to be considered during the design of any remediation system due to its buffering capacity.

In the BA#1 Area, nitrate and fluoride have been detected only at low concentrations, typically consistent with background. Therefore, there is little to no impact to groundwater from these constituents in this area.

There are three distinct types of groundwater in the BA #1 Area, including calcium bicarbonate water, calcium sulfate water, and magnesium bicarbonate water. Groundwater samples from the uplands are of the calcium bicarbonate type, while the alluvium samples contain all three types of water. Figure 4-7 presents the respective areas of the site where each water type is located. The magnesium-rich groundwater (represented by 02W10) is concentrated in the southeast portion of the alluvium in the transitional zone (area within blue line), the calcium bicarbonate water (Sandstone B groundwater, represented by TMW-2, 02W29, and 02W44) is distributed in the middle and northeast portion of alluvium (area between blue and orange colored lines), and the sulfate water (possibly an indication of water being contributed from Sandstone C represented by 02W24) is isolated in the northwest portion of the alluvium (areas within orange line). These three distinct types of groundwater form three segregated water-quality zones in the alluvium from southeast to northwest.

The spatial distribution of the different groundwater types can be attributed to the geologic environment where each groundwater type is in equilibrium. As discussed in Section 2.2 (Stratigraphy of the Cimarron Site) of this report, the alluvium can be divided into two zones, a clayey transitional zone and a sandy alluvium zone, with the approximate division along the line from monitor wells 02W03 to 02W13. The transitional zone is underlain by Sandstone B or Mudstone B and receives recharge mostly from Sandstone B. Therefore, groundwater in the transitional zone exhibits the geochemical signature of Sandstone B water. The sandy alluvium, in contrast, is underlain by various portions of Mudstone B and Sandstone C and receives recharge from both Sandstones B and C. Consequently, the alluvium has the geochemical signatures of both Sandstone B and Sandstone C water. The magnesium-rich groundwater is almost exclusively associated with clay- or silt-rich sediments.

In Figure 4-7, the Stiff diagrams of the groundwater samples from the high-magnesium and high-sulfate zones are relatively uniform with little changes in shape and sizes. This is because the groundwater within these two zones has seen limited mixing with groundwater from other sources. However, groundwater samples from the calcium bicarbonate zone (area between the blue and the orange zones) show a gradual change in Stiff diagrams from the upland to the sandy alluvium. In the uplands, the Stiff diagram (TMW-2) is small (low TDS) and has roughly equal width and length. As the groundwater moves to the transitional zone, the Stiff diagram (02W29) begins to take on an elongated shape with notable increases in calcium and bicarbonate concentrations. Farther away from the uplands into the sandy alluvium, the Stiff diagram (02W44) is "stretched" even longer (associated with an increase in TDS concentrations). These changes in Stiff diagrams occurred without significant changes in the basic pattern of the Stiff diagrams or the relative concentrations of the major cations and anions. This indicates that the calcium bicarbonate water in the transitional zone and sandy alluvium originates from Sandstone B and is re-equilibrated with the geological materials in the alluvium. Evidence of mixing is apparent along borderlines between two water type zones.

Piper diagrams provide a visual means to compare the chemistry of water samples. Figure 4-8 presents a Piper diagram (Piper, 1944) of groundwater in the BA #1 Area and Cimarron River water (USGS, 1960–1986). Also plotted is Sandstone C groundwater from the western portion of the Cimarron Site for comparison. Major cations (Ca, Mg, and Na+K) are plotted on the left triangle while major anions (HCO_3+CO_3 , SO_4 , and Cl) are plotted on the right triangle. Data points in the diamond are projected from the two triangles. As shown in the diagram, the river water is a sodium chloride type, with the data points grouped at the Na+K and Cl corners of the triangles. The average chloride to sulfate ratio of the river water is equal to 6. Typical Sandstone B groundwater is grouped at the HCO_3+CO_3 corner, whereas Sandstone C groundwater is at the SO_4 corner. Data points from the sandy alluvium are spread in the middle section between HCO_3+CO_3 and SO_4 , indicating possible mixing of Sandstone B and Sandstone C groundwaters.

4.3.2 Western Upland Area

Groundwater geochemical parameters were evaluated during the August/September 2004 groundwater sampling event in the monitor wells in the Western Upland Area.

The Stiff diagrams of representative groundwater samples from the Western Upland Area are illustrated in Figure 4-1. The patterns of Sandstone A and 1206 Seep water are both characterized by low TDS with bicarbonate being the dominant anion. The geochemical signature of this groundwater is very similar to the Sandstone B groundwater in the BA #1 Area, indicating the influence of precipitation.

In the Western Upland Area, fluoride and nitrate have been detected at concentrations above background. The highest concentrations have been detected in the vicinity of the former U Ponds. However, because of remedial actions taken, uranium concentrations are no longer elevated in this area, and therefore they are not included in this report.

4.3.3 Western Alluvial Area

TDS concentrations are generally high throughout the Western Alluvial Area. Near the escarpment, TDS is in the range of 800 to 1,890 mg/L, but within the area with uranium impacts exceeding 180 pCi/L, TDS is in the range of 700 to 2,140 mg/L. At well T-82, the TDS concentration is 923 mg/L.

The alkalinity concentration ranges from 230 to 438 mg/L, with calcium concentrations ranging from 144 to 406 mg/L and magnesium concentrations ranging from 29 to 84 mg/L. Sulfate concentrations ranged from 54 to 822 mg/L across the Western Alluvial Area.

Nitrate and fluoride are present at concentrations above background in Seeps 1206 and 1208, and in the Western Alluvium. However, their distribution is not coincident with the uranium distribution.

The Stiff diagrams of representative groundwater samples from the Western Alluvial Area are presented in Figure 4-2. There are two distinct types of water pattern in the alluvium.

The first type of groundwater, represented by well T-64, has a Stiff diagram in a fairly symmetrical shape. This groundwater is characterized by relatively low TDS content with bicarbonate content being higher than sulfate and chloride and is categorized as a calcium bicarbonate water. The pattern and TDS range of this groundwater are similar to groundwaters from Sandstone A in the uplands and Sandstone B in the BA #1 Area. Therefore, this groundwater is likely to be from Sandstone A and B with its chemistry influenced by infiltrating rain precipitation.

The second type of groundwater is represented by wells T-72 and T-74. This groundwater is characterized by high TDS content with sulfate concentration greater than bicarbonate and chloride and is categorized as a calcium sulfate water. Chloride concentration can be higher than bicarbonate and sodium higher than magnesium in some samples. The geochemical signature of this groundwater is almost identical to that of Sandstone C groundwater, suggesting some contribution from Sandstone C into the alluvium.

The spatial distribution of water types in the Western Alluvial Area is presented in Figure 4-9. A typical Sandstone C water from well 1332 is also shown for comparison. Of the 20 groundwater samples evaluated in the alluvium, eight exhibit the signature of Sandstone A and B groundwater (bicarbonate water), with the remaining showing the characteristics of Sandstone C groundwater (sulfate water). Generally, bicarbonate water predominates in areas adjacent to the escarpment whereas sulfate water is more abundant in areas away from the uplands.

Comparisons of geochemical characteristics of groundwaters from the Western Upland Area and the Western Alluvial Area are graphically illustrated in Figure 4-10. As can be seen from this Piper Diagram, Sandstone A groundwater clusters at the bicarbonate corner while Sandstone C groundwater clusters at the sulfate corner, with groundwater in the alluvium spreading across the entire spectrum between the two groundwaters. Apparently, groundwater in the alluvium is from Sandstones A, B, and C with various degrees of mixing among them.

4.4 Uranium Impacts to Groundwater

4.4.1 Geochemistry of Uranium

Uranium (U) has 14 isotopes, with the atomic mass of these isotopes ranging from 227 to 240. Naturally occurring uranium typically contains 99.283 percent U^{238} , 0.711 percent U^{235} , and 0.0054 percent U^{234} . Uranium can exist in the U^{3+} , U^{4+} , U^{5+} , and U^{6+} oxidation states, of which the U^{4+} and U^{6+} states are the most common states found in the environment.

The chemical behavior of U^{4+} and U^{6+} is influenced by a variety of reactions including dissolution, precipitation, complexation, and sorption. These reactions are affected by the redox conditions, solution pH, water chemistry, and mineral-water interactions. The U^{4+} species are sparingly soluble in aqueous solutions (less than 30 micrograms per liter [$\mu\text{g/L}$]) and tend to precipitate out under anoxic (reduced) conditions. U^{6+} species, in contrast, are fairly soluble and are responsible for the mobilization of uranium in oxidized conditions.

In natural groundwater, U^{6+} can be transported in various aqueous species depending on the pH and groundwater composition. In the absence of carbonate, U^{6+} in the form of uranyl ion (UO_2^{2+}) predominates at pH below 5. At pH values between 5 and 9, the U^{6+} hydrolytic species ($UO_2(OH)_2^0$) predominates. U^{6+} has a strong tendency to form complexes with carbonate. In solutions where dissolved carbon dioxide is present, the neutral uranyl carbonate species (UO_2CO_3) predominates in the pH range between 5 and 6.5. Anionic uranyl dicarbonate ($UO_2(CO_3)_2^{2-}$) and uranyl tr carbonate ($UO_2(CO_3)_3^{4-}$) species predominate in the pH ranges between 6.5 to 8.5 and above 8.5, respectively.

U^{6+} is readily adsorbed onto an aquifer matrix or single-phase mineral, resulting in a reduction of its mobility in groundwater. Aqueous pH and water chemistry are the two most important factors controlling the adsorption for a given matrix. Groundwater pH affects not only uranium speciation, but also its adsorption onto aquifer materials. Generally a surface is positively charged at lower pH and negatively charged at higher pH. Therefore, lower pH favors the adsorption of anionic species such as uranyl

dicarbonate while higher pH facilitates adsorption of cationic species such as uranyl ion. The optimum pH values for uranium adsorption appear to be in the range between 5 and 8.

The composition and concentration of ionic species in the groundwater will affect the speciation of uranium and the adsorption as well. Uranium adsorption in low-TDS water is relatively high and tends to decrease as TDS increases due to competition for adsorption sites from other constituents. Sulfate, for instance, is likely to interfere with the adsorption of uranyl dicarbonate and its removal at pH values above 6 if adsorption or ion exchange is utilized to treat uranium-impacted water.

In an effort to understand the form of uranium that is being transported in groundwater and the propensity of uranium for adsorption under the Cimarron Site's conditions, speciation of uranium in groundwater was calculated using the geochemical model MINTEQA2 (USEPA Version 4.02, 2000). This information is useful in evaluating the fate and transport of uranium at the site and for design of a treatment system where the operating conditions are highly dependent on the speciation of uranium.

MINTEQA2 is an equilibrium geochemical model that computes metal speciation in aqueous solutions. Developed by US EPA, this model is capable of calculating the equilibria among dissolved, adsorbed, solid, and gas phases. MINTEQA2 includes an extensive database of reliable thermodynamic data that allows for solving a broad range of problems encountered in a natural aqueous system. Input data required by the model consist of chemical analyses of total dissolved concentration for the components of interest. Field measured parameters such as pH and Eh can also be input to the model to specify equilibrium conditions, but are not necessary since these values can be calculated by the model.

Analytical data of geochemical parameters (major cations, anions, ferrous and ferric iron, nitrate, fluoride, and silica) and uranium concentrations of selected groundwater samples obtained from September 2004 sampling event were input into the MINTEQA2 model to compute the uranium speciation. The samples selected included 02W01, 02W02, 02W04, 02W19, 02W21, 02W24, 02W31, 02W47, TMW-09, 1315R, 1314, and 1321, which are representatives of different TDS, sulfate, bicarbonate alkalinity, and uranium concentrations of groundwater across the site. Evaluation of these samples provide insight into the effects of the TDS, sulfate, and alkalinity on uranium speciation. Field measured temperature and pH values were used in all model runs. Eh values were not used in the model, as it was assumed that uranium in the site groundwater is in the 6^+ valent state. This assumption is supported by the relatively high uranium concentrations and the presence of ferric iron oxides in the aquifer.

The MINTEQA2 model results indicate that uranyl dicarbonate ($\text{UO}_2(\text{CO}_3)_2^{2-}$) and uranyl tricarbonate ($\text{UO}_2(\text{CO}_3)_3^{4-}$) are the predominant uranium species expected in groundwater at the site. The relative abundance of these two species depends on solution pH and bicarbonate alkalinity. Generally, the higher range of pH values and bicarbonate alkalinity concentrations favor the formation of uranyl tricarbonate. For most groundwater at the site; however, the concentration of uranyl dicarbonate is about two times higher than the uranyl tricarbonate species based on geochemical modeling. Other uranium aqueous species including uranyl carbonate and hydrolytic species may also be present, but in minor amounts (less than 2 percent), suggesting that the groundwater at the site has sufficient bicarbonate alkalinity to complex uranium. Sulfate was found to have no effect on the speciation of uranium at the site at the concentrations detected at the Cimarron Site.

The estimated range of historical background concentrations of uranium observed in each of the water-bearing units is as follows:

- Sandstone A: 1.0 to 19.8 pCi/L (based on 7 wells);
- Sandstone B: 0.6 to 3.9 pCi/L (based on 5 wells);
- Sandstone C: 4.6 to 43.6 pCi/L (based on 6 wells); and
- Alluvial floodplain: 5.1 to 35.6 pCi/L (based on 9 wells).

These estimated uranium background concentrations are an update to the previous calculations presented in the document titled “Groundwater Quantity and Quality in Vicinity of Cimarron Corporation’s Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma” 1997, and new well selections provided by Cimarron Corporation hydrogeologists.

4.4.2 BA #1 Area

Monitoring wells installed in 1985 detected uranium immediately downgradient (to the north) of the four trenches in the BA #1 Area. The impacted groundwater was found in Sandstone B (which underlies the trenches) and was subsequently found to continue northward into the alluvial floodplain. The origin of the groundwater impacts was likely the four trenches, but the timing of the migration of uranium from the trenches into Sandstone B is uncertain. The monitoring wells installed in 1985 detected a plume of uranium, with concentrations of total uranium up to 2,500 pCi/L, suggesting that the uranium began migrating in groundwater prior to 1985.

When uranium leached from the former disposal trenches, it was carried into Sandstone B, where it migrated north toward the alluvium driven by the local hydraulic gradient. Groundwater flow velocity in Sandstone B is anticipated to be relatively high because of the steep hydraulic gradient in Sandstone B.

Once the groundwater reached the interface between the sandstone and the alluvial deposits at the buried escarpment, it refracted to the northwest under the influence of a mass of low-permeability clayey material to the northeast of the escarpment. This low permeability material interrupted the northern flow of Sandstone B groundwater and forced it to flow along a southeastern-northwestern trending paleochannel filled with higher permeability sandy material between the sandstone and the clayey materials in the transitional zone. Flow in the sandy paleochannel was uninterrupted until the groundwater encountered a clay-rich barrier in an area between TMW-9 and 02W01 as discussed in Section 2.3.1 (Detailed Stratigraphic Correlations at Cimarron – BA #1 Area) of this report. This clay-rich barrier affects the migration of uranium both by virtue of its lower permeability and its increased adsorption potential. After the uranium-impacted groundwater migrated through the clay-rich barrier, its flow continued to be slowed by the extremely flat gradient in the sandier alluvial materials, as shown in Figure 3-4.

The spatial distribution of uranium in the BA #1 Area is illustrated in Figure 4-11. As is shown, the uranium concentration varied from background levels to over 4,000 pCi/L based on the August/September 2004 groundwater monitoring data. The uranium plume, defined as uranium concentration exceeding the site-specific groundwater release criteria of 180 pCi/L, has an elongated shape, with the southern portion trending from southeast to northwest and the northern portion from south to north. The orientation and distribution of the plume coincides with the location of the paleochannel, discussed in Section 2.3.1 (Detailed Stratigraphic Correlations at Cimarron – BA #1 Area) of this report, indicating that the migration of uranium near the escarpment may be influenced by the paleochannel. In areas farther away from the uplands, the movement of uranium is affected by the regional groundwater gradient resulting in its movement toward the Cimarron River channel.

A comparison of the groundwater monitoring data from the August/September 2004 sampling event (Figure 4-11) and the August 2002 (Figure 4-12) event revealed some changes in the uranium distribution between the two data sets. The main differences are:

- The highest observed uranium concentration has decreased from 5,035 pCi/L (TMW-09) during 2002 to 4,387 pCi/L in 2004
- The area containing groundwater above 2,000 pCi/L total uranium appears to have advanced and spread out.
- The plume's leading edge has shifted toward the east relative to its 2002 location and there is little advancement to the north towards the Cimarron River.

Figures 4-11 and 4-12 were developed for comparative purposes, and provide a means for comparing the uranium data from two groundwater sampling events.

Based on data of only two site-wide sampling events, it is difficult to determine whether the spatial variation of the plume is statistically significant. However, there are seven wells (TMW-13, 02W04, 02W07, 02W08, 02W19, 02W43, and 02W62) in the northern portion of the plume that have more than four quarters' data available. For those wells the Mann-Kendall statistics was calculated to evaluate whether the concentration fluctuation was random or directional. The analysis indicated that except for one well (02W19) which showed an upward trend, there is no clear trend associated with the data in other wells, suggesting the concentration variations in those wells were random.

4.4.3 Western Upland Area

The BA #3 Area was excavated, surveyed by Cimarron and the NRC, and backfilled with clean soil prior to 1994. At the Seep 1206 sample collection point, the elevated uranium concentration in a sample collected in 1985 appeared to be spatially related to the BA #3 Area.

Historically, samples designated as being collected from the 1206 Seep were in fact collected from a pool of accumulated surface water near the escarpment. This Seep 1206 sampling location is identified in Figures 2-3, 2-8, 3-3, and 4-13 and represents, a location where water accumulates from a number of seeps along the escarpment.

Since 2003, total uranium concentrations observed in samples from the 1206 Seep collection point appear to be declining. In 2002, uranium values were in the range of 150 to 170 pCi/L. By March 2003, the reported values were around 200 pCi/L. In June 2003, the uranium values sharply declined to approximately 100 pCi/L. In January 2004, the uranium concentration subsequently increased to values around 180 pCi/L. Since that time, the uranium concentrations in samples from the collection pool have been steadily declining and are currently in the range of 100 pCi/L.

Because of the potential for the evapoconcentration of uranium in the surface water collection pools, the concentrations of uranium observed at this location may not be representative of the actual groundwater in this area. This suspicion is supported by the data from wells in the proximity of this area (wells 1354, 1355, 1357, and 1358), which have uranium concentrations below 5 pCi/L. A monitor well located downgradient of 1357 and 1358 may be better suited to evaluate impacts from the BA #3 Area.

Three wells in the BA #3 Area (1351, 1352, and 1356) have also exhibited unexpected fluctuations in uranium concentrations. Observed uranium concentrations in these three wells have fluctuated in the range of 67 pCi/L to 725 pCi/L over the last two years of groundwater monitoring (2003–2005).

Uranium and water quality data from the August/September 2004 groundwater sampling event for the Western Upland Area is presented in Figure 4-14.

4.4.4 Western Alluvial Area

The uranium impacts detected in the Western Alluvial Area above the site-specific groundwater release criteria of 180 pCi/L extend from near the base of the escarpment northward toward the Cimarron River, apparently originating where the western pipeline entered the alluvium north of the former Sanitary Lagoons. Uranium and water quality data from the August/September 2004 groundwater sampling event for the Western Alluvial Area is presented in Figure 4-15.

The observed impacts parallel the trace of the former West Pipeline Corridor that was used to discharge wastewater to the Cimarron River from 1966 to 1970. This pipeline and associated soils exceeding 30 pCi/g were removed in 1985, and the corridor backfilled with clean soil.

Concentrations of uranium detected in the Western Alluvial Area wells are generally in the range of 150 to 250 pCi/L. Concentrations in most wells have not varied to any noticeable degree over the past 2 years of sampling. Wells near the escarpment, mainly wells T-62 and T-64 are the main exceptions. The groundwater impacts in the Western Alluvial Area are not typical of a plume in the sense that a plume has a continuing source and represents a moving and changing zone of dissolved uranium in groundwater; rather, the groundwater impacts in the Western Alluvial Area are the result of downward seepage (i.e., no horizontal flow component) of uranium from a former pipeline that leaked uranium-bearing wastewater during the operational period of the Cimarron facility.

Two groundwater monitoring wells were installed in the Western "transition" area; one in the 1206 drainage (MWWA-09) and the other in the alignment where the former west pipeline was located (MWWA-03). Soil borings were sampled and analyzed for total U during installation of the wells; values ranged between 2.4 to 7.68 + or - ~1.1 (pCi/g) for soils from MWWA-03 and MWWA-09. Groundwater samples yielded 268 pCi/L (MWWA-09) and 1110 pCi/L (MWWA-03). It is possible that the pipeline leak has impacted both soil and groundwater near MWWA-03, and seepage from Burial Area #3 has impacted both soil and groundwater near MWWA-09.

4.4.5 Surface Water

The Cimarron River is relatively saline due to contributions in the northwest part of Oklahoma from Permian evaporite beds. The water quality of the Cimarron River is presented in Table 4-2 and was summarized from Adams and Bergman (1994) and data available on the USGS National Water Information System (NWIS) water data website. The TDS concentration of the Cimarron River water decreases from the Waynoka gage southeast to the Guthrie gage, which is located 10 miles east of the Cimarron Site. Similarly, sodium, chloride, and sulfate concentrations also decrease. This is due to the decreasing influence of Permian-age evaporite beds on the river chemistry and the greater influence of runoff from farmed areas and sewage outfalls. In the area of the Cimarron Site, which lies between the Dover and Guthrie gages, the Cimarron River can be expected to have TDS in the range of 8,000 to 12,000 mg/L, chloride between 3,600 and 5,700 mg/L, sulfate between 650 and 780 mg/L, sodium ranging from 1,900 to 3,400 mg/L, and alkalinity (bicarbonate) in the range of 200 mg/L. This water chemistry is very distinct from the groundwater chemistry of the alluvial floodplain. Based on the Secondary Maximum Concentration Limits (MCLs) recommended by the United States Environmental Protection Agency (USEPA) for drinking water, this water is considered non-potable.

Samples collected from the Cimarron River in June 1997 exhibited a mean total uranium concentration of 8.1 pCi/L at the upstream sample location, and 7.3 pCi/L at sample location 1202 downstream of the Cimarron site. (Cimarron Decommissioning Plan Groundwater Evaluation Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, July, 1998).

Table 4-1 August/September 2004 Groundwater Monitoring Data, Cimarron Site, Crescent, Oklahoma

Well ID	Water Bearing Unit	Dissolved Oxygen ¹ (mg/L)	Nitrate ^{2,3} (mg/L)	pH ¹ -	Redox Potential ¹ (mv)	Uranium ² (pCi/L)	Calcium ² (mg/L)	Chloride ^{2,3} (mg/L)	Magnesium ² (mg/L)	Sodium ² (mg/L)	Sulfate ^{2,3} (mg/L)	Bicarbonate Alkalinity ^{2,3} (mg/L)	Total Alkalinity ^{2,3} (mg/L)	Total Dissolved Solids ² (mg/L)
Burial Area #1														
02W01	Alluvial	1.5	0.3	7.2	271	4150	127	22.3	42.3	36.8	81.4	432	433	535
02W02	Alluvial	1.1	0.1	7.4	14	692.3	89.3	24.7	40.8	78.3	46.3	450	451	719
02W03	Alluvial	5.9	0.1	7.1	64	3779	132	31.2	61.2	60.3	85.6	555	556	1220
02W04	Alluvial	1.5		7.1	224	1789.8	171	47.7	84.9	90.6	433	452	454	1160
02W05	Alluvial	1.0	0.118	7.0	216	2542	182	150	113	170	283	673	677	1360
02W06	Alluvial	1.1	0.2	7.1	218	3462	179	62.1	67.5	91.5	273	512	513	1050
02W07	Alluvial	1.5	4.6	7.2	279	732.4	171	40.1	59.5	75.3	320	426	427	519
02W08	Alluvial	1.6	0.1	7.1	82	120.0	182	23.2	56	52.7	281	545	550	581
02W09	Alluvial	2.0	0.1	7.3	200	1.8	61.3	18.5	55.1	24.2	29	378	379	590
02W10	Alluvial		0.1	7.2		3.2	91.5	26.4	73.7	39.4	56.7	489	492	1330
02W11	Alluvial		0.1	7.1		29.0	177	38.3	60.3	70.5	279	527	534	699
02W12	Alluvial		0.1	7.1		43.7	125	22.3	50.5	50.8	131	463	465	661
02W13	Alluvial		0.1	6.9		30.5	142	18.7	44.3	33.4	95.1	501	502	920
02W14	Alluvial		0.1	7.1		113.7	155	35.3	59.7	84.7	195	553	556	1530
02W15	Alluvial	1.7	0.1	7.2	195	59.8	226	86.8	94.3	115	629	355	359	1440
02W16	Alluvial		0.1	7.1		24.3	254	49	77.5	67.5	626	346	347	1240
02W17	Alluvial	1.4	0.1	7.1	228	39.8	218	56.3	65	63.4	475	346	347	1090
02W18	Alluvial	1.7	0.1	7.1	124	744.7	167	35.2	49.1	66.6	328	410	411	1010
02W19	Alluvial		0.1	7.1		799.3	141	40.3	56.7	77.7	175	479	481	832
02W20	Alluvial	1.9		7.1	48	1.5	80.8	19.3	51.9	23.5	53.7	347	347	475
02W21	Alluvial			7.1		5.6	205	23.8	52.3	49	458	192	192	1030
02W22	Alluvial			7.0		8.6	210	41.4	65.6	58.3	478	352	353	1130
02W23	Alluvial	2.2		6.9	228	7.2	209	34.7	52.4	51.1	510	261	262	1160
02W24	Alluvial	1.5		7.0	120	117.2	213	50.6	65	58.8	520	325	326	1200
02W25	SS B	1.5		7.0	62	13.2	93	2.46	21.6	15.7	10.3	240	240	358
02W26	Alluvial			7.2		2.186	63.7	19.6	54.7	24	25.5	352	353	442
02W27	SS B			7.1		153.5	135	23.2	60.3	66.4	59.7	282	283	629
02W28	Alluvial			7.2		300	77	21	60.8	27.9	31.7	389	390	496

Table 4-1 August/September 2004 Groundwater Monitoring Data, Cimarron Site, Crescent, Oklahoma

Well ID	Water Bearing Unit	Dissolved Oxygen ¹ (mg/L)	Nitrate ^{2,3} (mg/L)	pH ¹ -	Redox Potential ¹ (mv)	Uranium ² (pCi/L)	Calcium ² (mg/L)	Chloride ^{2,3} (mg/L)	Magnesium ² (mg/L)	Sodium ² (mg/L)	Sulfate ^{2,3} (mg/L)	Bicarbonate Alkalinity ^{2,3} (mg/L)	Total Alkalinity ^{2,3} (mg/L)	Total Dissolved Solids ² (mg/L)
02W29	Alluvial	1.8		7.3	271	1845	106	7.83	35.3	15.1	22	330	331	441
02W30	SS B			6.9		457.4	146	59.2	49.1	35.2	43.2	448	449	656
02W31	Alluvial			7.2		570.5	76.4	18.6	59	26.9	36.3	479	481	499
02W32	Alluvial			7.1		413.3	117	31	63.7	61	124	378	379	707
02W33	Alluvial			6.9		7.5	237	55.3	75.6	67.2	558	266	267	1310
02W34	Alluvial			7.1		4.0	101	24.7	20.1	44.2	45.8	298	299	463
02W35	Alluvial			7.0		167	133	85.7	39.2	75.3	139	298	299	731
02W36	Alluvial	0.9		7.0	91	92.9	190	75.7	61.2	78.2	424	303	305	1140
02W37	Alluvial		0.1	7.0		433	152	122	76.1	163	191	618	622	1120
02W38	Alluvial			7.0		101.9	150	64.5	72.8	130	130	564	566	984
02W39	Alluvial	3.7		7.2	264	1209.7	95.8	9.5	35.4	15.5	19.1	372	374	391
02W40	SS B	1.9		7.2	290	1577	103	7.01	38.2	12	23.3	373	374	437
02W41	SS B	2.4		7.2	250	965.9	87.3	6.17	31.2	12.6	16.3	368	369	389
02W42	SS B	3.6		7.0	238	130.7	108	2.8	27.2	13.7	19	341	342	426
02W43	Alluvial		0.1	7.1		169.9	202	57	69.5	74.5	521	364	366	1240
02W44	Alluvial			7.0		157.8	133	58.3	60.6	81.5	132	586	588	924
02W45	Alluvial	1.3		7.1	61	120.6	214	198	57	139	396	447	449	1330
02W46	Alluvial			7.3		1377.4	109	27.1	66.6	55.9	72.8	543	545	686
02W47	SS B		0.451	6.7		375.8	121	10.3	48	13	29.3	473	474	535
02W50	SS B			7.4		3.5	72.5	16.4	26.9	22	8.47	277	278	369
02W51	SS B	6.9		7.6	274	5.4	57.4	2.2	18.9	11.9	23.3	229	230	254
02W52	SS B			7.4		1.9	60.9	15.6	22.4	19.2	7.75	361	363	322
02W53	SS B			7.1		76.7	130	117	53.3	86.6	184	420	422	911
02W62	Alluvial			7.0		5.5	130	62	29.9	66.4	123	404	406	691
1314	SS B			7.3		1.8	66.4	15.9	22	16.7	6.89	240	241	303
1315R	SS B	1.2	2.47	6.8	273	1793	183	22.5	70.9	30.1	102	628	629	816
1316R	SS B			6.9		151.7	152	11.8	46.7	20.1	30.5	222	222	611
TMW-01	SS B	6.2		6.7	190	1198.8	148	6.99	52.5	14.6	95	443	443	635
TMW-02	SS B	4.5		7.6	219	2.5	53.4	5.23	19.5	18.4	11.5	234	235	254

Table 4-1 August/September 2004 Groundwater Monitoring Data, Cimarron Site, Crescent, Oklahoma

Well ID	Water Bearing Unit	Dissolved Oxygen ¹ (mg/L)	Nitrate ^{2,3} (mg/L)	pH ¹ -	Redox Potential ¹ (mv)	Uranium ² (pCi/L)	Calcium ² (mg/L)	Chloride ^{2,3} (mg/L)	Magnesium ² (mg/L)	Sodium ² (mg/L)	Sulfate ^{2,3} (mg/L)	Bicarbonate Alkalinity ^{2,3} (mg/L)	Total Alkalinity ^{2,3} (mg/L)	Total Dissolved Solids ² (mg/L)
TMW-05	Alluvial	0.9		7.1	84	2.5	95.3	25.7	66.9	35.5	57.4	506	508	607
TMW-06	Alluvial	1.3		7.3	35	2.5	95.3	27.2	61.6	33.9	67.1	522	524	559
TMW-07	Alluvial	1.0		7.2	-9	26.8	93.9	21.6	55.4	40	40.1	490	492	542
TMW-08	SS B	3.7		7.0	262	3066	94.3	18.6	47.1	19.5	21.6	411	412	491
TMW-09	Alluvial			6.9		4387	127	16	39	28.6	76.6	422	424	566
TMW-13	Alluvial			7.2		4096	136	73	89.2	120	181	264	264	1010
TMW-17	SS C			6.9		4.7	161	23.3	45	40.9	301	320	321	830
TMW-18	SS B			7.1		12.4	311	285	113	183	799	251	251	2060
TMW-21	SS B	5.9		7.1	312	116.2	149	8.72	55.5	29.6	30.1	586	588	616
TMW-23	SS C			7.2		7.9	173	101	46.1	115	332	325	326	987
TMW-24	Alluvial	0.7		6.9	22	28.8	186	149	74.1	90.8	252	480	481	1120
TMW-25	SS B			7.2		179.2	67		22.8	16.7				
Minimum	Alluvial	0.7 TMW-24	0.1 02W37	6.9 TMW-24	-9 TMW-07	1.5 02W20	61.3 02W09	7.83 02W29	20.1 02W33	15.1 02W29	19.1 02W39	192 02W21	192 02W21	391 02W39
Maximum	Alluvial	5.9 02W03	4.6 02W07	7.4 02W02	279 02W07	4387 TMW-09	254 02W16	198 02W45	113 02W15	170 02W05	629 02W15	673 02W05	677 02W05	1530 02W14
Minimum	SS B	1.2 1315R		6.7 02W47	62 02W25	1.782 1314	53.4 TMW-02	2.2 02W51	18.9 02W51	11.9 02W51	6.89 1314	222 1316R	222 1316R	254 02W51
Maximum	SS B	6.9 02W51		7.6 02W51	312 TMW-21	3066 TMW-08	311 TMW-18	285 TMW-18	113 TMW-18	183 TMW-18	799 TMW-18	628 1315R	629 1315R	2060 TMW-18
Minimum	SS C			6.9 TMW-17		4.67 TMW-17	161 TMW-17	23.3 TMW-17	45 TMW-17	40.9 TMW-17	301 TMW-17	320 TMW-17	321 TMW-17	830 TMW-17
Maximum	SS C			7.2 TMW-23		7.9 TMW-23	173 TMW-23	101 TMW-23	46.1 TMW-23	115 TMW-23	332 TMW-23	325 TMW-23	326 TMW-23	987 TMW-23
Western Upland Area														
1206	Surface	2.9	3.91	7.3	259	109.0	97.8	6.41	35.8	30.6	31.5	402	407	518
1331	SS A			7.1		82.2								
1332	SS C			7.4		32.2								

Table 4-1 August/September 2004 Groundwater Monitoring Data, Cimarron Site, Crescent, Oklahoma

Well ID	Water Bearing Unit	Dissolved Oxygen ¹ (mg/L)	Nitrate ^{2,3} (mg/L)	pH ¹ -	Redox Potential ¹ (mv)	Uranium ² (pCi/L)	Calcium ² (mg/L)	Chloride ^{2,3} (mg/L)	Magnesium ² (mg/L)	Sodium ² (mg/L)	Sulfate ^{2,3} (mg/L)	Bicarbonate Alkalinity ^{2,3} (mg/L)	Total Alkalinity ^{2,3} (mg/L)	Total Dissolved Solids ² (mg/L)
1334	SS A	5.6		7.2	219	13.3	72.5		38.3	48.3	31.5	324	325	461
1348	SS A	1.3	16.8	7.3	233	136.7	24.7	3.72	9.13	15.3	20.2	277	278	206
1349	SS A	1.9	10.5	7.2	215	43.5	79.5	7.43	27.7	48.1	45.1	309	310	457
1350	SS A	1.1	44.8	7.3	269	35.6	82.8	4.38	28.8	24.4	22.2	261	262	564
1351	SS A	1.8	80.9	7.0	266	67.2	115	3.6	45	20.1	20.1	251	251	704
1352	SS A	1.2		7.0	247	736	137	6.2	31	47.2	24.4	295	297	527
1353	SS A	5.0	14.7	7.1	177		78.6	5.39	23.4	21.9	20.7	256	256	400
1354	SS A	2.0	166.0	7.0	262	3.1	197	6.52	86.7	23	11.1	288	289	1310
1355	SS A		79.6	7.5		2.4	69.3	3.58	23	14.5	12	176	176	720
1356	SS A	3.9	19.3	7.0	244	269.7	109	9.93	35.1	12.9	36.5	324	326	498
1357	SS A	1.4	57.0	7.1	286	2.4	83.6	3.81	30.6	16.5	12.9	245	246	533
1358	SS A	3.4	26.2	7.4	264	1.2	65.9	3.09	22.1	18.8	15.9	203	203	464
1359	SS A	1.1	21.1	7.1	258	26.1	90.6	6.45	30.3	24.8	30.1	288	289	559
1360	SS A	1.1	0.2	7.2	262	86.8	30.8	6.19	11.3	10.8	36.5	357	358	1010
Minimum	SS A	1.1 1350, 1360	0.2 1360	7.0 1356	177 1353	1.2 1358	24.7 1348	3.09 1358	9.13 1348	10.8 1360	11.1 1354	176 1355	176 1355	206 1348
Maximum	SS A	5.6 1334	166.0 1354	7.5 1355	286 1357	736 1352	197 1354	9.93 1356	86.7 1354	48.3 1334	45.1 1349	357 1360	358 1360	1310 1354
Western Alluvial Area														
T-58	Alluvial	3.6		7.1	338	26.4	144	19.2	47.8	35.3	182	229	230	843
T-62	Alluvial	2.7		7.1	335	416.3	167	18.6	69.6	57.5	73.1	405	406	1040
T-63	Alluvial	1.2		6.8	249	54.6	221	29	83.3	69.2	59.2	351	352	1720
T-64	Alluvial	1.9		7.2	327	835.6	119	46.3	50.5	73.1	106	405	406	818

Table 4-1 August/September 2004 Groundwater Monitoring Data, Cimarron Site, Crescent, Oklahoma

Well ID	Water Bearing Unit	Dissolved Oxygen ¹ (mg/L)	Nitrate ^{2,3} (mg/L)	pH ¹ -	Redox Potential ¹ (mv)	Uranium ² (pCi/L)	Calcium ² (mg/L)	Chloride ^{2,3} (mg/L)	Magnesium ² (mg/L)	Sodium ² (mg/L)	Sulfate ^{2,3} (mg/L)	Bicarbonate Alkalinity ^{2,3} (mg/L)	Total Alkalinity ^{2,3} (mg/L)	Total Dissolved Solids ² (mg/L)
T-65	Alluvial	1.8		7.1	318	178.5	171	18.9	63.4	52.9	94.2	437	438	1030
T-66	Alluvial	1.8		7.1	322	105.2	297	75.8	84.3	121	734	266	267	1890
T-67	Alluvial	1.2	39.0	7.0	263	197.7	193	29	57.1	80.4	205	373	377	988
T-68	Alluvial	1.8		7.1	311	107.0	198	150	58.6	158	426	373	374	1400
T-69	Alluvial	1.3		7.0	315	49.6	235	55	72.3	93.4	543	293	294	1550
T-70R	Alluvial	1.4		7.2	290	200.9	120	29	39.7	51.4	171	341	342	674
T-72	Alluvial	1.8		7.1	288	119.9	259	112	73.6	124	653	298	299	1650
T-73	Alluvial	1.4		7.1	283	11.6	114	54.2	45.5	54.7	83	330	331	629
T-74	Alluvial	2.4		7.2	307	20.6	241	124	65.8	111	609	373	374	1440
T-75	Alluvial	1.1		7.1	263	278.7	248	200	73.8	187	675	314	315	1700
T-76	Alluvial	1.3		7.1	282	206.6	152	25	52.4	57.5	138	389	390	869
T-77	Alluvial	1.0		7.0	267	231.7	293	70.9	83.3	348	104	369	372	749
T-78	Alluvial	1.9		7.1	279	23.76	289	319	72.4	289	822	292	294	2140
T-79	Alluvial	1.1		7.2	298	231.2	125	81.8	38.4	95	197	373	374	828
T-81	Alluvial	2.3		7.1	286	20.21	101	48.5	35	60.3	54.6	372	374	542
T-82	Alluvial	1.4		7.1	261	103.8	145	120	43.7	120	232	388	390	923
Minimum	Alluvial	1.0	39.0	6.8	249	11.6	101	18.6	35	35.3	54.6	229	230	542
		T-77	T-67	T-63	T-63	T-73	T-81	T-62	T-81	T-58	T-81	T-58	T-58	T-81
Maximum	Alluvial	3.6	39.0	7.2	338	835.6	297	319	84.3	348	822	437	438	2140
		T-58	T-67	T-74	T-58	T-64	T-66	T-78	T-66	T-77	T-78	T-65	T-65	T-78

- NOTES:
- 1 - Data collected in the field and provided by the Cimarron Hydrogeologic Staff.
 - 2 - Analyzed by off-site laboratory (General Engineering Labs, Charleston, SC).
 - 3 - Off-site laboratory data has been QA/QC reviewed and qualified. Qualifier flags have been removed for presentation purposes.


Table 4-2 Cimarron River Water Quality Data, Cimarron Site, Crescent, Oklahoma

SAMPLE LOCATION	DISCHARGE (cfs)	pH	POTASSIUM (mg/L)	SILICA (mg/L)	SPECIFIC CONDUCTANCE (umhos)	CALCIUM (mg/L)	CHLORIDE ² (mg/L)	MAGNESIUM (mg/L)	SODIUM (mg/L)	SULFATE ² (mg/L)	TOTAL ALKALINITY (mg/L)	TOTAL DISSOLVED SOLIDS ² (mg/L)
Waynoka Gage												
(2-86) (Adams et al, 1994)	149	8.2	9.6	10	27,000	290	9,100	100	5,400	940	173	16,600
Ranges (1979-1990) (USGS NWIS Waterdata)	9-17,700	7.5-8.4		10	44,200-51,000	120-450	5,000-21,000	26-160	2,000-12,000	240-1400		5,900-35,900
Dover Gage												
(2-86) (Adams et al, 1994)	304	8.1	7.6	5.1	12,100	240	5,700	89	3,400	780	193	10,600
Ranges (1979-1989) (USGS NWIS Waterdata)		7.5-8.4	6-12		3,270-29,000	76-310	830-9,500	17-100	550-5,800	200-780		1,840-17,300
Guthrie Gage¹												
(2-86) (Adams et al, 1994)	466	8.4	6.4	6.1	12,000	200	3,600	79	1,900	650	210	7,090

Note (1): Guthrie Gage is located approximately 10 miles east of the Cimarron site.

Note (2): All values for chlorides, sulfates, and TDS reported represent exceedances of the USEPA Secondary Drinking Water Maximum Concentration Limits (MCLs) i.e., 250 mg/L for chlorides/sulfates; 500 mg/L for TDS

Typical Stiff Diagrams of Sandstone Units

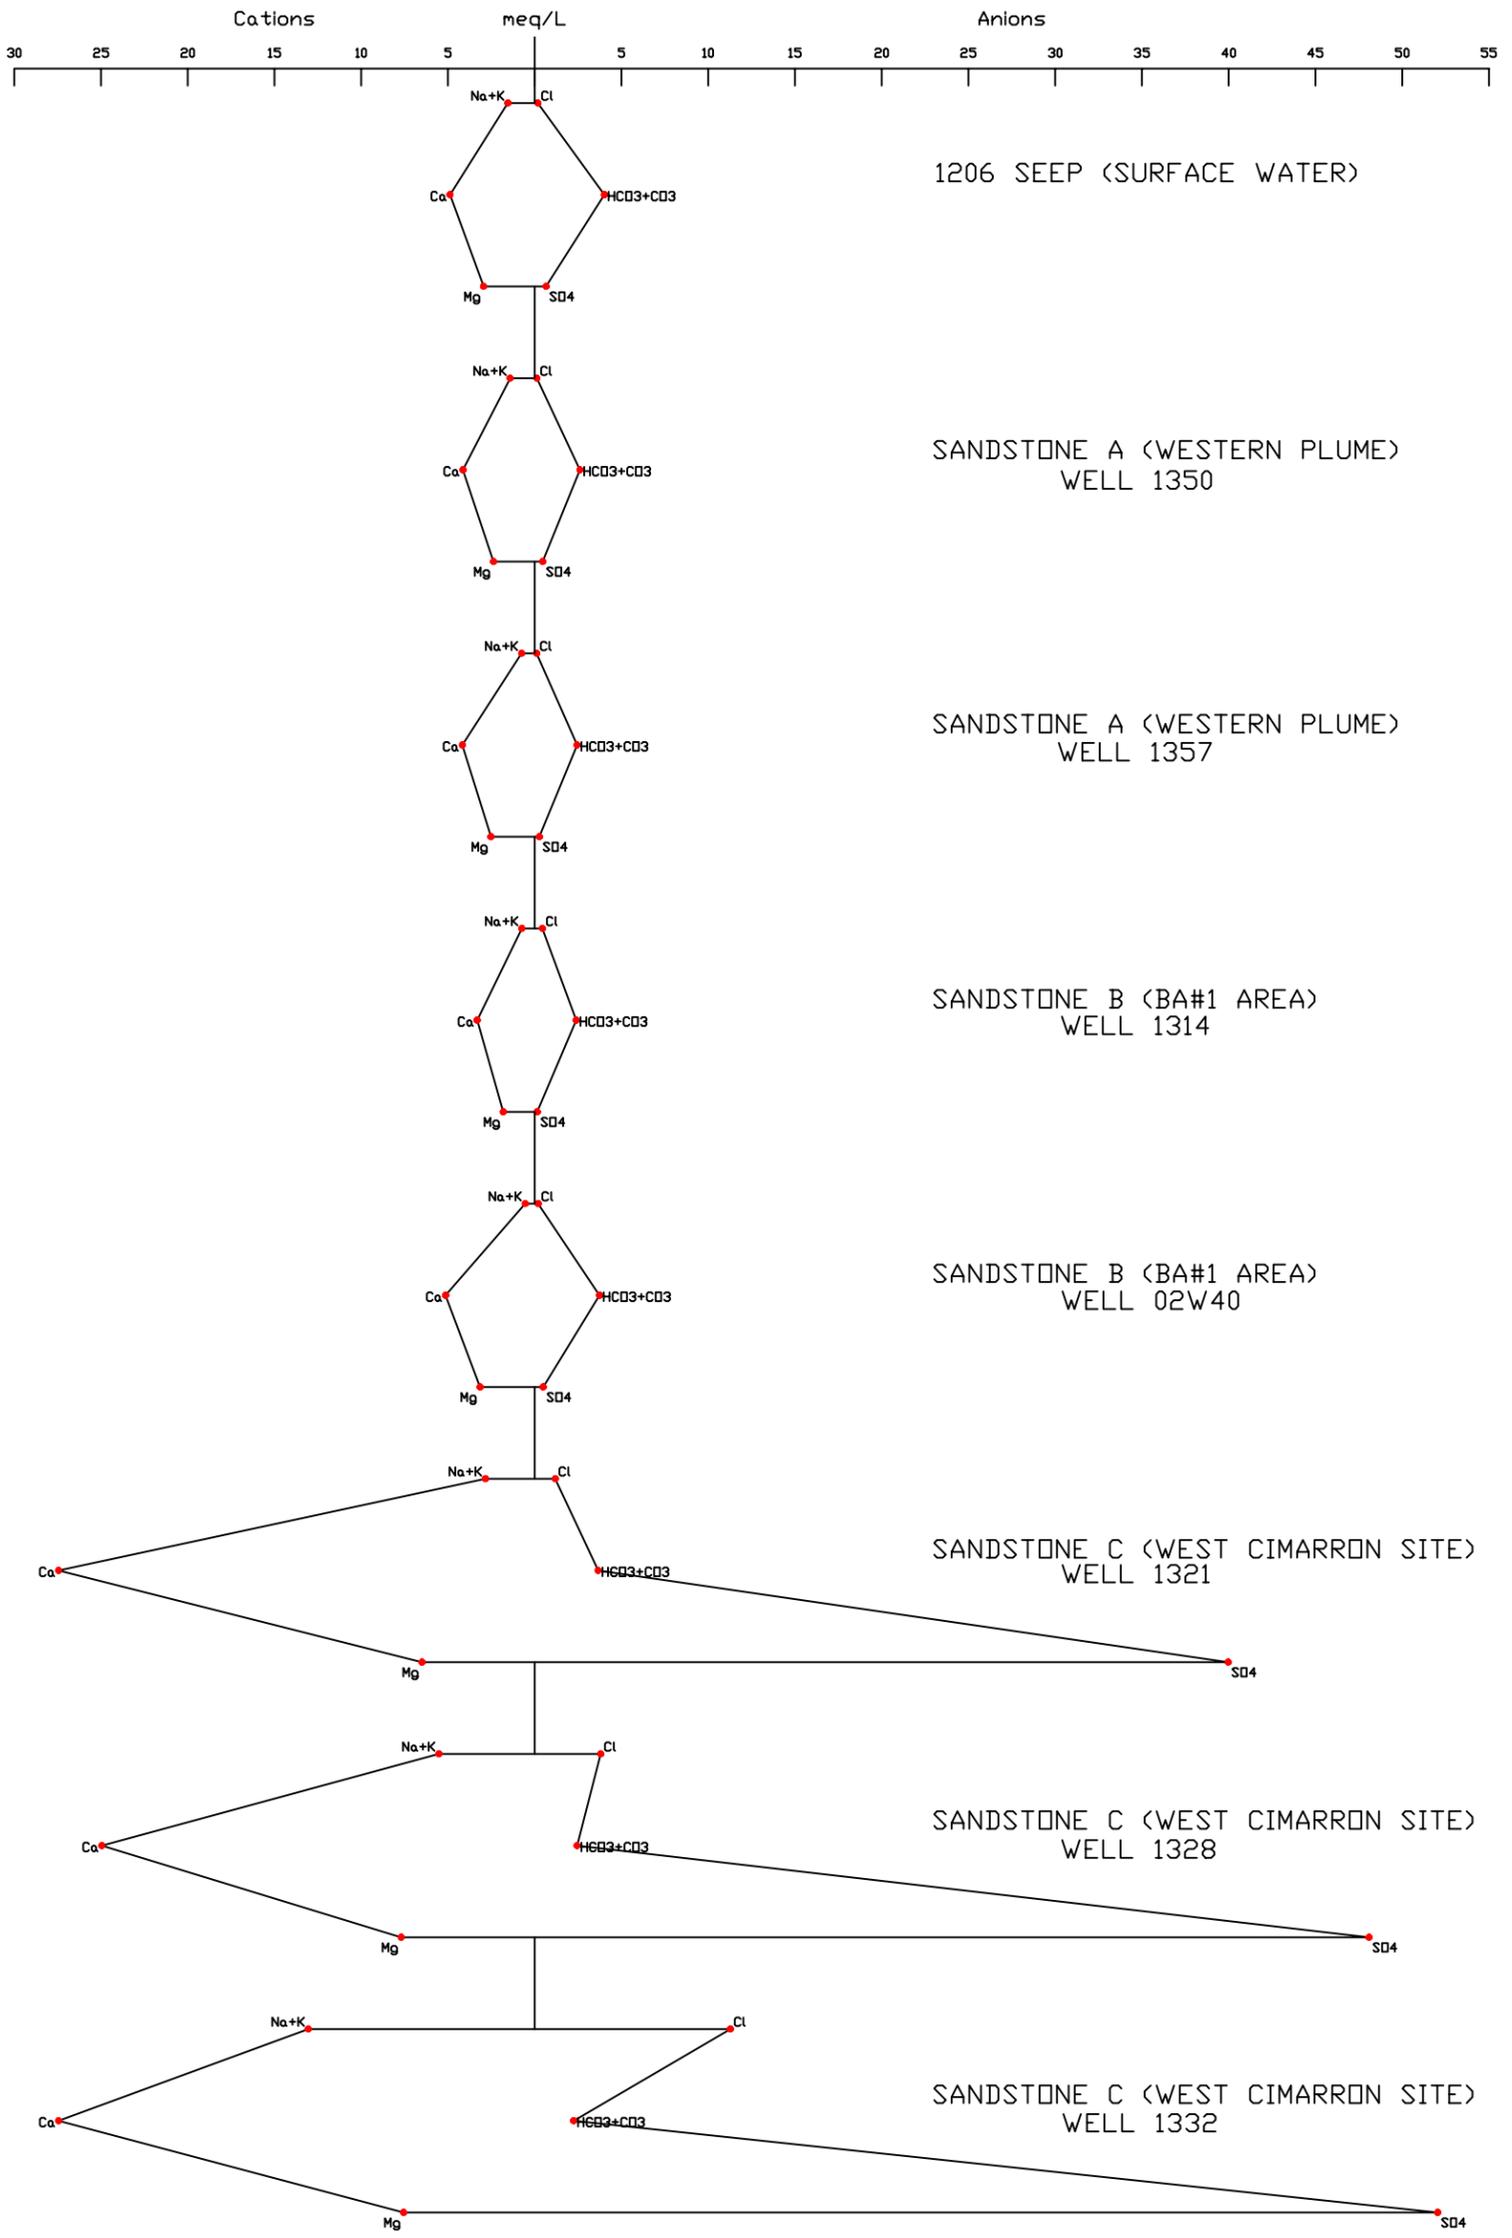

SHEET NUMBER: 1	FIGURE NUMBER: 4-1
--------------------	-----------------------


FIGURE 4-1 STIFF DIAGRAMS FOR SANDSTONE UNITS CIMARRON CORPORATION CRESCENT, OKLAHOMA		
SCALE:	DATE:	PROJECT NUMBER:
	8/10/05	04020-044-200

4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (978) 589-3100
 WEB: HTTP://WWW.ENSUR.COM

DESIGNED BY:	REVISIONS			
DRAWN BY:	NO.:	DESCRIPTION:	DATE:	BY:
JAS	1		6/17/05	
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

RIVER WATER STIFF DIAGRAM

Typical Stiff Diagrams of Alluvial

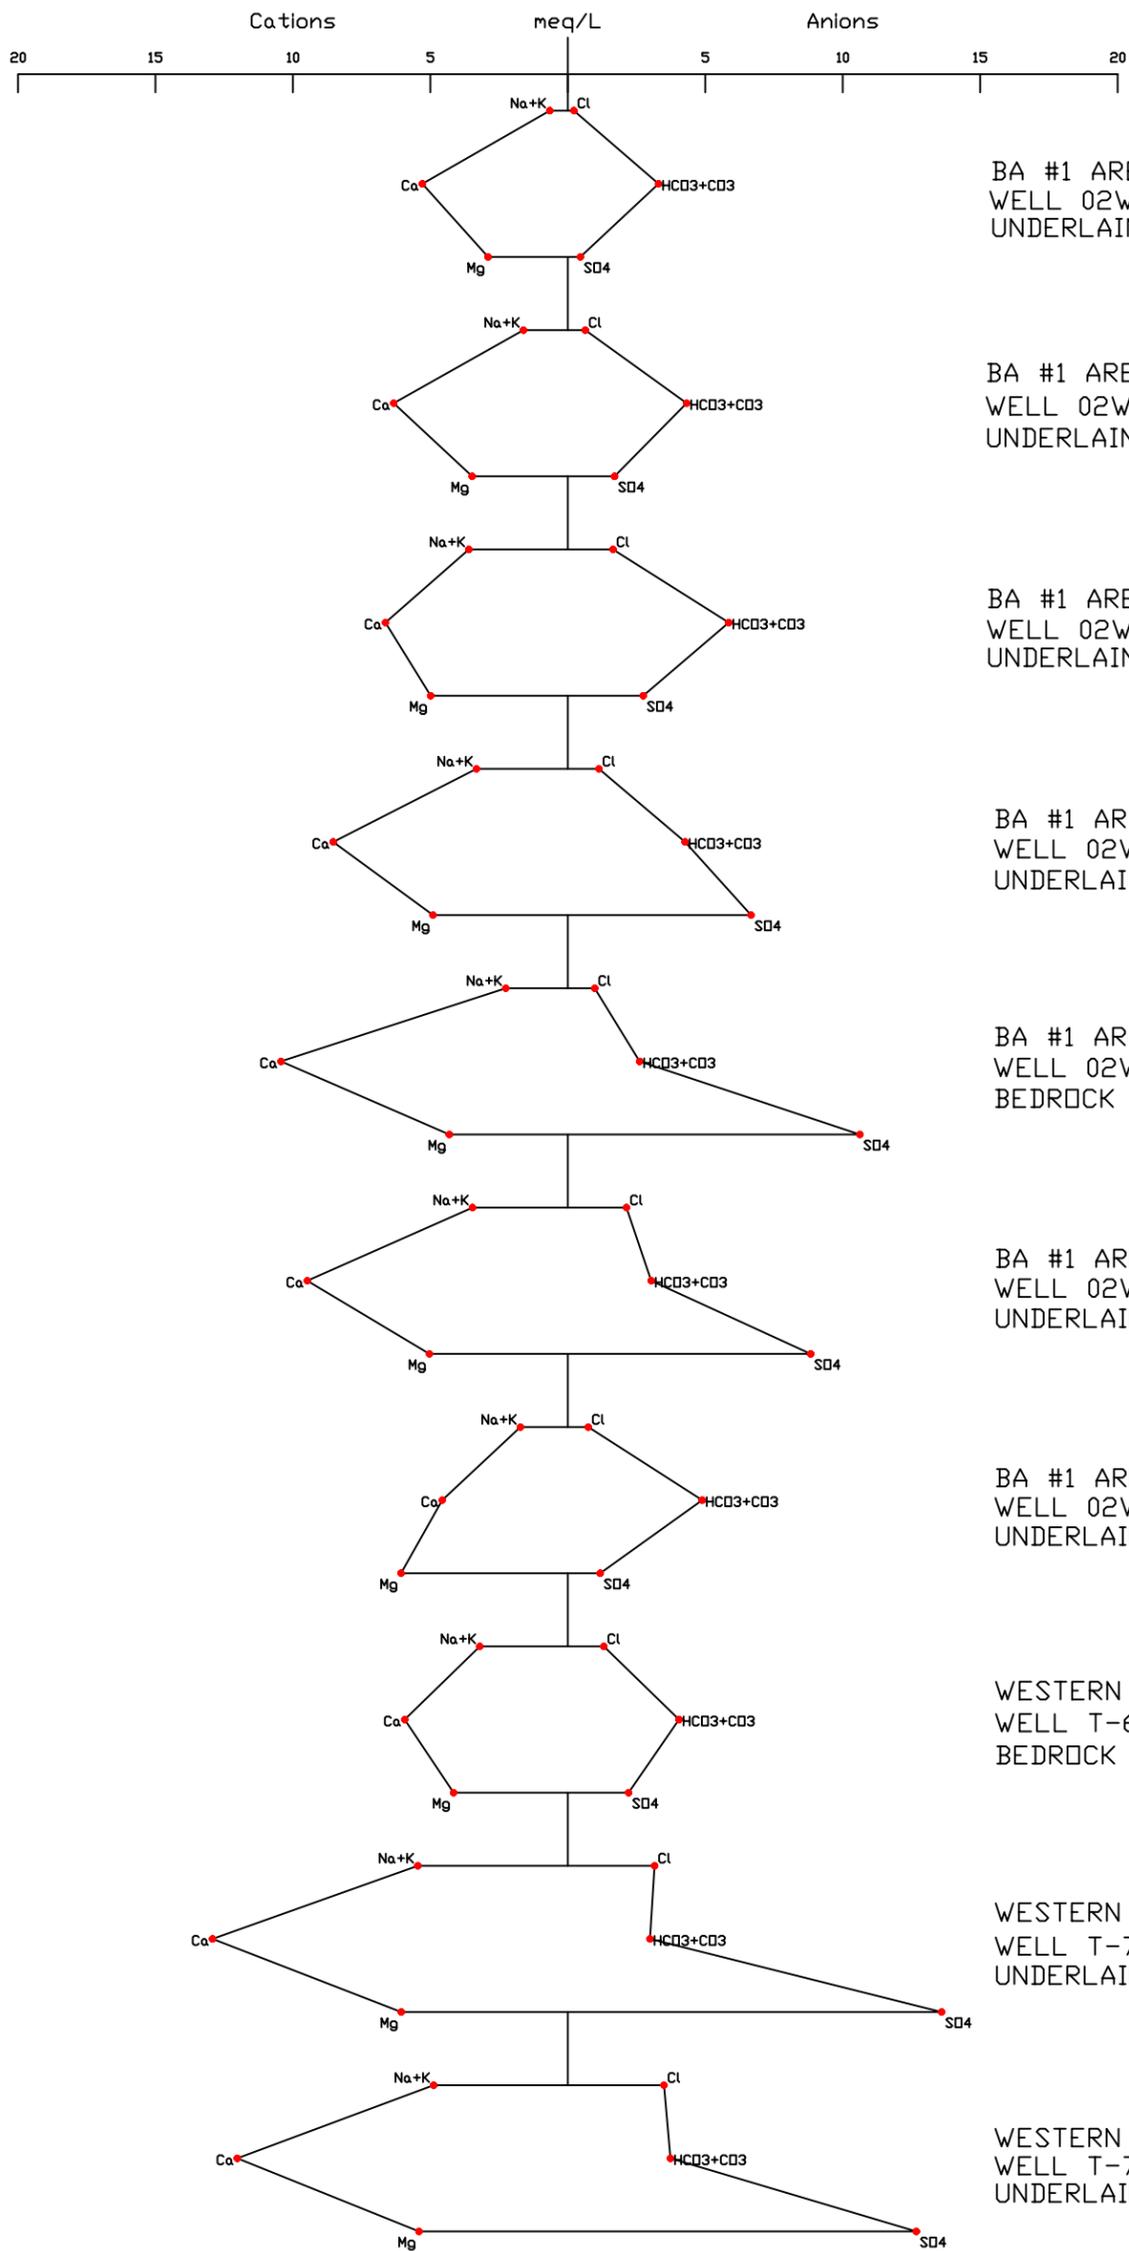

BA #1 AREA
WELL 02W29
UNDERLAIN BY MUDSTONE

BA #1 AREA
WELL 02W01
UNDERLAIN BY MUDSTONE

BA #1 AREA
WELL 02W44
UNDERLAIN BY SAND

BA #1 AREA
WELL 02W07
UNDERLAIN BY SANDSTONE

BA #1 AREA
WELL 02W23
BEDROCK UNKNOWN

BA #1 AREA
WELL 02W36
UNDERLAIN BY SANDSTONE

BA #1 AREA
WELL 02W10
UNDERLAIN BY CLAY/SHALE

WESTERN PLUME
WELL T-64
BEDROCK UNKNOWN

WESTERN PLUME
WELL T-72
UNDERLAIN BY SHALE

WESTERN PLUME
WELL T-74
UNDERLAIN BY SANDSTONE

FIGURE 4-2
STIFF DIAGRAMS FOR ALLUVIUM
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE: 1" = 80'	DATE: 8/10/05	PROJECT NUMBER: 04020-044-200
--------------------	------------------	----------------------------------



4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSRCOM

DESIGNED BY:	REVISIONS			
	NO.	DESCRIPTION	DATE	BY
DRAWN BY: JAS	1		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				

SHEET NUMBER:
1

FIGURE NUMBER:
4-2

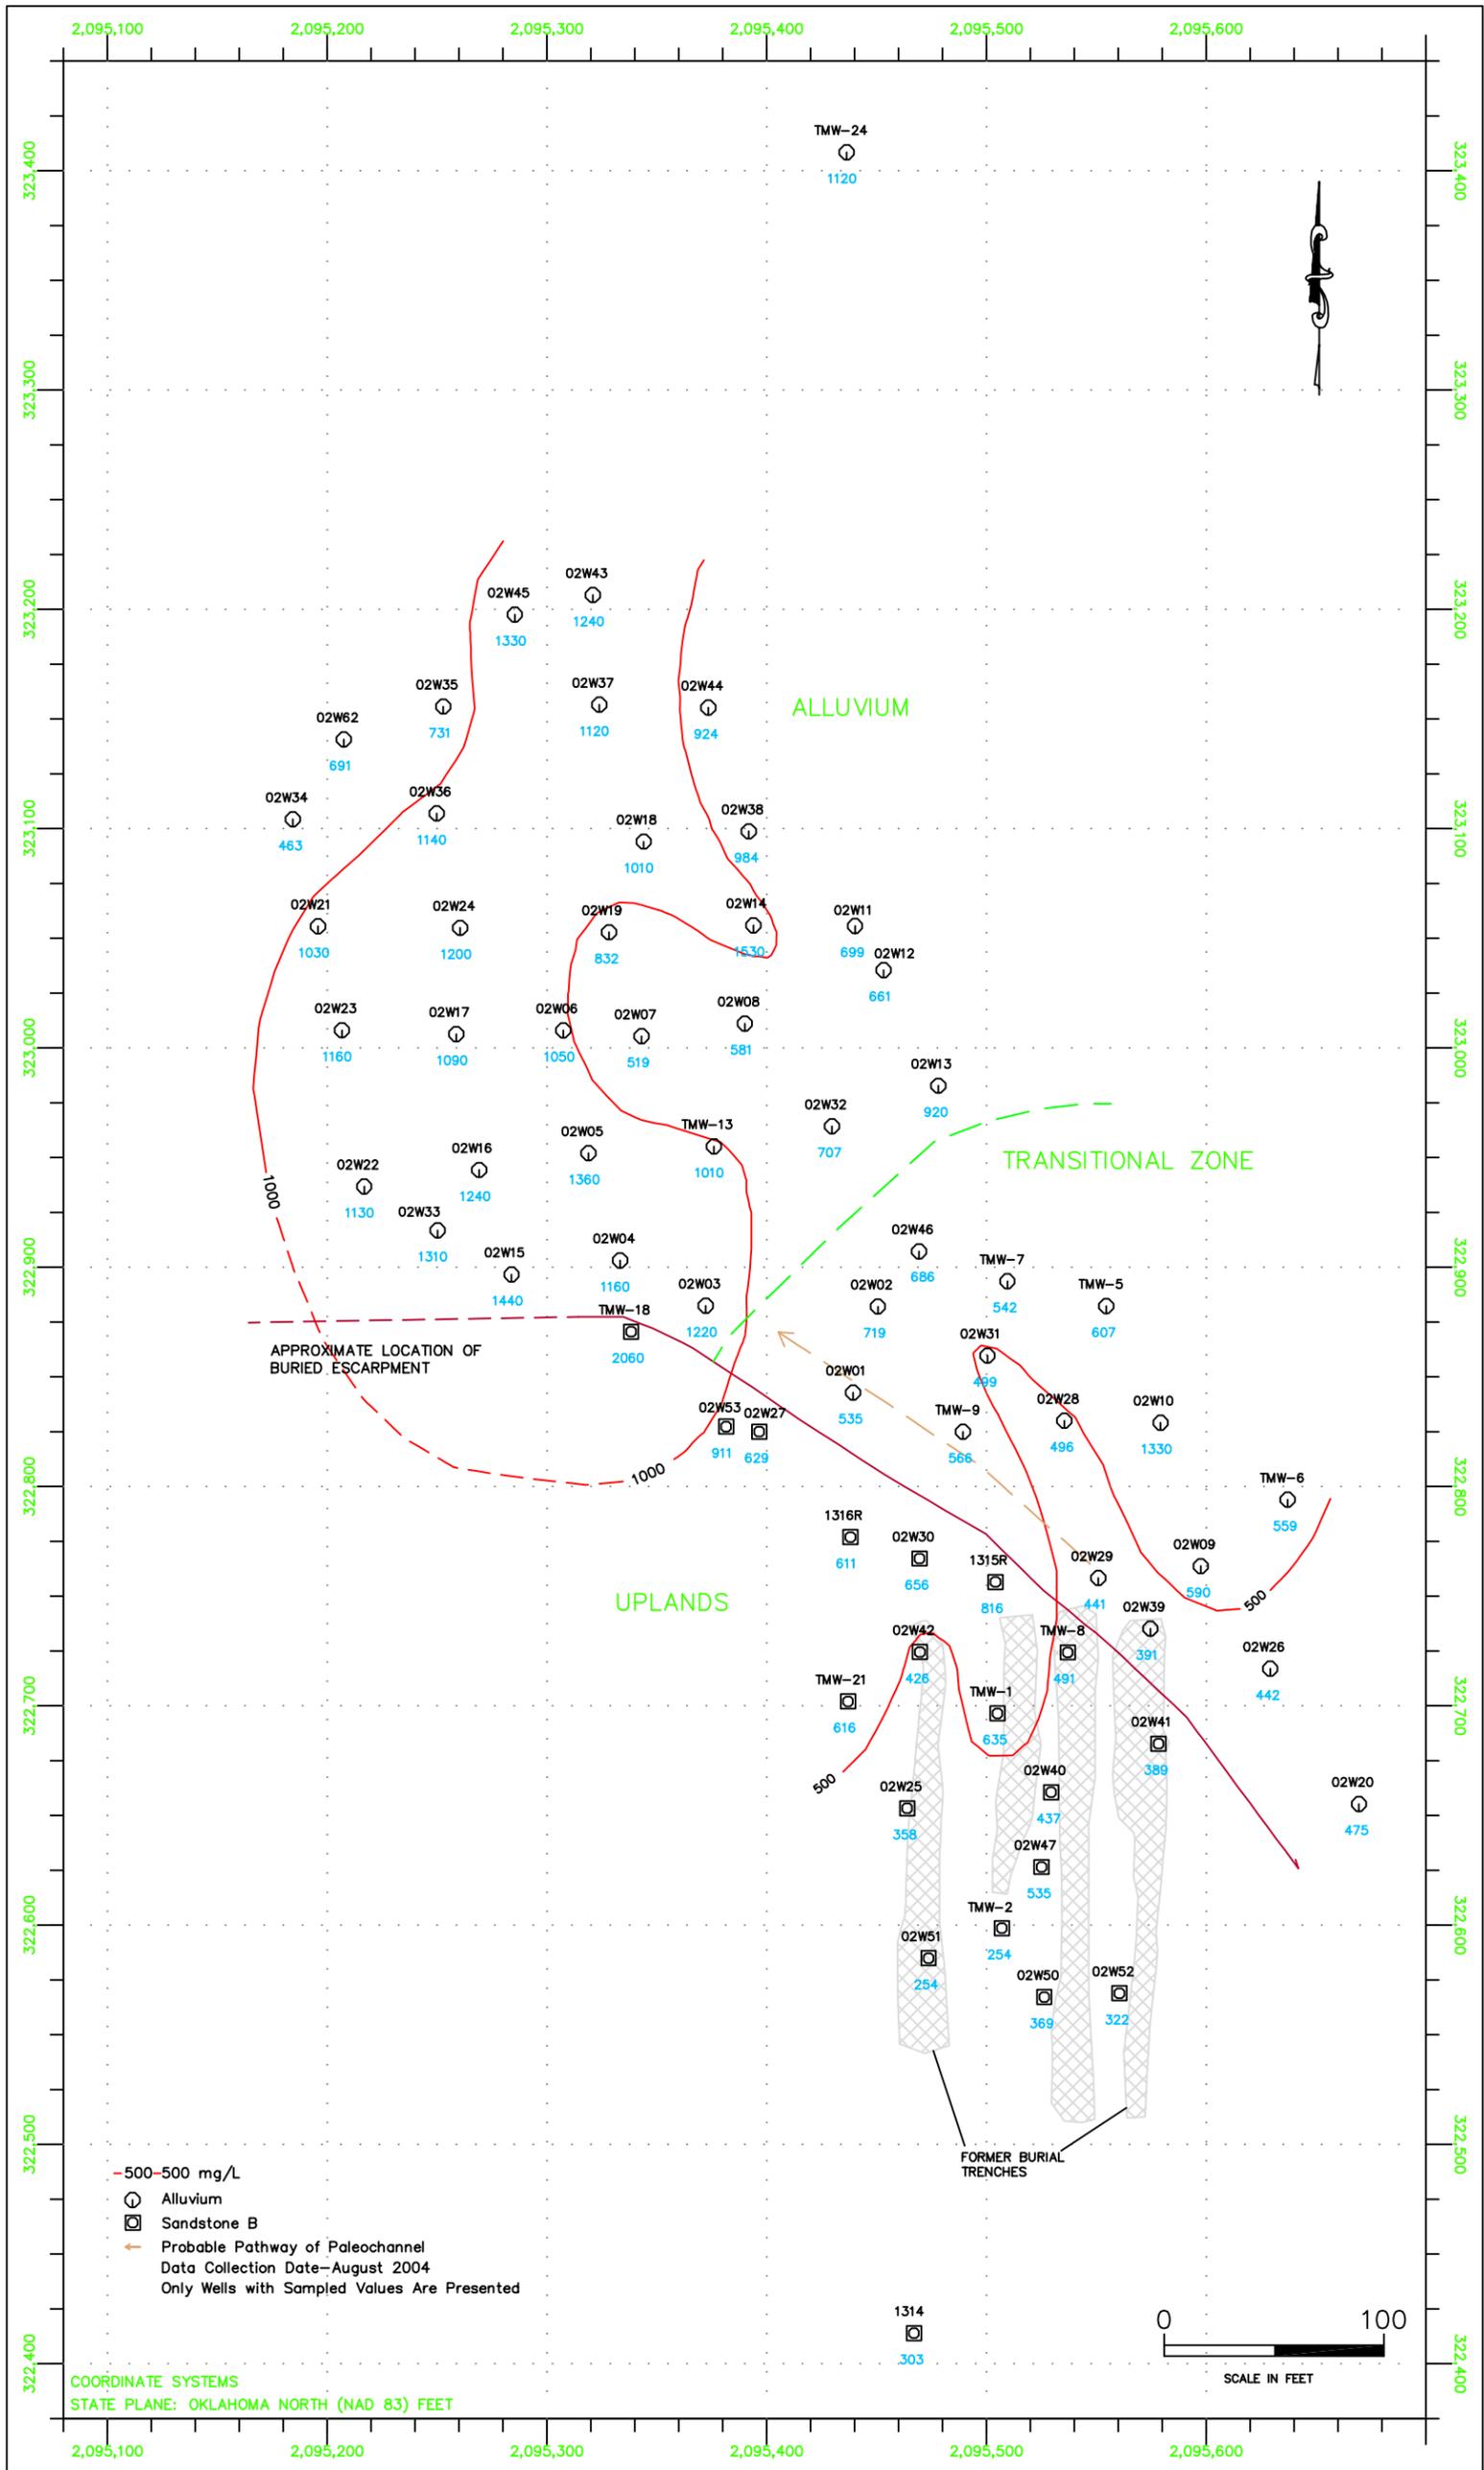


FIGURE 4-3
DISTRIBUTION OF TOTAL DISSOLVED SOLIDS
IN BA #1 AREA GROUNDWATER
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE: 1" = 80'	DATE: 8/10/05	PROJECT NUMBER: 04020-044-200
--------------------	------------------	----------------------------------



4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSUR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				

SHEET NUMBER:
1

FIGURE NUMBER:
4-3

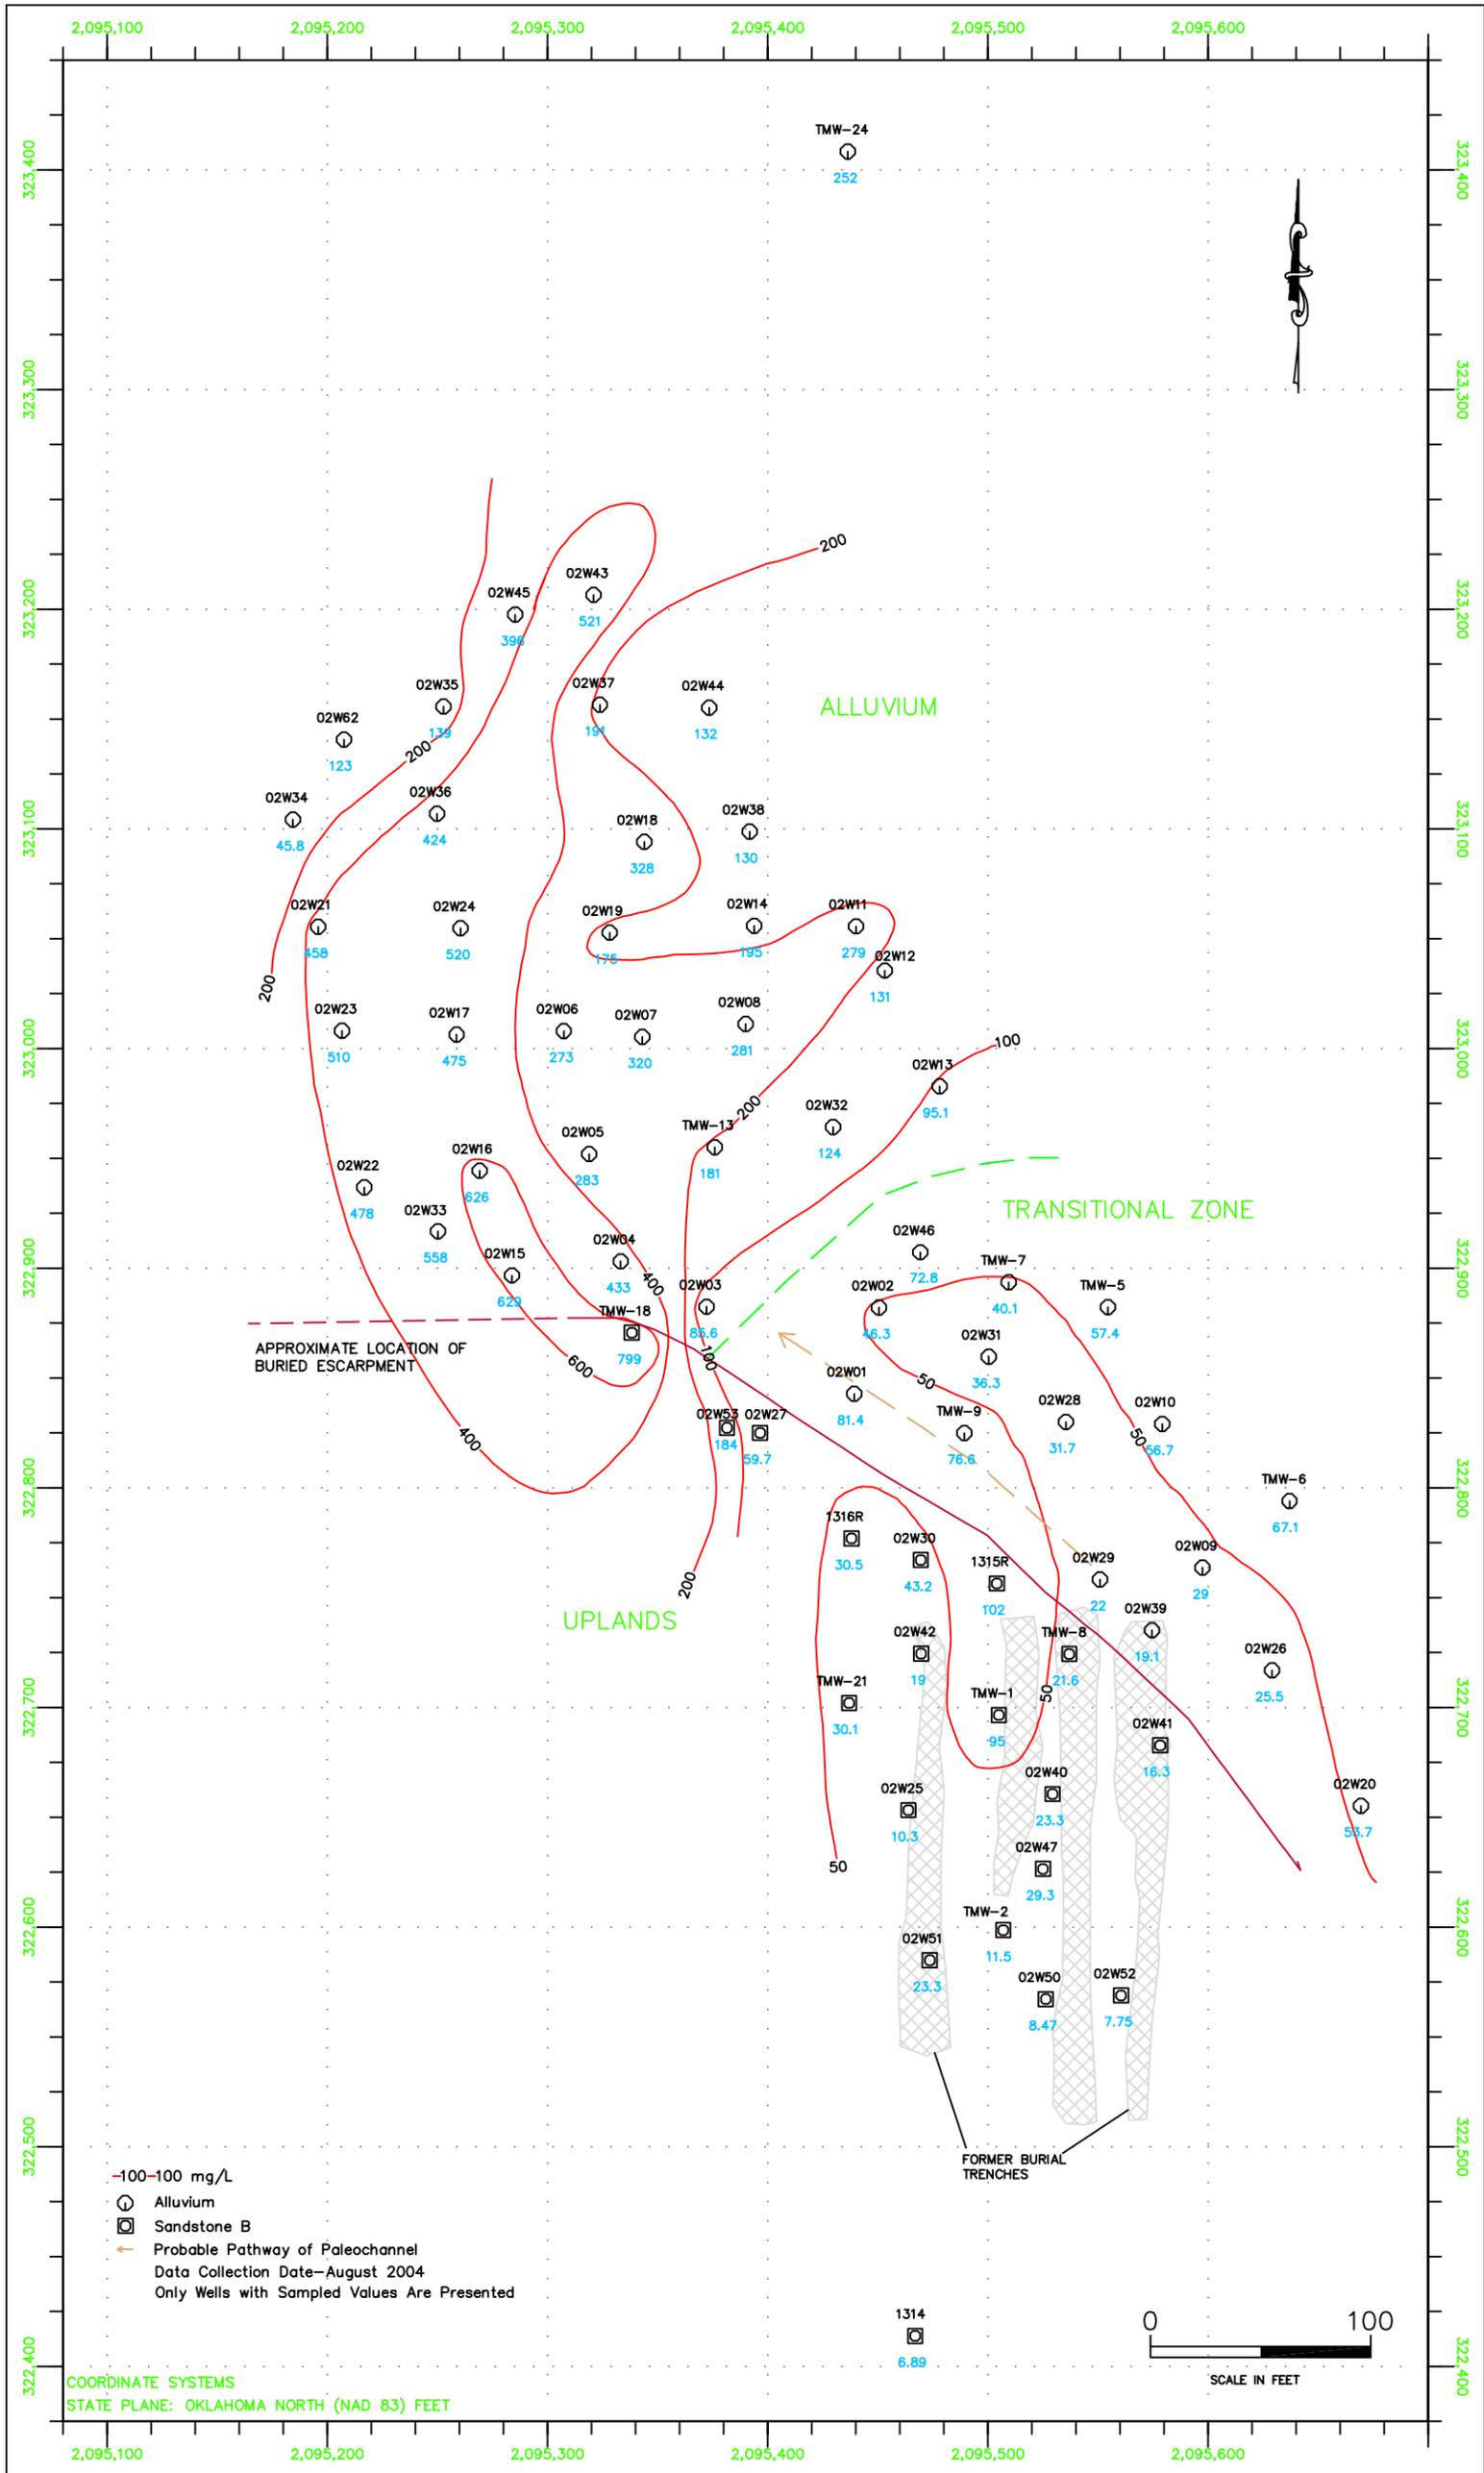


FIGURE 4-4
 DISTRIBUTION OF SULFATE IONS
 IN BA #1 AREA GROUNDWATER
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

SCALE: 1" = 80'
 DATE: 8/10/05
 PROJECT NUMBER: 04020-044-200



4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSUR.COM

DESIGNED BY:		REVISIONS		
NO.:	DESCRIPTION:	DATE:	BY:	
1		6/17/05		
DRAWN BY: JAS				
CHECKED BY: DJF				
APPROVED BY: DJF				

SHEET NUMBER:
1

4-4

FIGURE NUMBER:

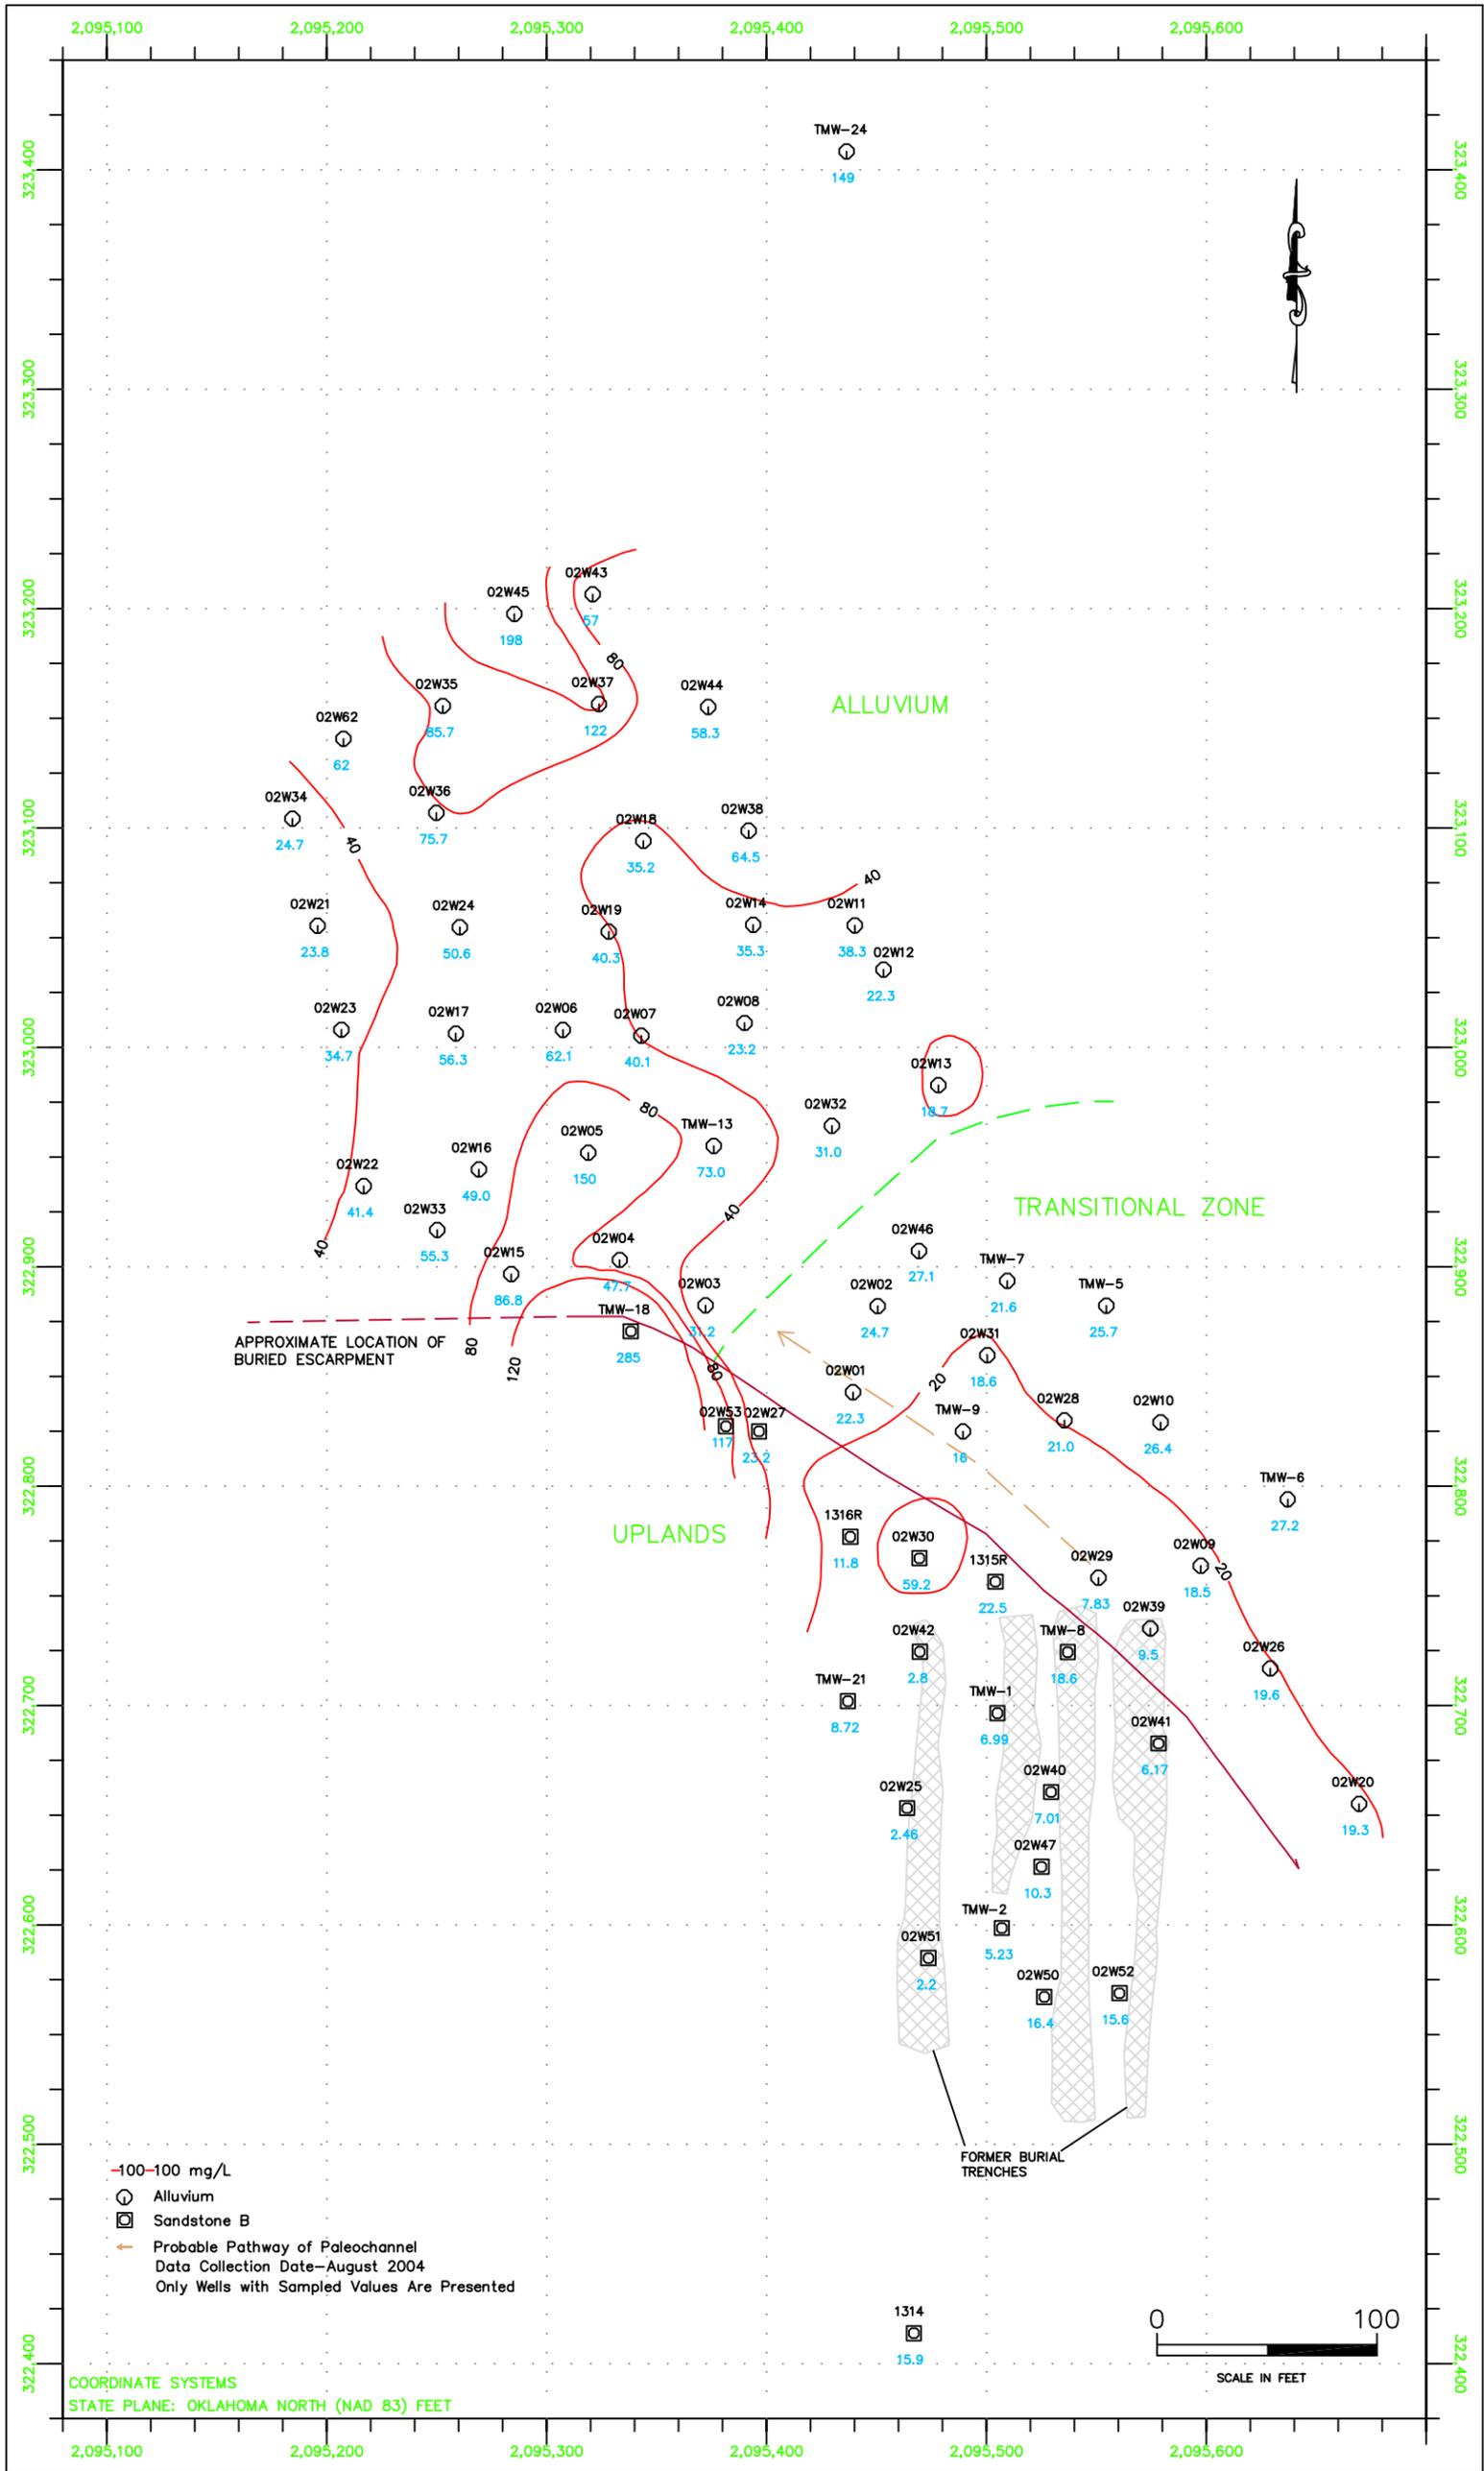


FIGURE 4-5
DISTRIBUTION OF CHLORIDE IONS
IN BA #1 AREA GROUNDWATER
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE: 1" = 80' DATE: 8/10/05 PROJECT NUMBER: 04020-044-200



4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSRI.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		6/17/05	
JAS				
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

SHEET NUMBER: 1

4-5

FIGURE NUMBER:

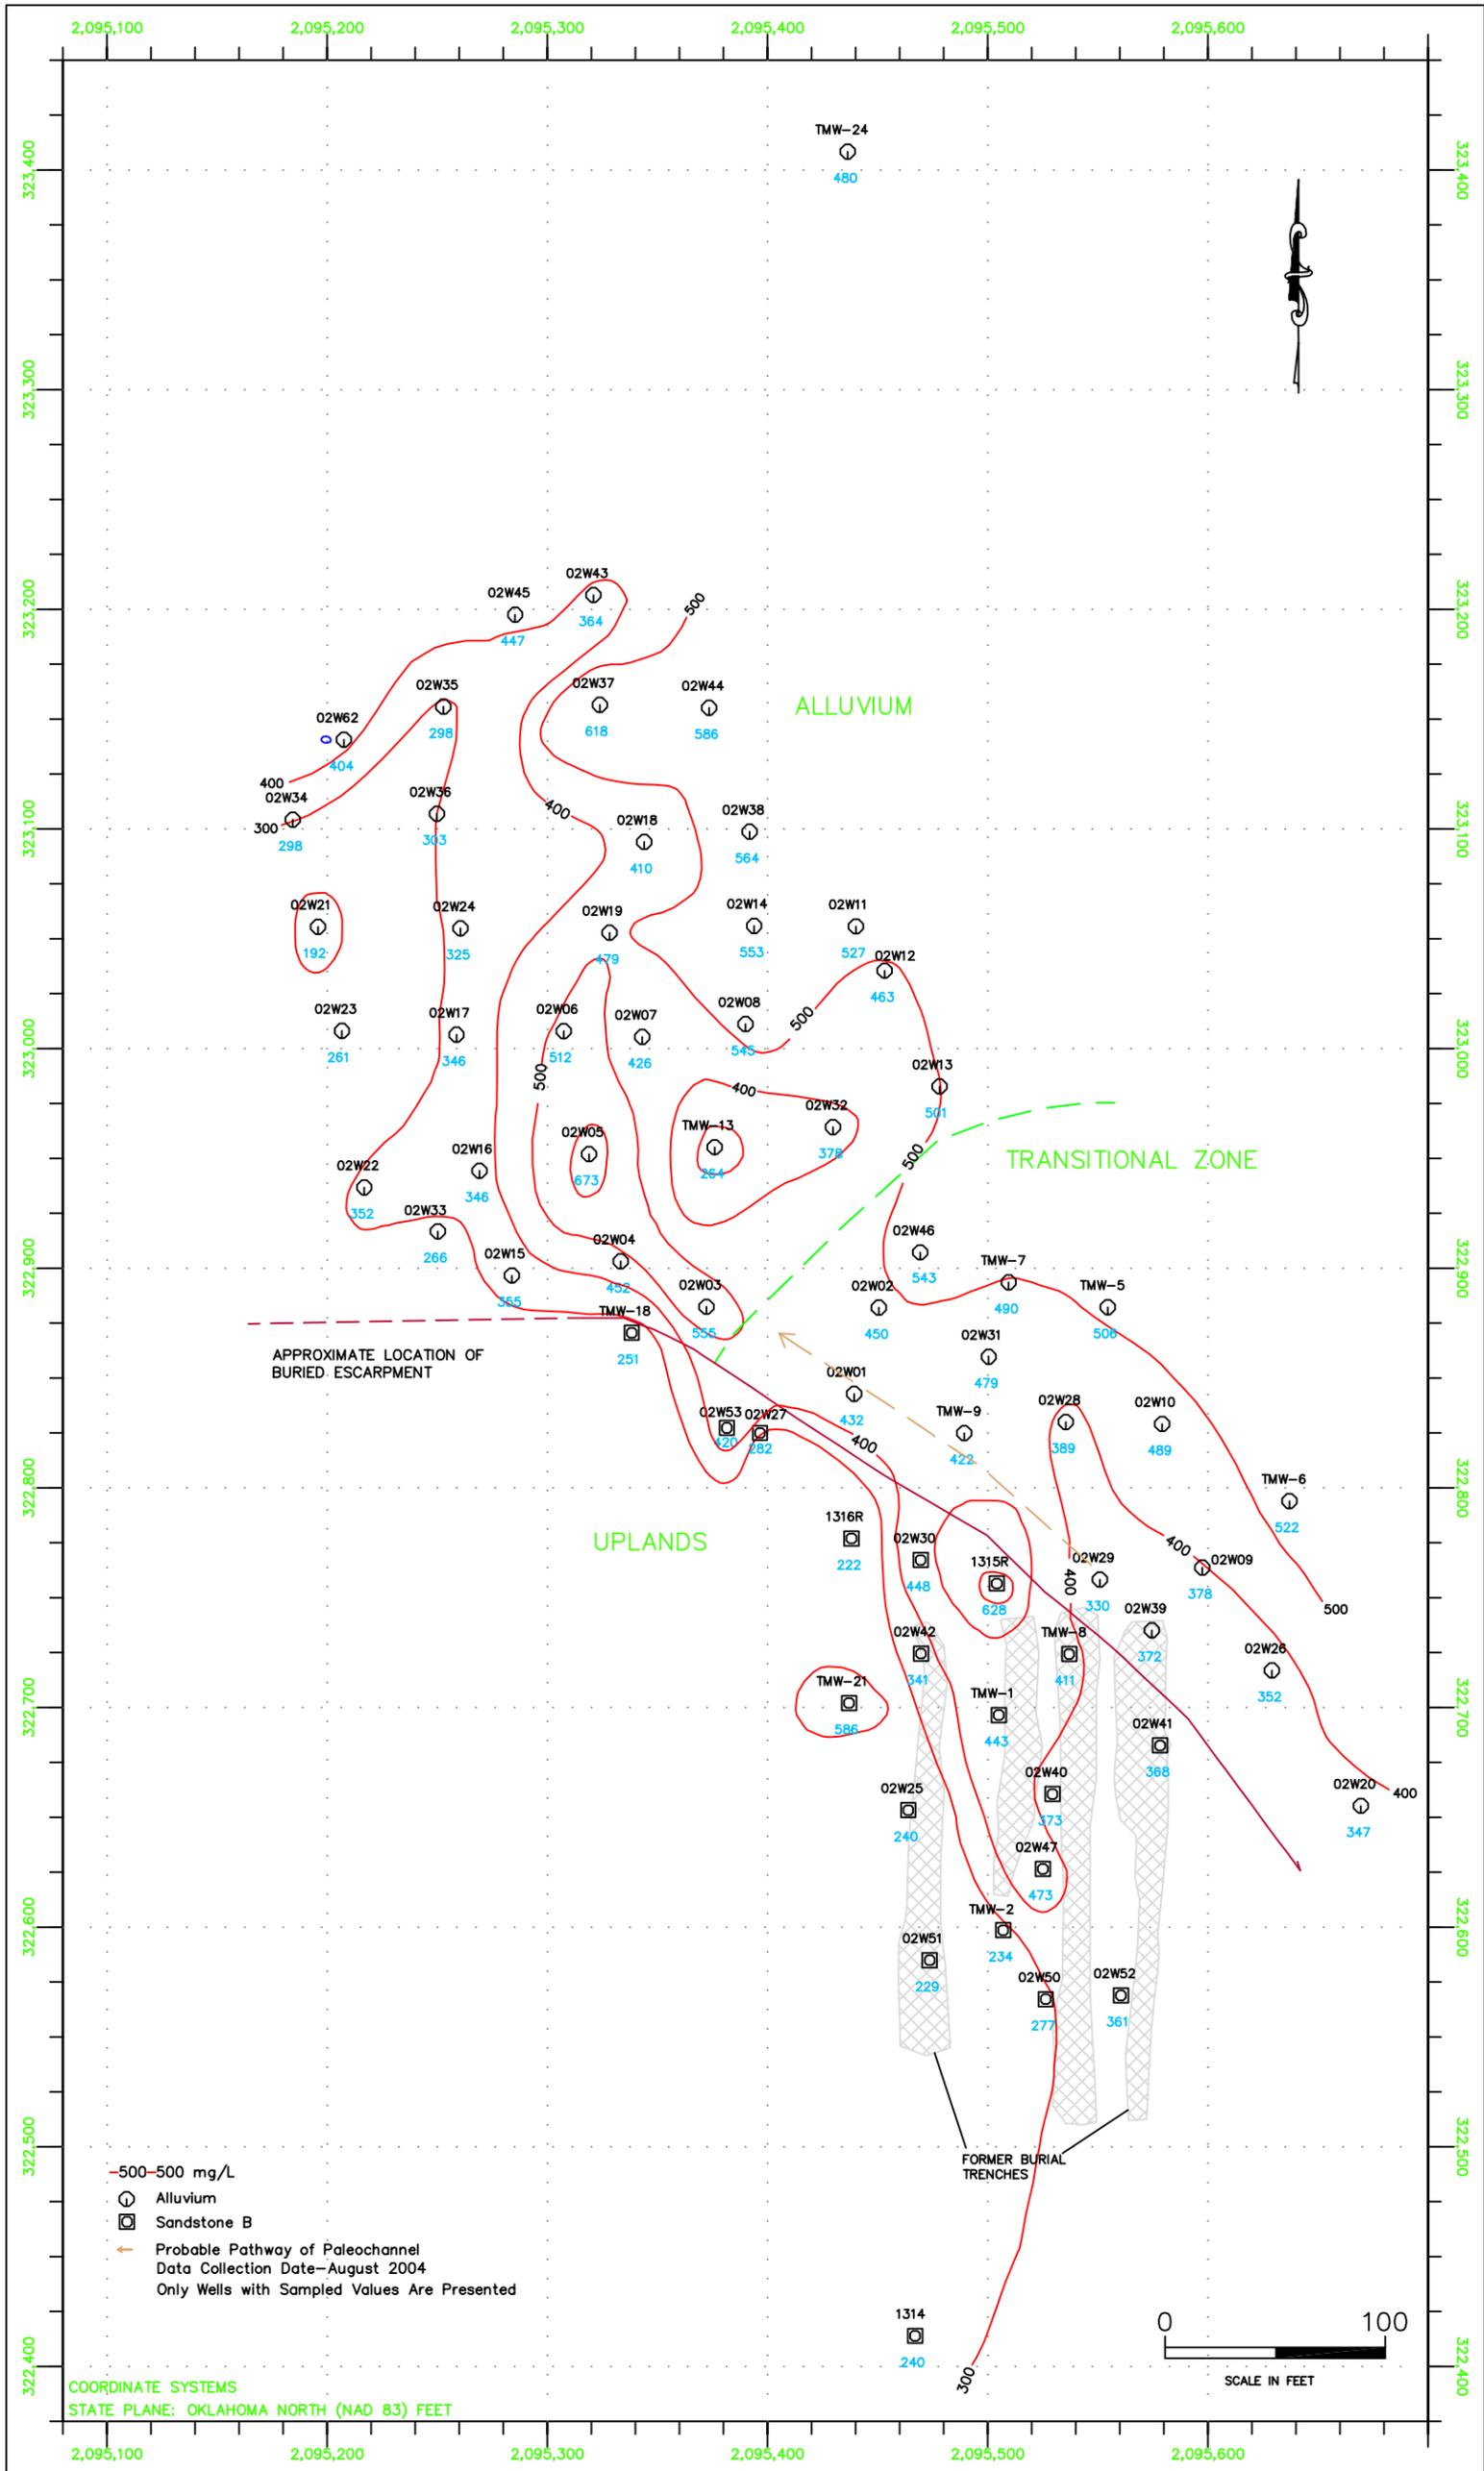


FIGURE 4-6
 DISTRIBUTION OF BICARBONATE ALKALINITY
 IN BA #1 AREA GROUNDWATER
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA


SCALE: 1" = 80'	DATE: 8/10/05	PROJECT NUMBER: 04020-044-200
--------------------	------------------	----------------------------------



4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				

SHEET NUMBER: 1	FIGURE NUMBER: 4-6
--------------------	-----------------------

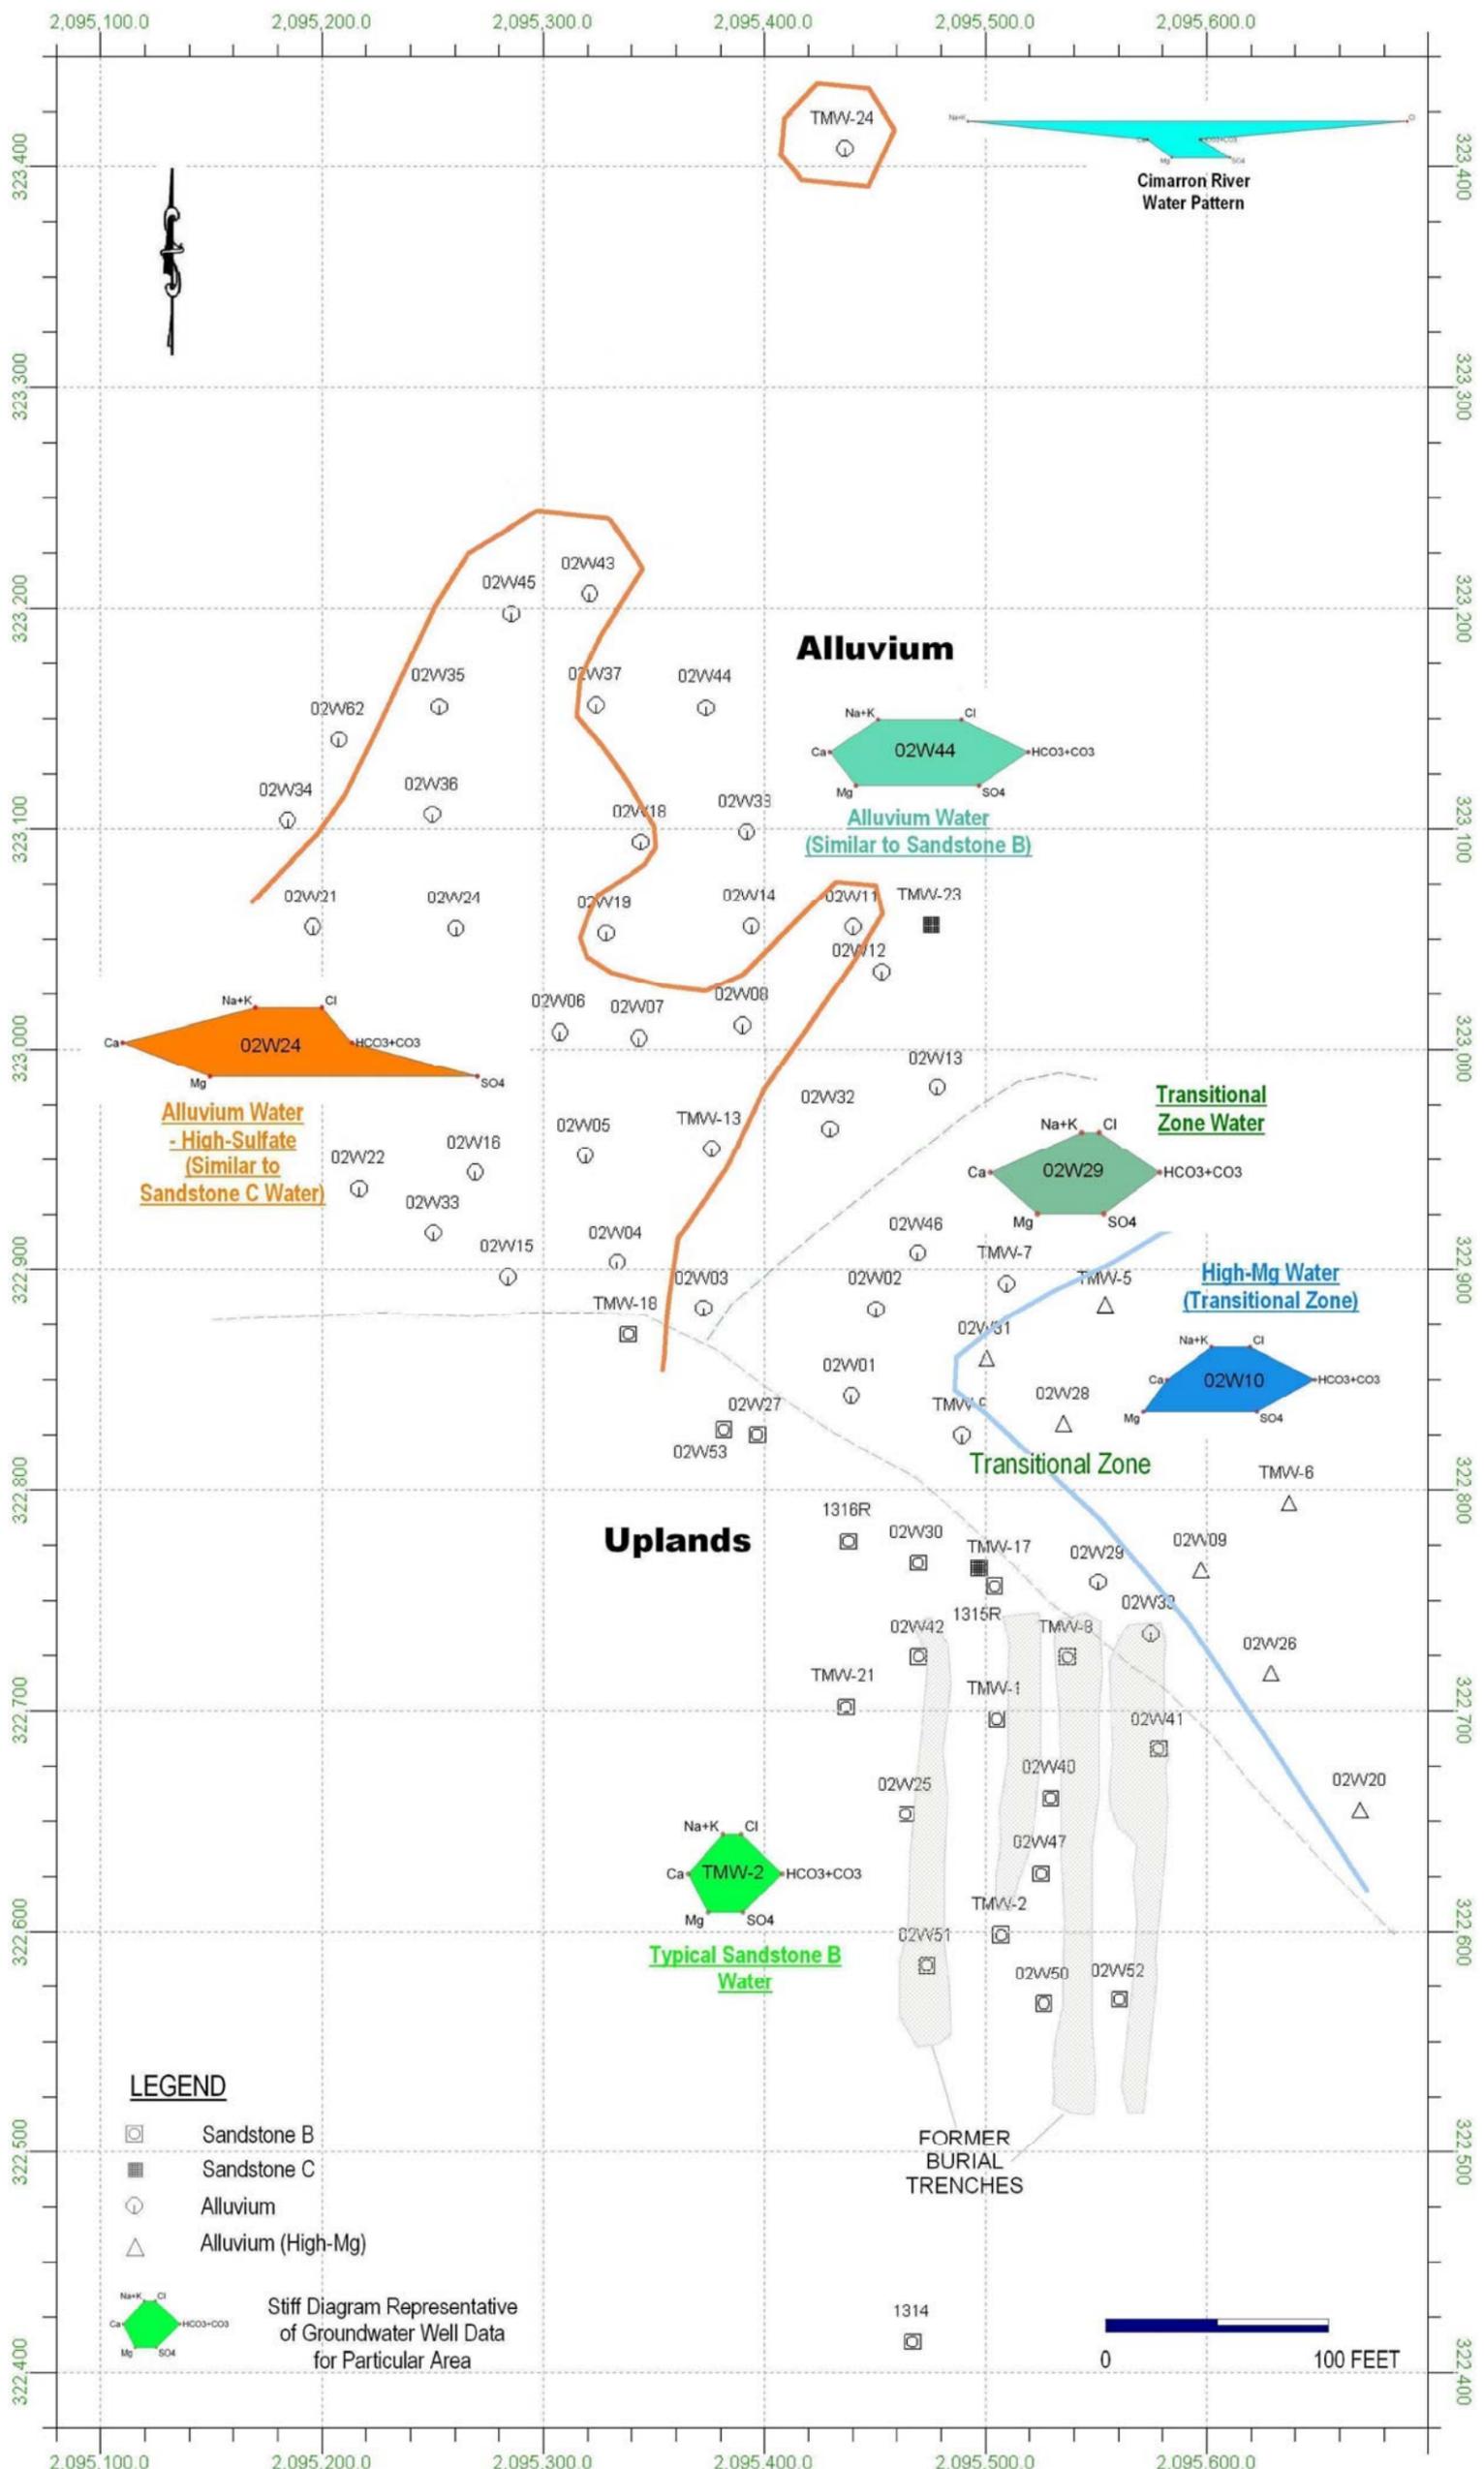

LEGEND

- ☐ Sandstone B
- Sandstone C
- Alluvium
- △ Alluvium (High-Mg)

Stiff Diagram Representative of Groundwater Well Data for Particular Area



FIGURE 4-7
 DISTRIBUTION OF WATER TYPES
 IN BA #1 AREA
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA


SCALE: 1" = 80'	DATE: 8/10/05	PROJECT NUMBER: 04020-044-200
--------------------	------------------	----------------------------------


ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY: JAS	1		6/17/05	
CHECKED BY: DJF				
APPROVED BY: DJF				

SHEET NUMBER:
1

FIGURE NUMBER:
4-7

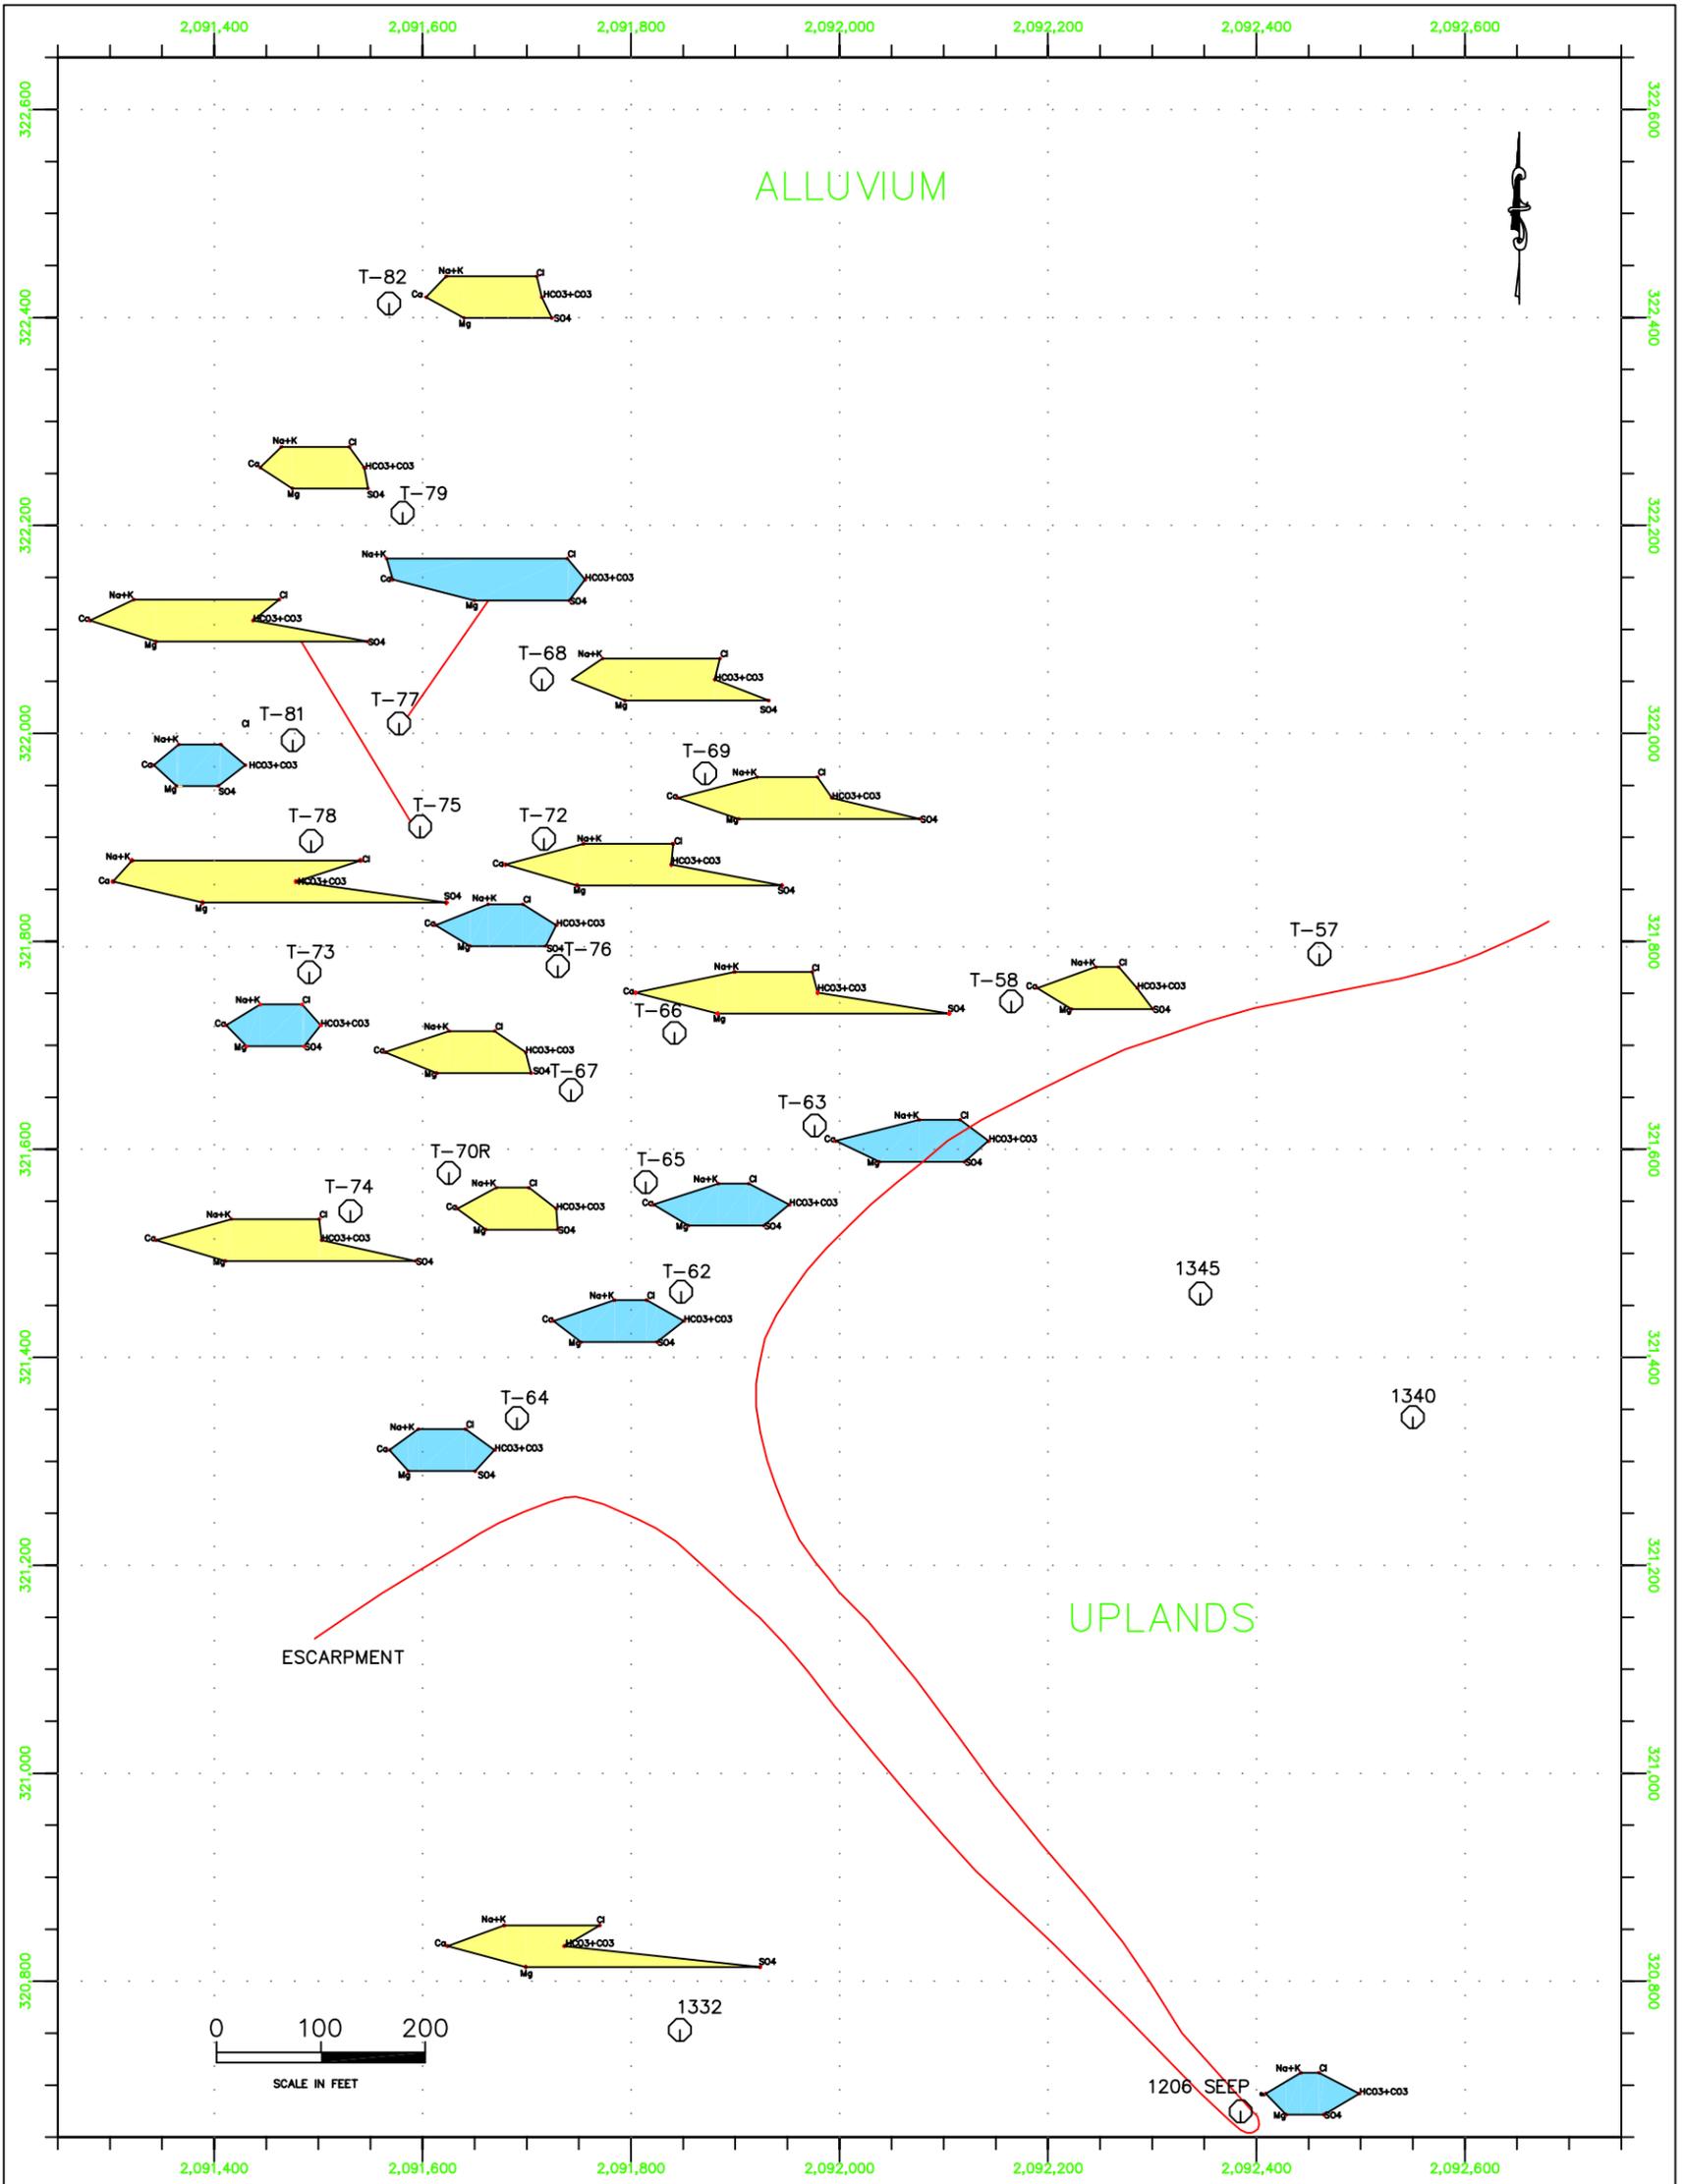

 SULFATE TYPE WATER
  BICARBONATE TYPE WATER

SHEET NUMBER:
 1

FIGURE NUMBER:
 4-9


FIGURE 4-9
WATER TYPE DISTRIBUTION
IN WEST ALLUVIAL AREA
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1" = 200'	8/10/05	04020-044-200

ENSR
INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		6/17/05	
JAS				
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

Piper Diagram

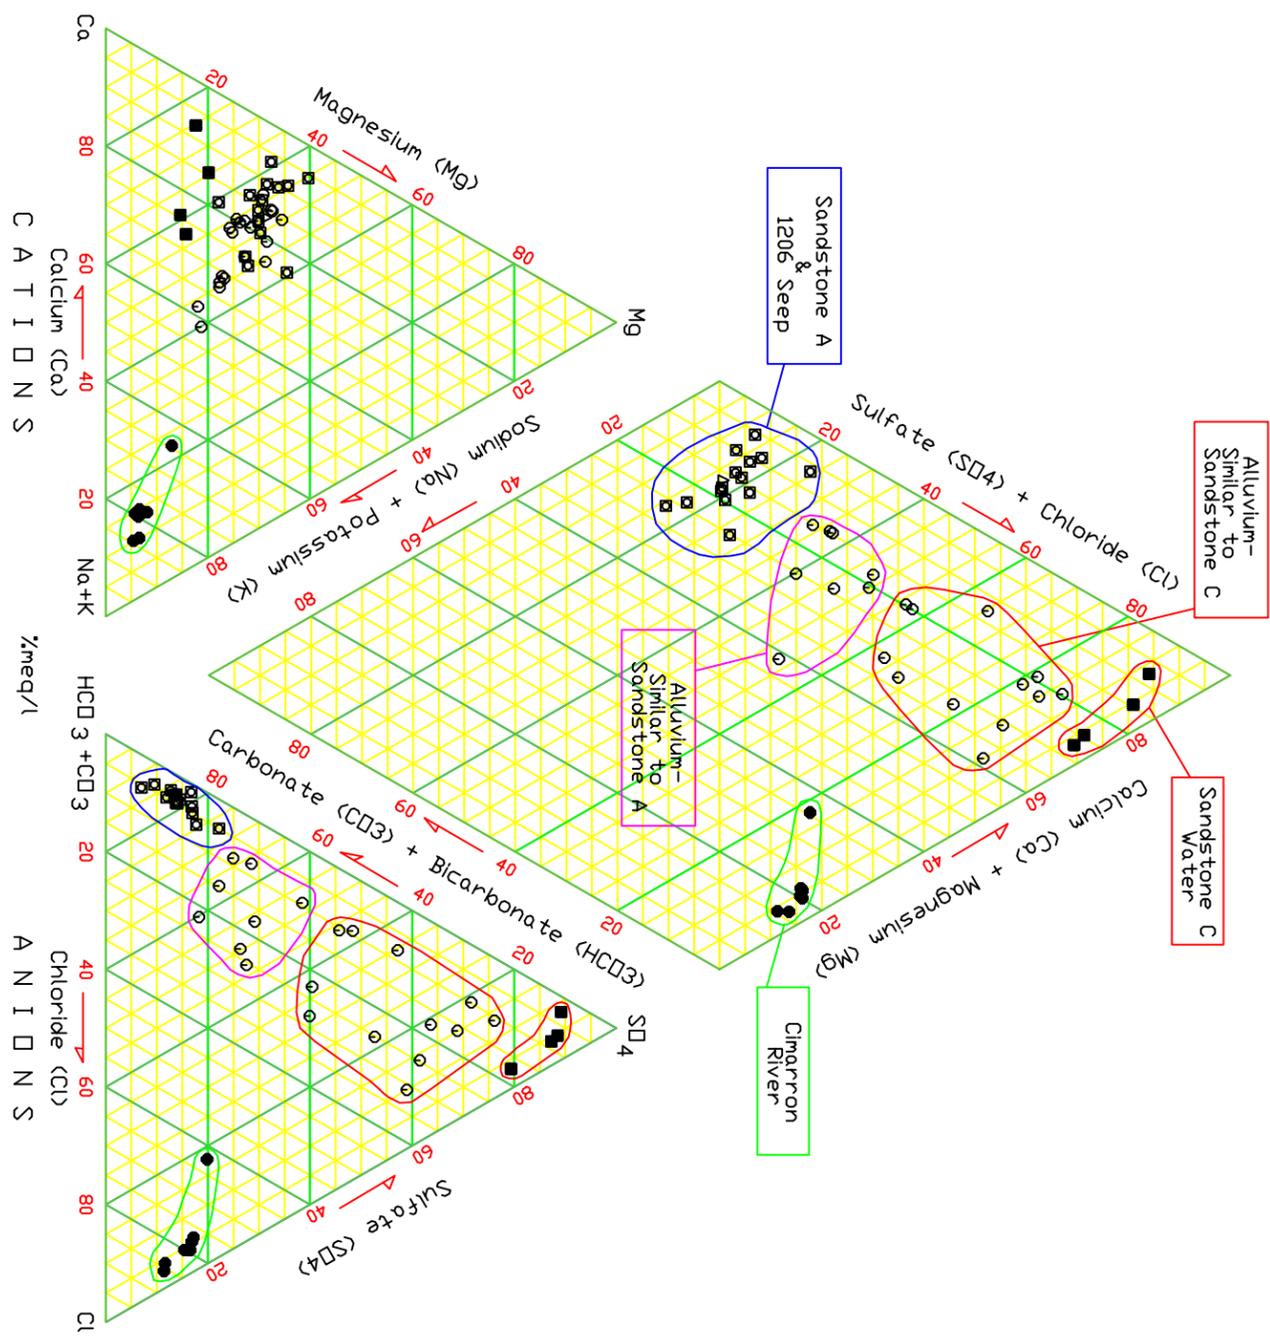

- LEGEND:**
- SANDSTONE A
 - SANDSTONE C
 - ▲ 1206 SEEP
 - ⊙ ALLUVIUM
 - ◆ CIMARRON RIVER

FIGURE 4-10
PIPER DIAGRAM FOR GROUNDWATER
SAMPLES FROM WESTERN
PORTION OF SITE
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
	8/10/05	04020-044-200

ENSR
INTERNATIONAL
4888 LOOP CENTRAL DR. SUITE 600
HOUSTON, TEXAS 77081
PHONE: (713) 520-9900
FAX: (713) 520-6802
WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.	DESCRIPTION	DATE	BY
DRAWN BY:	1		6/17/05	
JAS				
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

4-10

SHEET NUMBER:
1

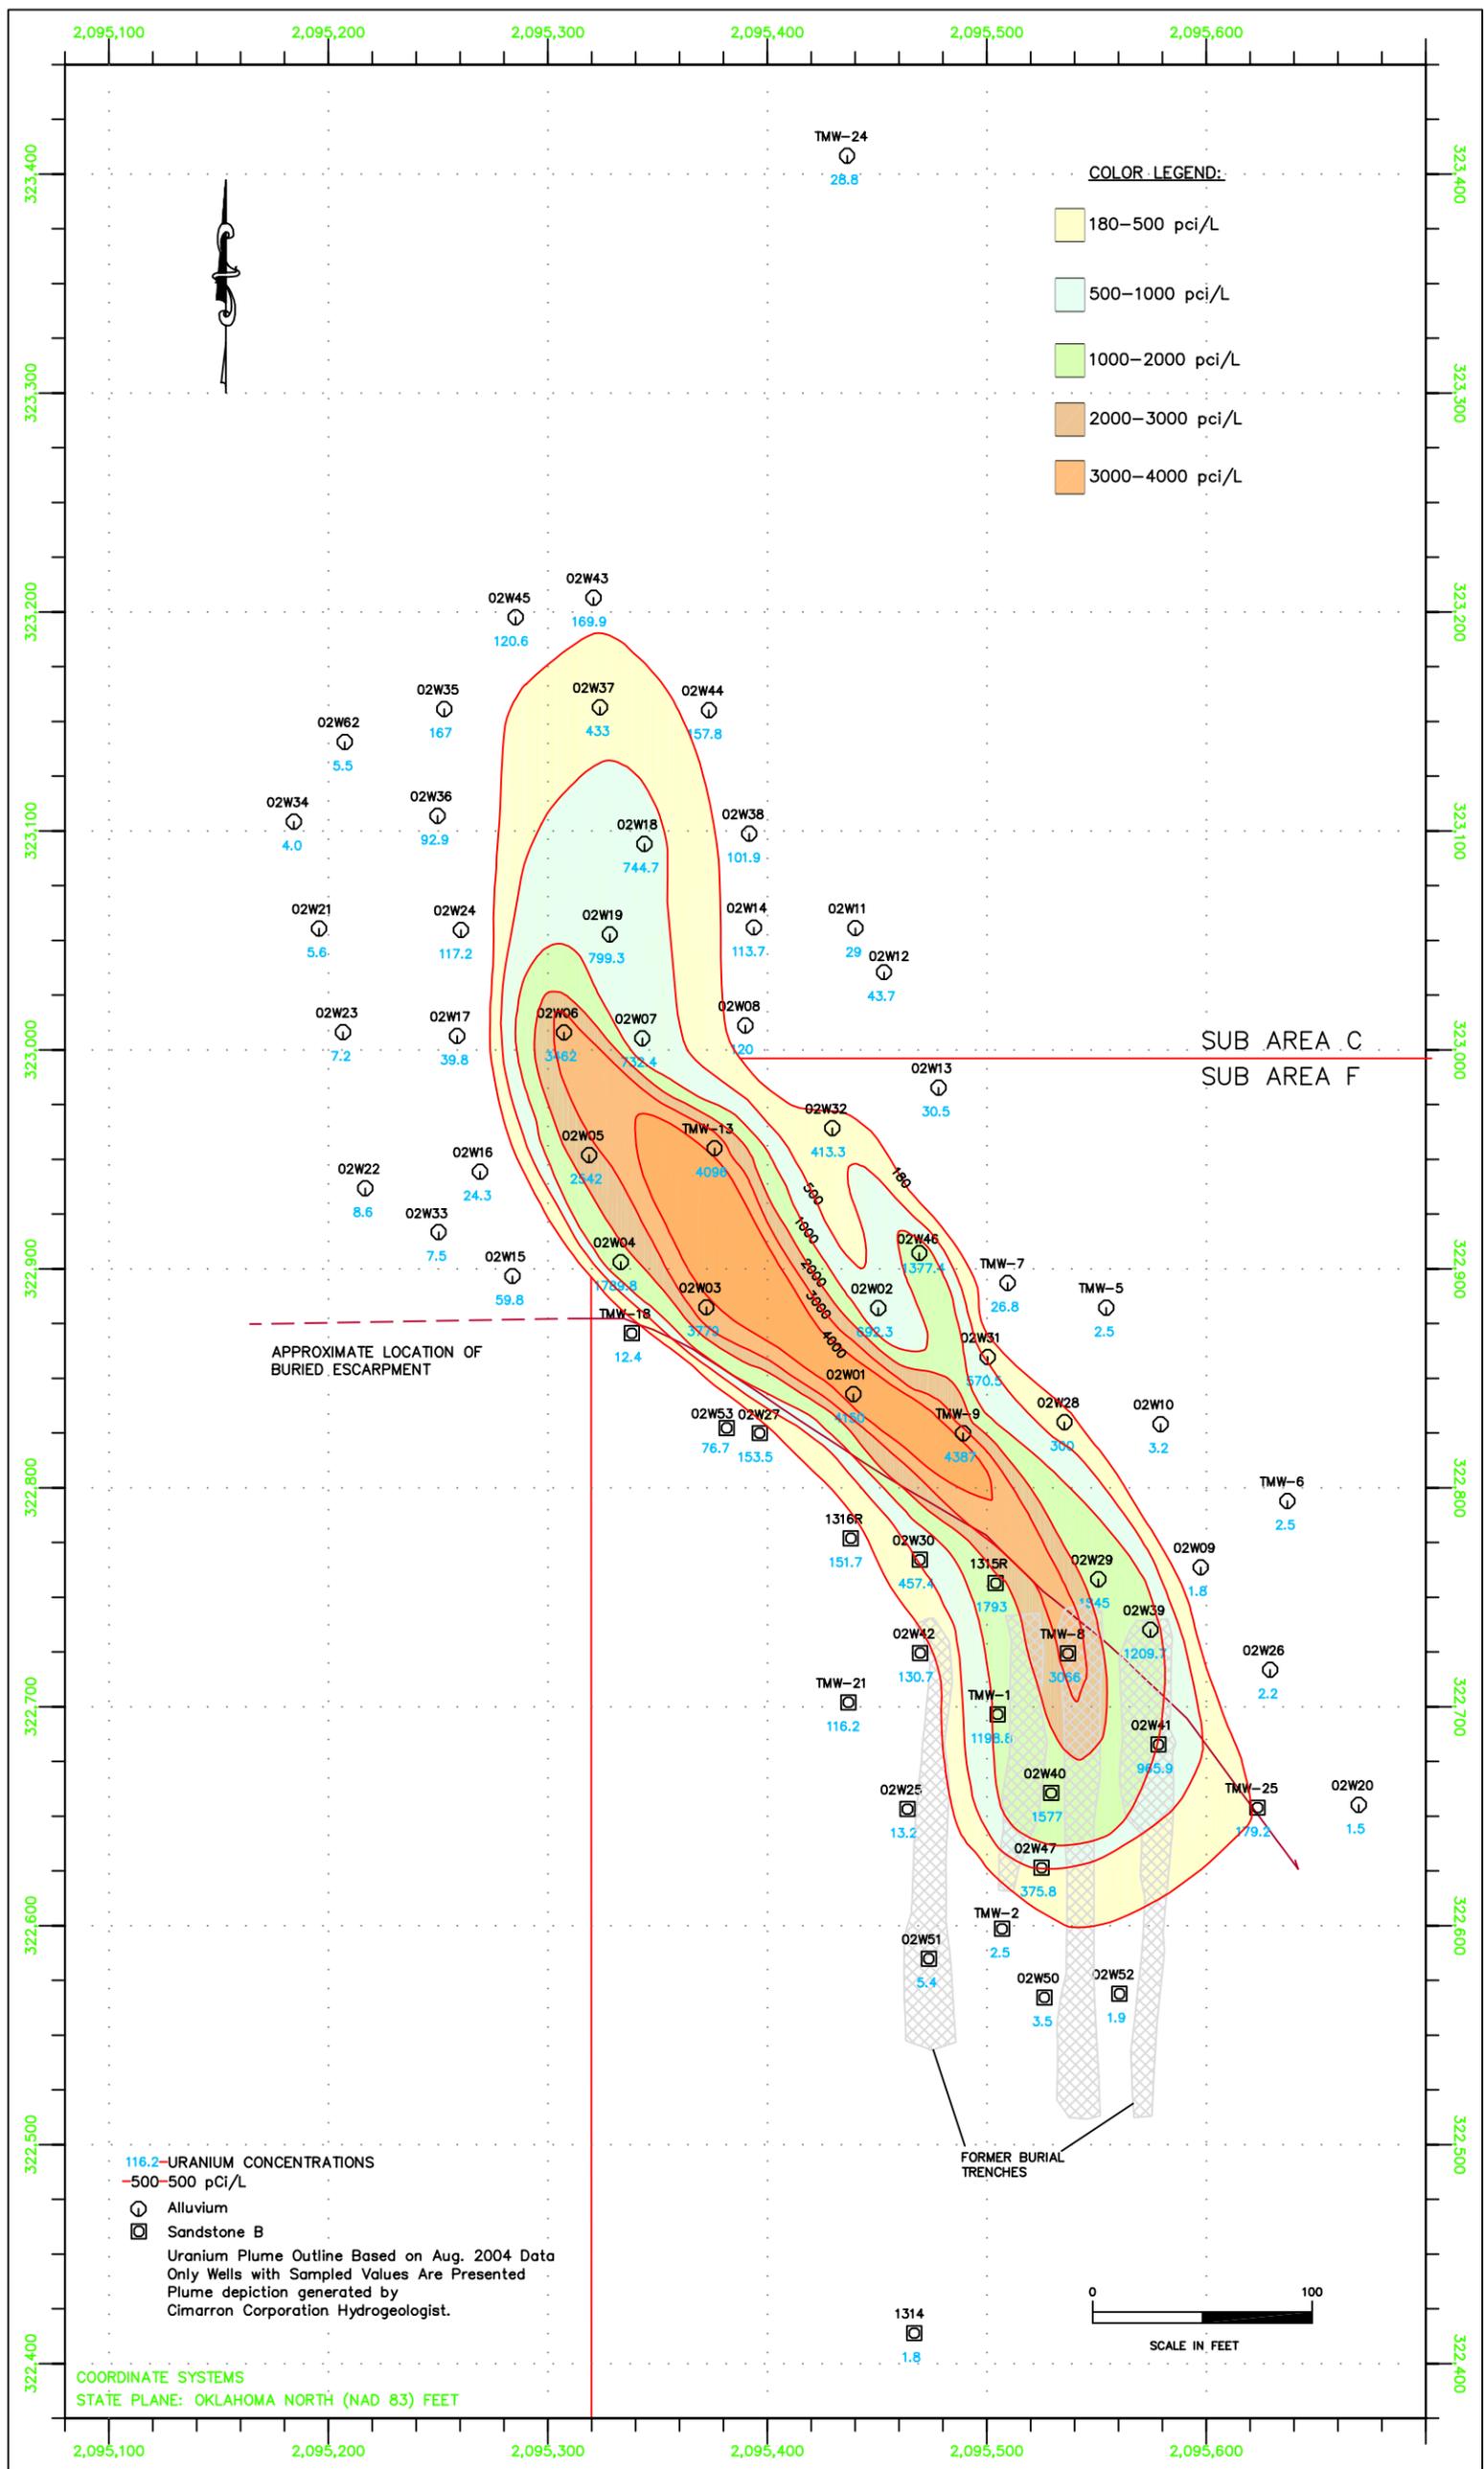


FIGURE 4-11
 URANIUM DISTRIBUTION IN BA #1 AREA
 AS OF AUGUST 2004
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

SCALE: 1" = 80' DATE: 8/10/05 PROJECT NUMBER: 04020-044-200



4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSUR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		6/17/05	
JAS				
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

SHEET NUMBER: 1
 FIGURE NUMBER: 4-11

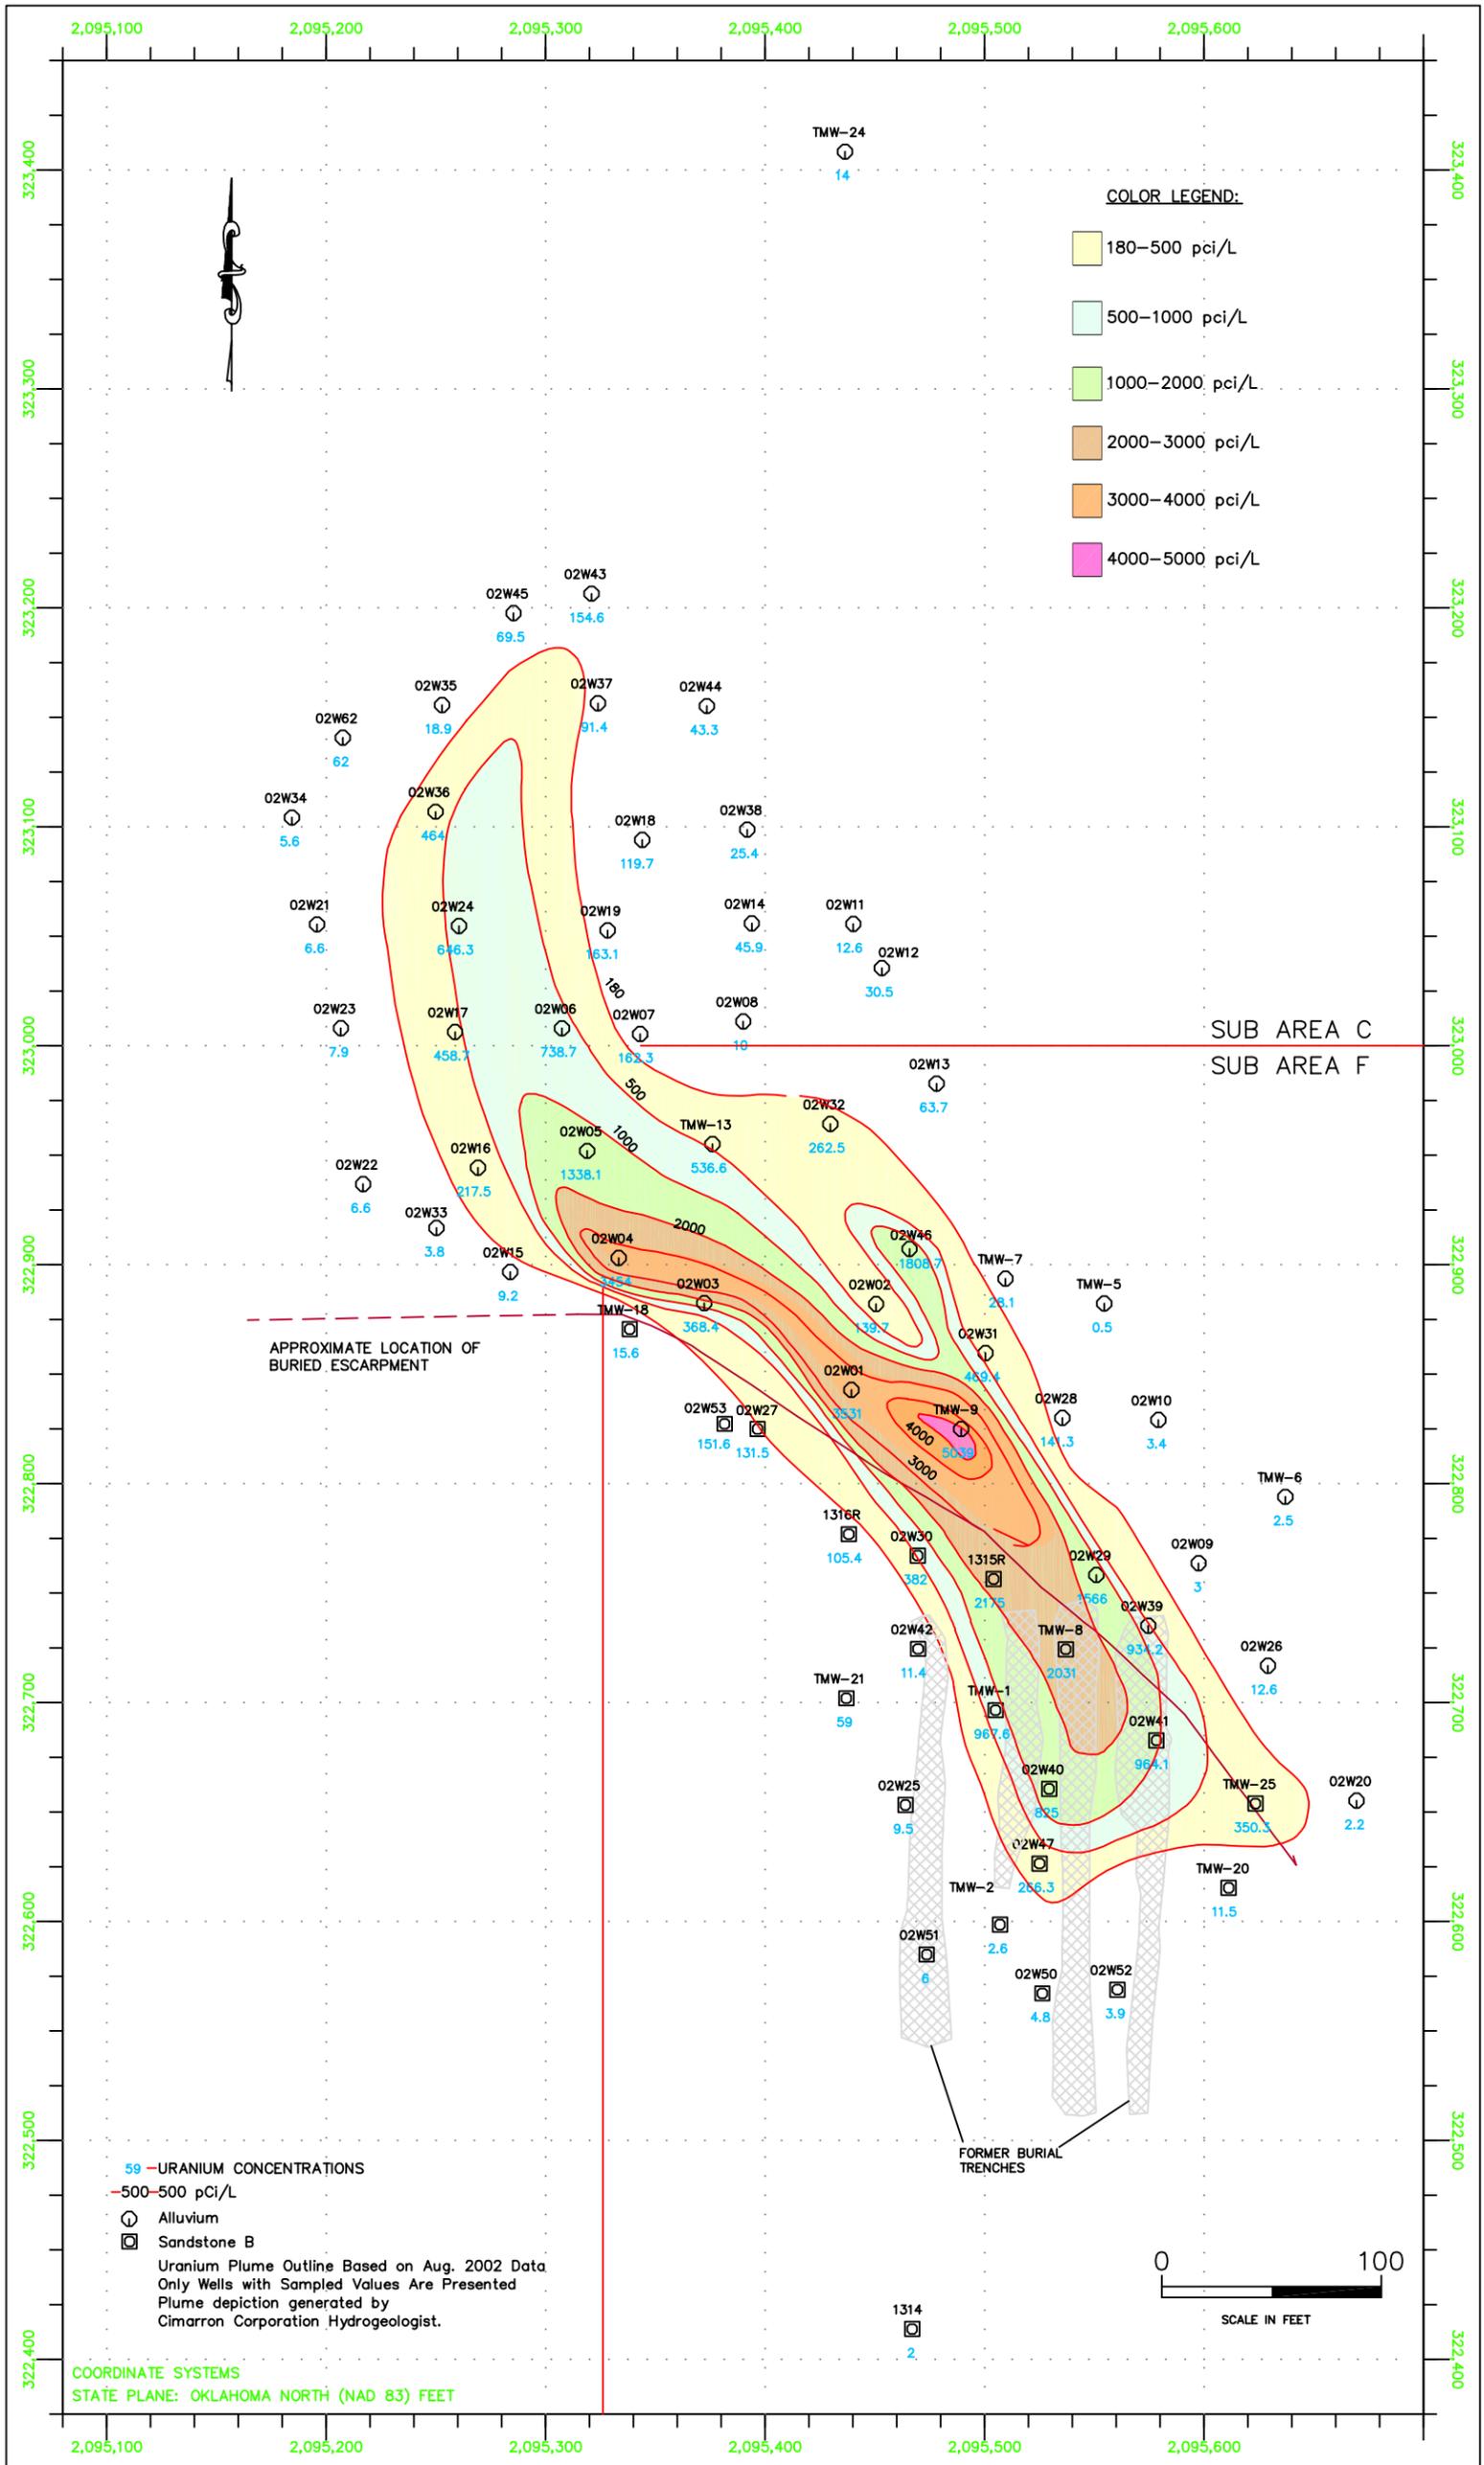


FIGURE 4-12
 URANIUM DISTRIBUTION IN BA #1 AREA
 AS OF AUGUST 2002
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA


SCALE: 1" = 80' DATE: 8/10/05 PROJECT NUMBER: 04020-044-200



4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSUR.COM

DESIGNED BY:	REVISIONS			
	NO.	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		6/17/05	
JAS				
CHECKED BY:				
DJF				
APPROVED BY:				
DJF				

SHEET NUMBER: 1	4-12	FIGURE NUMBER:

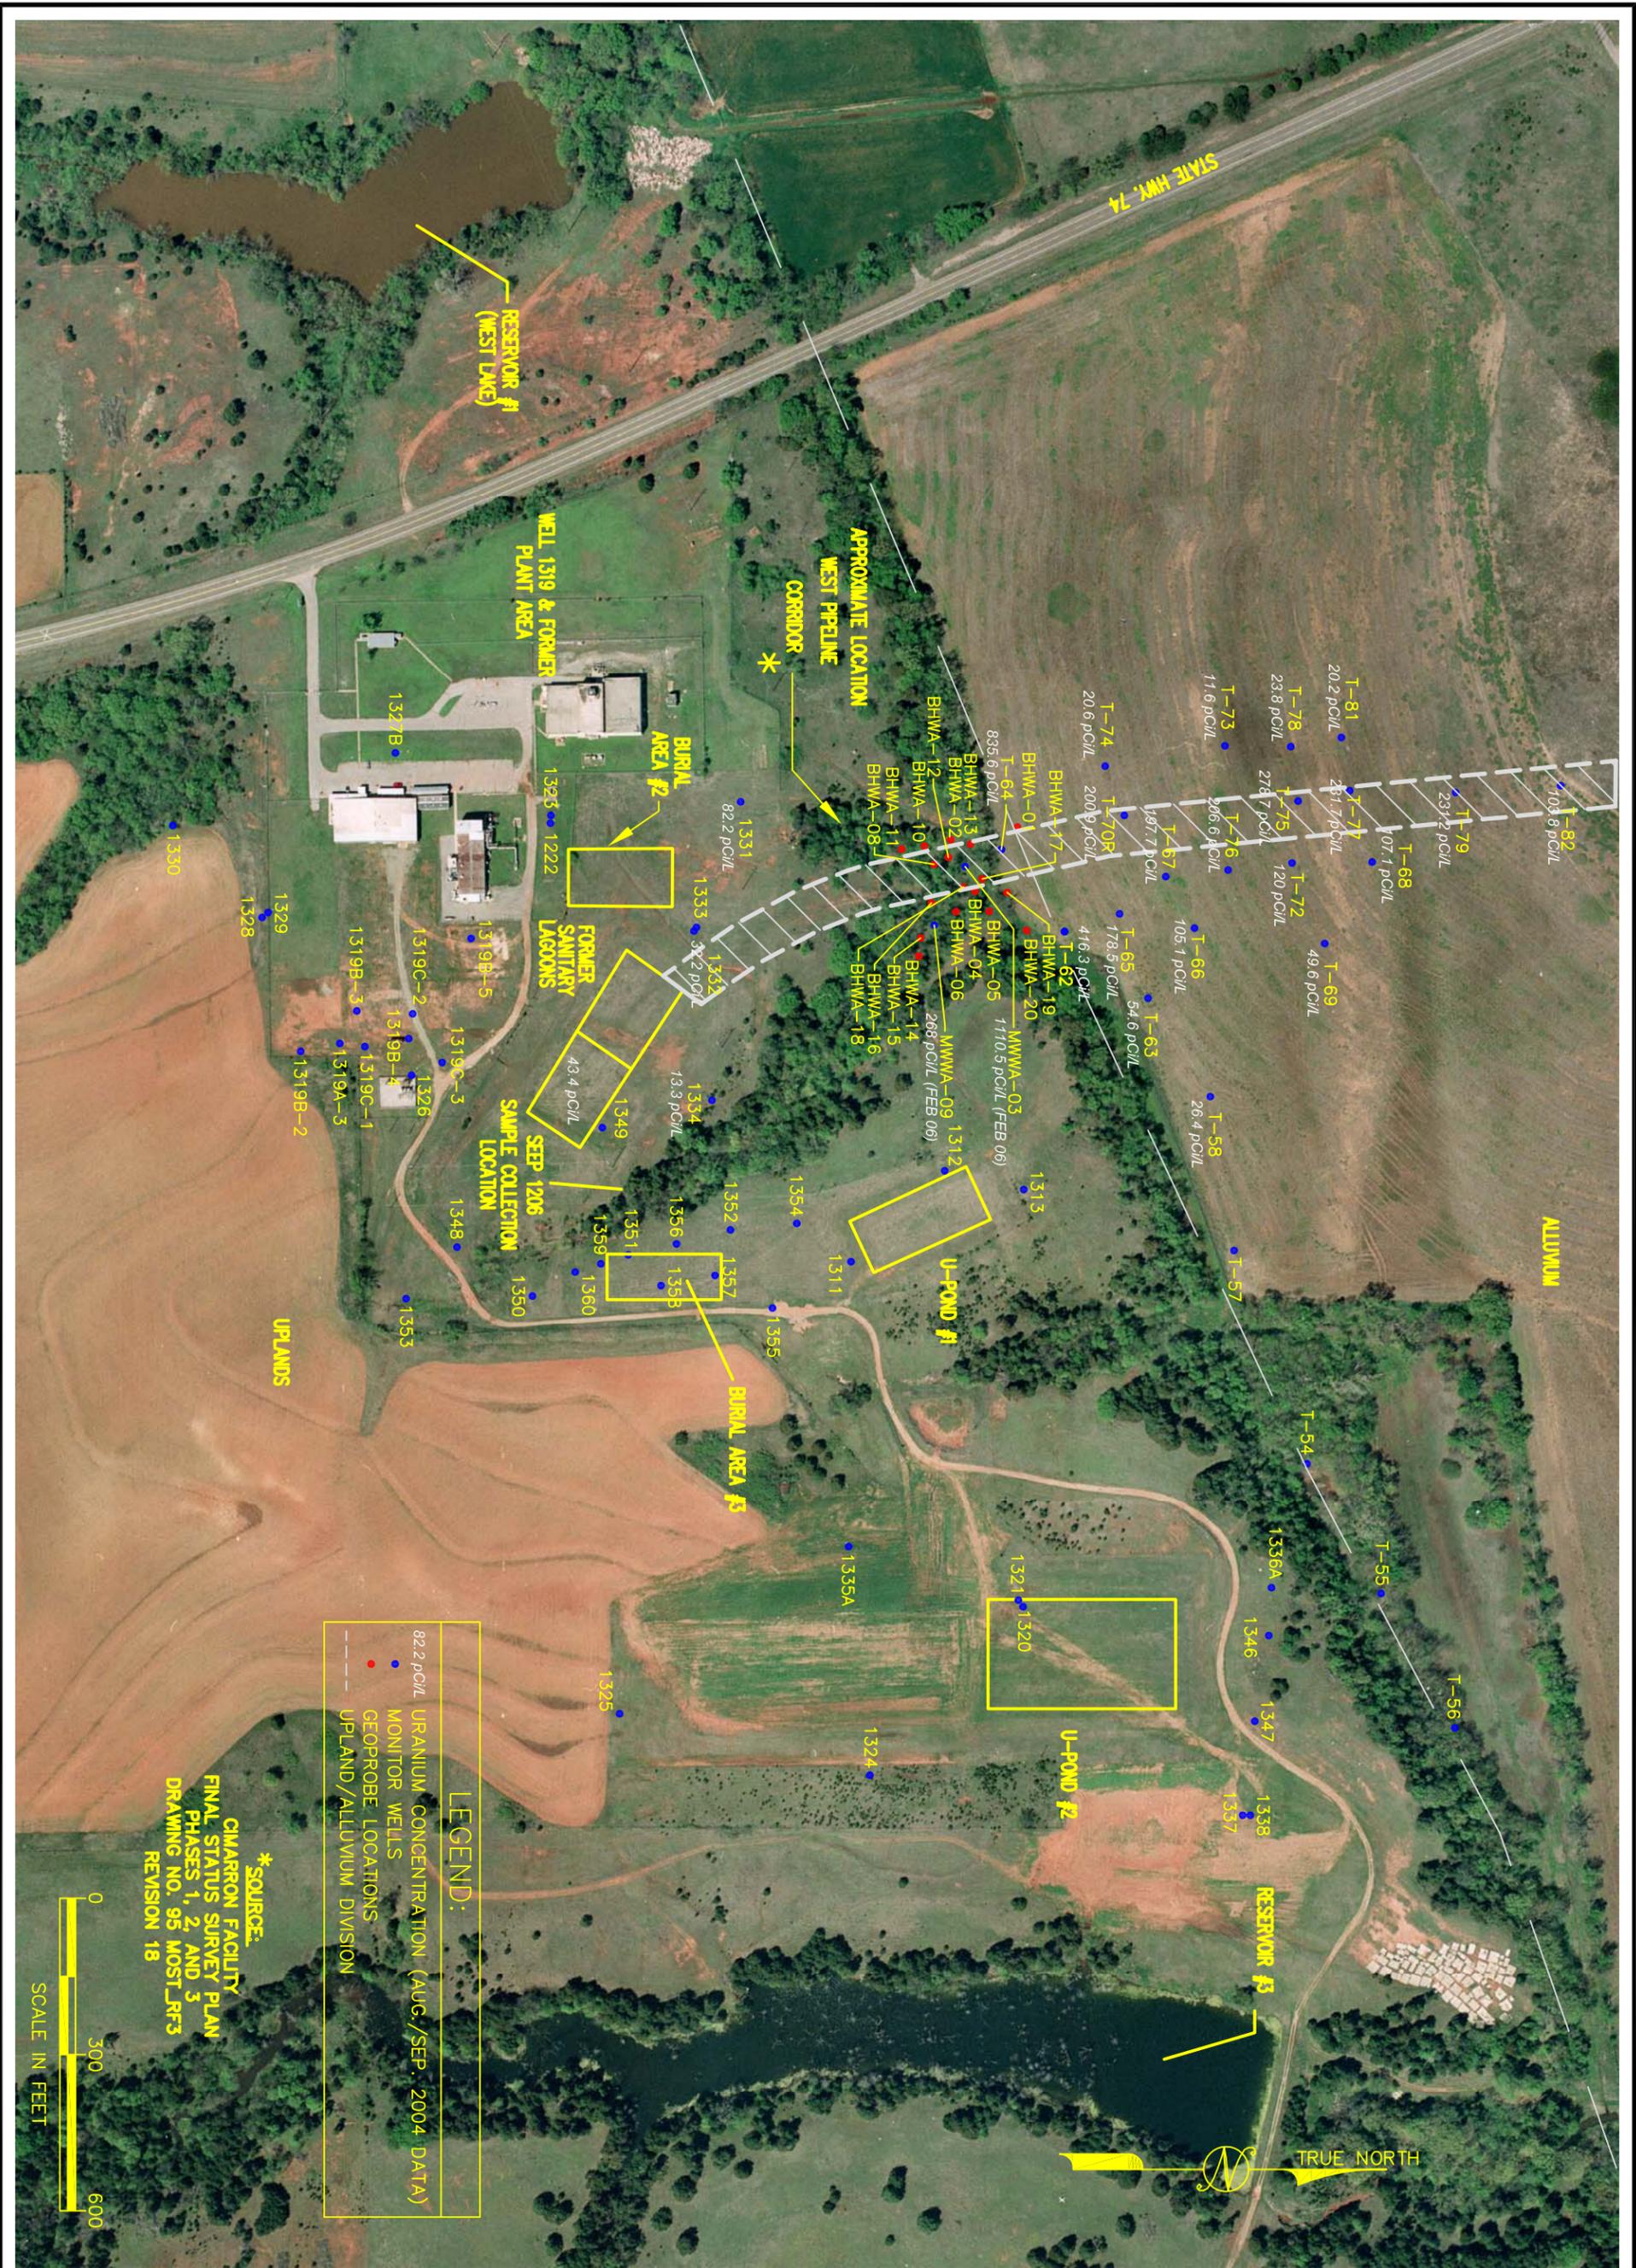

*SOURCE:
CIMARRON FACILITY
FINAL STATUS SURVEY PLAN
PHASES 1, 2 AND 3
DRAWING NO. 95 MOST_RP3
REVISION 18

LEGEND:
 82.2 pCi/L URANIUM CONCENTRATION (AVG./SEEP, 2004 DATA)
 ● MONITOR WELLS
 ● GEOPROBE LOCATIONS
 --- UPLAND/ALLUVIUM DIVISION

SCALE IN FEET
 0 300 600


FIGURE 4-13
 URANIUM DISTRIBUTION MAP
 FOR WESTERN PORTION OF SITE
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

SCALE:	DATE:	PROJECT NUMBER:
1" = 300'	9/27/06	04020-044-325

ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 770081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
	NO.:	DESCRIPTION:	DATE:	BY:
DRAWN BY:	1		4/10/05	JAS
HTP	2		6/17/05	JAS
CHECKED BY:	3		9/27/06	JAS
DJF				
APPROVED BY:				
DJF				

FIGURE NUMBER:
 4-13
 SHEET NUMBER:
 1

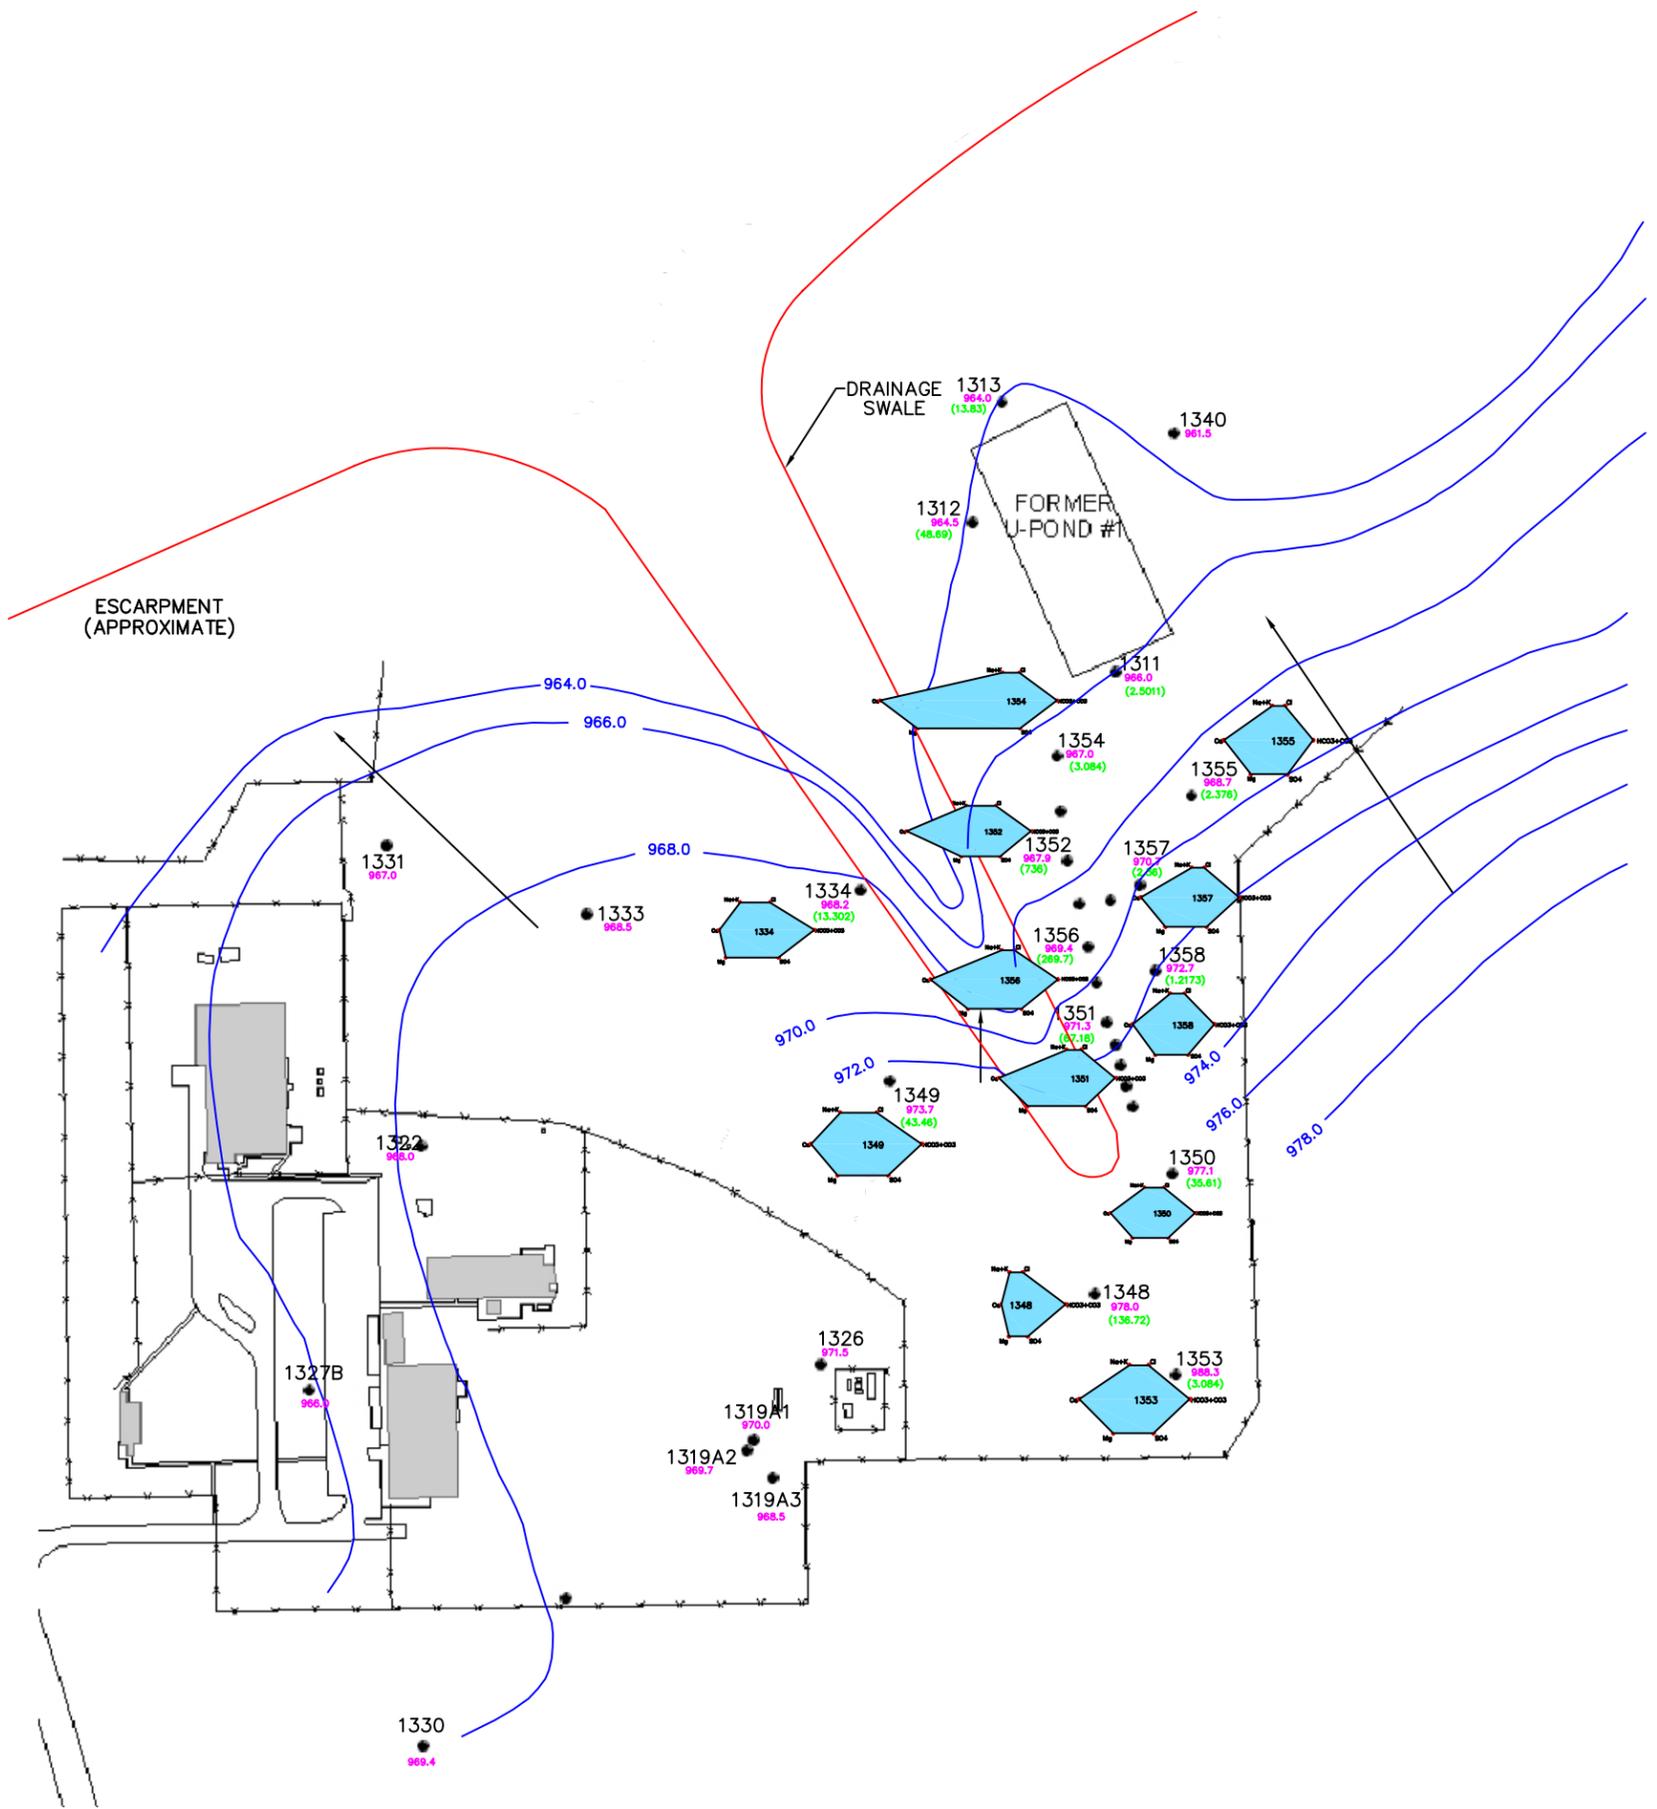


LEGEND:
 ● MONITORING WELL
 — GROUNDWATER CONTOUR
 → DIRECTION OF GROUNDWATER FLOW
 (136.72) URANIUM CONCENTRATIONS (pCi/L)
 947.5 WATER LEVEL ELEVATION (FEET-AMSL)

WATER LEVEL DATA
 AS OF AUGUST/SEPTEMBER 2004

COORDINATE SYSTEM
 STATE PLANE: OKLAHOMA NORTH (540 43) FEET

BICARBONATE TYPE WATER



NOT TO SCALE

SHEET NUMBER: 1	4-14	FIGURE NUMBER:
--------------------	------	----------------

FIGURE 4-14 WATER TYPE AND URANIUM (U) IMPACT DISTRIBUTION IN WESTERN UPLAND AREA CIMARRON CORPORATION CRESCENT, OKLAHOMA		
SCALE: N.T.S.	DATE: 8/10/05	PROJECT NUMBER: 04020-044-325

ENSR
 INTERNATIONAL
 4888 LOOP CENTRAL DR. SUITE 600
 HOUSTON, TEXAS 77081
 PHONE: (713) 520-9900
 FAX: (713) 520-6802
 WEB: HTTP://WWW.ENSR.COM

DESIGNED BY:	REVISIONS			
NO.:	DESCRIPTION:	DATE:	BY:	
DRAWN BY: JAS	1.		10/19/06 JAS	
CHECKED BY: DJF				
APPROVED BY: DJF				

5.0 Integrated Conceptual Model

This section combines the geological, hydrogeological, and geochemical models for the BA #1 Area, Western Upland Area, and Western Alluvial Area and presents an updated CSM based on site data available as of 2006. The goal is to facilitate an understanding not only of the nature and extent of uranium impact, and the environment in which it is present, but of how the uranium is being transported, and expectations regarding its impact on potential receptors.

5.1 BA #1 Area

The upland in the BA #1 Area is underlain by a sequence of sandstone and mudstone units, namely, from top to bottom: Sandstone A, Mudstone A, Sandstone B, Mudstone B, and Sandstone C (Figure 2-5). The alluvium can be divided into a clayey transitional zone and a sandy alluvial zone. The transitional zone consists predominantly of clay and silt and overlies Sandstone B or Mudstone B (Figure 2-5). A paleochannel appears to exist in the transitional zone parallel to the northeast border of the upland, which may control the flow of groundwater in the vicinity of the upland (Figure 2-7). The alluvium consists of mainly sand and overlies Sandstone C and, to a lesser extent, Mudstone B (Figure 2-5).

Groundwater from the former disposal trenches in the BA #1 Area flows into Sandstone B, across a buried escarpment that separates Sandstone B and the Cimarron River Floodplain Alluvium, and then into and through the floodplain alluvium to the Cimarron River (Figure 2-5).

Three geochemically distinct types of groundwater are present in the BA #1 Area: a calcium bicarbonate water from Sandstone B; a calcium sulfate water from Sandstone C; and a magnesium bicarbonate water in the transitional zone (Figure 4-7). Both Sandstone B groundwater and Sandstone C groundwater are present in the sandy alluvium. The influence of Sandstone C groundwater discharging into the alluvium increases closer to the Cimarron River (Figure 4-7).

Nitrate and fluoride are detected in groundwater in this area at levels that are consistent with background.

5.1.1 Nature and Extent

The only licensed material detected in the BA #1 Area at levels above the site-specific release criteria is total uranium. The spatial distribution of uranium concentrations detected in the vicinity of the BA #1 Area is illustrated in Figure 4-11. The uranium concentration varied from background concentrations to over 4,000 pCi/L based on the August/September 2004 data. The uranium-impacted groundwater, which has uranium concentrations exceeding the established site-specific groundwater release criteria of 180 pCi/L, has an elongated shape with the southern portion trending from southeast to northwest and the northern portion trending from south to north. The orientation and distribution of the impacted groundwater coincides with the location of a paleochannel discussed in Section 2.0 (Geological Conceptual Site Model), indicating that the migration of uranium near the escarpment may be controlled by the paleochannel. The numerical groundwater flow model (ENSR, 2006) replicates this groundwater flow direction based solely on the geologic conditions input to the model.

Uranium in all three types of groundwater found in the BA #1 Area is believed to be in the U^{6+} oxidation state, with the anionic forms uranyl carbonates as the predominant species. Of all the uranium aqueous species present in groundwater, the divalent uranyl dicarbonate ($UO_2(CO_3)_2^{2-}$) is by far the most abundant species at the concentration and pH ranges encountered at the site.

5.1.2 Fate and Transport

The primary mechanisms controlling transport for the U in groundwater in the BA#1 Area are advection (with the groundwater flow) and dispersion (spreading during transport). The numerical groundwater flow model (ENSR 2006), demonstrates that the directions of groundwater are to the northeast in Sandstone B, to the northwest in the transition area, and to the north in the alluvium, which is exactly the path taken by the U plume away from the burial trenches.

Flow in Sandstone B within the eastern BA #1 Area is mostly northeastward and is driven by a relatively steep hydraulic gradient (0.10 foot/foot) at the interface between Sandstone B and the floodplain alluvium. Once the groundwater enters the BA #1 Area transitional zone, the flow is refracted to a more northwest direction due to the presence of low-permeability clay northeast of the escarpment. These low-permeability sediments interrupt the northeasterly flow of Sandstone B groundwater and force it to flow along a southeastern-northwestern trending paleochannel containing relatively high-permeability sandy materials layered between the sandstone and the clayey material. The hydraulic gradient in the sand channel decreases to around 0.008 foot/foot due in part to the much higher overall hydraulic conductivity in the paleochannel compared to Sandstone B (10^{-3} cm/s versus 10^{-5} to 10^{-4} cm/s in Sandstone B) and the presence of a clay-rich barrier downgradient of the sandy paleochannel near TMW-9 and 02W01. In the sandy alluvium, the flow direction is northwards towards the Cimarron River, the groundwater discharge point. Calculated average linear groundwater velocities range from approximately 0.03 to 5 ft/day for the different geologic units.

As described in Section 3 above, the hydraulic gradients and flow directions do not change significantly over time. Therefore, rates and directions of contaminant transport are also unlikely to change significantly. It is possible that river flooding, surface water flow in the drainageways, and other short-term phenomenon could affect migration. However, these phenomena are by their nature of short duration. The migration of the U plume over the long term is controlled by the average hydraulic gradient and the nature of the geologic materials.

The principal factors controlling reactions of uranium during transport in groundwater at the BA #1 Area are pH, redox potential (Eh), ionic composition, and the physical characteristics of the subsurface materials as discussed in Section 4.4.

Uranium that was present in the waste materials buried in the former trenches in the BA #1 Area was leached out by infiltrating precipitation that percolated through the vadose zone into Sandstone B. Uranium was most likely transported in the forms of uranyl dicarbonate and tricarbonate species given the oxidative conditions of groundwater (most groundwater samples in this area have oxidation-reduction potential greater than 100 mv), the near-neutral groundwater pH, and the results of speciation modeling.

Uranyl dicarbonate is an anionic species and tends to be adsorbed onto positively charged surfaces. The potential surface for uranium adsorption at the site is likely to be iron hydroxides or oxides. Reddish colored clay, silt, and sand are widespread in the alluvium at the Cimarron Site, indicating the presence of iron hydroxides or oxides. At pH values encountered at the site (around 7), the surfaces of these minerals are positively charged, thus providing a favorable media for the adsorption of uranium. Adsorption onto subsurface materials results in a retardation of uranium migration, which appears to have occurred in the transitional zone.

Adsorption of uranium onto subsurface materials has previously been studied at the BA #1 Area. Hazen (2002), contracted by Cimarron Corporation, conducted experimental studies to assess the distribution of uranium between groundwater and site soils using a batch test. That study yielded a uranium soil-water

distribution coefficient (Kd) value of 3 milliliters per gram (mL/g). In another study also conducted by Hazen on behalf of Cimarron Corporation and supervised by ENSR in 2006, dynamic column elution tests were performed using three types of aquifer materials and two types of groundwater from the site. The three types of materials represent three size fractions of alluvial soils including sand, silt, and clay. The two waters were representatives of sandstone B and C waters. This study yielded Kd values of 0.5, 2.0, and 3.4 for sand, silt, and clay, respectively, indicating a clear size dependence. These results confirm that adsorption of uranium onto subsurface materials is occurring at the site and may influence the distribution of uranium in the subsurface.

Competition for adsorption sites from other anions may affect the adsorption of uranium onto soil particles. As discussed in Section 4.4, adsorption in low TDS and sulfate water is relatively high, and tends to decrease in high TDS and sulfate water due to increased competition for adsorption sites. The dynamic column elution tests discussed above also confirm that high TDS and sulfate water resulted in reduction of uranium Kd values. Therefore, in the transitional zone where the TDS and sulfate contents are low, conditions are more favorable for uranium adsorption. Uranium adsorption in the sandy alluvium is expected to be low or even negligible due to the presence of high TDS and sulfate water from Sandstone C. As a result, uranium in the sandy alluvium is thought to be more mobile than in the transitional zone. However, the actual rates of migration are also dependent on the relative velocities in the different geologic materials.

5.1.3 Impact to Receptors

The impacted media in the BA #1 Area is the shallow groundwater. As a result, it poses little threat to human or environmental receptors. Access restriction to the site precludes any exposure to the general public. The primary receptor is the Cimarron River. A risk assessment (Roberts Schornick & Associates, 1998) showed there were no unacceptable risks associated with the U, nitrate, or fluoride in groundwater at the site under current and likely future use.

An estimate of the time for the uranium to reach the river, plus an estimate of the maximum concentration of uranium in groundwater that will reach the river, was submitted by Cimarron Corporation as an attachment to a March 31, 2004, letter to David Cates of the Oklahoma DEQ. The conclusions of the analytical modeling performed at that time indicated the leading edge of the uranium-impacted groundwater is not expected to reach the Cimarron River for over 1,000 years of migration, and even then the concentration of uranium in groundwater will be less than 2 pCi/L when it reaches the river.

5.2 Western Upland Area

The Western Upland Area, which includes the former Uranium Pond #1, the 1206 Seep Area, and the former Sanitary Lagoons, is underlain primarily by Sandstone A, as shown in Figure 2-9. Sandstone B is exposed near the base of the drainage between the former Sanitary Lagoons and the former Uranium Pond #1 at the mouth of the drainage where it opens into the alluvial floodplain of the Cimarron River. In the vicinity of the BA #3 Area and the former Sanitary Lagoons, the upper part of Sandstone A is composed mostly of siltstone and shale, rather than sandstone (Figure 2-4).

Groundwater in the Western Upland Area is found in Sandstones A, B, and C. Groundwater flow in Sandstone A follows topography over most of the Cimarron Site. In the Western Upland Area, the drainage between the BA #3 Area and the former Sanitary Lagoons acts as a local drain for groundwater in Sandstone A (Figure 2-10). Groundwater flows toward this drainage from the vicinity of the BA #3 Area, as this drainage is incised into Sandstone A and Mudstone A. The thick vegetation and groundwater seeps, such as those at the Western Upland Area, attest to groundwater discharge to this

drainage (thus becoming surface water) from Sandstone A. Although vertical downward gradients are likely in Mudstone A, the relatively higher permeability of the sandstone units results in preferred horizontal flow in the water bearing units compared to vertical flow across units. The hydrogeology of the Western Upland Area is discussed in Section 3.0 (Hydrogeological Conceptual Site Model) of this report.

5.2.1 Nature and Extent

Elevated uranium concentrations in groundwater appear to be spatially related to the BA #3 Area. This disposal trench was excavated, surveyed by the NRC, and backfilled with clean soil prior to 1994. Thus, any remaining sources of uranium in Sandstone A may be secondary sources generated by precipitation of uranium in Sandstone A during the operational phase of the BA #3 Area, or sources related to material left in the trench at the BA #3 Area. Other constituents detected in the groundwater are reasonably typical for the Cimarron Site.

5.2.2 Fate and Transport

Uranium has been detected in the Western Upland Area in only a limited number of monitor wells screened in Sandstone A near the BA #3 Area. This suggests diffusion and slow migration of uranium away from local “hot spots” related to the BA #3 Area.

The uranium transport mechanism in the Western Upland Area is uncertain. Based on observations in other areas, the primary mechanisms are expected to be advective transport and hydrodynamic dispersion. Because there is no well-defined groundwater plume in the Western Upland Area, formally evaluating the “fate and transport” of uranium in this area is not necessarily useful.

5.2.3 Impact to Receptors

There is no present impact to environmental, biological, or human receptors in the Western Upland Area due to the localized nature of the elevated uranium concentrations detected in groundwater. A risk assessment has demonstrated that there is no unacceptable risk associated with exposure to the uranium, nitrate or fluoride in the seeps (Roberts Schornick & Associates, 1998).

5.3 Western Alluvial Area

Alluvial sediments of the Cimarron River floodplain in the Western Alluvial Area consist predominantly of sand with minor amounts of clay and silt (Figure 2-9). The alluvial floodplain consists of groundwater in the alluvial floodplain sands that flow toward the Cimarron River under a very low hydraulic gradient. The hydraulic gradient is influenced by the stage of the Cimarron River and can on rare occasion temporarily reverse during periods of flooding by the river. Recharge to the alluvial floodplain comes from Sandstone A through seepage along the escarpment face, from Sandstones B and, and from precipitation.

There are two distinct types of groundwater in the alluvium: a calcium bicarbonate water; and a calcium sulfate water. Additional information on the various types of water encountered at the Western Alluvial Area is presented in Section 4.3.3 (Area-specific Geochemical Considerations – Western Alluvial Area) of this report.

5.3.1 Nature and Extent

Impact in the Western Alluvial Area consists mainly of uranium in groundwater. Data from the August/September 2004 annual sampling event for the Western Alluvial Area is presented in Table 4-1. The spatial distribution of uranium in groundwater in the Western Alluvial Area is shown in Figure 4-13.

The uranium concentration varied from background concentrations to over 800 pCi/L based on the August/September 2004 data. The uranium-impacted groundwater, which has uranium concentrations exceeding the established site-specific groundwater release criteria of 180 pCi/L, has an elongated shape extending for the escarpment northwards approximately 900 ft towards the Cimarron River.

The impacts apparently originate near the mouth of the upland drainage that separates the former Sanitary Lagoons and the BA #3 Area. The uranium impacts parallel the trace of the former West Pipeline Corridor that was used to discharge wastewater to the Cimarron River from 1966 to 1970. The pipeline was removed in 1985, at which time the soil areas exceeding 30 pCi/g were excavated and backfilled with clean soil.

Nitrate and fluoride are also elevated relative to background in the Western Alluvium Area.

5.3.2 Fate and Transport

The primary transport mechanisms within the Western Alluvial Area are probably advection and hydrodynamic dispersion. However, the current distribution of uranium in this area is not entirely due to transport, but also to leaks from the former pipeline. The sources for the uranium in this area include leaks from the pipeline, and also transport of uranium into the alluvium from the mouth of the drainage way. Recent installation of two wells in this area shows the presence of uranium in groundwater, and uranium is present upgradient in water at Seep 1206.

The groundwater flow and chemical transport directions in the alluvial materials are to the north towards the Cimarron River. Calculated average linear groundwater velocities range from approximately 0.9 to 1.5 ft/day.

As described in Section 3 above, the hydraulic gradients and flow directions do not change significantly over time. Therefore, rates and directions of contaminant transport are also unlikely to change significantly. It is possible that river flooding, surface water flow in the drainageways, and other short-term phenomenon could affect migration. However, these phenomena are by their nature of short duration. The migration of the U plume over the long term is controlled by the average hydraulic gradient and the nature of the geologic materials.

The relatively low clay content of the alluvial materials and the uniform geochemistry of non-licensed materials suggest that mass removal processes, such as adsorption, are not significantly affecting transport of the uranium.

5.3.3 Impact to receptors

In the Western Alluvial Area, the uranium impact is farther from the Cimarron River, and uranium concentrations are lower than at the BA #1 Area. As in the BA#1 Area, the primary receptor is the Cimarron River. A risk assessment (Roberts Schornick & Associates, 1998) showed there were no unacceptable risks associated with the U, nitrate, or fluoride in groundwater at the site under current and likely future use.

6.0 Conclusions and Recommendations

6.1 Purpose and Objective

Cimarron Corporation has investigated the geology, hydrogeology, and geochemistry related to licensed material in groundwater at the Cimarron Site. The purpose of this CSM is to provide an overview of the geology and hydrogeology of the Cimarron Site, and to compile and integrate historical and recent site information into a focused comprehensive model of the BA #1 Area, the Western Upland Area, and the Western Alluvial Area.

The objectives of this CSM are twofold:

- To provide a defensible integrated conceptual model understood by Cimarron, NRC, and Oklahoma DEQ personnel; and
- To provide a basis upon which groundwater remediation activities can be designed and justified.

This section summarizes the information presented in Section 5.0 (Integrated Conceptual Model) as a conclusion for each of the three areas of concern, and presents recommendations for moving forward.

6.2 BA #1 Area

6.2.1 Conclusion

Assessment of the BA #1 Area is complete. Licensed material exists in shallow groundwater, migrating from former disposal trenches into Sandstone B, and then into the Cimarron River alluvium. Groundwater monitoring results indicate that the maximum concentration of licensed material is decreasing slowly over time. The maximum concentration observed in the 2004 sampling events was less than 4,500 pCi/L. Monitoring results also show that impacted groundwater migrates through a permeable paleochannel in the alluvium, is slowed by a “barrier” of low-permeability clay, and then progresses into a zone with higher permeability but a relatively flat potentiometric surface. Continued migration appears to be relatively slow.

6.2.2 Recommendation

Cimarron Corporation intends to remediate groundwater exceeding 180 pCi/L in this area. Cimarron Corporation will submit a detailed remedial design to both NRC and Oklahoma DEQ. The design will include a post-decommissioning monitoring program to demonstrate compliance with groundwater decommissioning criteria.

6.3 Western Upland Area

6.3.1 Conclusion

Assessment of the Western Upland Area is complete. Licensed material has been observed at concentrations typically less than 500 pCi/L in a few monitor wells in Sandstone A. These monitor wells are located near the BA #3 Area, which was decommissioned prior to 1992. Other nearby wells yield total uranium concentrations below 30 pCi/L (the MCL for uranium).

Impacted groundwater migrates from Sandstone A in the Western Upland Area into the nearby drainage way, where it combines with other seepage from both sides of this drainage. The impacted shallow groundwater in the Western Upland Area poses no threat to human or environmental receptors.

6.3.2 Recommendation

Cimarron Corporation intends to remediate groundwater exceeding 180 pCi/L in this area. Cimarron Corporation will submit a detailed remedial design to both NRC and Oklahoma DEQ. The design will include a post-decommissioning monitoring program to demonstrate compliance with groundwater decommissioning criteria.

6.4 Western Alluvial Area

6.4.1 Conclusion

Assessment of the Western Upland Area is complete. Licensed material has been observed at low concentrations (typically, less than 300 pCi/L) in alluvial materials immediately beneath the trace of a former pipeline. The pipeline was excavated in 1985; "source" material exceeding 30 pCi/g total uranium was removed by 1995. Because of the flat hydraulic gradient in this area, impacted groundwater appears to be moving very slowly.

6.4.2 Recommendation

Cimarron Corporation intends to remediate groundwater exceeding 180 pCi/L in the Western Alluvial Area. Cimarron Corporation will submit a detailed remedial design to both NRC and Oklahoma DEQ. The design will include a post-decommissioning monitoring program to demonstrate compliance with groundwater decommissioning criteria.

7.0 References


- Adams, G.P, and D.L. Bergman, 1995. Geohydrology of Alluvium and Terrace Deposits, Cimarron River from Freedom to Guthrie, Oklahoma. USGS WRI 95-4066.
- American Society for Testing and Materials. 2003. E1689-95(2003)e1 Standard Guide for Developing Conceptual Site Models for Contaminated Sites
- Carr, J.E. and M.V. Marcher, 1977. Preliminary Appraisal of the Garber-Wellington Aquifer, Southern Logan and Northern Oklahoma Counties. USGS OFR 77-278.
- Chase Environmental Group, Inc., 1994. Radiological Characterization Report for Cimarron Corporation's Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, October.
- Chase Environmental Group, Inc, 1996. Groundwater and Surface Water Assessment for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, December.
- Chase Environmental Group, Inc, 2003a. Justification for Utilization of Fully Penetrating Groundwater Monitoring Wells in Shallow Alluvial Aquifer at the Cimarron Facility, January.
- Chase Environmental Group, Inc , 2003b. Technetium-99 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, December.
- Cimarron Corporation, 1997. Groundwater Quantity and Quality in Vicinity of Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma
- Cimarron Corporation, 1998. Cimarron Decommissioning Plan Groundwater Evaluation Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, Crescent, Oklahoma, July.
- Cimarron Corporation, 2003a. Burial Area #1 Groundwater Assessment Report for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, January.
- Cimarron Corporation, 2003b. Assessment Report for Well 1319 Area for Cimarron Corporation's Former Nuclear Fuel Fabrication Facility, December.
- Cimarron Corporation, 2004. Letter to Oklahoma Department of Environmental Quality (addressed to David Cates), March 31.
- ENSR Corporation, 2005. Refined Conceptual Site Model, Cimarron Site, Crescent, Oklahoma, August.
- ENSR 2006. Groundwater flow modeling report. [correct citation when report is finalized]
- Grant and Associates, J.L., 1989, Site Investigation Report for the Cimarron Corporation Facility, Logan County, Oklahoma.
- Hazen, Research, Inc., 2002, Determination of Distribution Coefficients (Kd) for Uranium in Soils.
- Langmuir, D. 1978. Uranium Solution-Mineral Equilibria at Low Temperatures with Applications to Sedimentary Ore Deposits. *Geochimica et Cosmochimica Acta*, 42:547-569.

- Nuclear Regulatory Commission Office of Nuclear Material Safety and Safeguards, 1999. Environmental Assessment by the Office of Nuclear Material Safety and Safeguards of the Proposed Decommissioning Plan and Other Proposals Related to the Cimarron Corporation Former Fuel Fabrication Facility, July.
- Pettyjohn, W. A., 1983. Water Atlas of Oklahoma, University Center for Water Research, Stillwater, Oklahoma.
- Piper, A. M., 1944, A Graphic Procedure in the Geochemical Interpretation of Water Analysis, American geophysical Union Transactions, v.25, p. 914 – 923.
- Rockware Inc., 2004. RockWorks Ver.2004.
- Roberts Schornick & Associates, Inc., 1998. Risk Assessment for Groundwater, Cimarron Corporation, Crescent, Oklahoma.
- Stiff, H. A., Jr., 1951 The Interpretation of Chemical Water Analysis by Means of Patterns, Journal of Petroleum Technology, v.3, no. 10, p. 15-17.
- Tortorelli, Robert L. and Lan P. McCabe. 2001. Flood Frequency Estimates and Documented and Potential Extreme Peak Discharges in Oklahoma. USGS Water Resources Investigations Report 01-4152.
- United States Environmental Protection Agency (USEPA), 1999. Understanding Variation in Partition Coefficient, K_d, Values: Vol. II, Geochemistry and Available K_d Values for Selected Inorganic Constituents. EPA 402-R-99-004 A&B, August.
- United States Environmental Protection Agency, 2000. Metal Speciation Equilibrium Model for Surface and Ground Water, MINTEQA2, Ver. 4.02.
- United States Geological Survey, 1996. Groundwater Quality Assessment of the Central Oklahoma Aquifer, Oklahoma – Geochemical and Geohydrologic Investigations. U.S. Geological Survey Water-Supply Paper 2357.
- United States Geological Survey. Water Quality Samples for Oklahoma, USGS 07160000 Cimarron River near Guthrie, OK. USGS Web Site.
- Wood, P.R., and Burton, L.C., 1968, Ground-water resources of Cleveland and Oklahoma Counties, Oklahoma: Oklahoma Geological Survey Circular 71, 75 p.

Appendix A

Stiff Diagrams for Wells Sampled August/September 2004

Stiff Diagram

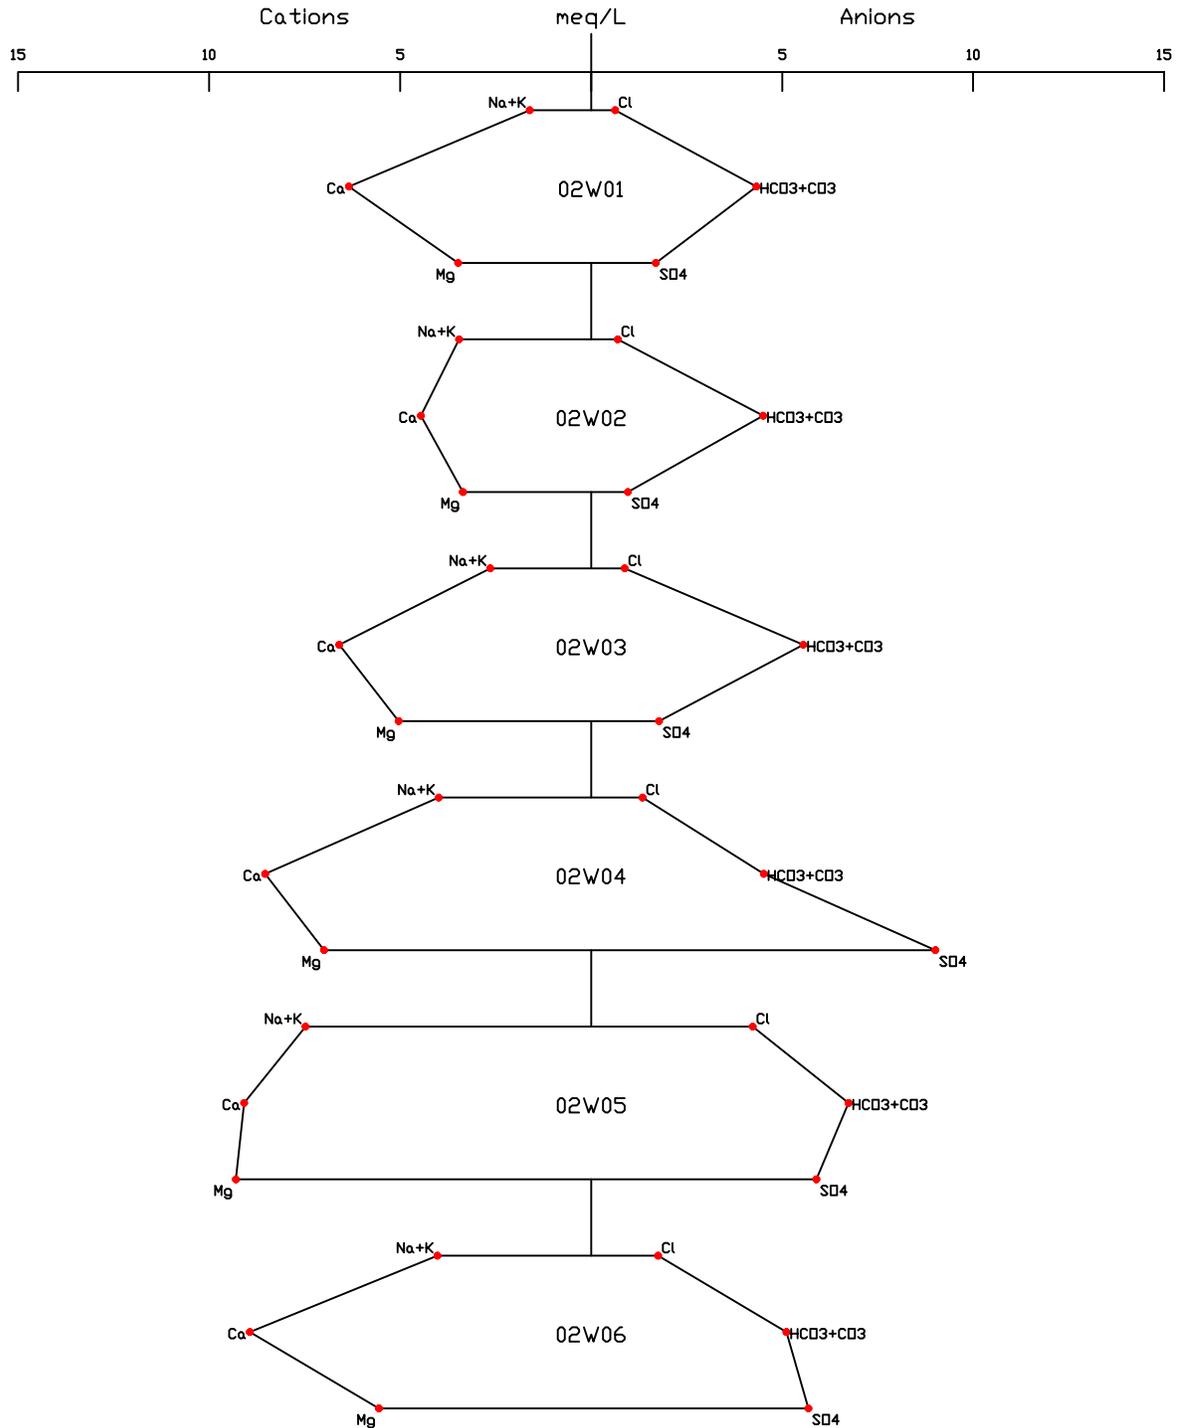

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
STIFF DIAGRAMS
BA #1 AREA (1 of 12)
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

Stiff Diagram

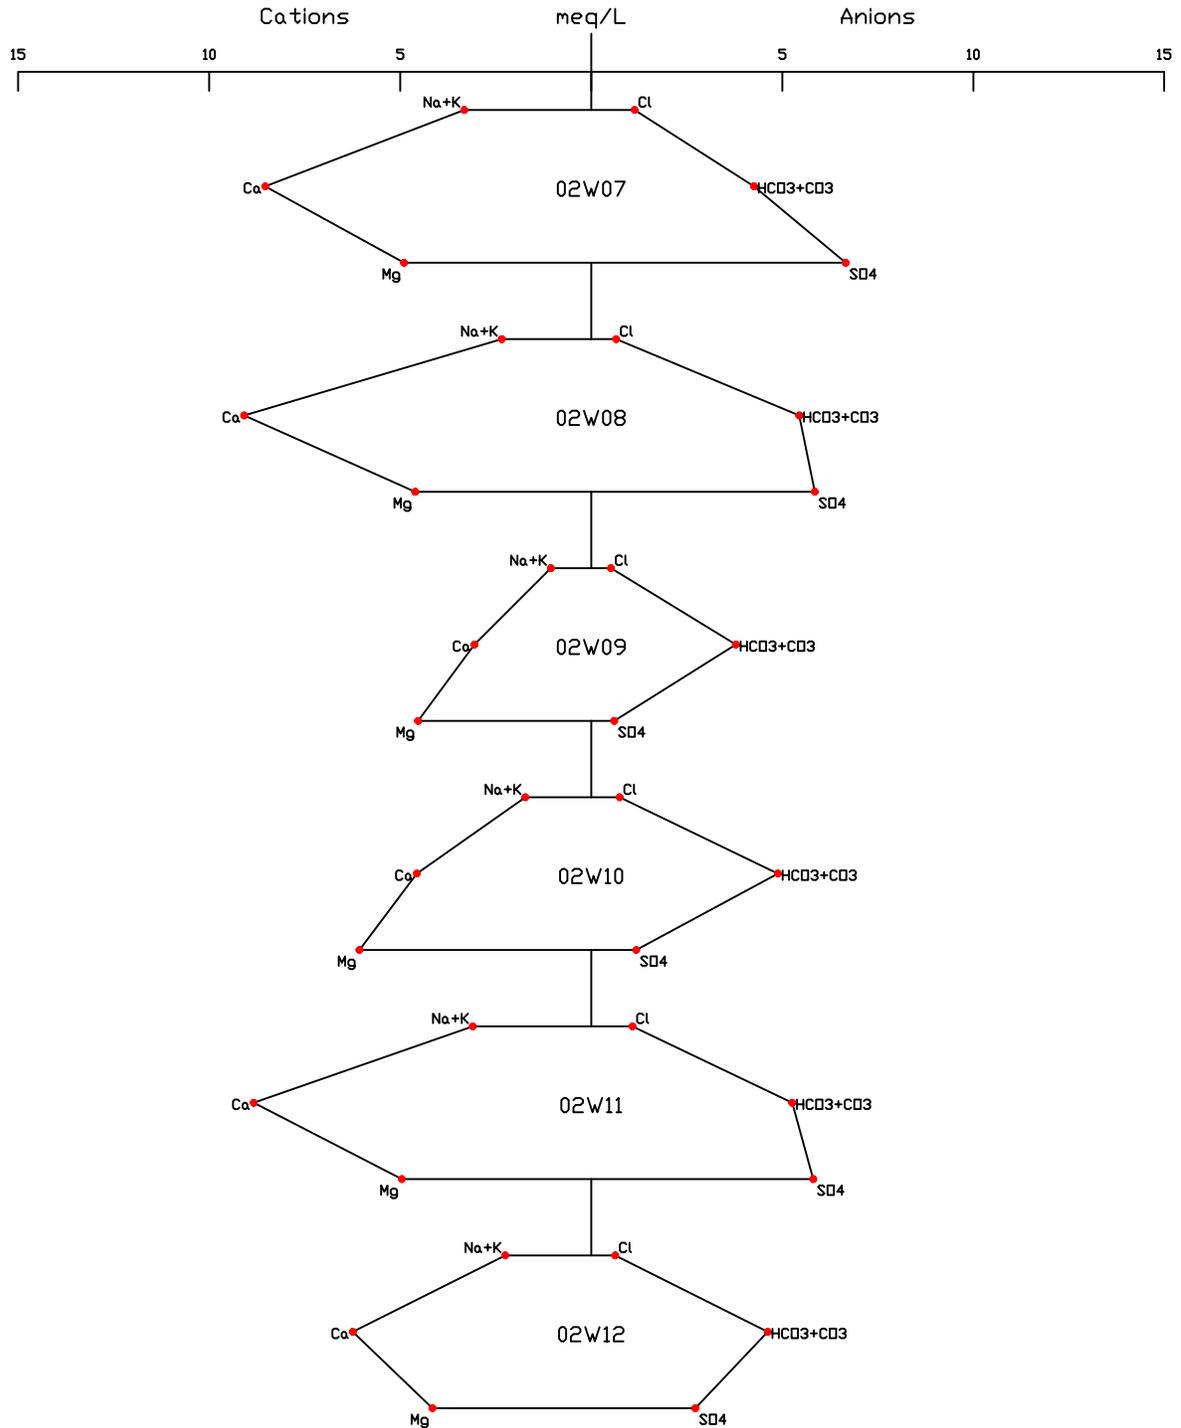

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
STIFF DIAGRAMS
BA #1 AREA (2 of 12)
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

Stiff Diagram

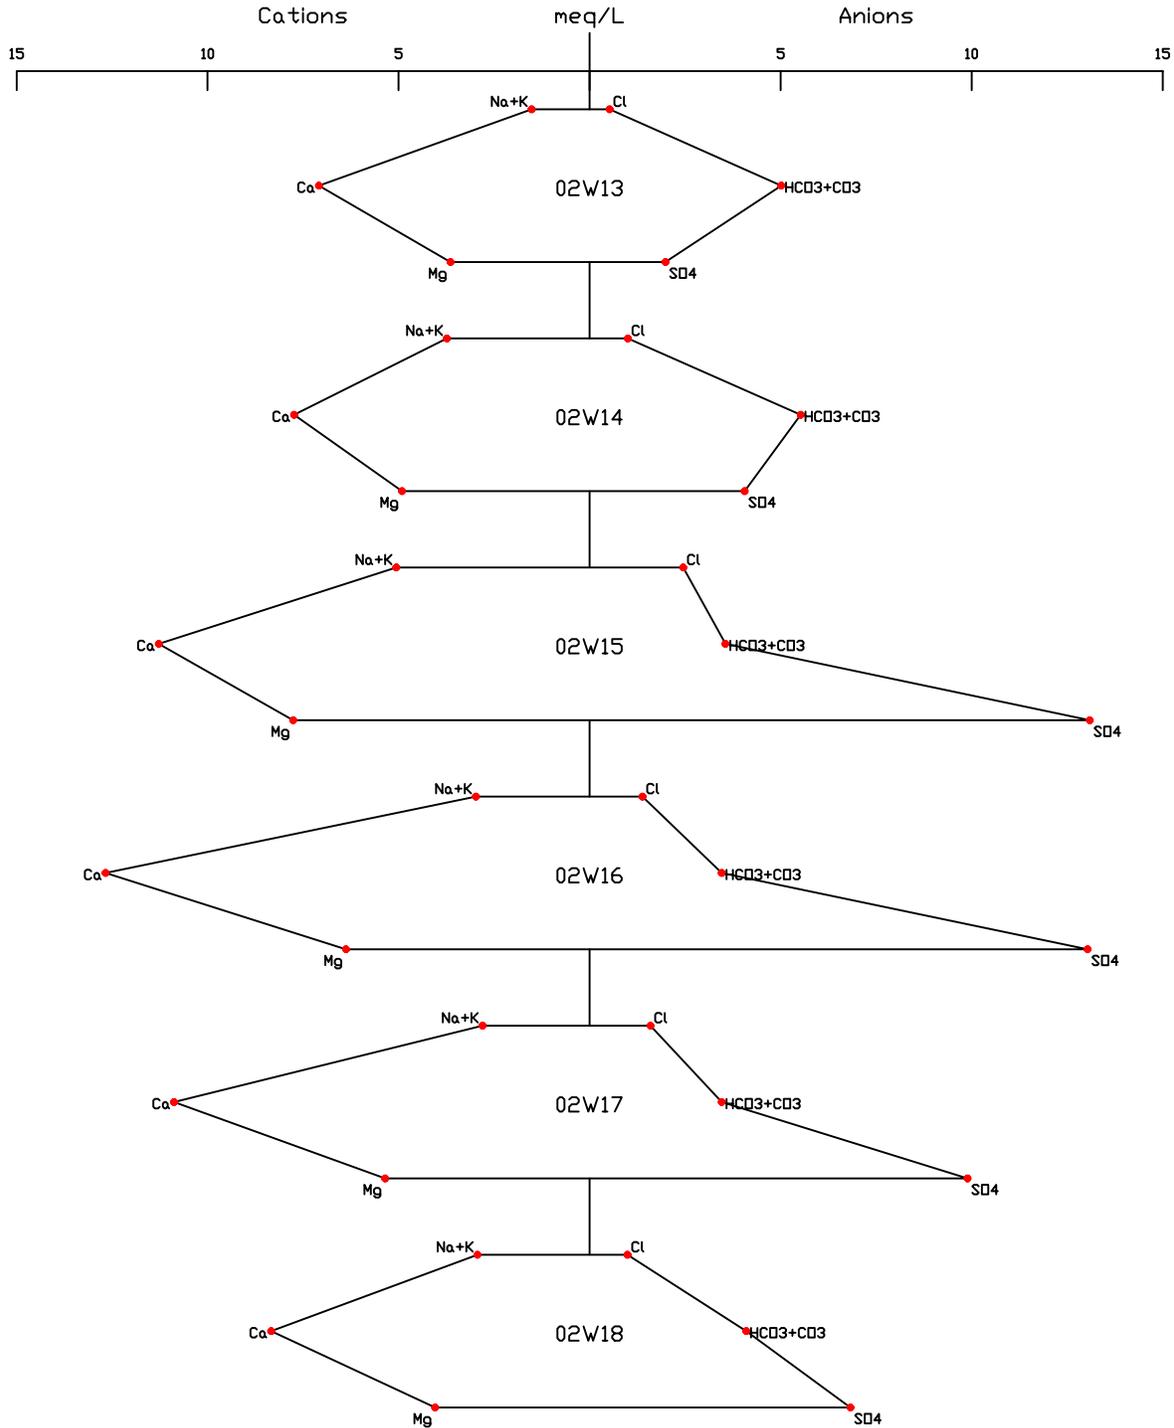

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
STIFF DIAGRAMS
BA #1 AREA (3 of 12)
CIMARRON CORPORATION
CRESCENT, OKLAHOMA

Stiff Diagram

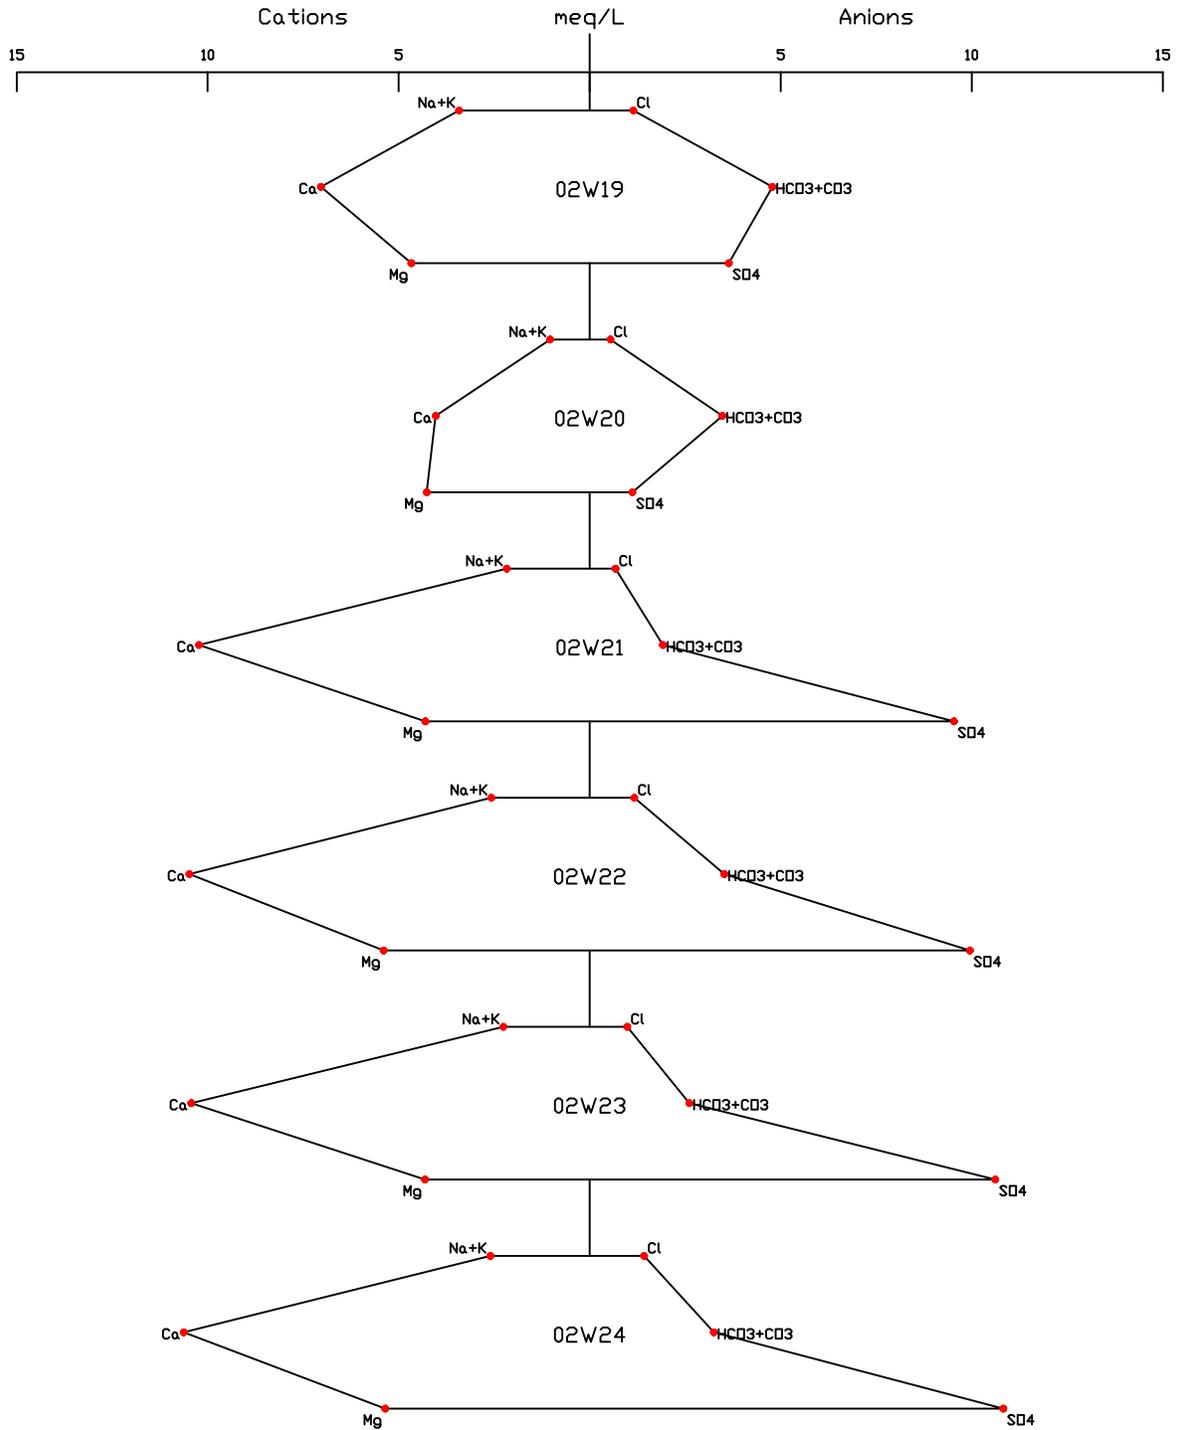

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (4 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

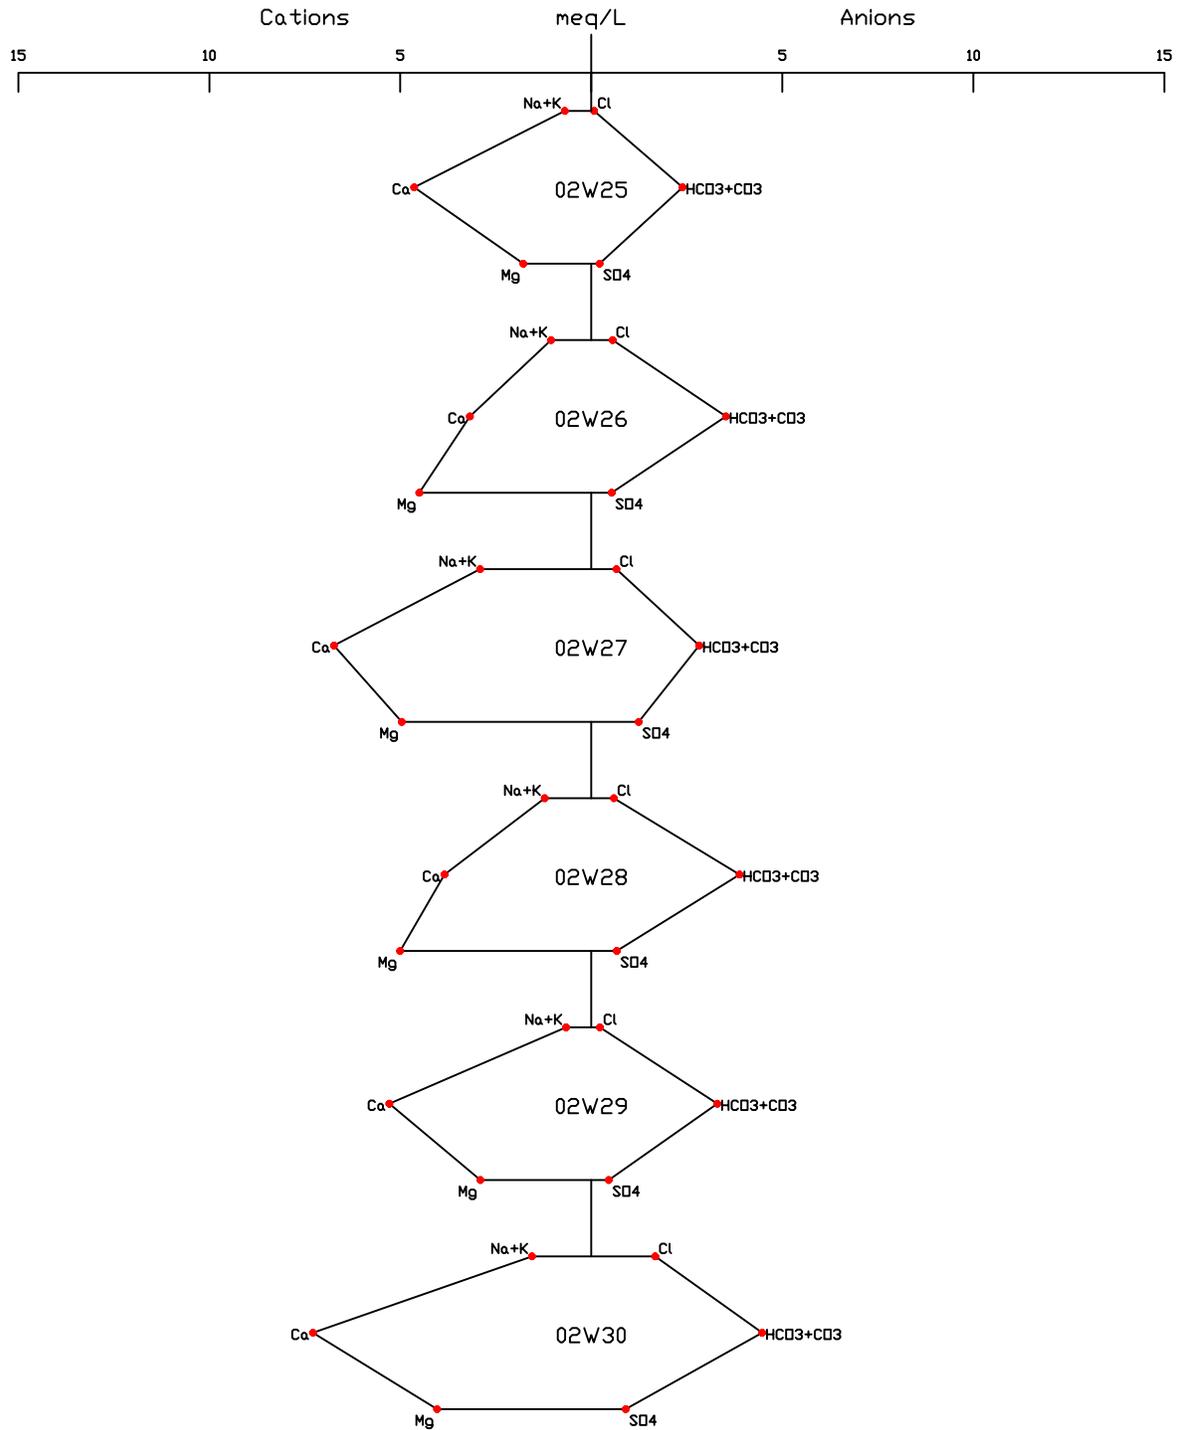

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (5 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

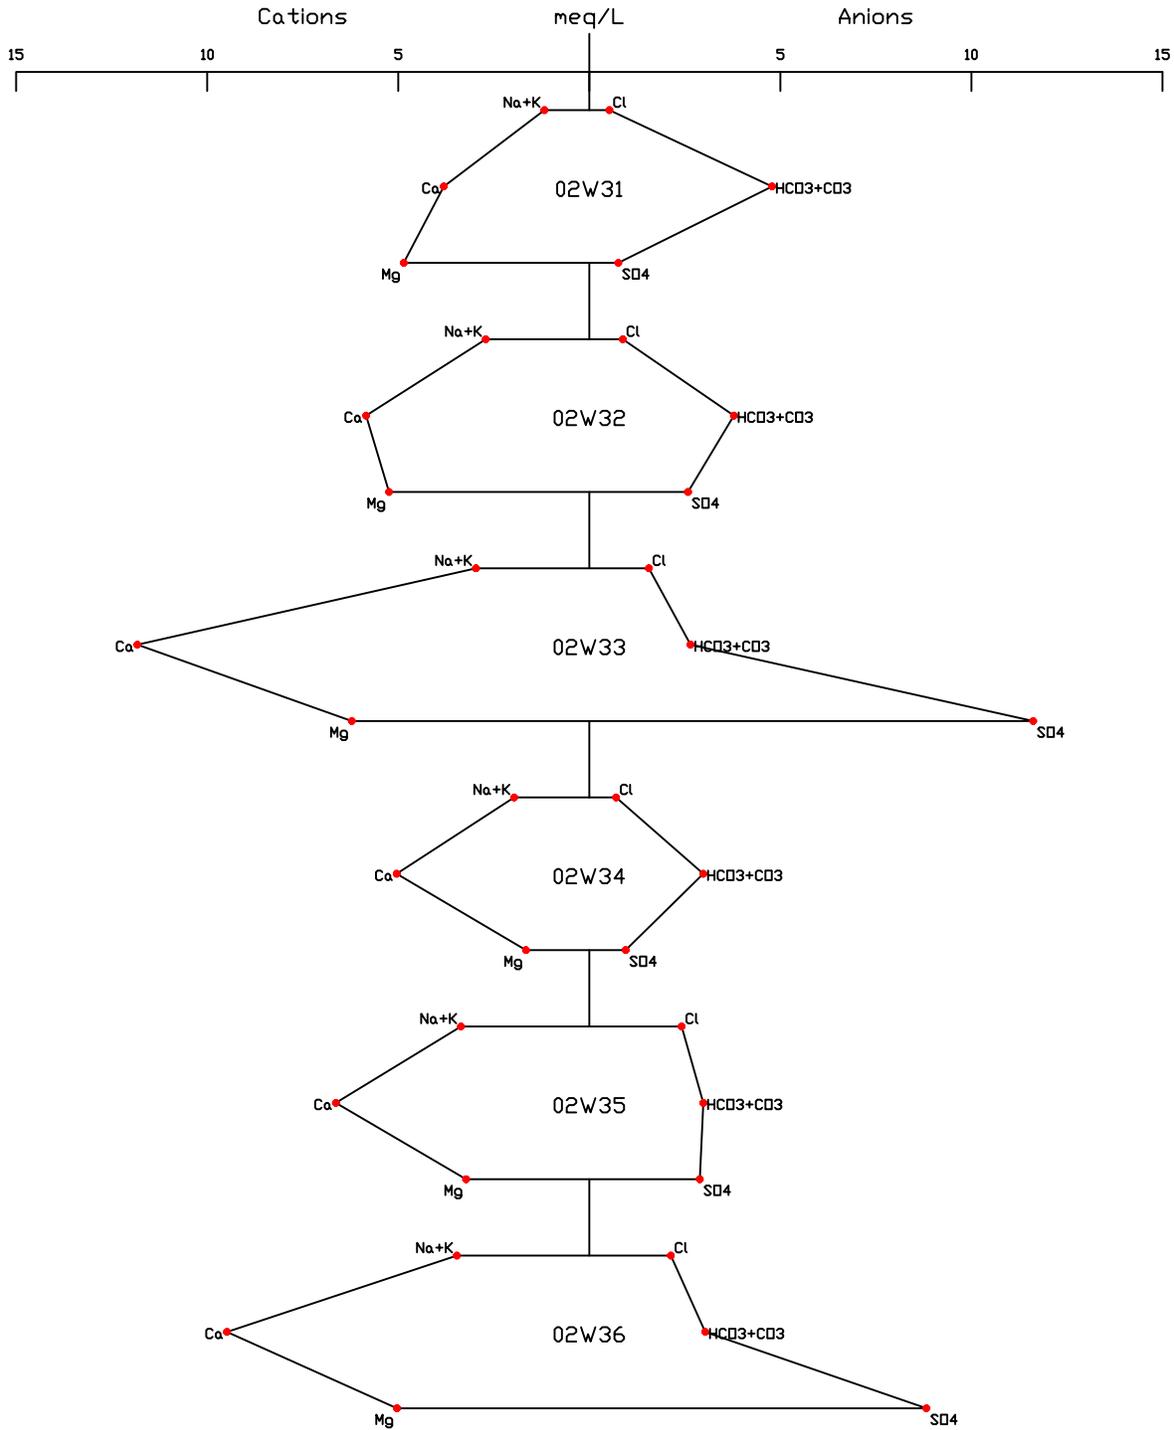

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (6 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

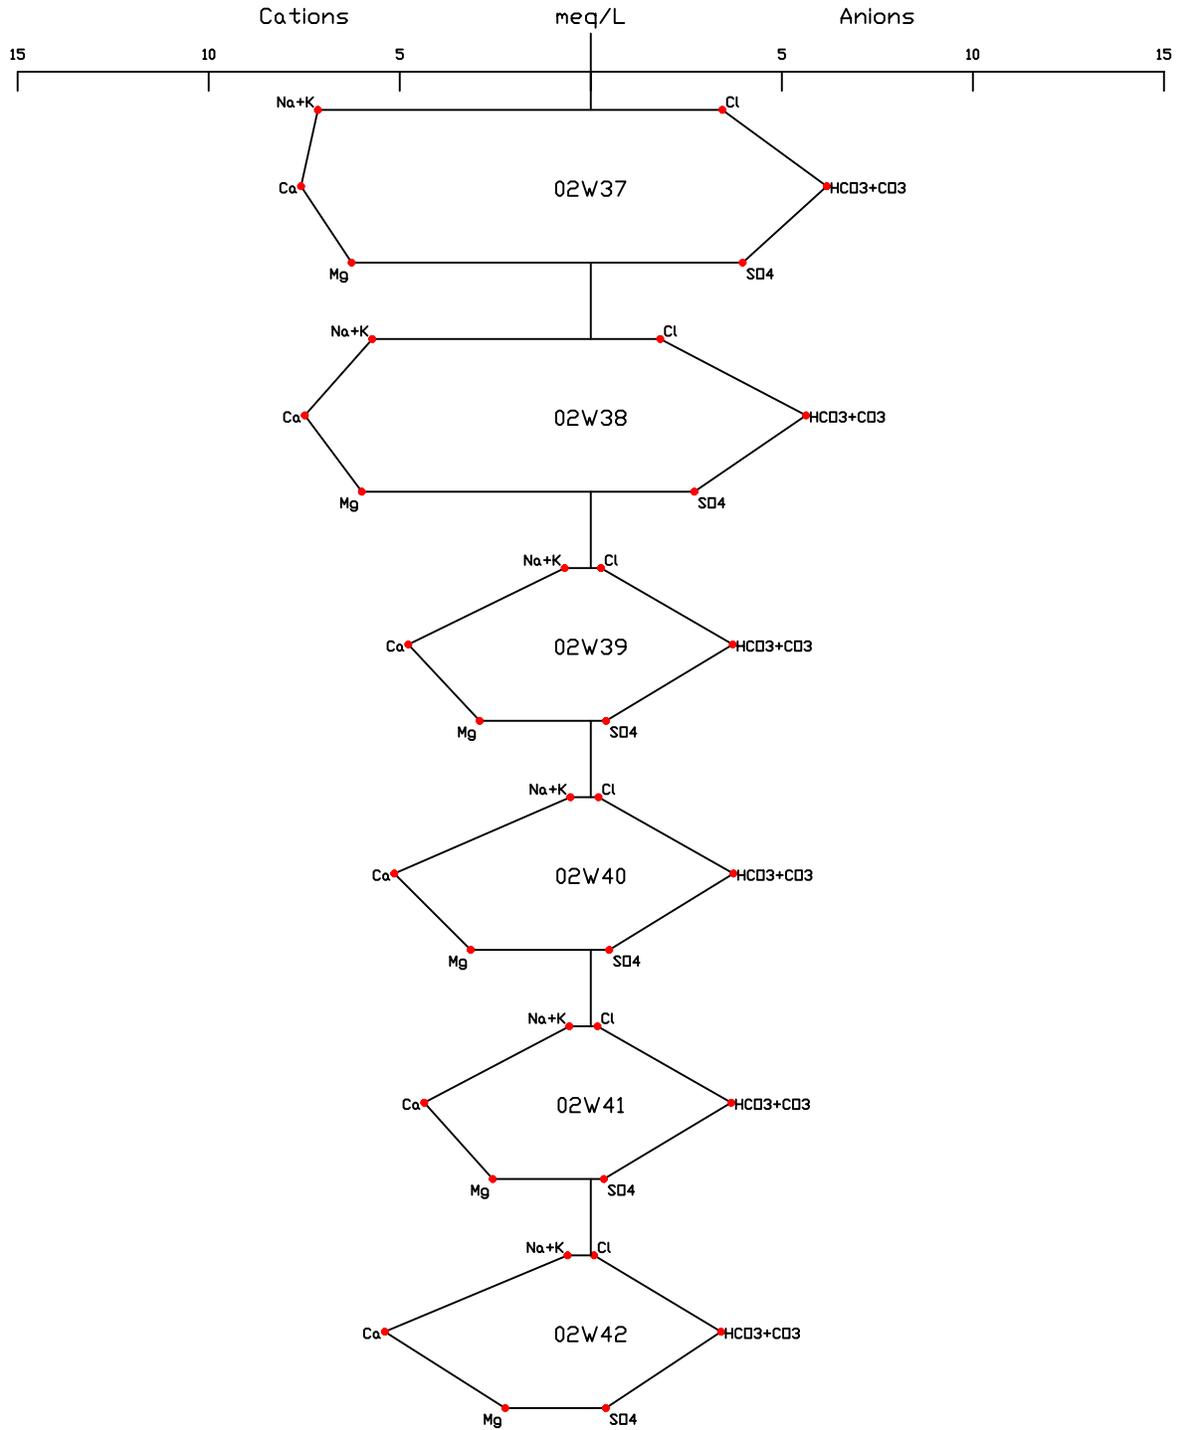

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (7 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

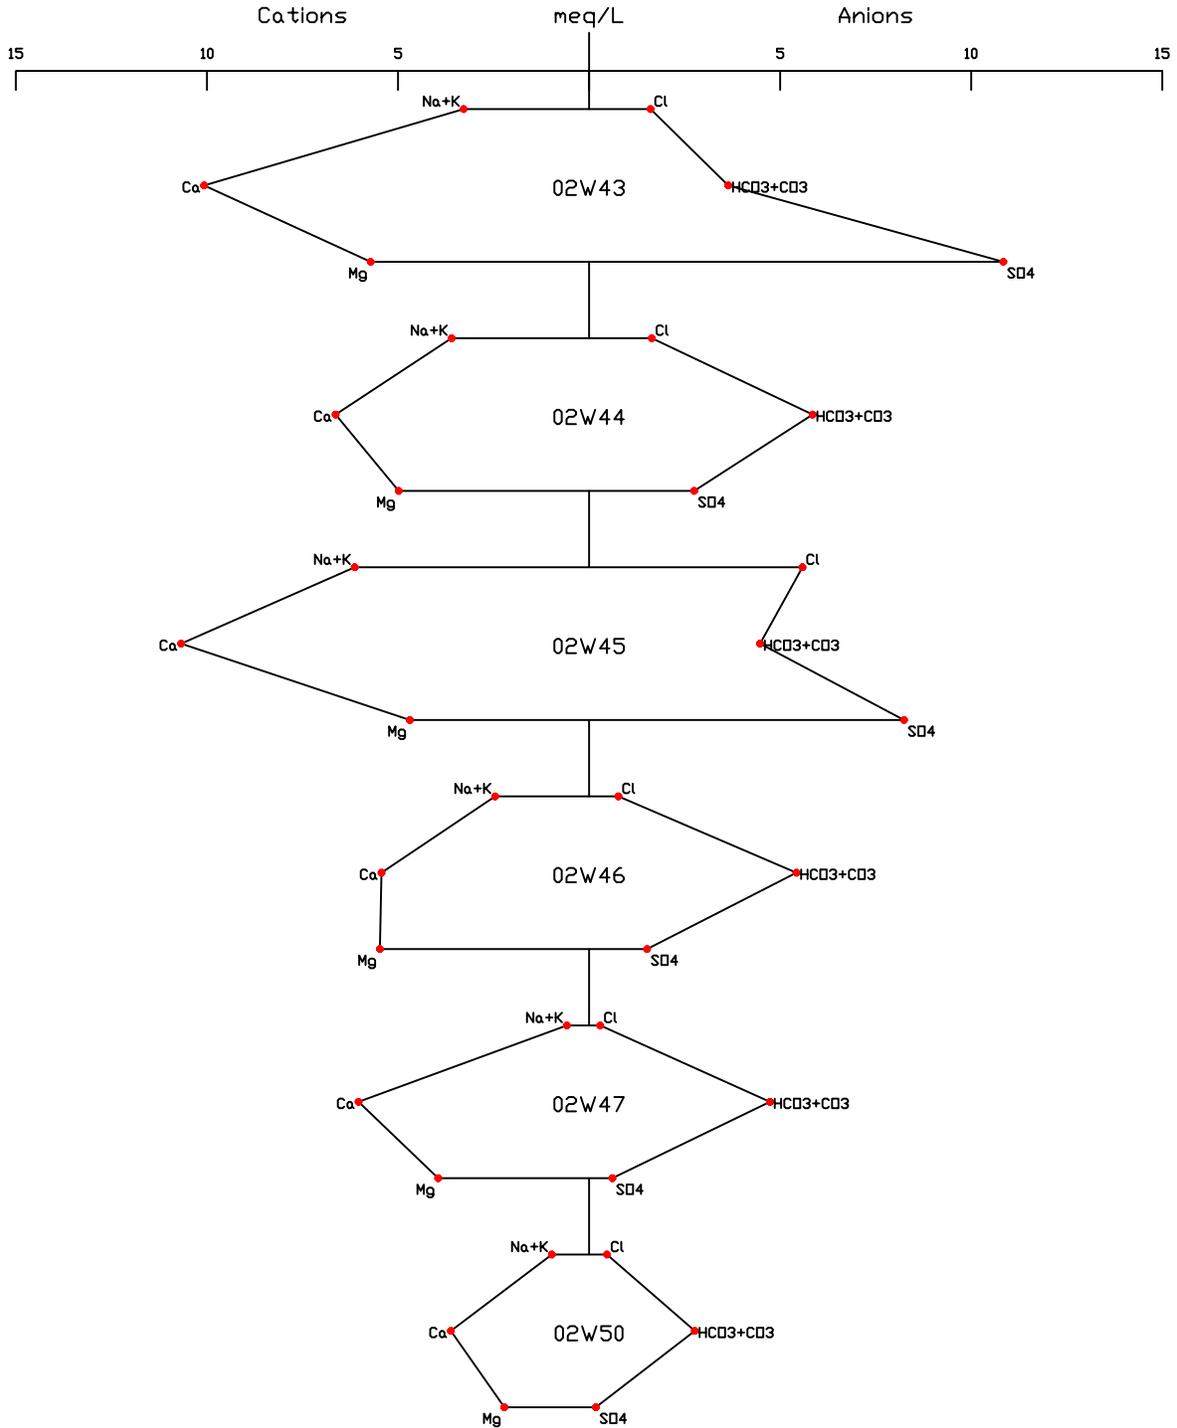

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (8 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

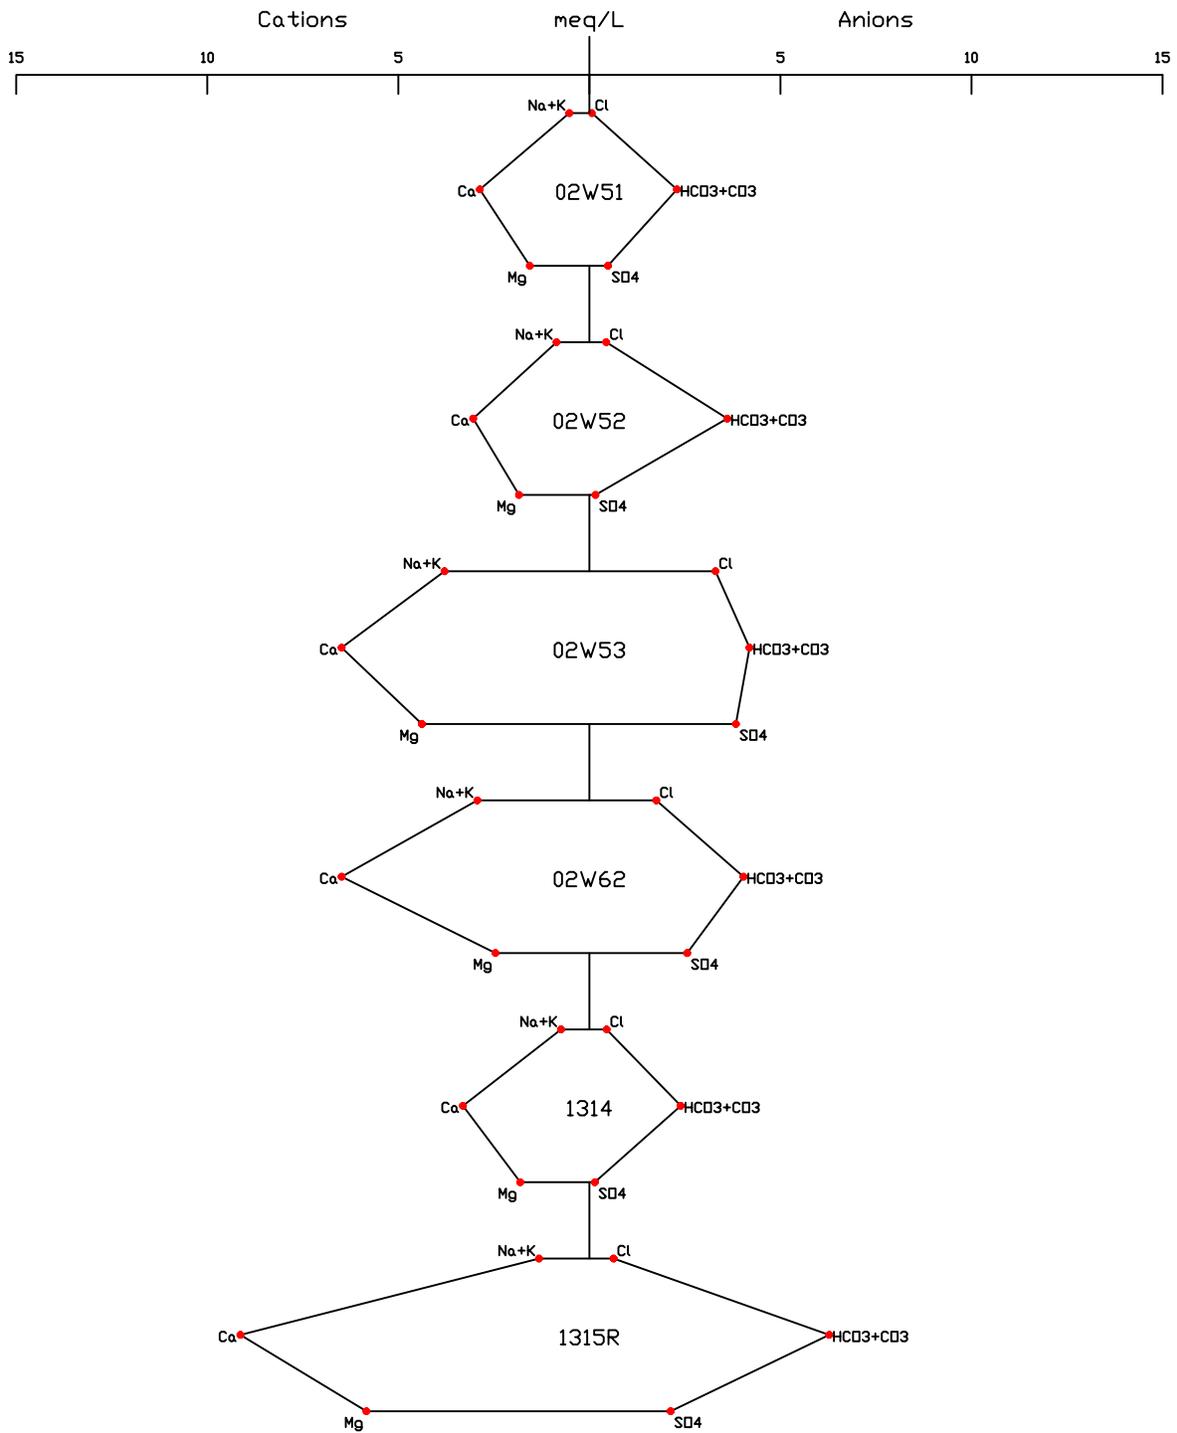

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (9 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

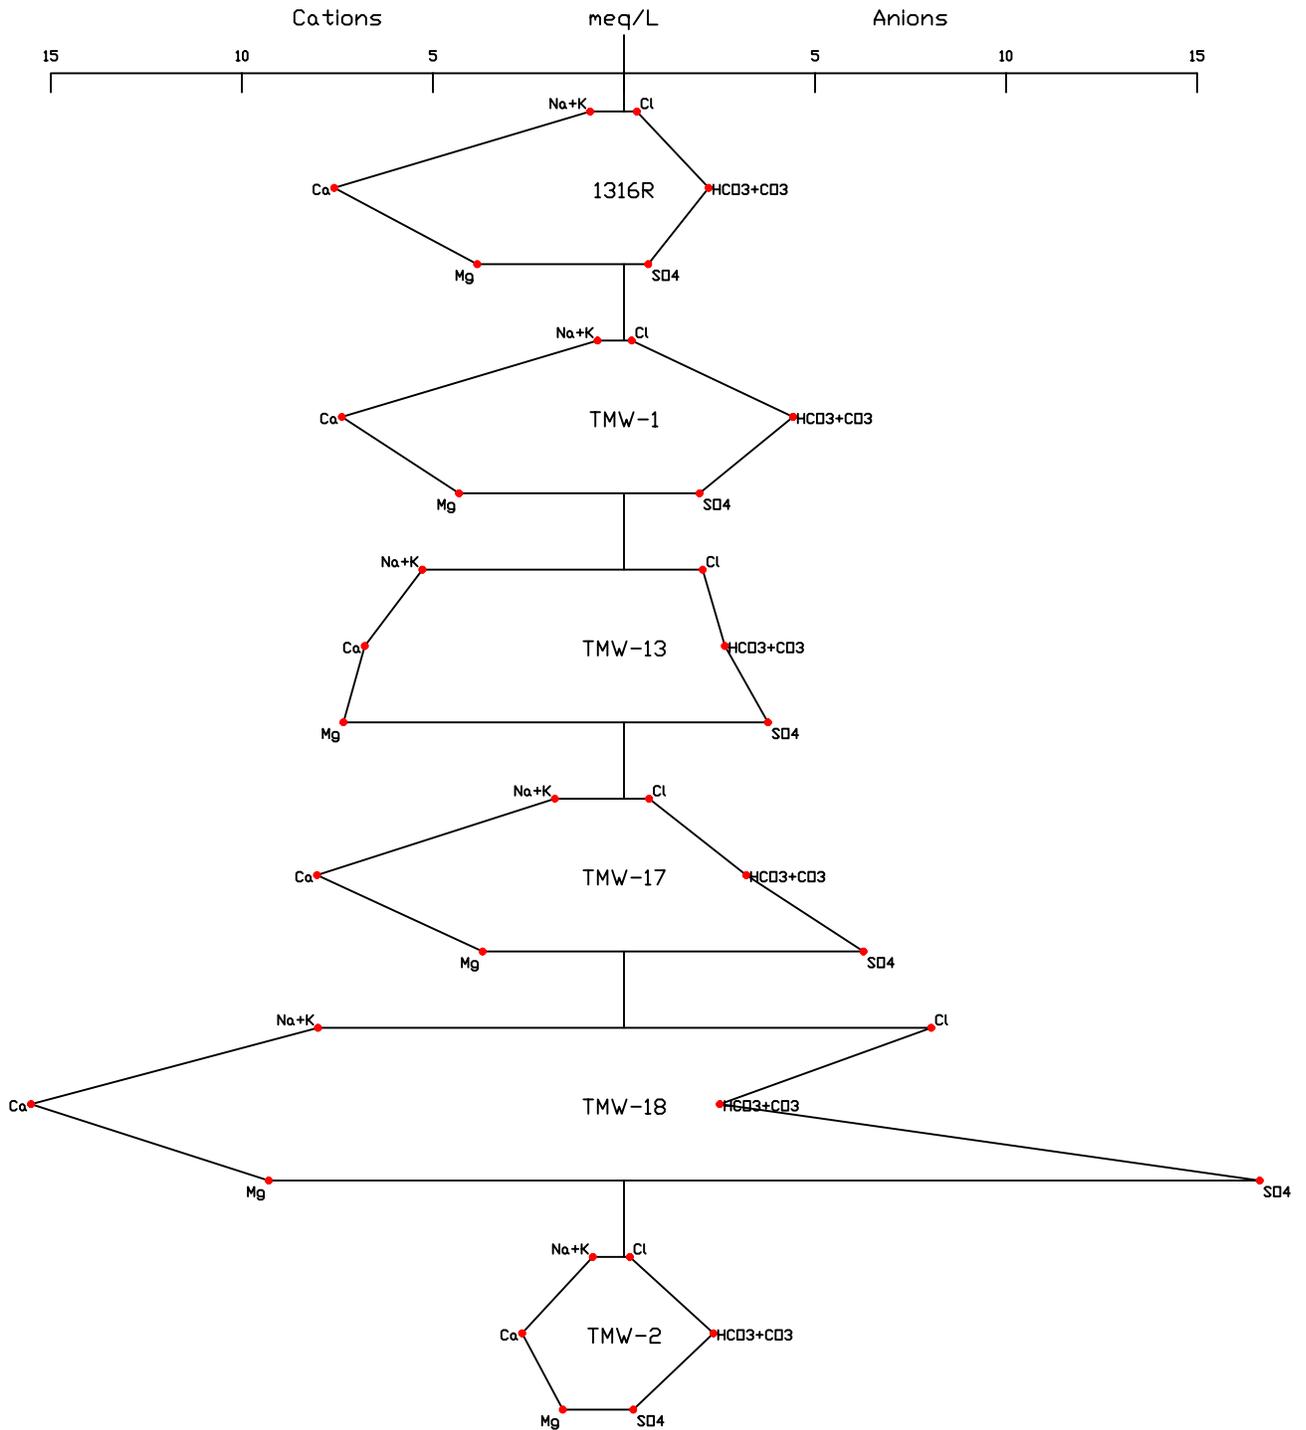

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (10 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

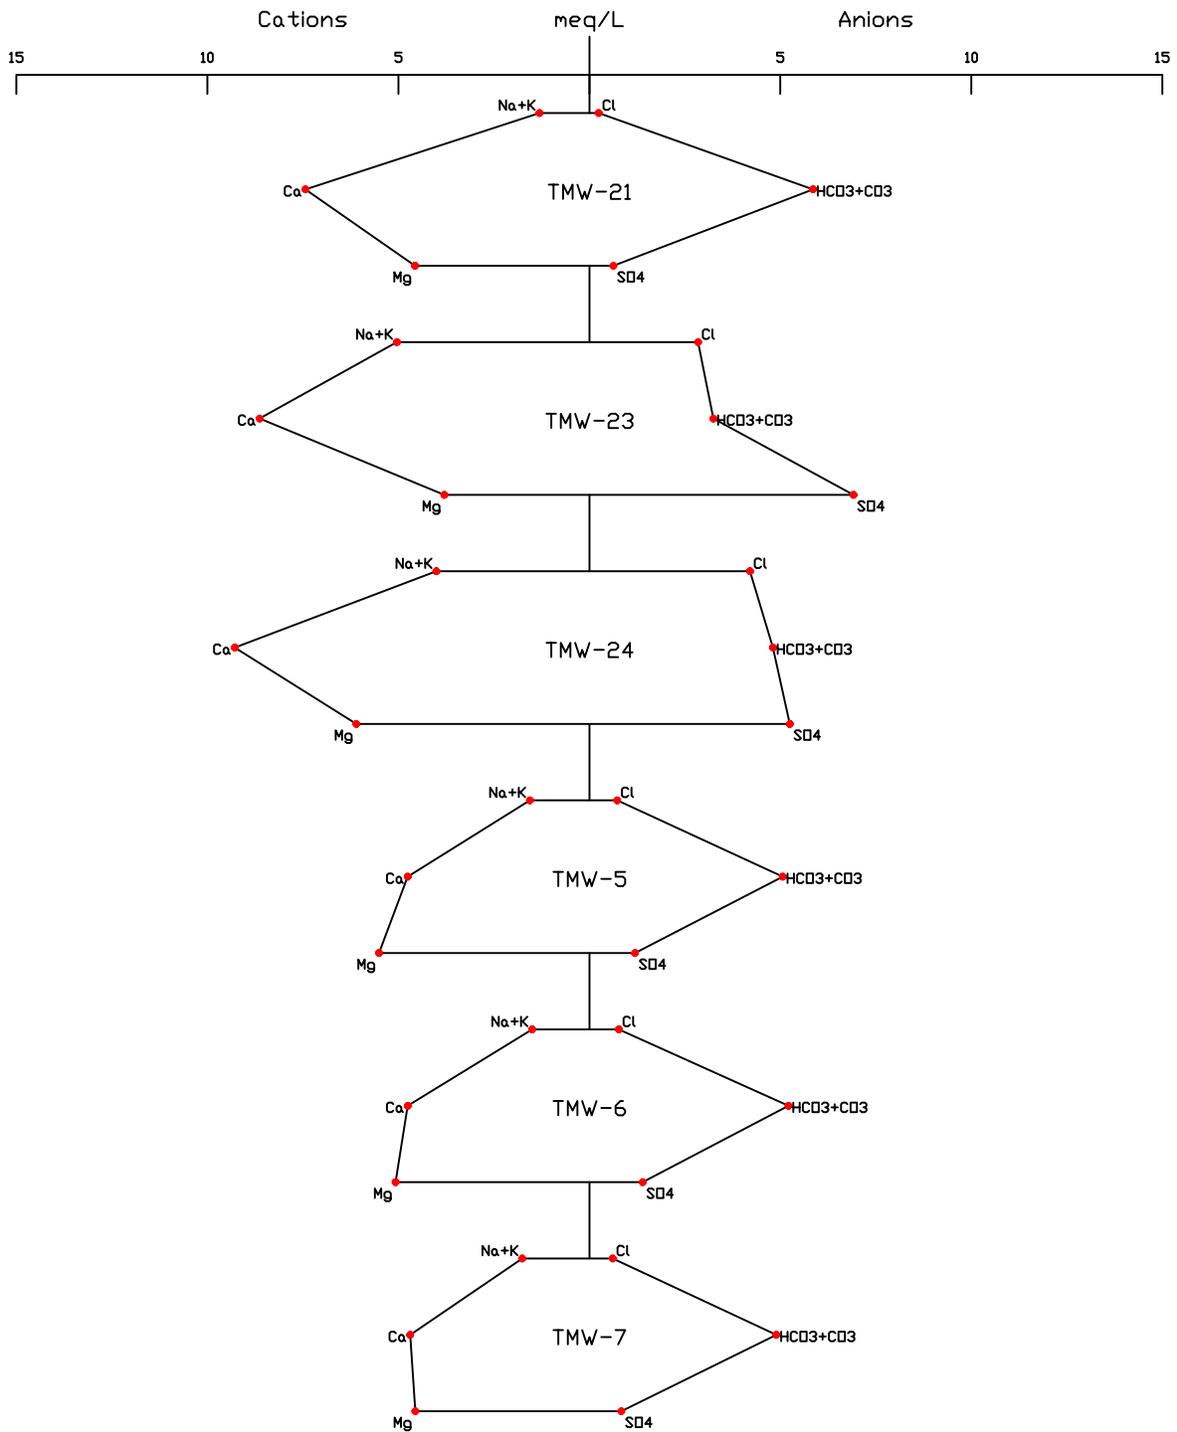

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (11 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

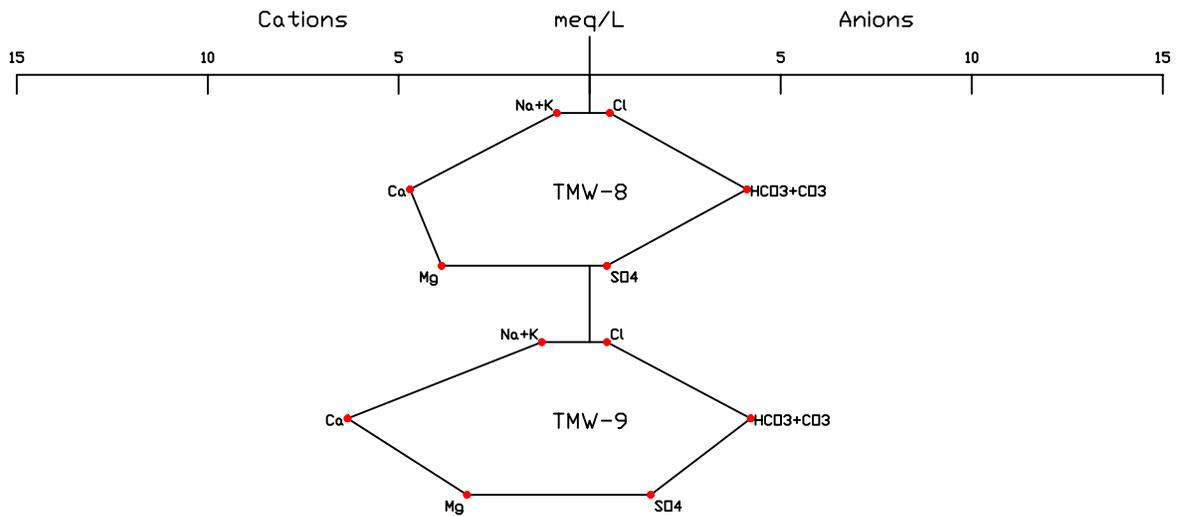

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 BA#1 AREA (12 of 12)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

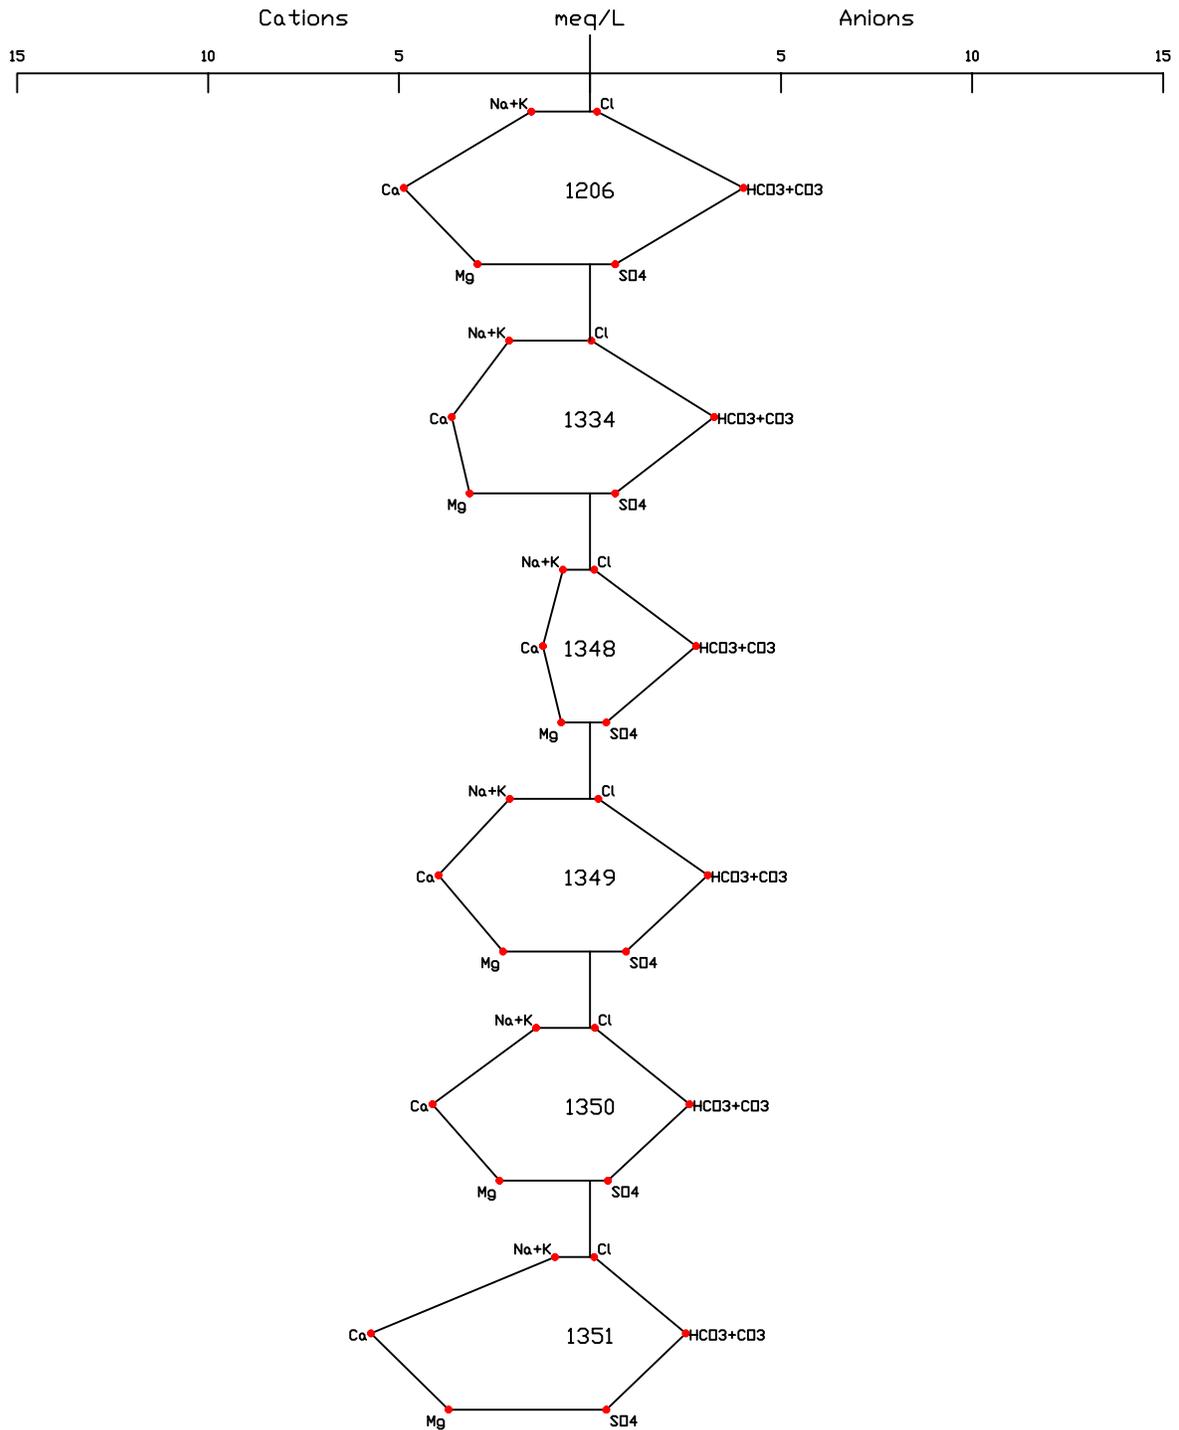

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN UPLAND AREA (1 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

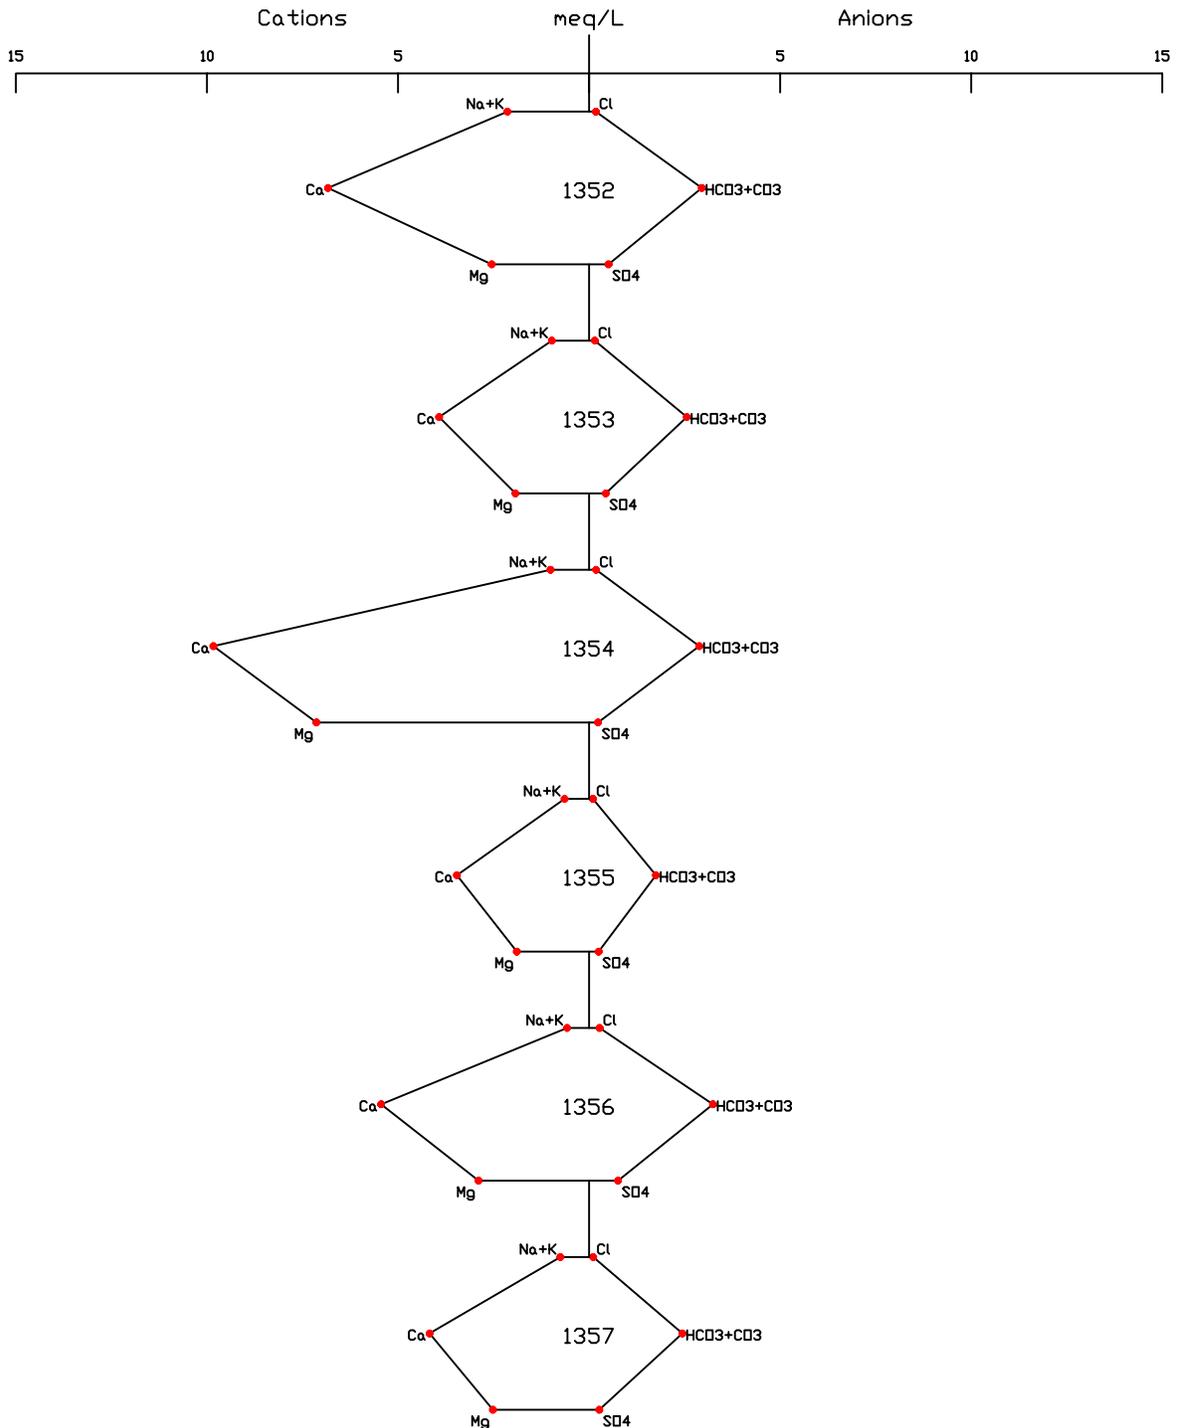

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN UPLAND AREA (2 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

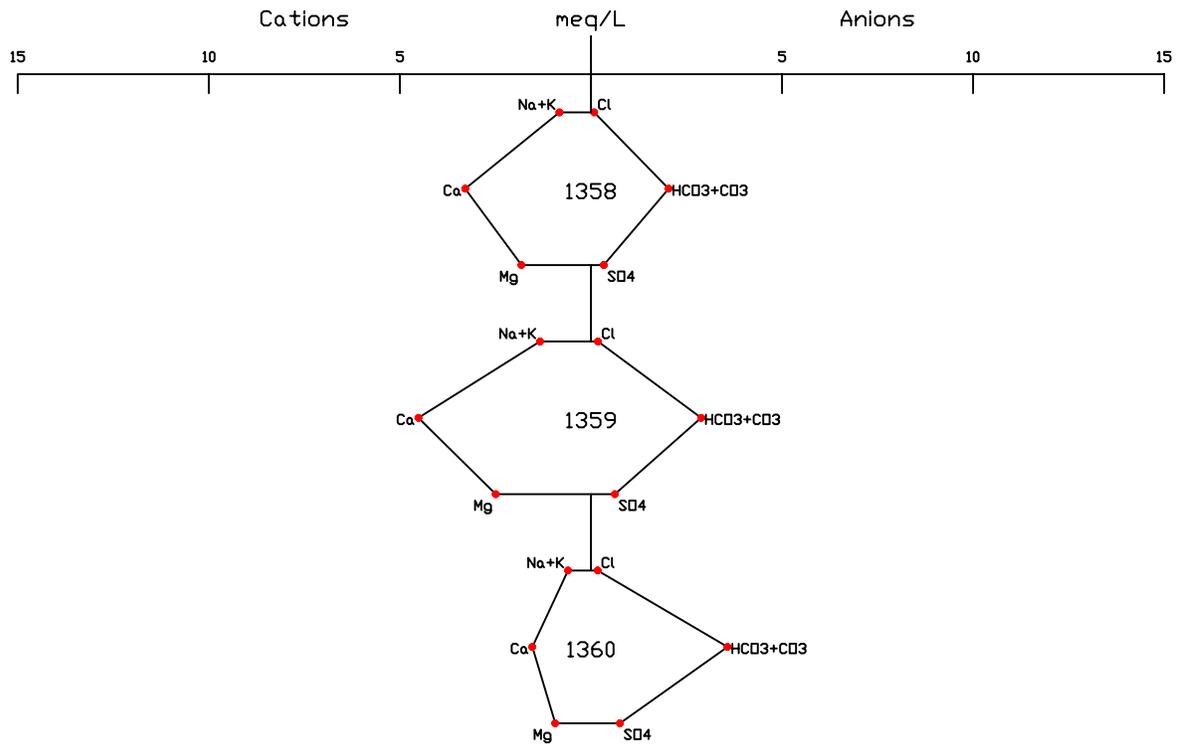

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN UPLAND AREA (3 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

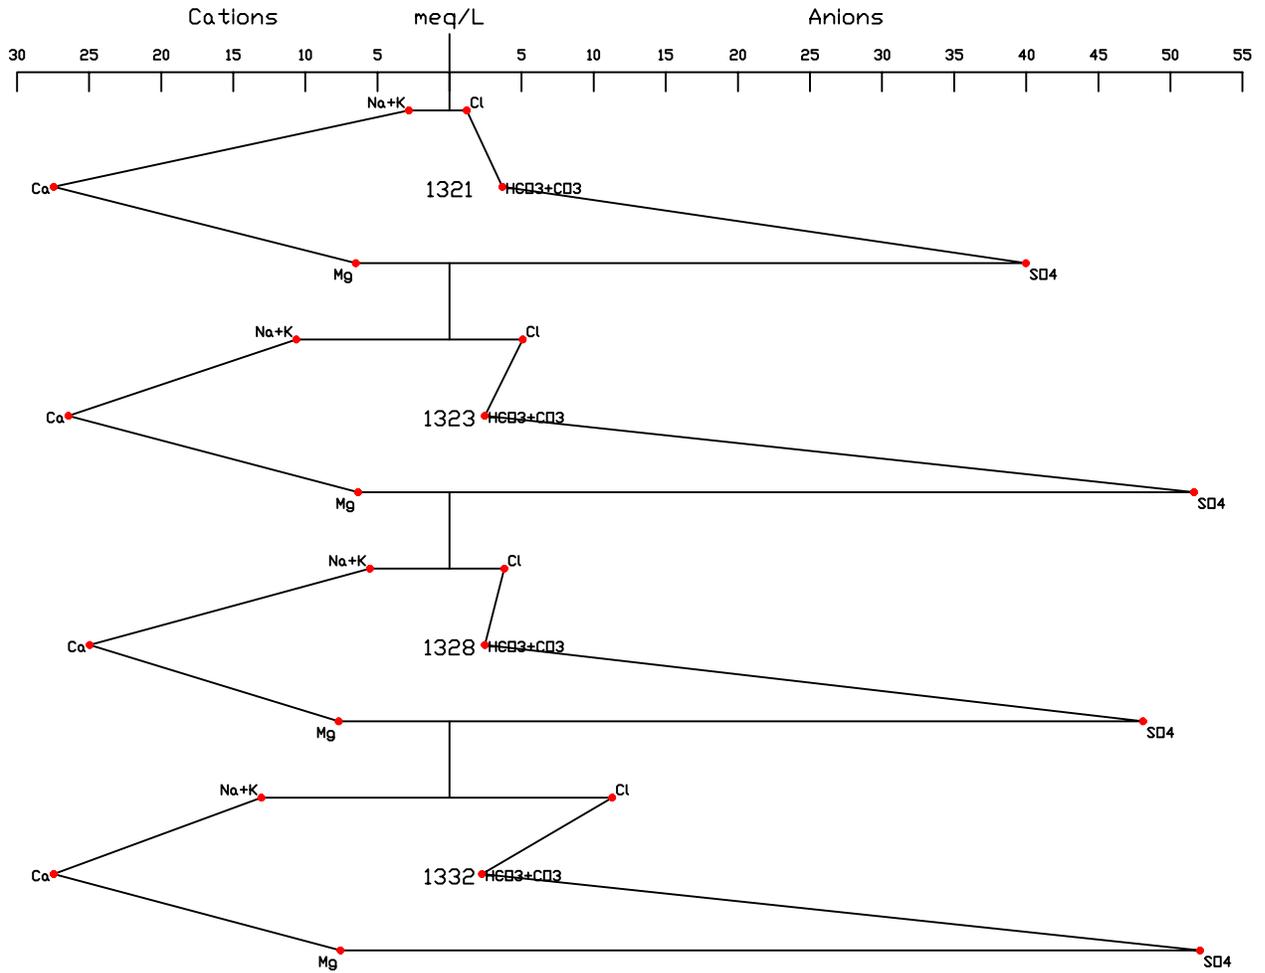

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN UPLAND AREA (4 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

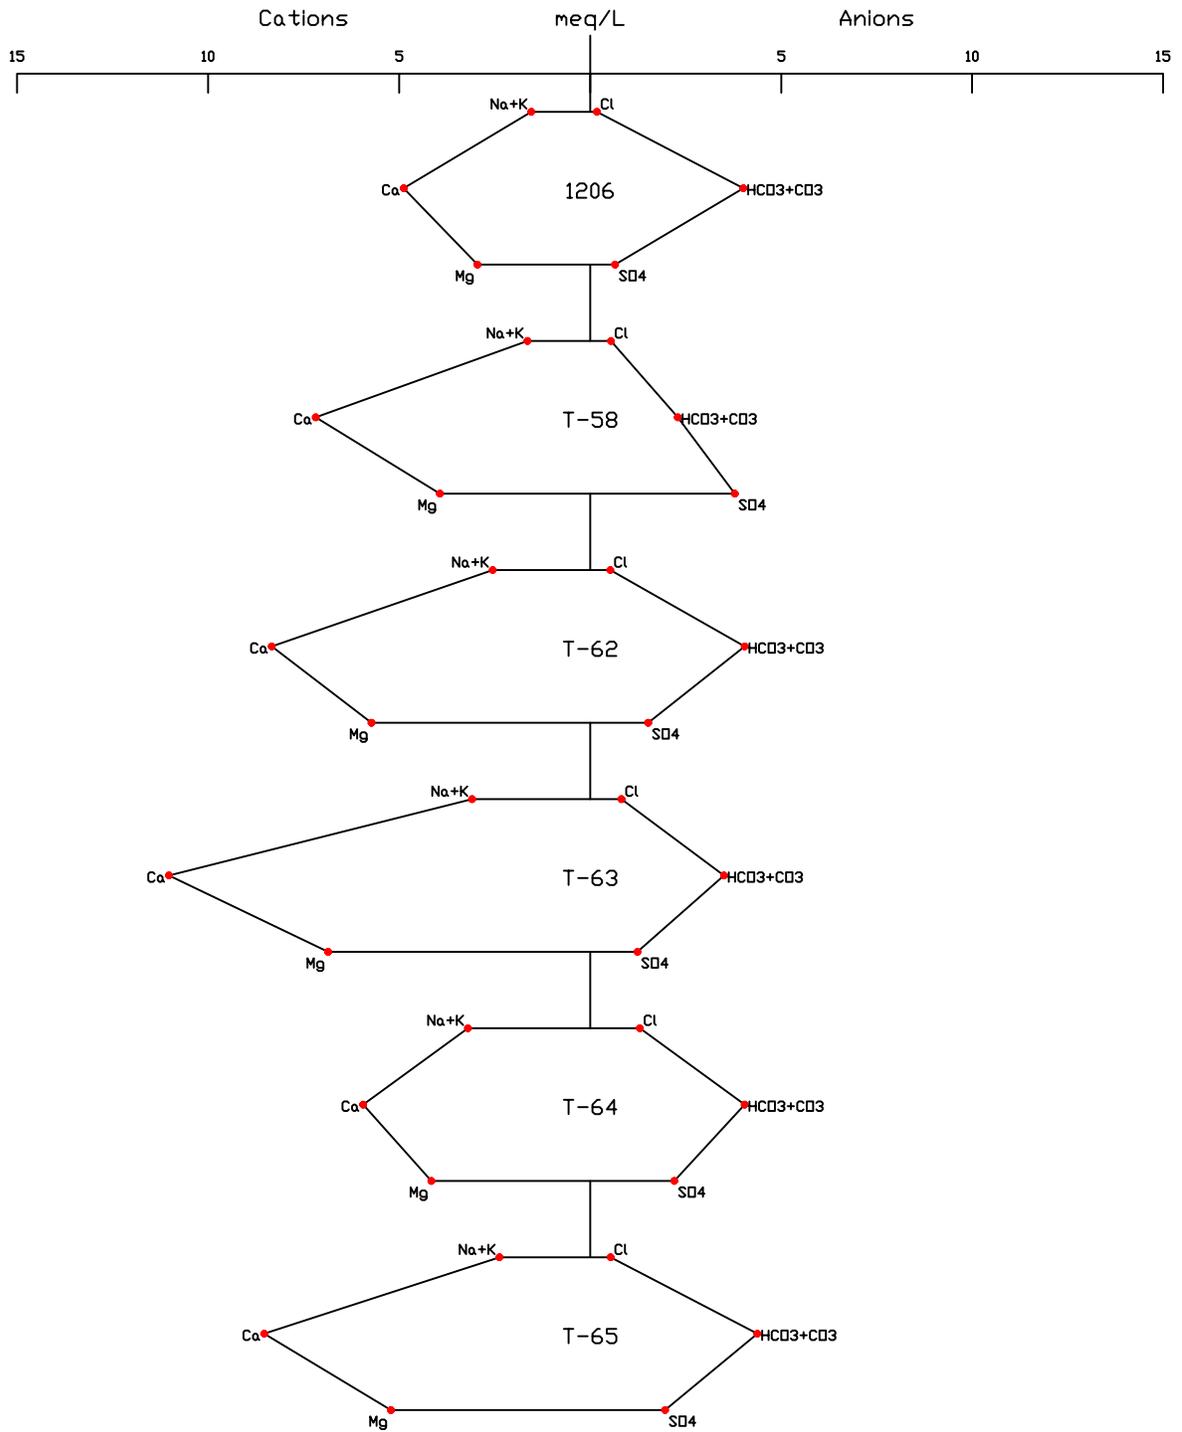

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN ALLUVIUM AREA (1 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

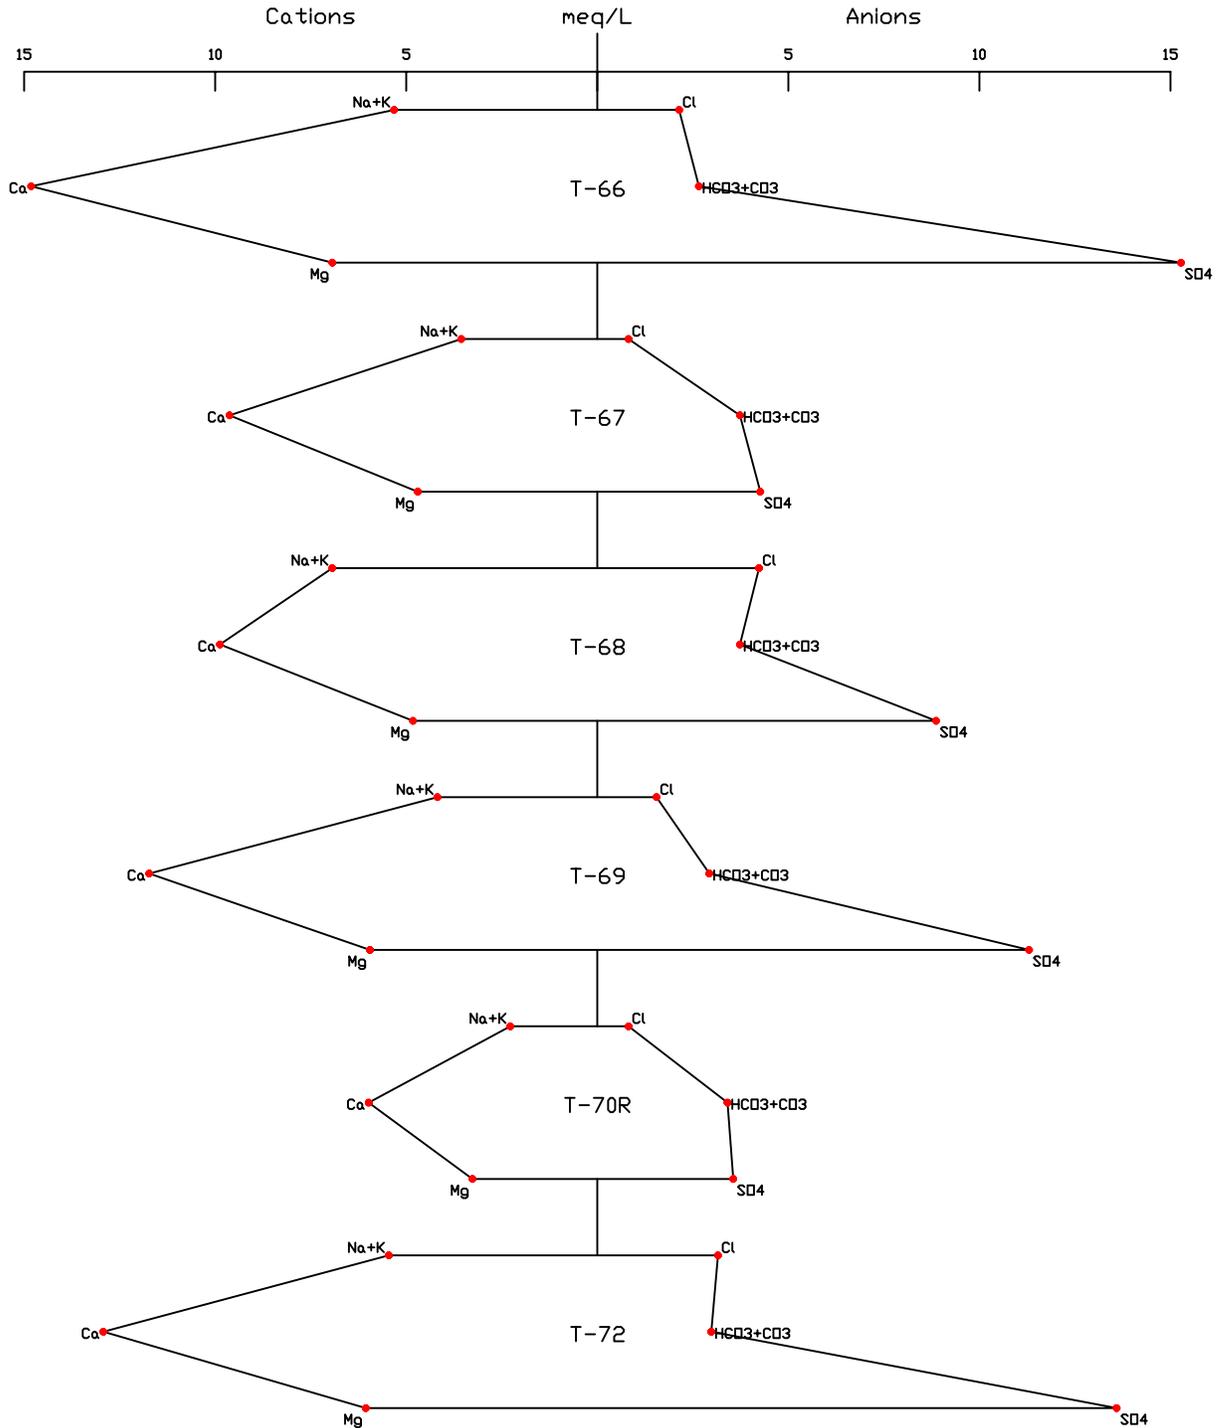

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN ALLUVIUM AREA (2 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

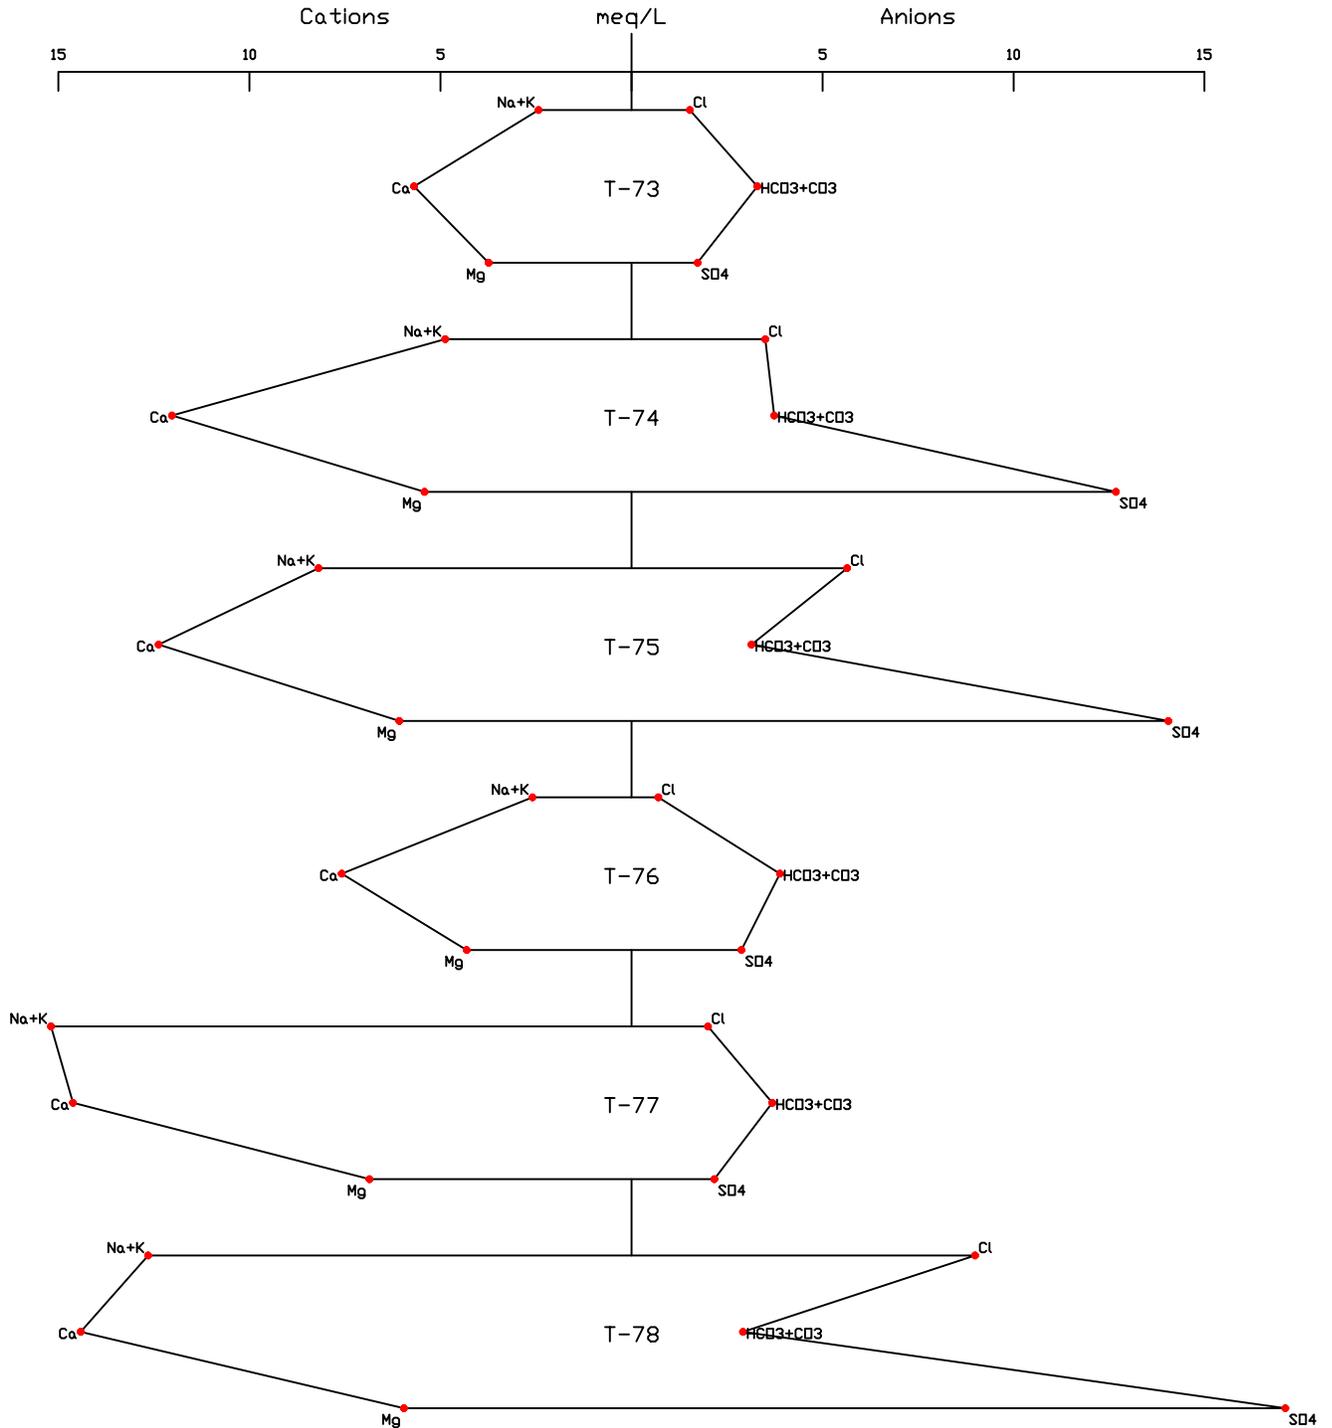

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN ALLUVIUM AREA (3 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

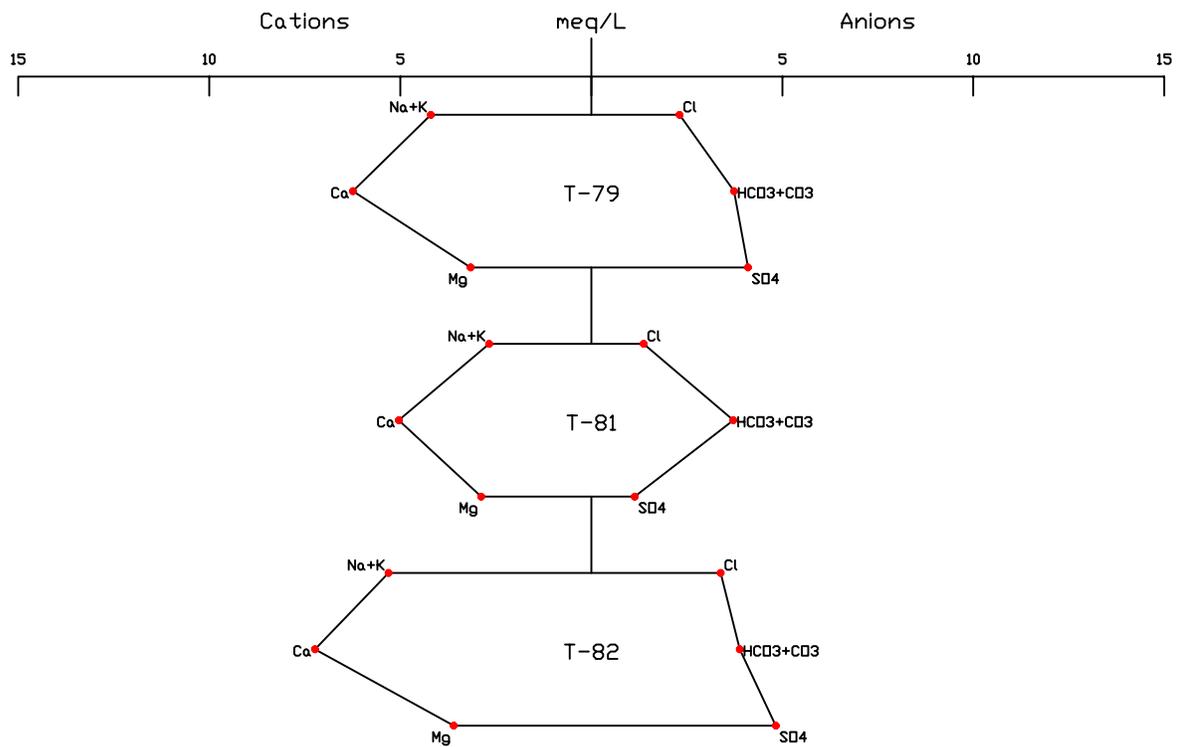

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS


CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 WESTERN ALLUVIUM AREA (4 of 4)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA

Stiff Diagram

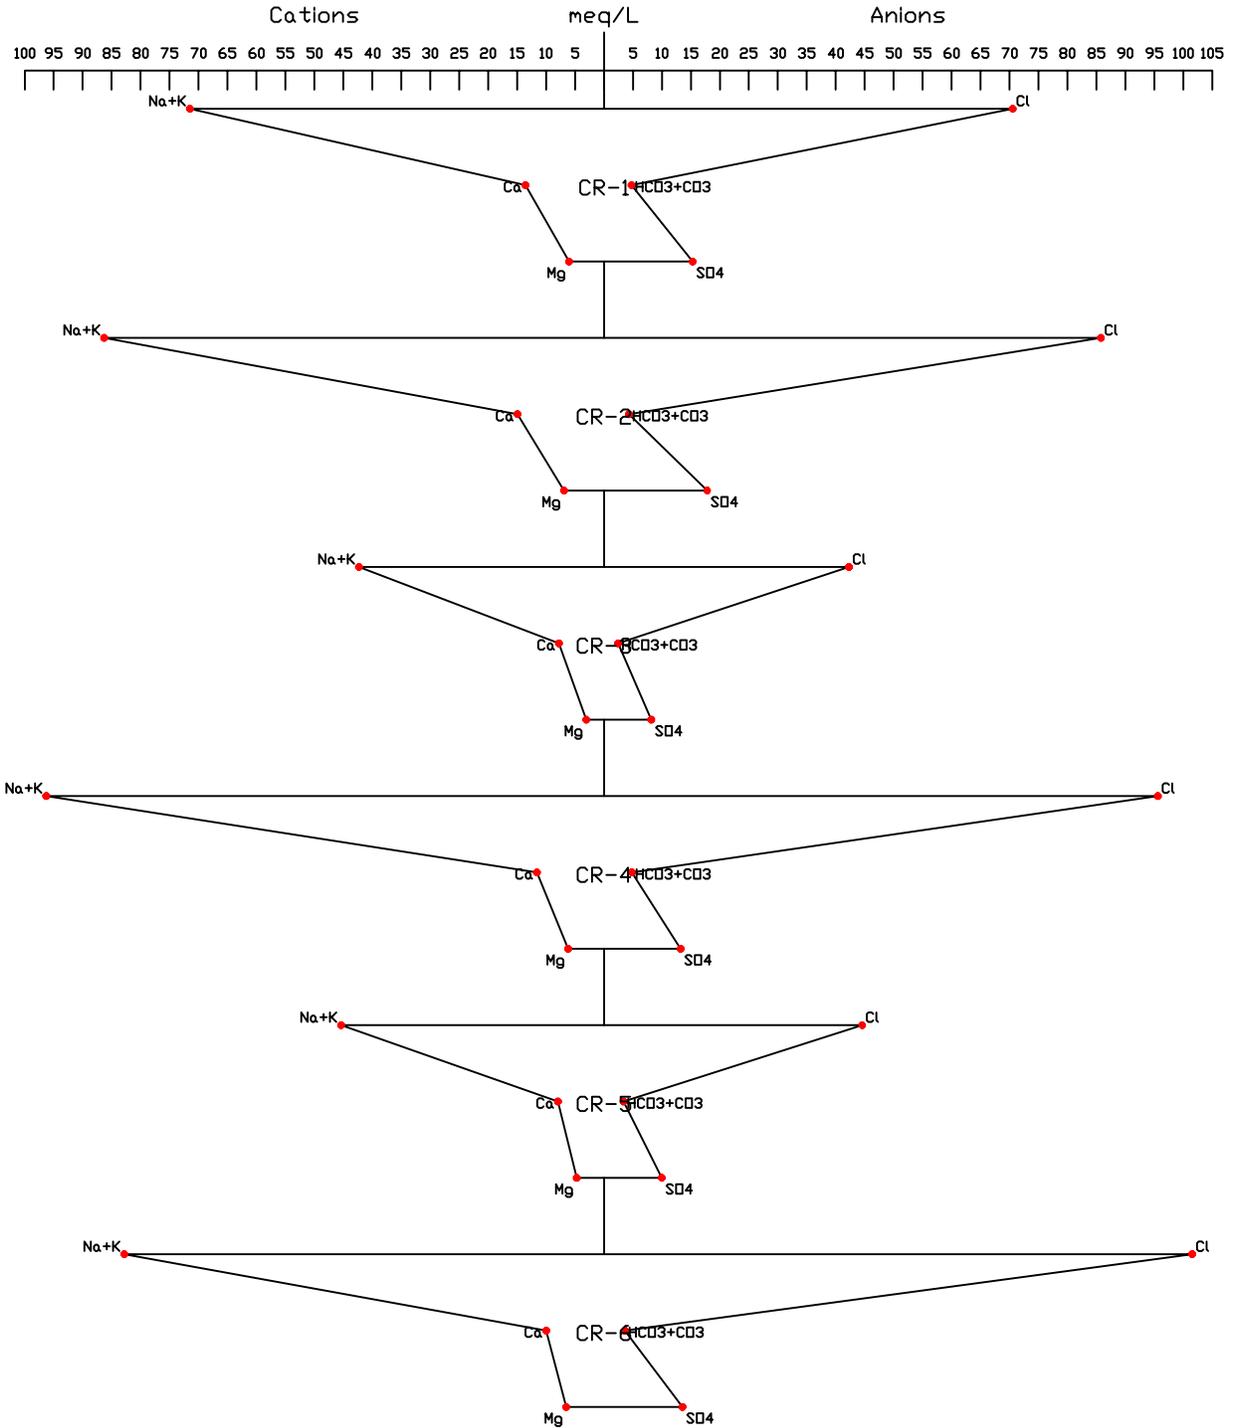

Consulting • Engineering • Remediation

PROJECT NO.: 04020-044-200

DRAWN: JAS

CHECKED: DJF

DATE: 7/22/05

DRAWING NO.:

APPENDIX A
 STIFF DIAGRAMS
 CIMARRON RIVER (1 of 1)
 CIMARRON CORPORATION
 CRESCENT, OKLAHOMA