
FORT CALHOUN STATION PERFORMANCE INDICATORS

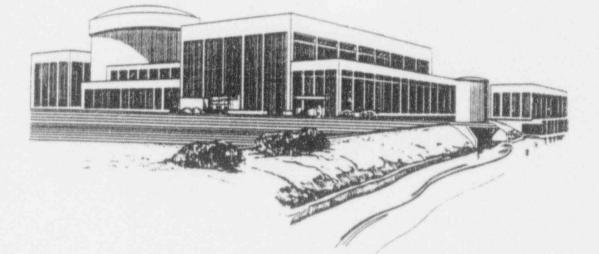

FEBRUARY 1994

SAFE OPERATIONS PERFCRMANCE EXCELLENCE COST EFFECTIVENESS

9404010192 940325 PDR ADOCK 05000285 R PDR

1 B

ŵ

Pursuit of excellence is an attitude... it involves wisdom and sound judgment ... it is a lifetime, career-long commitment... it is a way of life...it is doing the job right the first time, every time. It is inner-directed, not the result of external pressure, it is our own self worth-who we are and the pride and satisfaction that comes from being the right kind of person, not just in doing the right things. James J. O'Connor

OMAHA PUBLIC POWER DISTRICT FORT CALHOUN STATION PERFORMANCE INDICATORS REPORT

Prepared By: Production Engineering Division System Engineering Test and Performance Group

FEBRUARY 1994

FORT CALHOUN STATION FEBRUARY 1994 MONTHLY OPERATING REPORT

OPERATIONS SUMMARY

During the first week of February while Fort Calhoun Station operated at 100% power, scheduled Diesel Generator (DG) maintenance and modification outages were conducted for DG-1 and DG-2. Each was successfully completed and the diesel generators were returned to operable status.

On Friday, February 11, 1994 at 0340 hours, the plant experienced an unplanned automatic reactor trip from 100 percent power. The trip occurred following a failure of the supervisory relay 86B/CPHSS which resulted in tripping the Containment Pressure High Signal (CPHS) lockout relay 86B/CPHS. The CPHS relay trip actuated the Safety Injection Actuation Signal (SIAS), Containment Isolation Actuation Signal (CIAS), Ventilation Isolation Actuation Signal (VIAS) and Steam Generator Isolation Signal (SGIS). SGIS automatically closed both main steam isolation valves, which resulted in a concurrent turbine and reactor trip. Details of this event, including corrective actions, are included in Licensee Event Report 94-001.

Following completion of the post-trip assessment and replacement of the failed relay, 86B/ CPHSS, the reactor was taken critical at 1324 on February 12. The generator was synchronized to the grid at 0415 on February 13. Power ascension was commenced, and the station returned to 100 percent power on February 17.

On February 15, OP-ST-DG-0002, a monthly surveillance test on Diesel Generator DG-2 was conducted. A portion of the test requires a manual start from a local pushbutton; however, the diesel generator did not start. The root cause of the problem was identified as broken pieces within the local pushbutton switch. The problem was corrected and the diesel generator was then successfully tested. The corresponding local pushbutton on the other diesel generator is routinely tested at approximately the same frequency, and has not exhibited similar problems.

On February 16, low water levels in both steam generators occurred. Narrow range instrument readings reached below the 65% alarm setpoint, but remained well above the 31.2% Reactor Protection System trip setpoint. It was determined that Condensate Recirculation Control Valve FCV-1172 had failed open, restricting feedwater flow to both generators. The valve was isolated, steam generator levels were returned to normal, and a maintenance work request was initiated. A pressure switch was repaired and the valve was returned to service later that day.

A one-hour report was made to the NRC on February 18 at 1101 hours because of the results of an engineering evaluation initiated after the February 11 reactor trip discussed above. The evaluation identified a concern involving a postulated premature actuation of either of two Safety Injection and Refueling Water "ank Low Signal (STLS) lockout relays, i.e., 86A/STLS or 86B/ STLS, due to a coil-shorting failure of a supervisory relay. If such a failure were to occur coincident with certain accidents, i.e., a Loss of Coolant Accident (LOCA), a Steam Generator Tube Rupture (SGTR), or a Main Steam Line Break (MSLB), a premature Recirculation Actuation Signal (RAS) could be generated. Such a premature RAS could result in loss of water to the High Pressure Safety Injection (HPSI), Low Pressure Safety Injection (LPSI) and Containment

FORT CALHOUN STATION FEBRUARY 1994 MONTHLY OPERATING REPORT

OPERATIONS SUMMARY (continued)

Spray pumps due to the realignment of the suction header from the Safety and Injection and Refueling Water Tank (SIRWT) to the containment sump. Details of this event, including corrective actions, are included in Licensee Event Report 94-001.

Power operation at 100 percent continued throughout the remainder of February 1994.

The following NRC inspection was completed during this reporting period:

IER No. Description


94-03 Monthly Resident Inspection

The following LER was submitted during this period:

LER No. Description


93-020 Ventilation Mode Requirement Not Met While Toxic Gas Monitors Inoperable Rev. 1

Source: Nuclear Licensing & Industry Affairs

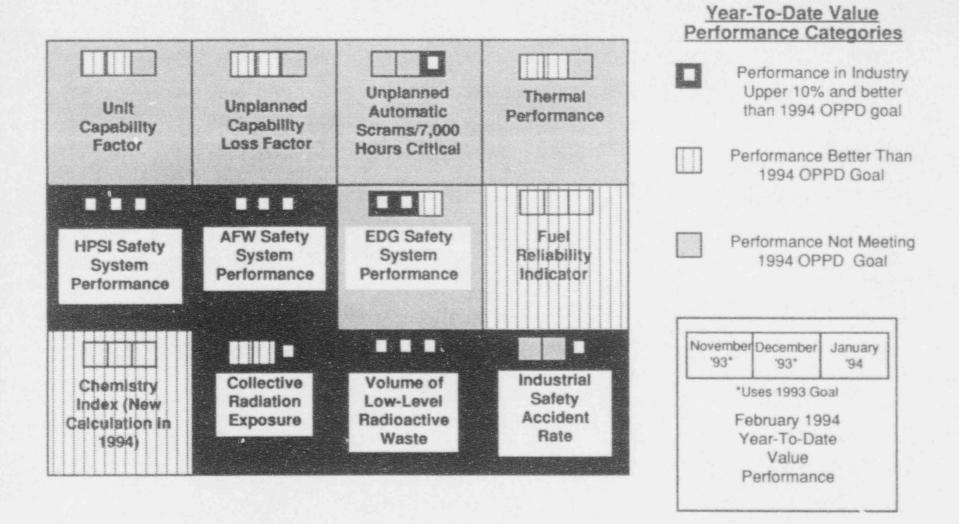

INPO PERFORMANCE INDICATORS

(Performance for the months of January through February 1994)

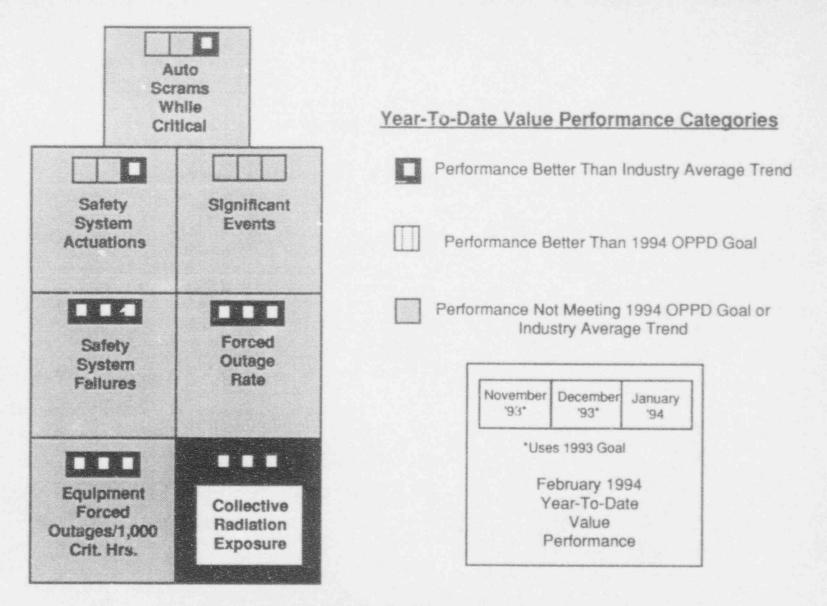

Z.

NRC PERFORMANCE INDICATORS

(Safety System Failures and Significant Events ratings are averages for October 1990 through September 1993. All other indicator values are for the months of January through February 1994.)

FORT CALHOUN STATION PERFORMANCE INDICATORS REPORT FEBRUARY 1994 - SUMMARY

POSITIVE TREND REPORT

A performance indicator with data representing three consecutive months of improving performance or three consecutive months of performance that is superior to the stated goal is exhibiting a positive trend per Nuclear Operations Division Quality Pr~ edure 37 (NOD-QP-37).

The following performance indicators exhibited positive trends for the reporting month:

Fuel Reliability Indicator (Page 11)

Emergency Diesel Generator Unit Reliability (Page 12)

Diesel Generator Reliability (25 Demands) (Page 13)

Emergency Diesel Generator Unreliability (Page 14)

Number of Missed Surveillance Tests Resulting in Licensee Event Reports (Page 20)

Forced Outage Rate (Page 23) Although the FOR has risen in recent months, performance has been superior to the 1993 and 1994 goals since September 1993.

Hazardous Waste Produced (Page 52)

End of Positive Trend Report.

ADVERSE TREND REPORT

A Performance Indicator with data representing 3 consecutive months of declining performance; or 3 consecutive months of performance that is not meeting the established goal; or four or more consecutive months of performance that is trending towards declining as determined by the Manager - Station Engineering, constitutes an adverse trend per NOD-OP-37. A supervisor whose performance indicator exhibits an adverse trend by this definition may specify in written form (to be published in this report) why the trend is not adverse.

The following performance indicators were exhibiting adverse trends for the reporting month.

Number of Control Room Equipment Deficiencies (Page 15)

An adverse trend is indicated based on more than 3 consecutive months of performance not meeting the established goal of a maximum of 45 deficiencies.

ADVERSE TREND REPORT (continued)

Document Review

(Page 55)

An adverse trend is indicated based on more than 3 consecutive months with document reviews more than 6 months overdue.

Temporary Modifications

(Page 57)

An adverse trend is indicated based on more than 3 consecutive months of performance not meeting the established goal of 0 temporary modifications removable online that are >6 months old.

End of Adverse Trend Report.

INDICATORS NEEDING INCREASED MANAGEMENT ATTENTION REPORT

A performance indicator with data for the reporting period that is inadequate when compared to the OPPD goal is defined as "Needing Increased Management Attention" per NOD-QP-37.

The following performance indicators are cited as needing increased management for the reporting month:

Recordable Injury/Illnesses Cases Frequency Rate (Page 4)

The recordable Injury/Illnesses cases frequency rate value for the reporting month (1.61) is above the 1994 goal of a maximum value of 1.5.

Emergency AC Power System Safety System Performance

(Page 10)

The emergency AC power system year-to-date unavailability value for the reporting month (0.0417) is above the 1994 year-end goal of a maximum value of 0.025. (The large increase in the number of unavailable hours during February reflects maintenance outages for both diesel generators.)

Unit Capability Factor

(Page 25)

The year-to-date UCF value of 90.0% is below the 1994 year-end goal of a minimum of 96.03%.

Unplanned Capability Loss Factor

(Page 26)

The year-to-date UCLF value of 9.97% is above the 1994 year-end goal of a maximum of 3.97%.

FORT CALHOUN STATION PERFORMANCE INDICATORS REPORT FEBRUARY 1994 - SUMMARY

INDICATORS NEEDING INCREASED MANAGEMENT ATTENTION REPORT (continued)

Unplanned Automatic Reactor Scrams per 7,000 Hours Critical (Page 27)

The year-to-date number of unplanned automatic reactor scrams per 7,000 hours critical (5.06) exceeds the 1994 goal of 0.

Unplanned Safety System Actuations - (INPO Definition) (Page 28)

The number of INPO unplanned safety system actuations for 1994 (1) exceeds the goal of 0.

Unplanned Safety System Actuations - (NRC Definition) (Page 29)

The number of NRC unplanned safety system actuations for 1994 (1) exceeds the goal of 0.

Thermal Performance

(Page 31)

The year-to-date average monthly thermal performance value for the reporting month (99.2%) is below the 1994 year-end goal of 99.55%.

Equipment Forced Outages per 1,000 Critical Hours (Page 33)

The year-to-date number of equipment forced outages per 1,000 critical hours (0.723) exceeds the 1994 yearend goal of 0.20.

Primary System Chemistry Percent of Hours Out of Limit (Page 38)

The primary system chemistry percent of hours out of limit for the reporting month (2.4%) exceeds the 1994 goal of a maximum of 2%.

Percentage of Total MWOs Completed per Month Identified as Rework

(Page 47)

The percentage of total MWOs completed per month identified as rework for the reporting month (4.56%) exceeds the 1994 monthly goal of a maximum of 3%.

End of Management Attention Report.

PERFORMANCE INDICATOR REPORT IMPROVEMENTS/CHANGES

This section lists significant changes made to the report and to specific indicators within the report since the previous month.

The Definition of an Adverse Trend has been expanded to include 3 consecutive months of performance that is not meeting the established goal.

Revised INPO Industry Upper 10% Values have been included in this report based on the INPO 1993 Year-End Report.

INPO and NRC Annunciator Windows have been revised to be based on year-to-date performance values rather than 12 month performance values.

Gross Heat Rate

(Page 30) The graph for this indicator has been revised to show a lower GHR for January 1994.

Engineering Change Notice Status

(Page 60)

Graphs have been added to this indicator to depict ECNs by type, location and priority.

Document Change Engineering Change Notices Open (Page 61)

This indicator was formerly titled "Engineering Change Notice Breakdown". The graphs have been revised.

End of Performance Indicator Report Improvements/ Changes Report

Table of Contents/Summary

	PAGE
<u>GOALS</u>	X
SAFE OPERATIONS	PAGE
INDUSTRIAL SAFETY ACCIDENT RATE - INPO	
DISABLING INJURY/ILLNESS FREQUENCY RATE	
RECORDABLE INJURY/ILLNESS CASES FREQUENCY RATE	
CLEAN CONTROLLED AREA CONTAMINATIONS 21,000 DISINTEGRATIONS/MINUTE PER PROBE AREA	
PREVENTABLE/PERSONNEL ERROR LERs	
SAFETY SYSTEM FAILURES	
SAFETY SYSTEM PERFORMANCE HIGH PRESSURE SAFETY: INJECTION SYSTEM AUXILIARY FEEDWATER SYSTEM EMERGENCY AC POWER SYSTEM	
FUEL RELIABILITY INDICATOR	
EMERGENCY DIESEL GENERATOR UNIT RELIABILITY	
EMERGENCY DIESEL GENERATOR RELIABILITY (25 DEMANDS)	
EMERGENCY DIESEL GENERATOR UNRELIABILITY	
NUMBER OF CONTROL ROOM EQUIPMENT DEFICIENCIES	
COLLECTIVE RADIATION EXPOSURE	
MAXIMUM INDIVIDUAL RADIATION EXPOSURE	
VIOLATIONS PER 1,000 INSPECTION HOURS	
SIGNIFICANT EVENTS	
NUMBER OF MISSED SURVEILLANCE TESTS RESULTING IN LERS	

PERFORMANCE (continued)	PAGE
EQUIVALENT AVAILABILITY FACTOR	
UNIT CAPABILITY FACTOR	
UNPLANNED CAPABILITY LOSS FACTOR	
UNPLANNED AUTOMATIC REACTOR SCRAMS PER 7,000 HOURS CRITICAL	
UNPLANNED SAFETY SYSTEM ACTUATIONS - (INPO DEFINITION)	
UNPLANNED SAFETY SYSTEM ACTUATIONS - (NRC DEFINITION)	
GROSS HEAT RATE	
THERMAL PERFORMANCE	
DAILY THERMAL OUTPUT	
EQUIPMENT FORCED OUTAGES PER 1,000 CRITICAL HOURS	
COMPONENT FAILURE ANALYSIS REPORT (CFAR) SUMMARY	
REPEAT FAILURES	
CHECK VALVE FAILURE RATE	
VOLUME OF LOW-LEVEL SOLID RADIOACTIVE WASTE	
PRIMARY SYSTEM CHEMISTRY PERCENT OF HOURS OUT OF LIMIT	
CHEMISTRY INDEX/SECONDARY SYSTEM CHEMISTRY	

COST

PAGE

CENTS PER KILOWATT HOUR	61
STAFFING LEVEL	42
SPARE PARTS INVENTORY VALUE	43

DIVISION AND DEPARTMENT PERFORMANCE INDICATORS	PAGE
MAINTENANCE WORKLOAD BACKLOGS (CORRECTIVE NON-OUTAGE)	

DIVISION AND DEPARTMENT PERFORMANCE INDICATORS (continued)

RATIO OF PREVENTIVE TO TOTAL MAINTENANCE & PREVENTIVE MAINTENANCE ITEMS OVERDUE	
PERCENTAGE OF TOTAL MWOS COMPLETED PER MONTH IDENTIFIED AS REWORK	
MAINTENANCE OVERTIME	
PROCEDURAL NONCOMPLIANCE INCIDENTS (MAINTENANCE)	
PERCENT OF COMPLETED SCHEDULED MAINTENANCE ACTIVITIES (ALL MAINTENANCE CRAFTS)	
IN-LINE CHEMISTRY INSTRUMENTS OUT-OF-SERVICE	51
HAZARDOUS WASTE PRODUCED	
CONTAMINATED RADIATION CONTROLLED AREA	
RADIOLOGICAL WORK PRACTICES PROGRAM	
DOCUMENT REVIEW	
LOGGABLE/REPORTABLE INCIDENTS (SECURITY)	
TEMPORARY MODIFICATIONS	
OUTSTANDING MODIFICATIONS	
ENGINEERING ASSISTANCE REQUEST (EAR) BREAKDOWN	59
ENGINEERING CHANGE NOTICE STATUS	
ENGINEERING CHANGE NOTICE BREAKDOWN	
LER ROOT CAUSE BREAKDOWN	
LICENSED OPERATOR REQUALIFICATION TRAINING	
LICENSE CANDIDATE EXAMS	
OPEN CORRECTIVE ACTION REPORTS AND INCIDENT REPORTS	
MWO PLANNING STATUS (CYCLE 16 REFUELING OUTAGE)	
PROGRESS OF CYCLE 16 MODIFICATION PLANNING	67
PROGRESS OF 1994 ON LINE MODIFICATION PLANNING	

PAGE

ACTION PLANS, DEFINITIONS, SEP INDEX & DISTRIBUTION LIST	PAGE
ACTION PLANS FOR ADVERSE TRENDS	
PERFORMANCE INDICATOR DEFINITIONS	
SAFETY ENHANCEMENT PROGRAM INDEX	
REPORT DISTRIBUTION LIST	

OPPD NUCLEAR ORGANIZATION GOALS

Vice President - 1994 Priorities

MISSION

The safe, reliable and cost effective generation of electricity for OPPD customers through the professional use of nuclear technology. The Company shall conduct these operations prudently, efficiently and effectively to assure the health, safety and protection of all personnel, the general public and the environment.

GOALS

Goal 1: SAFE OPERATIONS

To ensure the continuation of a "safety culture" in the OPPD Nuclear Program and to provide a professional working environment, in the control room and throughout the OPPD nuclear organization, that assures safe operation so that Fort Calhoun Station is recognized as a nuclear industry leader.

1994 Priorities: Improve SALP ratings. Improve INPO rating. Reduce NRC violations with no violations more severe than level 4. No unplanned automatic reactor scrams or safety system actuations.

Goal 2: PERFORMANCE

To strive for Excellence in Operations utilizing the highest standards of performance at Fort Calhoun Station that result in safe, reliable plant operation in power production.

1994 Priorities:
Improve Quality, Professionalism, and Teamwork.
Improve Plant Reliability.
Meet or exceed INPO key parameters and outage performance goals.
Reduce the number of human performance errors.
Identify programmatic performance problems through effective self assessment.

Goal 3: COSTS

Operate Fort Calhoun Station in a manner that cost effectively maintains nuclear generation as a viable source of electricity.


1994 Priorities:

Maintain total O & M and Capital expenditures within budget. Streamline work processes to improve cost effectiveness.

Goals Source: Scofield (Manager)

SAFE OPERATIONS

Goal: To ensure the continuation of a "safety culture" in the OPPD Nuclear Program and to provide a professional working environment in the control room and throughout the OPPD Nuclear Organization that assures safe operation so that Fort Calhoun Station is recognized as a nuclear industry leader.

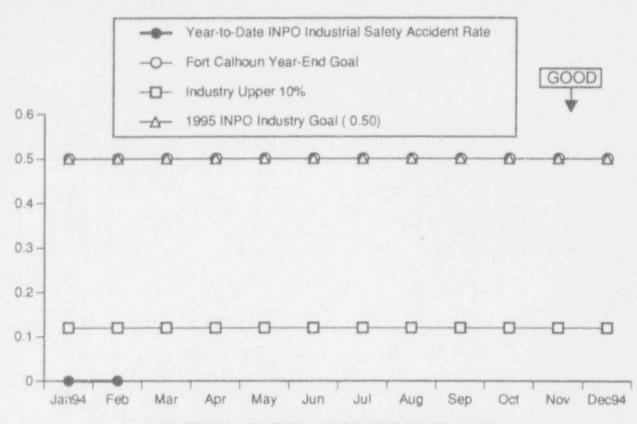

INDUSTRIAL SAFETY ACCIDENT RATE - INPO

As stated in INPO's December 1993 publication 'Detailed Descriptions of World Association of Nuclear Operators (WANO) Performance Indicators and Other Indicators for Use at U.S. Nuclear Power Plants': "The purpose of this indicator is monitor progress in improving industrial safety performance for utility personnel permanently assigned to the station. Accident rate was chosen by INPO as the personnel safety indicator over other indicators, such as the injury rate or severity rate, because the criteria are clearly defined, utilities currently collect this data, and the data is least subjective."


The INPO industrial safety accident rate value year-to-date was 0.0 at the end of February. The value for the 12 months from March 1, 1993 through February 28, 1994 was 0.76.

The values for this indicator are determined as follows:

(number of restricted-time + lost-time accidents + fatalities) X 200.000 (number of station person-hours worked)

The 1994 Fort Calhoun year-end goal is ≤ 0.50 . The 1995 INPO industry goal is ≤ 0.50 . The approximate industry upper ten percentile value (for the period from 1/93 through 12/93) is 0.12.

Data Source: Sorensen/Skaggs (Manager/Source) Chase/Booth (Manager/Source) Accountability: Chase/Conner Adverse Trend: None

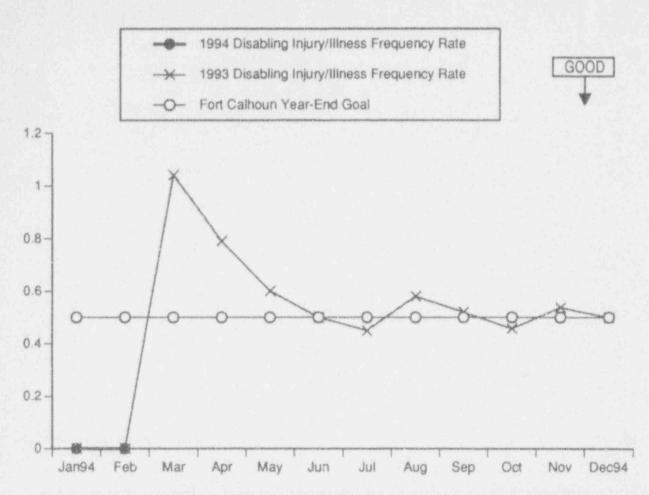

DISABLING INJURY/ILLNESS FREQUENCY RATE (LOST TIME ACCIDENT RATE)

This indicator shows the 1994 disabling injury/illness frequency rate. The 1993 disabling injury/illness frequency rate is also shown.

The disabling injury/illness frequency rate for January through February 1994 was 0.0. There were no lost time accidents reported for February.

The disabling injury/illness frequency rate for the 12 months from March 1, 1993 through February 28, 1994 was 0.38.


The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 0.5.

Data Source: Sorenson/Skaggs (Manager/Source)

Accountability: Chase/Conner

Adverse Trend: None

SEP 25, 26 & 27

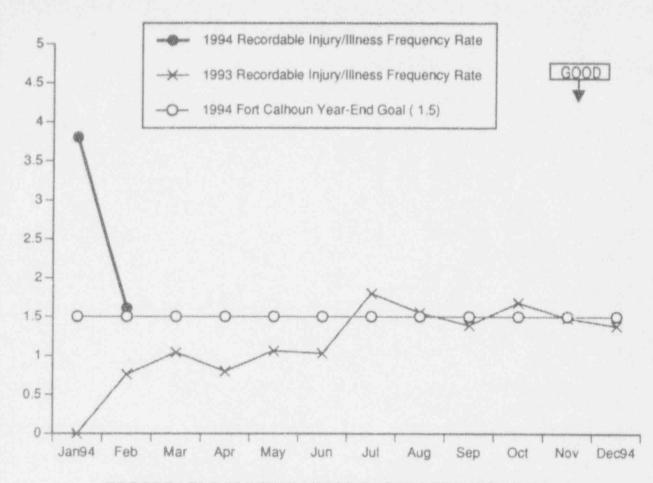

RECORDABLE INJURY/ILLNESS CASES FREQUENCY RATE

This indicator shows the 1994 recordable injury/illness cases frequency rate. The 1993 recordable injury/illness cases frequency rate is also shown.

A recordable injury/illness case is reported if personnel from any of the Nuclear Divisions are injured on the job and require corrective medical treatment beyond first aid. The recordable injury/illness cases frequency rate is computed on a year-to-date basis.

The recordable injury/illness rate for January through February 1994 was reported as 1.61. There were 2 recordable injury/illness cases reported for the month of February.

The recordable injury/illness rate for the 12 months from March 1, 1993 through February 28, 1994 was 1.52.


The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 1.5.

Data Source: Sorenson/Skaggs (Manager/Source)

Accountability: Conner

Adverse Trend: None

SEP 15, 25, 26 & 27

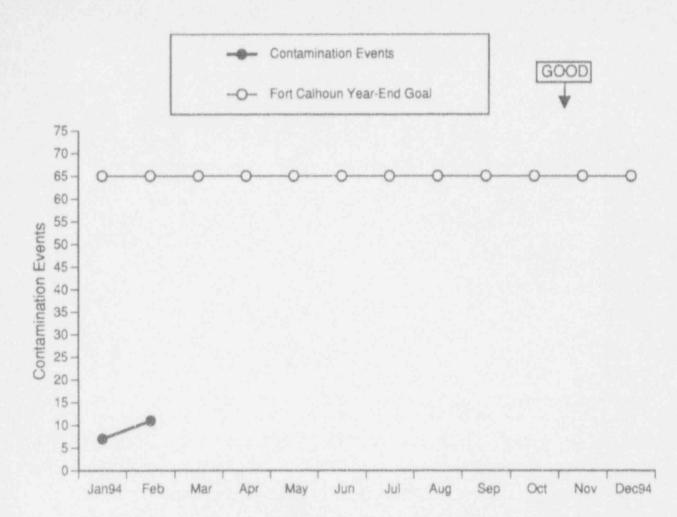

CLEAN CONTROLLED AREA CONTAMINATIONS ≥1,000 DISINTEGRATIONS/ MINUTE PER PROBE AREA

This indicator shows the Personnel Contamination Events in the Clean Controlled Area for contaminations ≥1,000 disintegrations/minute per probe area for the reporting month.

There were 4 contamination events in February 1994. There has been a total of 11 contamination events in 1994.


The 1994 year-end goal for this indicator is a maximum of 65 contamination events.

Data Source: Chase/Little (Manager/Source)

Accountability: Chase/Lovett

Adverse Trend: None

SEP 15 & 54

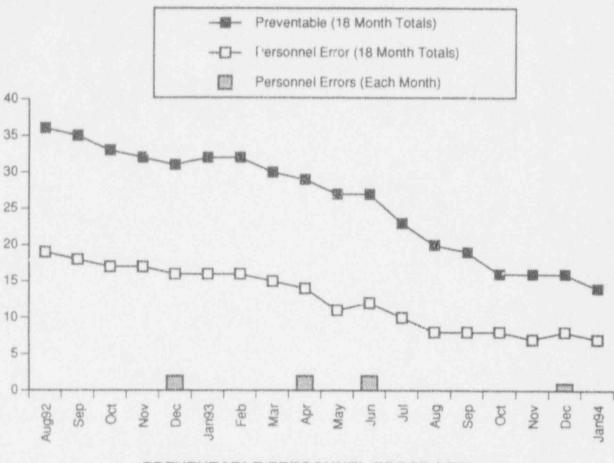

PREVENTABLE/PERSONNEL ERROR LERS

This indicator depicts 18 month totals for numbers of "Preventable" and "Personnel Error" LERs.

The graph shows the 18 month totals for preventable LERs, the 18 month total for personnel error LERs and the personnel error totals for each month. The LERs are trended based on the LER event date as opposed to the LER report date.

In January 1994, there were no events that were subsequently reported as LERs. Consequently, no LERs were categorized as Preventable or Personnel Error.


The total LERs for the year 1994 (through January 31, 1994) is (. The total personnel error LERs for the year 1994 is 0.

The 1994 goals for this indicator are that the year-end values for the 18 month totals be no more than 12 Preventable and 5 Personnel Error LERs. (Note: Because this indicator is based on an 18 month period, the 1994 year-end totals will include LERs occurring in 1994 and the last 6 months of 1993.)

Data Source: Short/Cavanaugh (Manager/Source) Accountability: Chase Adverse Trend: None

SEP 15

6

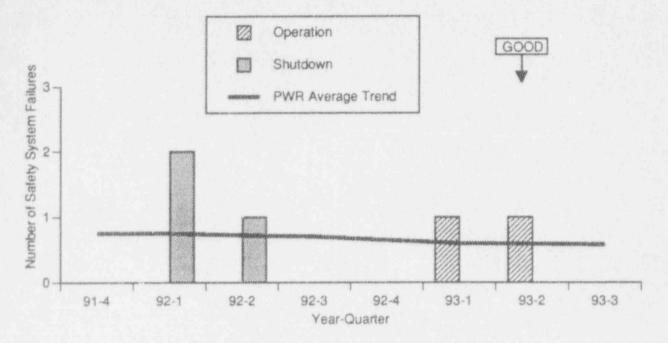

SAFETY SYSTEM FAILURES

This indicator illustrates the number of NRC Safety System Failures as reported by the Nuclear Regulatory Commission's Office for Analysis and Evaluation of Operational Data in the biannual "Pe formance Indicators for Operating Commercial Nuclear Power Reactors" report.

The following NRC safety system failures occurred between the fourth quarter of 1991 and the third quarter of 1993:


First Quarter 1992: 1) Defective control switches in the 4KV switchgear could have rendered safety equipment inoperable. 2) All 4 channels of the SG DP trip for RPS had been calibrated nonconservatively. This occurred due to an incorrect procedure which specified a tolerance band that was too wide.

Second Quarter 1992: Fuse and breaker coordination problems for the DC buses could cause a loss of the entire bus if a fault occurred on one of the loads.

First Quarter 1993: The SG low pressure scram signal block reset values, for all 4 channels of both SGs, were greater than the allowed limits, rendering this scram input inoperable during certain operating conditions.

Second Quarter 1993: A section of the piping configuration for the borated water source of the safety injection system was not seismically qualified. This could have resulted in a failure of the system to meet design requirements during a seismic event.

Data Source: Nuclear Regulatory Commission Accountability: Chase Adverse Trend: None

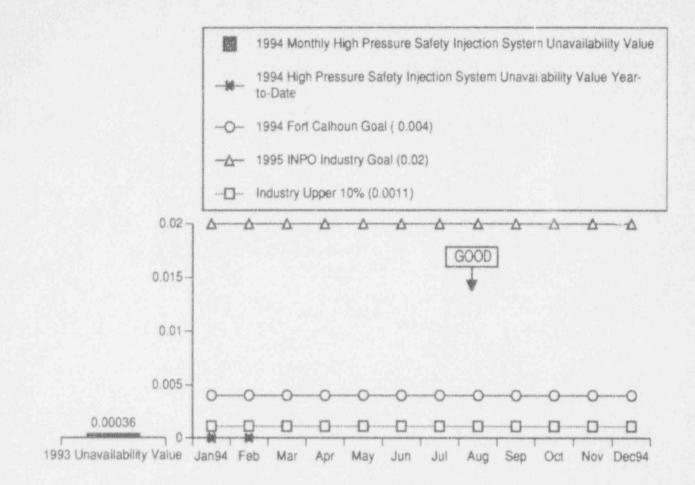

HIGH PRESSURE SAFETY INJECTION SYSTEM SAFETY SYSTEM PERFORMANCE


This indicator shows the High Pressure Safety Injection System unavailability value, as defined by INPO in the Safety System Performance Indicator Definitions, for the reporting month.

The High Pressure Safety Injection System unavailability value for the month of February 1994 was 0.0. There were no hours of planned or unplanned unavailability during the month. The 1994 year-to-date HPSI unavailability value was 0.0 at the end of February. The unavailability value for the last 12 months was 0.000293.

There have been no hours of planned unavailability (for maintenance and surveillance tests) and no hours of unplanned unavailability for the HPSI system in 1994.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 0.004. The 1995 INPO industry goal is 0.02 and the industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 0.0011.

Data Source: Jaworski/Schaffer Accountability: Jaworski/Schaffer Adverse Trend: None

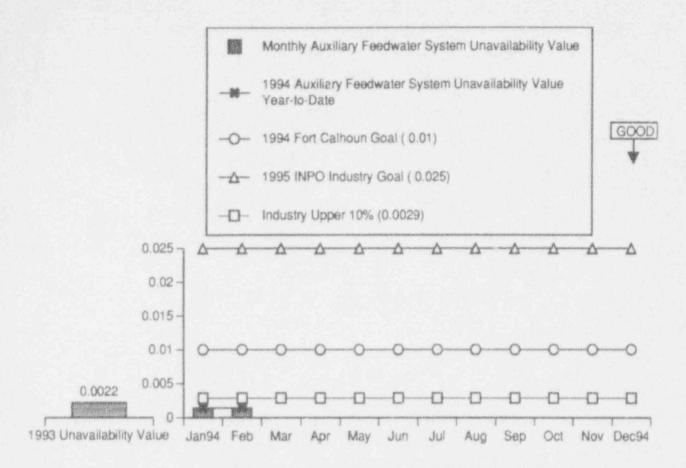

AUXILIARY FEEDWATER SYSTEM SAFETY SYSTEM PERFORMANCE

This indicator shows the Auxiliary Feedwater System Unavailability value, as defined by INPO in the Safety System Performance Indicator Definitions, for the reporting month.


The Auxiliary Feedwater System Unavailability Value for February 1994 was 0.00143. There was at total of 1.83 hours of unplanned unavailability for repair of YCV-1045 leakage during the month. The year-to-date unavailability value was 0.00145, and the value for the last 12 months was 0.00207 at the end of February.

There has been a total of 1.25 hours of planned unavailability (for surveillance tests) and 2.76 hours of unplanned unavailability for the auxiliary feedwater system in 1994.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 0.01.

The 1995 INPO industry goal is 0.025 and the industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 0.002.

Data Source: Jaworski/Nay Accountability: Jaworski/Nay Adverse Trend: None

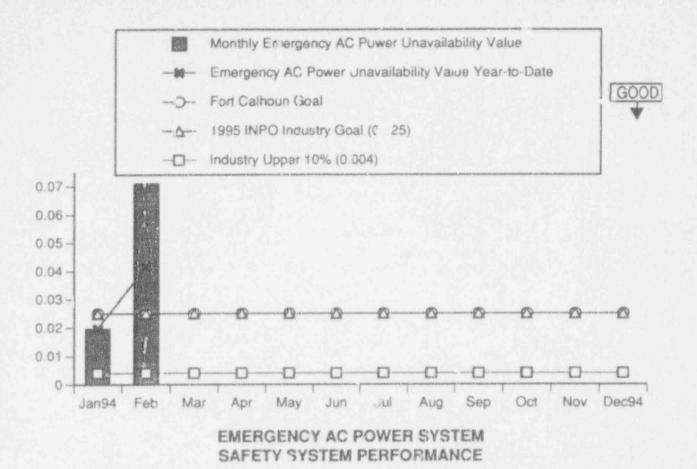

This indicator shows the Emergency AC Power System unavailability value, as defined by INPO in the Safety System Performance Indicator Definitions, for the reporting month.


The Emergency AC Power System unavailability value for February 1994 was 0.0709. During the month, there were 89 hours of planned unavailability for surveillance tests and maintenance, and 6.25 hours of unplanned unavailability due to the failure of the emergency start pushbutton. (The large increase in the number of unavailable hours during February reflects the maintenance outages on both diesel generators.) The Emergency AC Power System unavailability value year-to-date was 0.0417 and the value for the last 12 months was 0.0087 at the end of February.

There has been a total of 118.15 hours of planned unavailability (for surveillance tests and maintenance) and 6.25 hours of unplanned unavailability for the emergency AC power system in 1994.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 0.025.

The 1995 INPO industry goal is 0.025 and the industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 0.004.

Data Source: Jaworski/Ronning Accountability: Jaworski/Ronning Adverse Trend: None 10

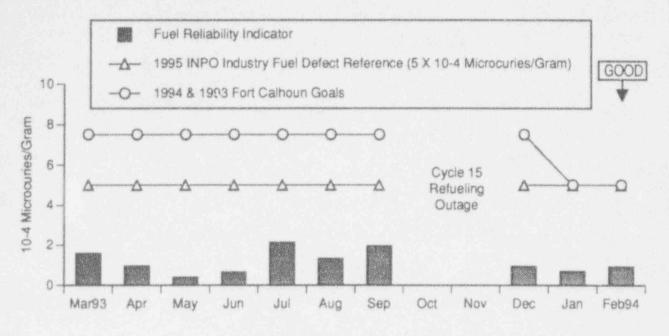

FUEL RELIABILITY INDICATOR


The Fuel Reliability Indicator (FRI) value for February 1994 was 0.931 X 10-4 microcuries/gram. The purpose of the FRI is to monitor industry progress in achieving and maintaining a high level of fuel integrity. The February FRI value, which is less than the zero defect threshold value, discussed below, indicates a defect free core. Except for a trip and power recovery from February 11 through 16, the plant operated at full power. The February FRI was calculated based on the average fission product activities present in the reactor coolant during the steady state full power operation days, February 1 through 10 and February 20 through 28.

The February FRI value of 0.931 X 10⁻⁴ microcuries/gram is comparable to the December 1993 and January 1994 FRI values of 0.944 X 10⁻⁴ and 0.701 X 10⁻⁴microcuries/gram respectively.

Fission product activity data from February full power operation, trip and power ascension show no Xenon -133 activity increase and no iodine spiking due to fuel defects. A slight increase in lodine 134 seen on February 18 was due to a reduction in purification letdown flow from 73 to 33 gpm. The last detected fuel failure was during Cycle 13.

The INPO September 1992 Report "Performance Indicators for U.S. Nuclear Utility Industry" (INPO No. 92-011) states that "...the 1995 industry goal for fuel reliability is that units should strive to operate with zero fuel defects. A value larger than 5.0 X 10⁻⁴ microcuries/gram indicates a high probability of unit operation with one or more fuel defects. The determination of current defect-free operation requires more sophisticated analysis by utility reactor engineers." The value of 5.0 X 10⁻⁴ microcuries/gram is defined as a "Fuel Defect Reference" number or a "Zero Leaker Threshold". Each utility will calculate whether the core is defect free or not. The 1994 Fort Calhoun Station FRI performance indicator goal will be to maintain a monthly FRI below 5.0 X 10-4 microcuries/gram.

Data Source: Holthaus/Guliani Accountability: Chase/Spilker Positive Trend

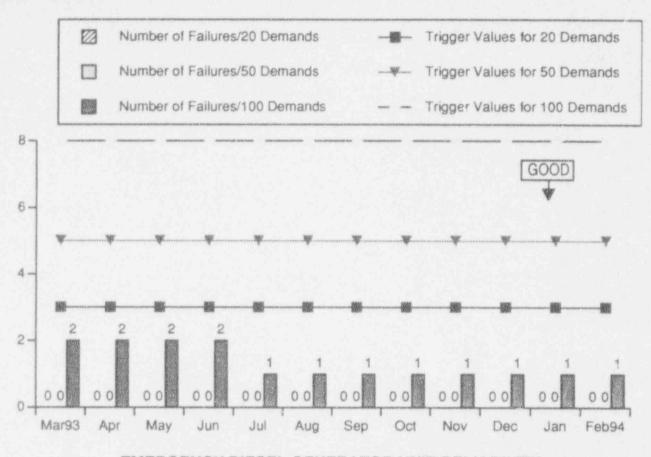


EMERGENCY DIESEL GENERATOR UNIT RELIABILITY

This bar graph shows three monthly indicators pertaining to the number of failures that were reported during the last 20, 50, and 100 emergency diesel generator demands at the Fort Calhoun Station. Also shown are trigger values which correspond to a high level of confidence that a unit's diesel generators have obtained a reliability of greater than or equal to 95% when the failure values are below the corresponding trigger values. The Fort Calhoun 1994 goal is to have fewer failures than these trigger values.

The demands counted for this indicator include the respective number of starts and the respective number of load-runs for both Diesel Generators combined. The number of start demands includes all valid and inadvertent starts, including all start-only demands and all start demands that are followed by load-run demands, whether by automatic or manual initiation. Load-run demands must follow successful starts and meet at least one of the following criteria: a load-run that is a result of a real load signal, a load-run test expected to carry the plant's load and duration as stated in the test specifications, and a special test in which a diesel generator was expected to be operated for a minimum of one hour and to be loaded with at least 50% of design load (see exceptions and other demand criteria in the Definition Section of this report).

Data Source: Jaworski/Ronning (Manager/Source) Accountability: Jaworski/Ronning Positive Trend

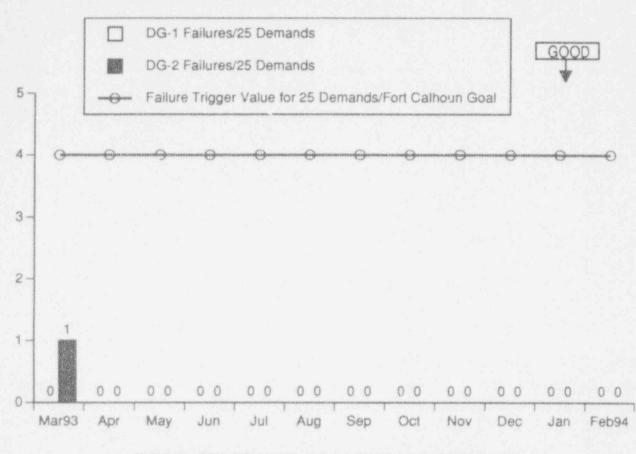

DIESEL GENERATOR RELIABILITY (25 DEMANDS)


This indicator shows the number of failures experienced by each emergency diesel generator during the last 25 start demands and the last 25 load-run demands. A trigger value of 4 failures within the last 25 demands is also shown. This trigger value of 4 failures within 25 demands is the Fort Calhoun goal for 1994.

It must be emphasized that, in accordance with NUMARC criteria, certain actions will take place in the event that any one emergency diesel generator experiences 4 or more failures within the last 25 demands on the unit. These actions are described in the Definitions Section of this report. A System Engineering Instruction has been approved for the Fort Calhoun Station to institutionalize and formally approve/adopt the required NUMARC actions.

Diesel Generator DG-1 has not experienced any failures during the last 25 demands on the unit.

Diesel Generator DG-2 has not experienced any failures during the last 25 demands on the unit.

Data Source: Jaworski/Ronning (Manager/Source) Accountability: Jaworski/Ronning Positive Trend

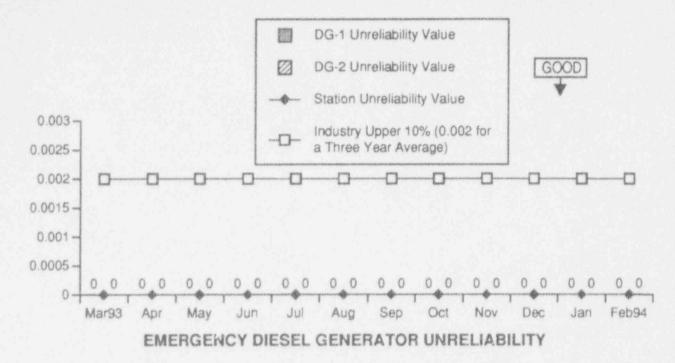

The purpose of this indicator is to monitor the likelihood that emergency AC power generators will respond to off-normal events or accidents. It also provides an indication of the effectiveness of maintenance, operation and test practices in controlling generator unreliability.

The year-to-date station EDG unreliability value at the end of February 1994 was 0.0. The 1994 goal for this indicator is a maximum value of 0.05.

For DG-1: There were 4 start demands for the reporting month without failures. In addition, there was 1 load-run demand without failure.

For DG-2: There were 6 start demands for the reporting month without failures. In addition, there were 2 load-run demands without failures.

Emergency diesel generator unreliability is calculated as follows:


value per $DG = SU + LU - (SU \times LU)$

where SU = Start Unreliability = number of unsuccessful starts number of valid start demands

LU = Load-run Unreliability = number of unsuccessful load-runs number of valid load-run demands

Station Value = average of DG-1 and DG-2 values

Data Source: Jaworski/Ronning (Manager/Source) Accountability: Jaworski/Ronning Positive Trend

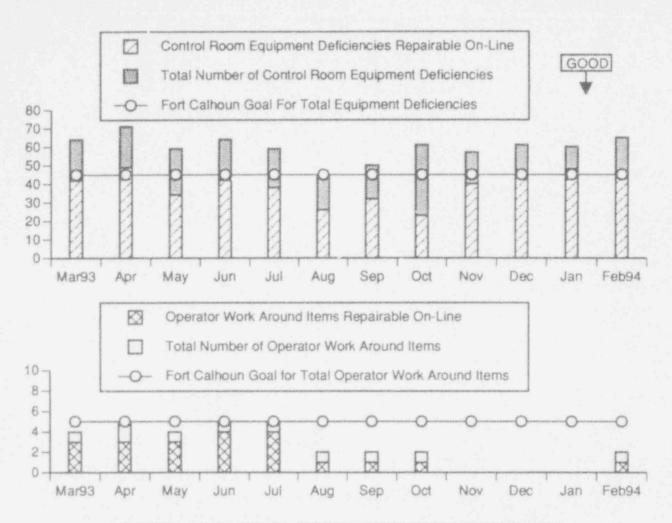

NUMBER OF CONTROL ROOM EQUIPMENT DEFICIENCIES

This indicator shows the number of control room equipment deficiencies that are repairable during plant operations (on-line), the total number of control room equipment deficiencies, the number of Operator Work Around (OWA) Items repairable on-line, the total number of OWAs and the Fort Calhoun goals.

There was a total of 65 control room equipment deficiencies at the end of February 1994. 44 of these deficiencies are repairable on-line and 21 require a plant outage to repair. There were 8 deficiencies added and 3 deficiencies completed during the month.


There were 2 identified Operator Work Around Items at the end of the month.

The 1994 Fort Calhoun monthly goal for this indicator is a maximum of 45 deficiencies and 5 OWAs.

Data Source: Chase/Tills (Manager/Source)

Accountability: Chase/Faulhaber

Adverse Trend: An adverse trend is indicated based on more than 3 consecutive months of performance not meeting the established goal.

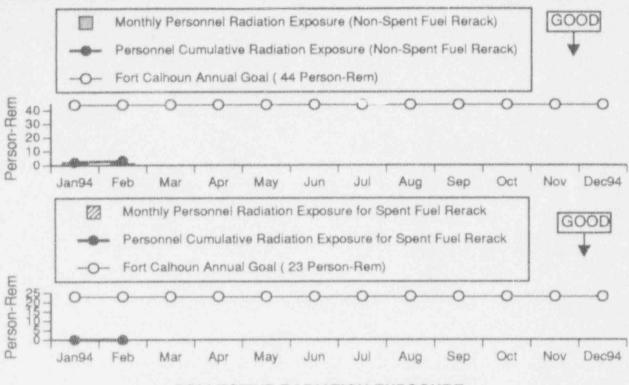

COLLECTIVE RADIATION EXPOSURE

The 1994 Fort Calhoun goal for collective radiation exposure, excluding the spent fuel rerack, is less than 44 person-Rem.

> The exposure for February 1994 was 1.123 person-Rem. The year-to-date exposure was 3.064 person-Rem at the end of February.


The Fort Calhoun goal for collective radiation exposure to complete the Spent Fuel Rerack is less than 23 person-Rem.

The Spent Fuel Rerack exposure for February was 0.020 person-Rem. The Spent Fuel Rerack exposure year-to-date was 0.044 person-Rem at the end of February.

The collective radiation exposure at the end of February (i.e., the sum of non-spent fuel rerack exposure and spent fuel rerack exposure) was 3.108 person-Rem. The collective radiation exposure for the last 12 months was 156.209 person-Rem at the end of February.

The 1995 INPO industry goal for collective radiation exposure is 185 person-rem per year. The industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 110.5 person-rem per year. The yearly average for Fort Calhoun Station for the three years from 3/91 through 2/94 was 151.818 person-rem per year.

Data Source: Chase/Little (Manager/Source) Accountability: Chase/Lovett Adverse Trend: None 16

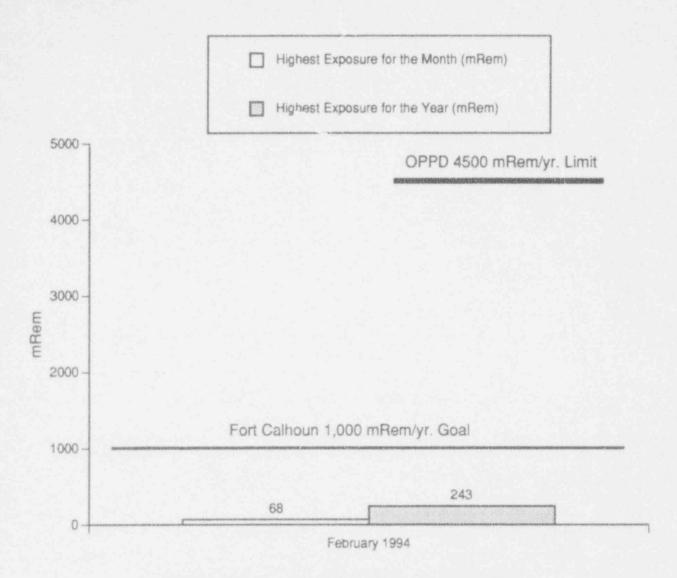

MAXIMUM INDIVIDUAL RADIATION EXPOSURE

During February 1994, an individual accumulated 68 mRem, which was the highest individual exposure for the month.


The maximum individual exposure for the year was 243 mRem at the end of February.

The OPPD limit for the maximum yearly individual radiation exposure is 4,500 mRem/ year. The 1994 Fort Calhoun year-end goal is a maximum of 1,000 mRem.

Date Source: Chase/Little (Manager/Source)

Accountability: Chase/Lovett

Adverse Trend: None

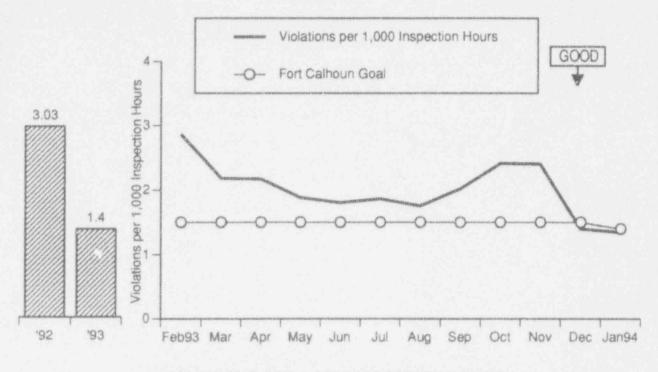

VIOLATIONS PER 1,000 INSPECTION HOURS

This indicator displays the number of NRC violations cited in inspection reports per 1,000 NRC inspection hours. This indicator is one month behind the reporting month due to the time involved with collecting and processing the data.

The violations per 1,000 inspection hours indicator was reported as 1.35 for the twelve months from February 1, 1993 through January 31, 1994.

The following inspections ended during this reporting period:


IER No.	Title	No. of Hours
94-03	Resident Monthly Inspection	480

To date, OPPD has received no violations in 1994:

Level III Violations	(0)
Level IV Violations	(0)
Level V Violations	(0)
Non-Cited Violations (NCV)	(0)

The 1994 Fort Calhoun goal for this indicator is a maximum of 1.4 violations per 1,000 inspection hours.

Data Source: Short/Cavanaugh (Manager/Source) Accountability: Short Adverse Trend: None

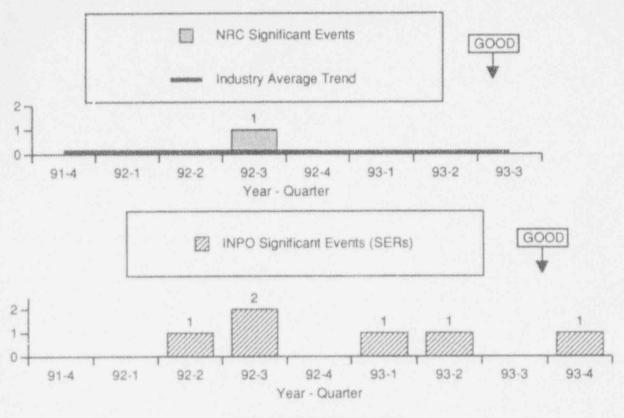



This indicator illustrates the number of NRC and INPO Significant Events for Fort Calhoun Station as reported by the Nuclear Regulatory Commission's Office for Analysis and Evaluation of Operational Data in the biannual "Performance Indicators for Operating Commercial Nuclear Power Reactors" report and INPO's Nuclear Network.

The following <u>NRC</u> significant events occurred between the fourth quarter of 1991 and the third quarter of 1993:

Third Quarter 1992: The failure of a Pressurizer Code safety valve to reseat initiated a LOCA with the potential to degrade the reactor coolant pressure boundary.

The following INPO significant events, as reported in Significant Event Reports (SERs), occurred between the fourth guarter of 1991 and the fourth guarter of 1993:

Second Quarter 1992: Intake of Transuranics during Letdown Filter Change-out.


Third Quarter 1992: 1) RC-142 LOCA; and 2) Premature Lift of RC-142.

First Quarter 1993: Inoperability of Power Range Nuclear Instrumentation Safety Channel D.

Second Quarter 1993: SBFU Breaker Relay (Switchyard) Plant Trip

Fourth Quarter 1993: Unexpected CEA Withdrawal.

Data Source: Nuclear Regulatory Commission & INPO Accountability: Chase Adverse Trend: None

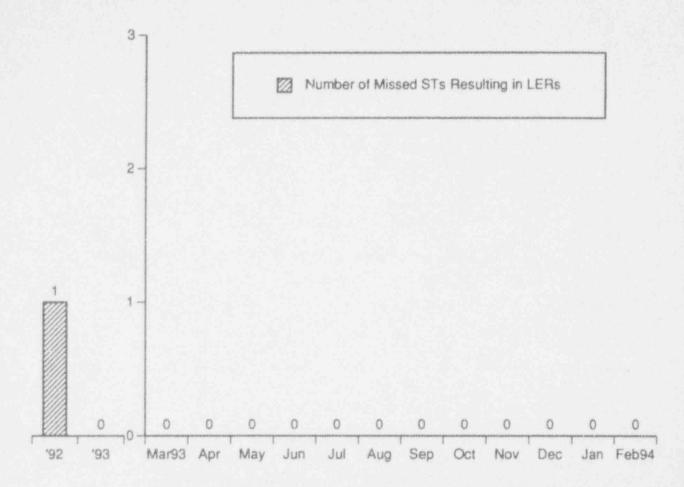

NUMBER OF MISSED SURVEILLANCE TESTS RESULTING IN LICENSEE EVENT REPORTS

This indicator shows the number of missed Surveillance Tests (STs) that result in Licensee Event Reports (LERs) during the reporting month. The graph on the left shows the yearly totals for the indicated years.

There were no missed surveillance tests resulting in LERs during February 1994.

During the month of January 1993 it was discovered that during December 1992 an ASME Section XI Code required surveillance was not completed nor corrective maintenance performed as a result of AC-10A falling into the "Alert Range" (LER 93-003 Failure to Satisfy Inservice Testing Requirements for Raw Water Pump).

The 1994 Fort Calhoun monthly goal for this indicator is 0.

Data Source: Monthly Operating Report & Plant Licensee Event Reports (LERs)


Accountability: Chase/Jaworski

Positive Trend

SEP 60 & 61

PERFORMANCE

Goal: To strive for Excellence in Operations utilizing the highest standards of performance at Fort Calhoun Station that result in safe, reliable plant operation in power production.

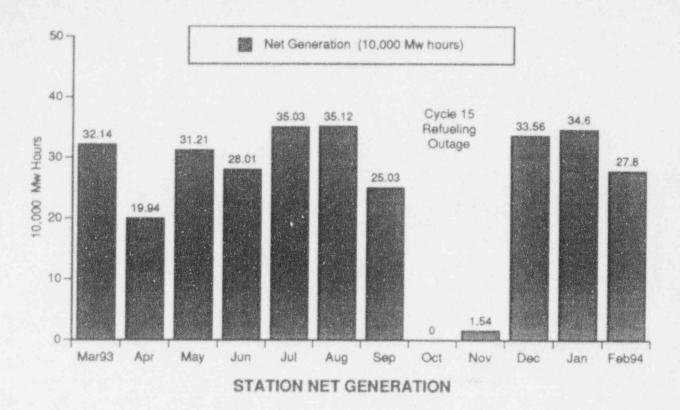

During the month of February 1994 a net total of 278,033.4 MWH was generated by the Fort Calhoun Station. Energy losses for the month were attributable to a generator and reactor trip that occurred following the failure of the relay for the Containment High Pressure Supervisory Circuit.

Energy losses for the month of January 1994 were attributable to derates to repair condenser tubes and a failed level control valve on a heater drain tank.


Energy losses for the month of December 1993 were a result of a forced outage that began on December 6 and ended on December 7. The outage was caused by an EHC test failure.

Energy losses for September, October and November 1993 were attributable to the shutdown for the Cycle 15 refueling outage, which began on September 25 and ended on November 26.

Unplanned energy losses for the months of June and July 1993 were attributable to a forced outage that began on June 24 when the inadvertent jarring of a 345 KV fault relay in the switchyard caused a turbine and reactor trip. The plant returned to 100% power on July 2nd.

Planned energy losses for the months of April and May 1993 were the result of a maintenance outage.

Data Source: Station Generation Report Accountability: Chase Adverse Trend: None

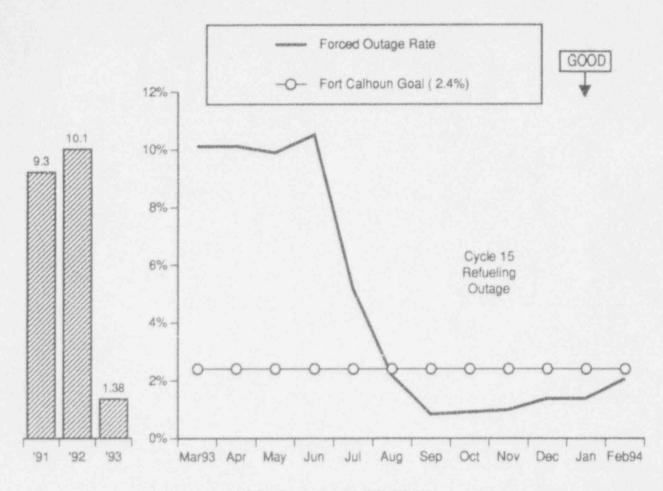

FORCED OUTAGE RATE

The forced outage rate (FOR) was reported as 2.06% for the twelve months from March 1, 1993 to February 28, 1994. A forced outage occurred on February 11 due to a generator and reactor trip that occurred following the failure of the relay for the Containment High Pressure Supervisory Circuit. The generator was put on-line on February 13.

A forced outage occurred on December 6, 1993 when the plant tripped during weekly testing of the turbine EHC system. The generator was off-line for 27.1 hours.


There was one forced outage during the month of June 1993. This outage, which occurred when the inadvertent jarring of a 345 KV fault relay in the switchyard caused a turbine and reactor trip, lasted 70.6 hours.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 2.4%. The 1993 Fort Calhoun year-end goal was a maximum value of 2.4%.

Data Source: Monthly Operations Report & NERC GAD Forms

Accountability: Chase

Positive Trend

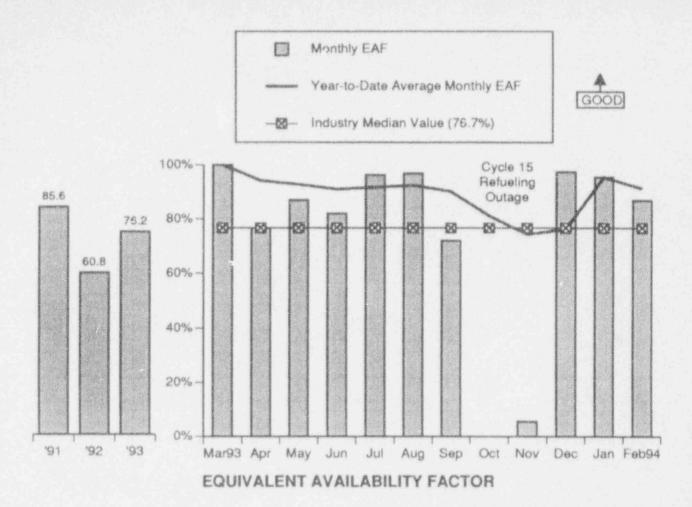

This indicator shows the plant monthly Equivalent Availability Factor (EAF), the year-todate average monthly EAF, and the year-end average monthly EAF for the previous 3 years.


The EAF for February 1994 was reported as 86.99%. Energy losses for the month were due to a generator and reactor trip that occurred following the failure of the relay for the Containment High Pressure Supervisory Circuit. The year-to-date monthly average EAF was 91.26% at the end of the month

The EAF for January 1994 was reported as 95.5%. Energy losses for the month were due to derates for condenser tube repair and a failed level control valve on a heater drain tank.

The April, May and June 1993 EAF values are the result of a maintenance outage and a forced outage that occurred when the inadvertent jarring of a 345 KV fault relay in the switchyard caused a turbine and reactor trip.

The industry median EAF value for the three year period from 7/90 through 6/93 was 76.7%. The Fort Calhoun average monthly EAF for the three years preceding this report was 75.0%.

Data Source: Dietz/Parra (Manager/Source) Accountability: Chase Adverse Trend: None 24

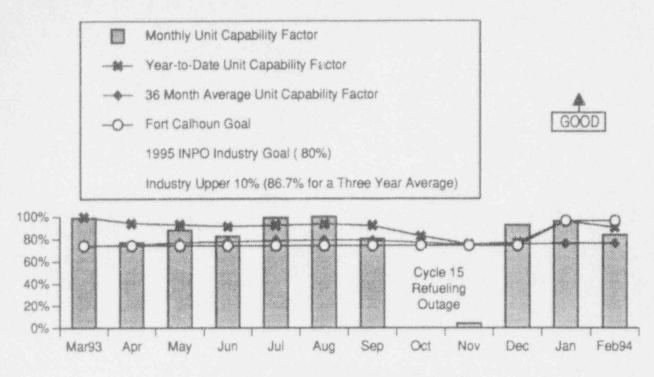

UNIT CAPABILITY FACTOR

This indicator shows the plant monthly Unit Capability Factor (UCF) value, the 1994 and 1993 year-to-date UCFs, the goals, the 36 month average UCFs, the 1995 INPO industry goal and the approximate industry upper ten percentile value. UCF is defined as the ratio of the available energy generation over a given period of time to the reference energy generation (the energy that could be produced if the unit were operated continuously at full power under reference ambient conditions) over the same time period, expressed as a percentage.

The UCF for February 1994 was reported as 83.7%. Energy losses for the month were due to a generator and reactor trip that occurred following the failure of the relay for the Containment High Pressure Supervisory Circuit. The year-to-date UCF was 90.0%, the UCF for the last 12 months was 75.7%, and the 36 month average UCF was reported as 75.7% at the end of February.


The UCF for January 1994 was reported as 95.8%. Energy losses for the month were due to derates to repair condenser tubes and a failed level control valve on a heater drain tank.

The UCF for December 1993 was reported as 92.4%. Energy losses for the month were due to rampup from the Cycle 15 Refueling Outage and a plant trip that occurred on December 6 during testing of the EHC system

The UCF for June 1993 was reported as 82.6%. Energy losses for the month were due to Moderator Coefficient Testing and a forced outage from June 24 through June 27.

The 1995 INPO industry goal is 80% and the industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 86.7%. The 1994 Fort Calhoun year-end goal for this indicator is a minimum of 96.03%.

Data Source: Generation Totals Report & Monthly Operating Report Accountability: Chase Adverse Trend: None

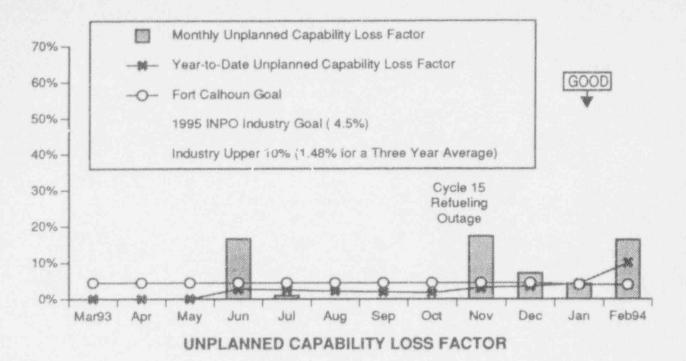

This indicator shows the plant monthly Unplanned Capability Loss Factor (UCLF), the year-todate UCLF, the goal, the 1995 INPO industry goal and the approximate industry upper ten percentile value. UCLF is defined as the ratio of the unplanned energy losses during a given period of time, to the reference energy generation (the energy that could be produced if the unit were operated continuously at full power under reference ambient conditions), expressed as a percentage.

The UCLF for the month of February 1994 was reported as 16.3%. Unplanned energy losses for the month were due to a generator and reactor trip that occurred following the failure of the relay for the Containment High Pressure Supervisory Circuit. The year-to date UCLF was 9.97%, the UCLF for the last 12 months was 5.1%, and the 36 month average UCLF was reported as 8.5% at the end of February.

The UCLF for the month of January 1994 was reported as 4.2%. Unplanned energy losses for the month were due to derates to repair condenser tubes and a failed level control valve on a heater drain tank.


The UCLF for the month of December 1993 was reported as 7.2%. Unplanned energy losses for the month were the result of a plant trip that occurred on December 6 during EHC testing.

The UCLF was reported as 16.6% for the month of June 1993. Unplanned energy losses for the month were the result of a forced outage that occurred as a result of the inadvertent jarring of a 345 KV fault relay in the switchyard.

The 1995 INPO industry goal is 4.5% and the industry upper ten percentile value (for the three year period from 1/91 through 12/93) is approximately 1.48%.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 3.97%.

Data Source: Generation Totals Report & Monthly Operating Report Accountability: Chase Adverse Trend: None 26

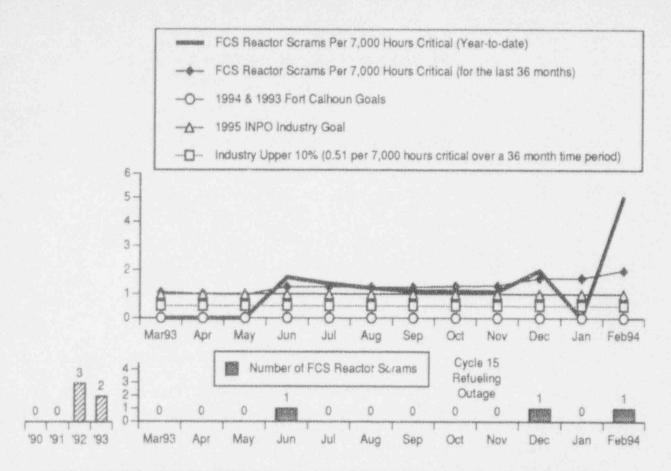

UNPLANNED AUTOMATIC REACTOR SCRAMS PER 7,000 HOURS CRITICAL


The upper graph shows the number of unplanned automatic reactor scrams per 7,000 hours critical (as defined in INPO's 12/92 publication "Detailed Descriptions of International Nuclear Power Plant Performance Indicators and Other Indicators") for Fort Calhoun Station. The lower graph shows the number of unplanned automatic reactor scrams that occurred during each month for the last twelve months.

The 1994 station value is 5.06 at the end of February 1994. An unplanned automatic reactor scram occurred on February 11 when supervisory relay 86B/CPHSS failed. The value for the 12 months from March 1, 1993 through February 28, 1994 is 2.98. The value for the last 36 months is 1.99.

An unplanned automatic reactor scram occurred on December 6, 1993 during EHC testing. An unplanned automatic reactor scram occurred on June 24, 1993 when the inadvertent jarring of a 345 KV fault relay in the switchyard caused a turbine and reactor trip.

The 1994 Fort Calhoun monthly goal for this indicator is 0. The 1995 INPO industry goal is a maximum of 1 unplanned automatic reactor scram per 7,000 hours critical. The industry upper ten percentile value is approximately 0.51 scrams per 7,000 hours critical for the 36 month time period from 1/91 through 12/93.

Data Source: Monthly Operations Report & Plant Licensee Event Reports (LERs) Accountability: Chase Adverse Trend: None

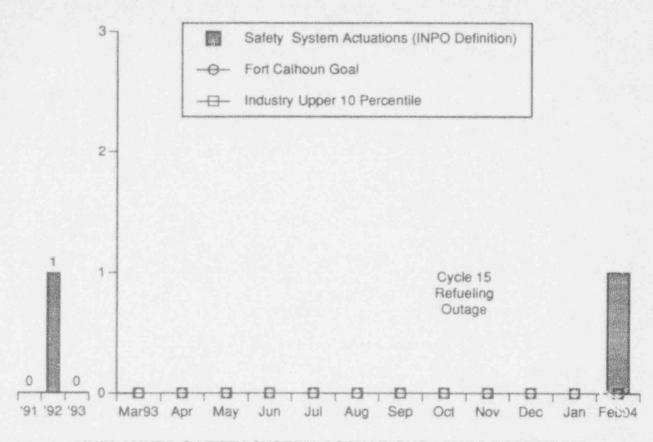

UNPLANNED SAFETY SYSTEM ACTUATIONS - (INPO DEFINITION)


There was 1 INPO unplanned safety system actuation during the month of February 1994. It occurred on February 11 when supervisory relay 86B/CPHSS failed, which resulted in tripping relay 86B/CPHS. The CPHS relay trip actuated the Safety Injection Actuation Signal, Containment Isolation Actuation Signal, Ventilation Isolation Actuation Signal and Steam Generator Isolation Signal. The Steam Generator Isolation Signal automatically closed both main steam isolation valves, which resulted in a concurrent turbine and reactor trip.

An INPO unplanned safety system actuation occurred during the month of July 1992 and was due to the loss of an inverter and the subsequent reactor trip on 7/3/92.

The 1994 Fort Calhoun goal for this indicator is 0.

Data Source: Monthly Operations Report & Plant Licensee Event Reports (LERs)

Accountability: Jaworski/Foley/Ronning

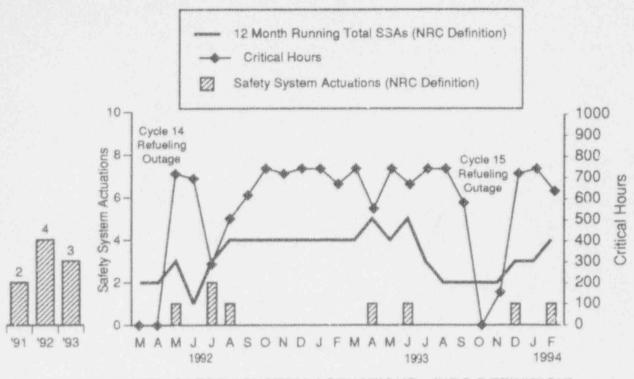

UNPLANNED SAFETY SYSTEM ACTUATIONS - (NRC DEFINITION)

This indicator shows the number of unplanned safety system actuations (SSAs), which includes the High and Low Pressure Safety Injection Systems, the Safety Injection Tanks, and the Emergency Diesel Generators. The NRC classification of SSAs includes actuations when major equipment is operated and when the logic systems for these safety systems are challenged.


There was 1 NRC unplanned safety system actuation during the month of February 1994. It occurred on February 11 when supervisory relay 86B/CPHSS failed, which resulted in a concurrent turbine and reactor trip.

There were 3 NRC unplanned safety system actuations in 1993: 1) in December 1993 the main turbine and reactor tripped during Electro-Hydraulic Control pump start testing; 2) In June 1993 the inadvertent jarring of a 345 KV fault relay in the switchyard caused a turbine and reactor trip; and 3) In April 1993 a non-licensed operator mistakenly opened the wrong potential fuse drawer, causing a low voltage alarm on bus 1A1, a loadshed on bus 1A1 and an auto start of an EDG.

There were 4 unplanned safety system actuations in 1992: 1) In August, due to the failure of an AC/DC converter in the Turbine Electro Hydraulic Control system, pressurizer safety valve RC-142 opened prior to reaching design pressure during a plant transient and trip; 2) On July 3 there was an inverter failure and the subsequent reactor trip; 3) On July 23 there was an unplanned diesel generator start when an operator performing a surveillance test inadvertently pushed the normal start button instead of the alarm acknowledge button; and 4) In May the turbine generator tripped on a faise high level moisture separator trip signal which caused a simultaneous reactor trip and subsequent anticipatory start signal to both diesel generators.

There has been 1 unplanned safety system actuation/quarter for the last 12 months. The 1994 Fort Calhoun goal for this indicator is 0.

Data Source: Monthly Operations Report & Plant Licensee Event Reports (LERs) Accountability: Jaworski/Foley/Ronning Adverse Trend: None

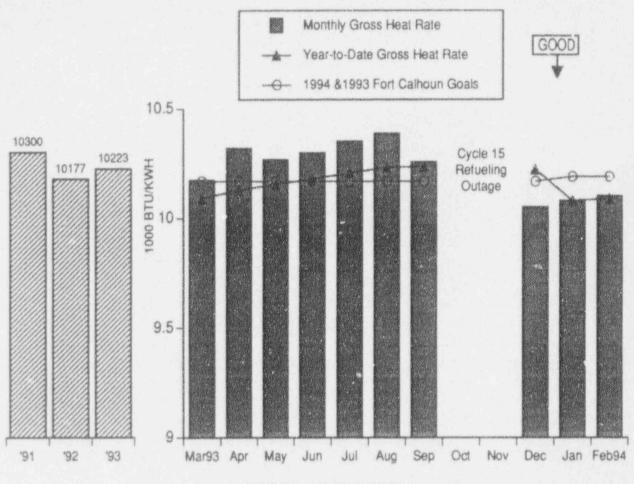

GROSS HEAT RATE

This indicator shows the Gross Heat Rate (GHR) for the reporting month, the year-todate GHR, the 1993 goal and the year-end GHR for the previous 3 years.


The gross heat rate for Fort Calhoun Station was 10,103 for the month of February 1994. The 1994 year-to-date GHR was 10,091 at the end of the month.

The GHR was not calculated for the months of October and November 1993 because of the Cycle 15 Refueling Outage.

The GHR varies with fluctuations in river water temperature. In general, the GHR improves during the winter months and degrades during the summer. This is because the gross heat rate is not normalized to the design river water temperature of 60 degrees Fahrenheit.

The 1994 Fort Calhoun year-end goal for this indicator is 10,190.

Data Source: Holthaus/Gray (Manager/Source) Accountability: Chase/Jaworski Adverse Trend: None

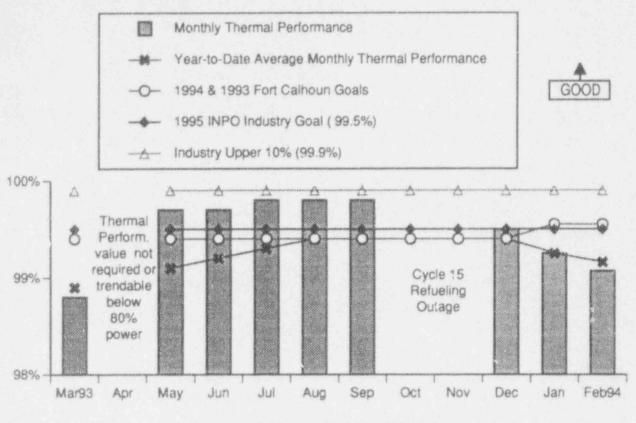




This indicator shows the Thermal Performance value for the reporting month, the yearto-date average thermal performance value, the 1994 and 1993 Fort Calhoun goals, the 1995 INPO industry goal and the approximate industry upper ten percentile value.

The thermal performance value for February 1994 was 99.1%. The year-to-date average monthly thermal performance value was 99.2% at the end of the month. The average monthly value for the 12 months from March 1, 1993 through February 28, 1994 was 99.5%.

The thermal performance values for the months of November and October 1993 were not calculated due to the Cycle 15 Refueling Outage. The thermal performance value for April 1993 could not be calculated (per INPO guidance) because the plant was operated at less than 80% power from April 1 through 23 prior to the maintenance outage.


The 1994 Fort Calhoun year-end goal for this indicator is 99.55%. The 1993 Fort Calhoun Goal was a minimum of 99.4%. The 1995 INPO industry goal is 99.5% and the industry upper ten percentile value (for the one year period from 1/93 through 12/93) is approximately 99.9%.

Data Source: Jaworski/Popek Accountability: Jaworski/Popek Adverse Trend: None

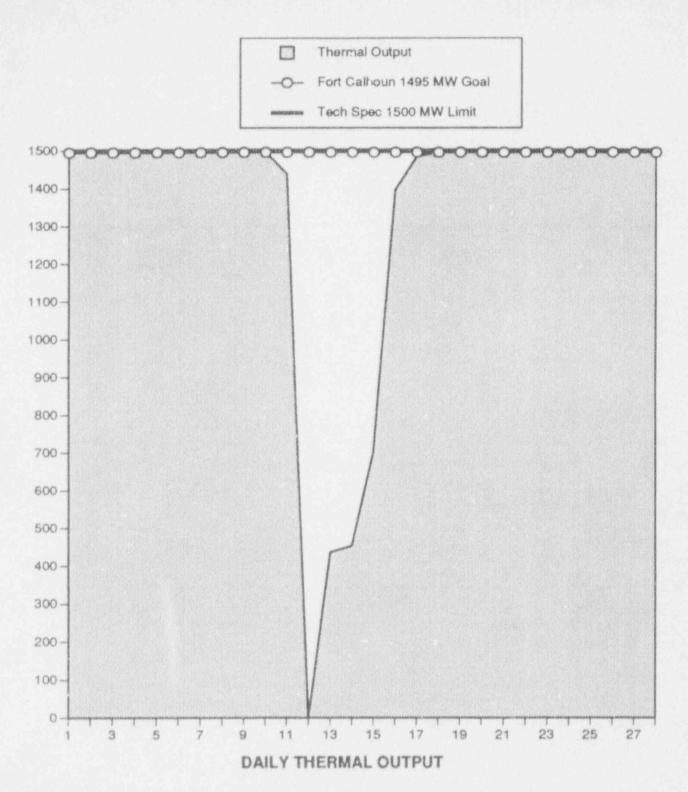

The thermal output graph displays the daily operating power level during February 1994, the 1500 thermal megawatt average technical specification limit, and the 1495 thermal megawatt Fort Calhoun goal. Energy losses during the month are due to an unplanned automatic reactor trip that occurred as a result of the failure of the supervisory relay 86B/CPHSS.

Data Source: Holthaus/Gray (Manager/Source) Accountability: Chase/Tills Adverse Trend: None

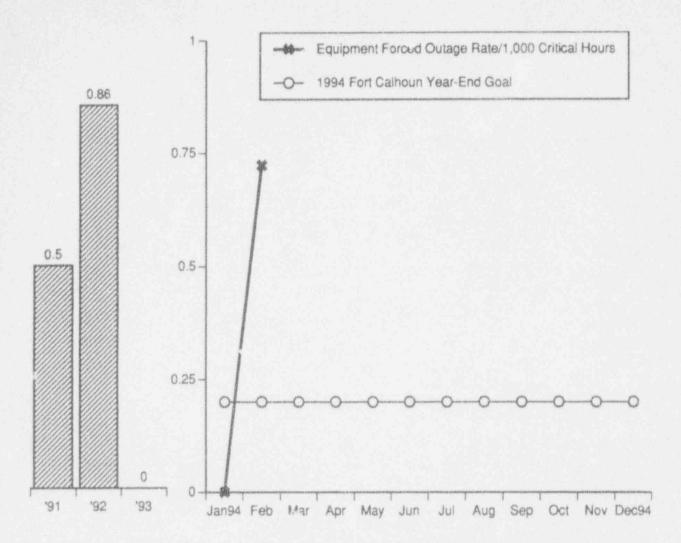


EQUIPMENT FORCED OUTAGES PER 1,000 CRITICAL HOURS

The equipment forced outage rate per 1,000 critical hours was 0.723 for the months from January through February 1994. An equipment forced outage occurred on February 11, 1994 when the plant experienced an unplanned automatic reactor trip as a result of the failure of the supervisory relay 86B/CPHSS. The value for the 12 months from March 1, 1993 through February 28, 1994 is 0.142.

An equipment forced outage occurred in August 1992 and continued through September. It was due to the failure of an AC/DC converter in the Turbine Electro Hydraulic Control System.

The 1994 Fort Calhoun year-end goal for this indicator is a maximum value of 0.20.

Data Source: Monthly Operations Report & Plant Licensee Event Reports (LERs) Accountability: Chase/Jaworski Adverse Trend: None

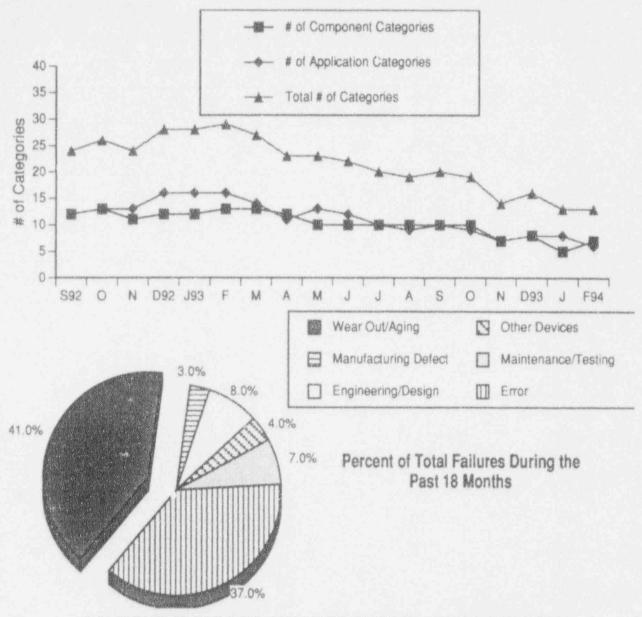


COMPONENT FAILURE ANALYSIS REPORT (CFAR) SUMMARY

The top chart illustrates the number of component categories, application categories and total categories in which the Fort Calhoun Station has significantly higher (1.645 standard deviations) failure rates than the industry failure rates during the past 18 months (from June 1992 through November 1993). Fort Calhoun Station reported a higher failure rate in 7 of the 87 component categories (valves, pumps, motors, etc.) during the past 18 months. The station reported a higher failure rate in 6 of the 173 application categories (main steam stop valves, auxiliary/ emergency feedwater pumps, control element drive motors, etc.) during the past 18 months.

The pie chart depicts the breakdown by INPO cause categories (see the "Definitions" section of this report for descriptions of these categories) for the 85 failure reports that were submitted to INPO by Fort Calhoun Station during the past 18 months. Of these, the failure cause was known for 71. The pie chart reflects known failure causes.

Data Source: Jaworski/Edwards (Manager/Source) Accountability: Jaworski/Edwards Adverse Trend: None

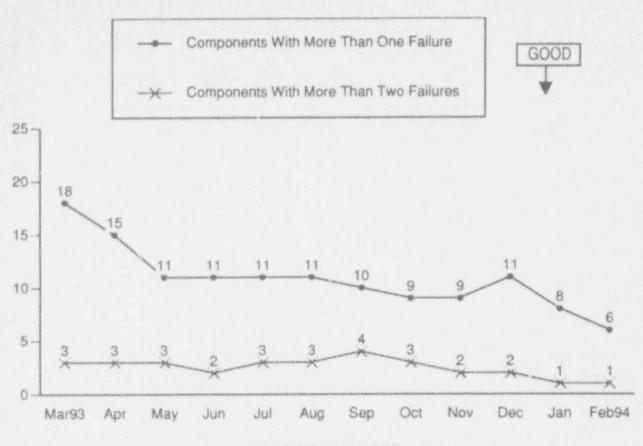

REPEAT FAILURES


The Repeat Failures Indicator (formerly called the "Maintenance Effectiveness" performance indicator) was developed in response to guidelines set forth by the Nuclear Regulatory Commission's Office for Analysis and Evaluation of Operational Data (NRC/ AEOD). The NRC requirement for a Maintenance Effectiveness Performance Indicator has been dropped, but station management considers it useful to continue to track repetitive component failures using the Nuclear Plant Reliability Data System (NPRDS).

This indicator shows the number of NPRDS components with more than 1 failure during the last eighteen months and the number of NPRDS components with more than 2 failures during the last eighteen months.

During the last 18 reporting months there were 6 NPRDS components with more than 1 failure. 1 of the 6 had more than 2 failures. The tag number of the component with more than 2 failures is AC-10C. Recommendations and actions to correct these repeat component failures are listed in the guarterly Component Failure Analysis Report.

Data Source: Jaworski/Edwards (Manager/Source)

Accountability: Chase

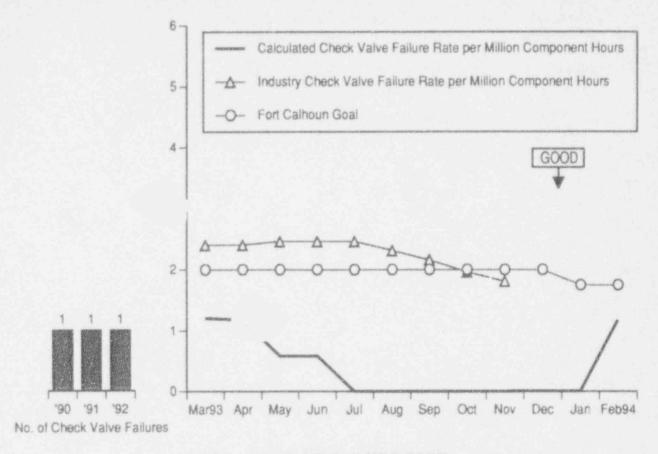

C' `K VALVE FAILURE RATE

This indicator shows the calculated Fort Calhoun check valve failure rate, the Fort Calhoun goal and the industry check valve failure rate. This rate is based upon failures during the previous 18 months. The number of check valve failures at Fort Calhoun Station for the previous three years are shown on the left.


The data for the industry check valve failure rate is three months behind the reporting month due to the time involved in collecting and processing the data.

For November 1993, the Fort Calhoun Station reported an actual check valve failure rate of 0.585 E-6, while the industry reported an actual failure rate of 1.81 E-6. At the end of February 1934, the Fort Calhoun Station reported a calculated check valve failure rate of 1.169 E-6. The increase in the calculated check valve failure rate is due to two failures of RC-374: one occurred in October, and another occurred in November 1993.

The 1994 Fort Calhoun monthly goal for this indicator is 1.75 E-6.

Data Source: Jaworski/Edwards (Manager/Source)

Accountability: Jaworski/Rollins

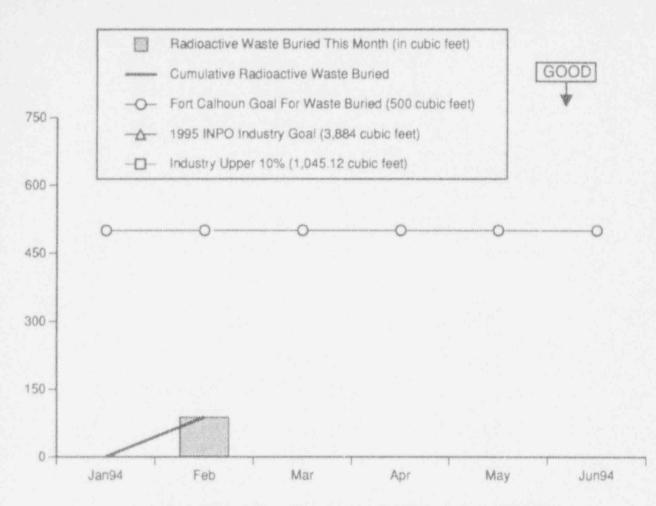

VOLUME OF LOW-LEVEL SOLID RADIOACTIVE WASTE

This indicator shows the volume of the monthly radioactive waste buried, the cumulative annual total for radioactive waste buried, the Fort Calhoun and INPO goals, and the approximate industry upper 10%.


Amount of solid radwaste shipped off-site for processing during February (cubic feet)	0.0
Volume of Solid Radwaste Buried during February (cubic feet)	88.4
Cumulative volume of solid radioactive waste buried in 1994 (cubic feet)	88.4
Amount of solid radioactive waste in temporary storage after July 1, 1994 (cubic feet)	0.0

A graph will be added to this indicator in July 1994 to depict the amount of solid radioactive waste in temporary storage.

The 1994 Fort Calhoun goal for the volume of solid radioactive waste which has been buried is 500 cubic feet. The 1995 INPO industry goal is 110 cubic meters (3,884 cubic feet) per year. The industry upper ten percentile value from 1/91 through 12/93 is approximately 29.59 cubic meters (1,045.12 cubic feet) per year.

Data Source: Chase/Breuer (Manager/Source)

Accountability: Chase/Lovett

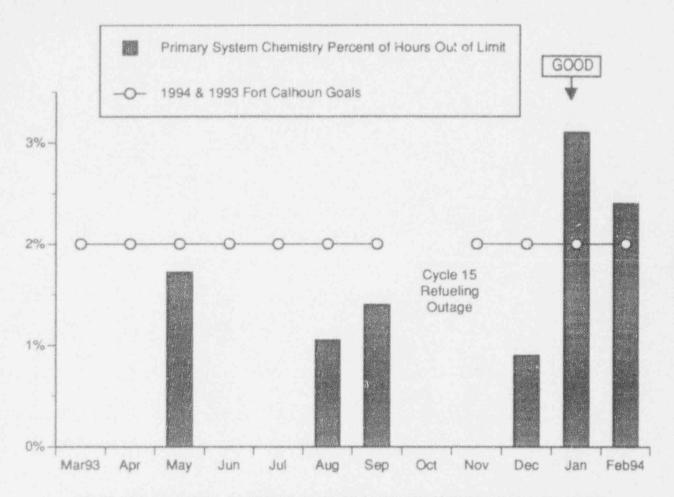

PRIMARY SYSTEM CHEMISTRY PERCENT OF HOURS OUT OF LIMIT


The Primary System Chemistry Percent of Hours Out of Limit indicator tracks the primary system chemistry performance by monitoring six key chemistry parameters. The key parameters are: lithium, dissolved oxygen, chlorides, fluoride, hydrogen and suspended solids. 100% equates to all six parameters being out of limit for the month.

The Primary System Chemistry Percent of Hours Out of Limit was 2.4% for the month of February 1994. Hours out of specification are due to 24.6 hours for lithium and 73.6 hours for hydrogen. Total available hours was 4,032.

The 1994 and 1993 Fort Calhoun monthly goals for this indicator are a maximum of 2% Hours Out of Limit.

Data Source: Smith/Spires (Manager/Source)

Accountability: Chase/Smith

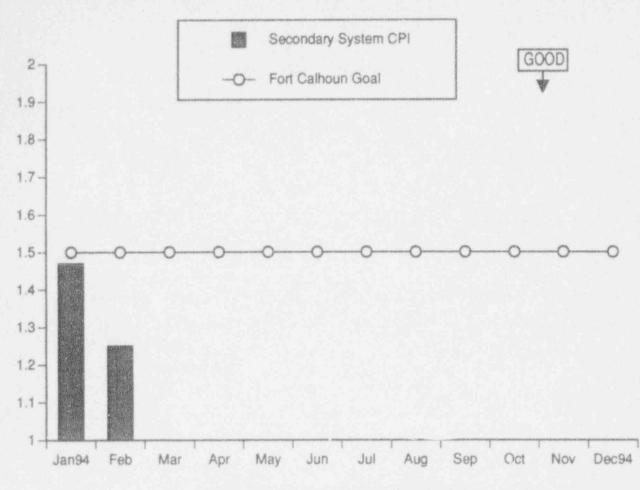

SECONDARY SYSTEM CHEMISTRY

Criteria for calculating the Secondary System Chemistry Performance Index (CPI) are: 1) The plant is at greater than 30% power; and 2) the power is changing at less than 5% per day.

The CPI for February 1994 was 1.25.

The CPI for December 1993 was 1.92. This relatively higher number was due primarily to iron transport following the plant startup.


The 1994 Fort Calhoun monthly goal for the CPI is a maximum value of 1.5.

The CPI calculation is different from that reported in 1993 in that it reflects the recent INPO revision to the calculation. This revision addresses the penalties for the beneficial effect of alternative chemistry, i.e., morpholine, such as used at Fort Calhoun Station, and focuses more on specific impurities.

Data Source: Smith/Spires (Mana_o//Source) Accountability: Chase/Smith Adverse Trend: None

COST

Goal: To operate Fort Calhoun Station in a manner that cost effectively maintains nuclear generation as a viable source of electricity.

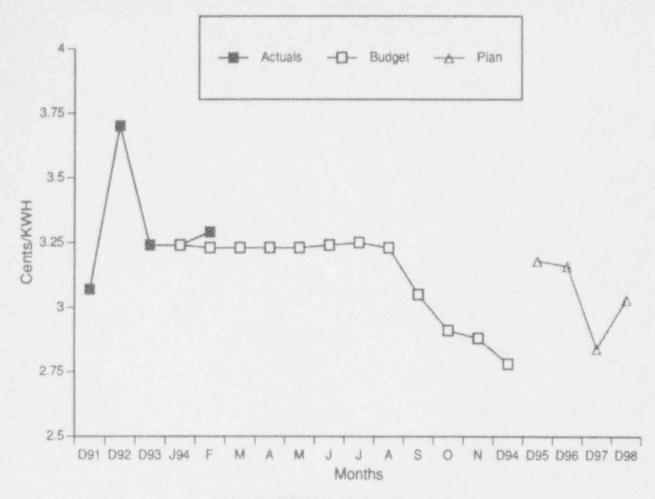




The purpose of this indicator is to quantify the economical operation of Fort Calhoun Station.

The cents per kilowatt hour indicator represents the budget and actual cents per kilowatt hour on a 12 month rolling average for the current year. The basis for the budget curve is the approved 1993 and 1994 revised budget. The basis for the actual curve is the Financial and Operating Report.

The December 31 amounts are also shown for the prior years 1991, 1992 and 1993. In addition, the report shows the plan amounts for the years 1995 through 1998 for reference. The basis for the dollars are the Nuclear Long Range Financial Plan and the 1994 Corporate Planning and Budget Review. The basis for the generation is provided by Nuclear Fuels.

The unit price is averaging higher than budget due to a shortfall in February's generation.

Data Source: Scofield/Jamieson (Manager/Source) Accountability: Scofield Adverse Trend: None

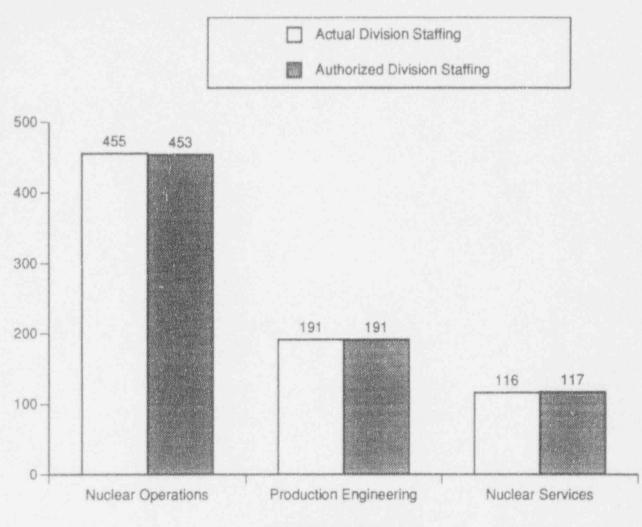


STAFFING LEVEL

The authorized and actual staffing levels at the end of February 1994 are shown for the three Nuclear Divisions.

Data Source: Ponec (Manager & Source)

Accountability: Ponec

Adverse Trend: None

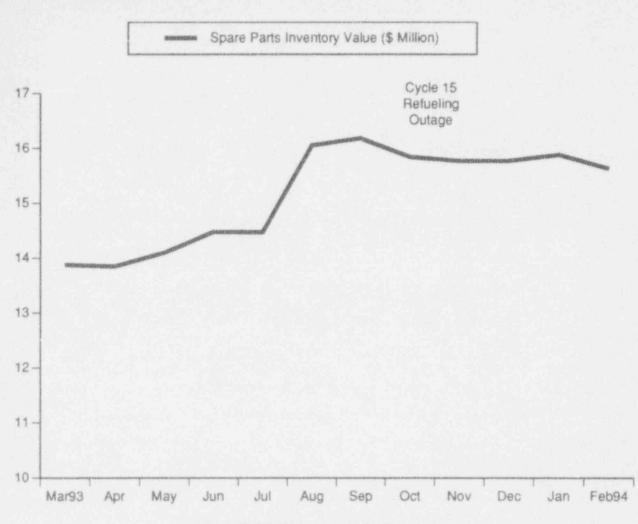

SPARE PARTS INVENTORY VALUE

The spare parts inventory value at the Fort Calhoun Station at the end of February 1994 was reported as \$15,629,881. The rise in inventory value is the result of several factors:


- 1. Prior to July 1993, incorrect reports from MMD gave low inventory values.
- Significant amounts of material previously purchased as "non-stock" have been added to the inventory.
- Significant amounts of material purchased and staged for outage use were not used and remain in the inventory.

Data Source: Steele/Huliska (Manager/Source)

Accountability: Willrett/McCormick

DIVISION AND DEPARTMENT PERFORMANCE INDICATORS


These indicators may be deleted from this report if the responsible group contacts the Manager - Station Engineering to request their removal. Indicators referencing SEP items require documentation to ensure that the original intent and scope of the SEP item will not be altered by removal of the indicator from this report.

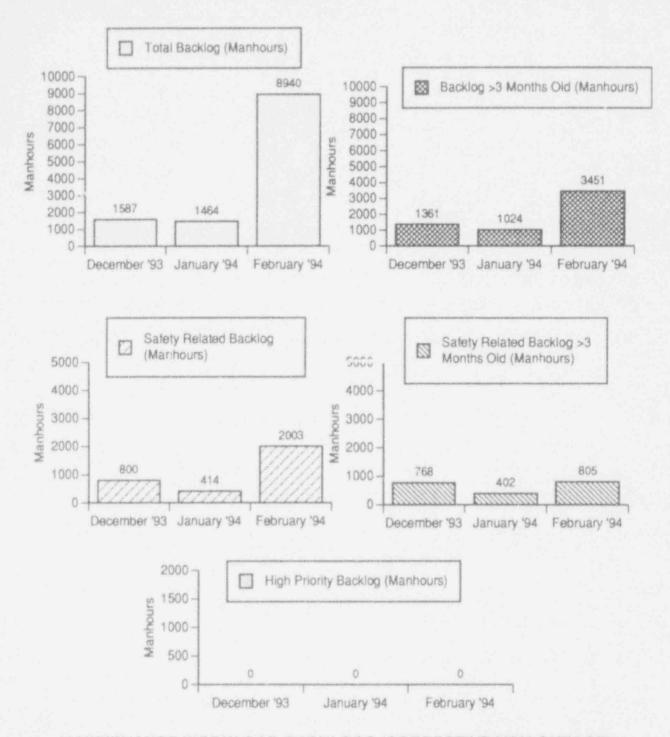

MAINTENANCE WORKLOAD BACKLOGS (CORRECTIVE NON-OUTAGE)

This indicator shows the estimated manhours for corrective non-outage MWOs remaining open at the end of the reporting month, along with a breakdown by several key categories.

Data Source: Chase/Schmitz (Manager/Source) Accountability: Chase//Faulhaber Adverse Trend: None

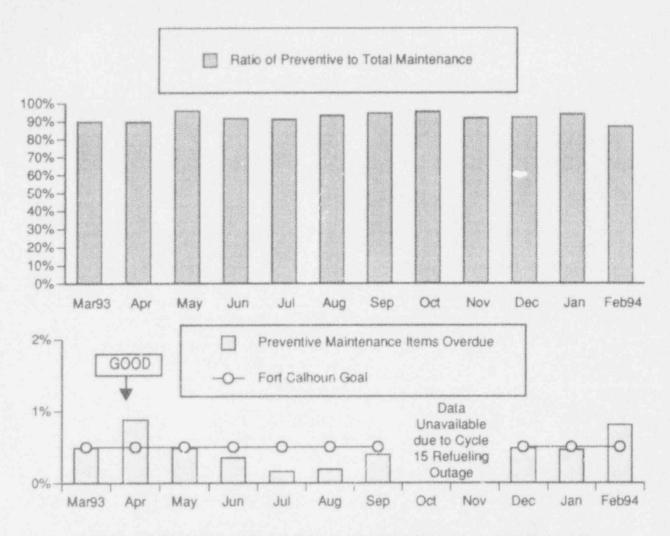

RATIO OF PREVENTIVE TO TOTAL MAINTENANCE & PREVENTIVE MAINTENANCE ITEMS OVERDUE

The top graph shows the ratio of completed non-outage preventive maintenance to total completed non-outage maintenance.


The ratio of preventive to total maintenance was 86.8% in February 1994.

The lower graph shows the percentage of preventive maintenance items overdue. During February, 495 PM items were completed. 4 of these PM items (0.81% of the total) were not completed within the allowable grace period.

The 1994 Fort Calhoun monthly goal for the percentage of preventive maintenance items overdue is a maximum of 0.5%.

Accountability: Chase//Faulhaber

Data Source: Chase/Schmitz/Melstad (Manager/Sources)

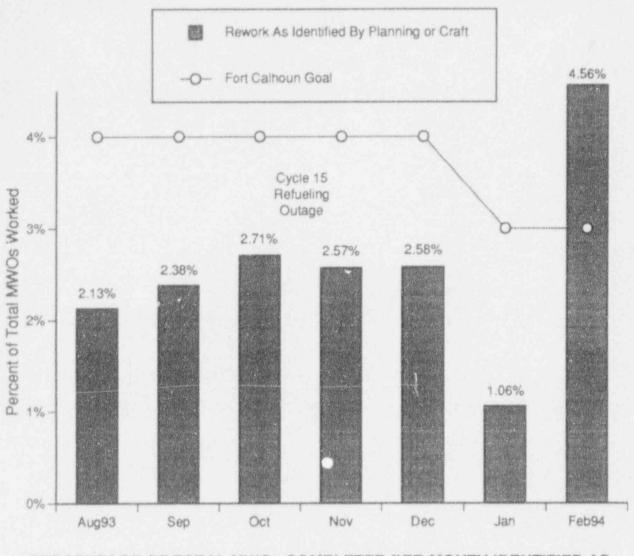


PERCENTAGE OF TOTAL MWOS COMPLETED PER MONTH IDENTIFIED AS REWORK

This graph indicates the percentage of total MWOs completed per month identified as rework. Rework activities are identified by maintenance planning and craft.

The 1994 Fort Calhoun monthly goal for this indicator is <3%.

Data Source: Faulhaber/Schmitz (Manager/Source)

Accountability: Chase/Faulhaber

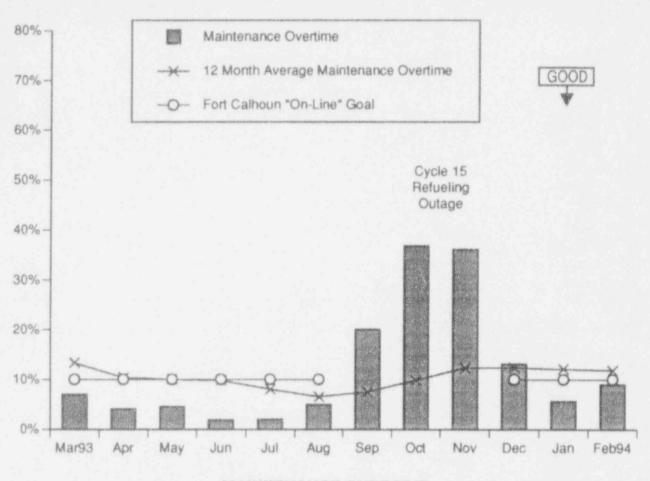

MAINTENANCE OVERTIME


The Maintenance Overtime Indicator monitors the ability to perform the desired maintenance activities with the allotted resources.

The percent of overtime hours with respect to normal hours was reported as 9.0% for the month of February 1994. The 12 month average percentage of overtime hours with respect to normal hours was reported as 11.85% at the end of the month.

The 1994 Fort Calhoun monthly "on-line" goal for this indicator is a maximum value of 10%.

Data Source: Chase/Schmitz (Manager/Source)

Accountability: Chase/Faulhaber

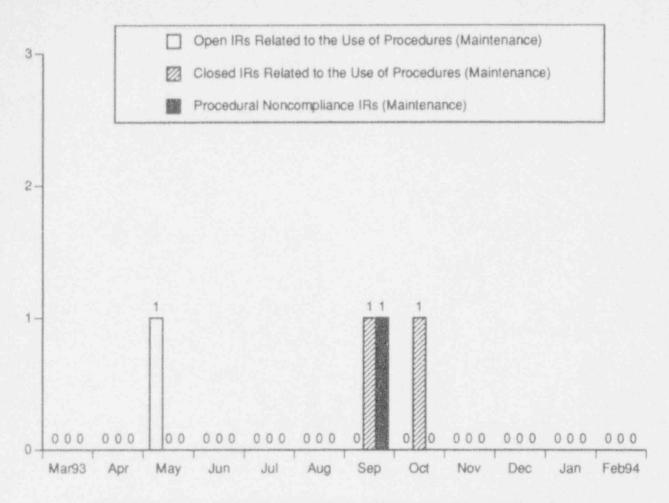

PROCEDURAL NONCOMPLIANCE INCIDENTS (MAINTENANCE)

This indicator shows the number of open Maintenance Incident Reports (IRs) that are related to the use of procedures, the number of closed IRs that are related to the use of procedures, and the number of open and closed IRs that received procedural noncompliance cause codes for each of the last twelve months.

There were no procedural noncompliance incidents for maintenance reported for the month of February 1994.


There was 1 procedural noncompliance incident (IR 930225) reported in September 1993.

Data Source: Chase/Keister (Manager/Source)

Accountability: Chase/Conner

Adverse Trend: None

SEP 15, 41 & 44

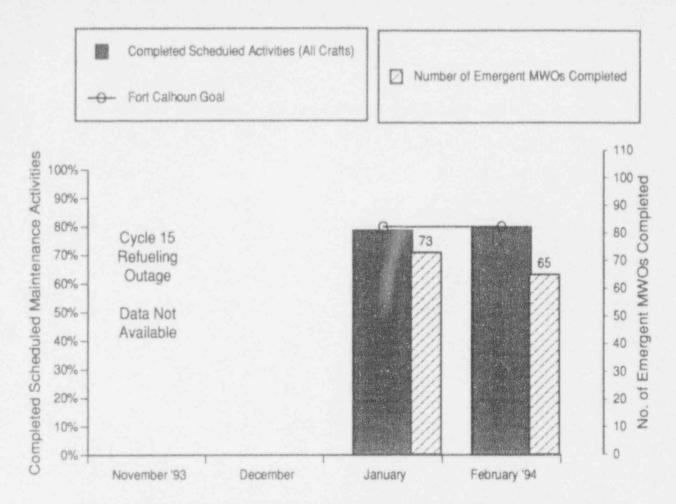

PERCENT OF COMPLETED SCHEDULED MAINTENANCE ACTIVITIES (ALL MAINTENANCE CRAFTS)


This indicator shows the percent of the number of completed scheduled maintenance activities as compared to the number of scheduled maintenance activities concerning all Maintenance Crafts. Maintenance activities include MWRs, MWOs, STs, PMOs, calibrations, and miscellaneous maintenance activities. The number of emergent MWOs completed for the month is also shown.

The percent of the number of completed scheduled maintenance activities as compared to the number of scheduled maintenance activities for February 1994 was 79.8%. Also, there were 65 emergent MWOs completed during the month.

Due to the Cycle 15 Refueling Outage, data for this indicator was not available until after the first month on-line during Cycle 15.

The 1994 Fort Calhoun monthly goal for completed scheduled maintenance activities is 80%.

Data Source: Chase/Schmitz (Manager/Source) Accountability: Chase/Faulhaber Adverse Trend: None 50

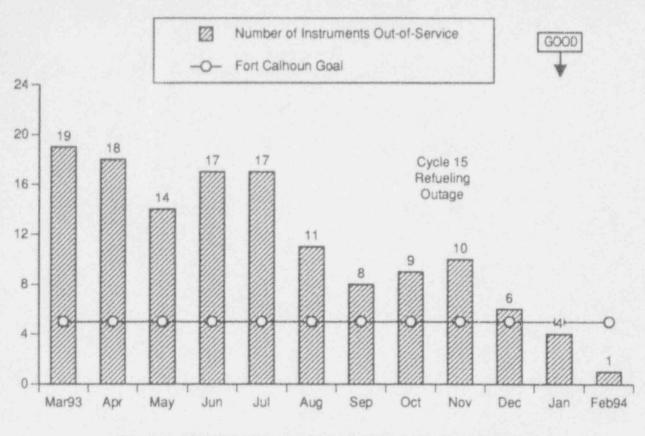

IN-LINE CHEMISTRY INSTRUMENTS OUT-OF-SERVICE

This indicator shows the total number of in-line chemistry system instruments out-ofservice at the end of the reporting month. The chemistry systems involved in this indicator include the Secondary System and the Post Accident Sampling System (PASS).


At the end of February 1994 there was 1 in-line chemistry instrument out-of-service. The instrument was from the Secondary System. There were no instruments out-ofservice from PASS.

The trend for PASS instruments for this reporting period has not changed. The trend for Secondary instruments this reporting period has decreased from 4 to 1. The blowdown sample panel had 1 instrument out-of-service at the end of the reporting month.

The entire instrument channel is considered inoperative if: 1) the instrument is inoperative, 2) the chart recorder associated with the instrument is inoperative, or 3) the alarm function associated with the instrument is inoperative. If any of the functions listed above are not operational, then the instrument is not performing its intended function.

The 1994 Fort Calhoun monthly goal for this indicator is a maximum of 5. Six out-ofservice chemistry instruments make up 10% of all the chemistry instruments that are counted for this indicator.

Data Source: Chase/Renaud (Manager/Source) Accountability: Chase/Jaworski Adverse Trend: None

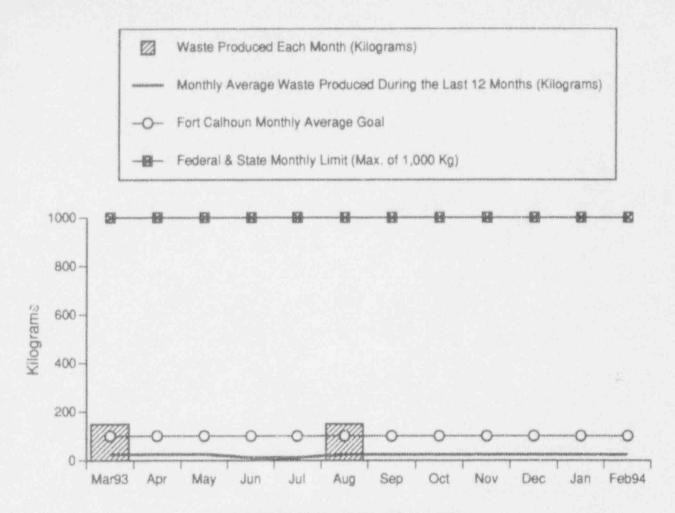

HAZARDOUS WASTE PRODUCED


This indicator shows the total amount of hazardous waste produced by the Fort Calhoun Station each month, the monthly average goal and the monthly average total for hazardous waste produced during the last 12 months. This hazardous waste consists of non-halogenated hazardous waste, halogenated hazardous waste, and other hazardous waste produced.

During the month of February 1994, 0.0 kilograms of non-halogenated hazardous waste was produced, 0.0 kilograms of halogenated hazardous waste was produced, and 0.0 kilograms of other hazardous waste was produced. The total for hazardous waste produced during the last 12 months is 299 kilograms. The monthly average for hazardous waste produced during the last 12 months is 24.9 kilograms.

Hazardous waste is counted based upon a full drum of waste.

The 1994 Fort Calhoun monthly average goal for this indicator is a maximum of 100 kilograms.

Date Source: Chase/Henning (Manager/Source) Accountability: Chase/Henning Positive Trend

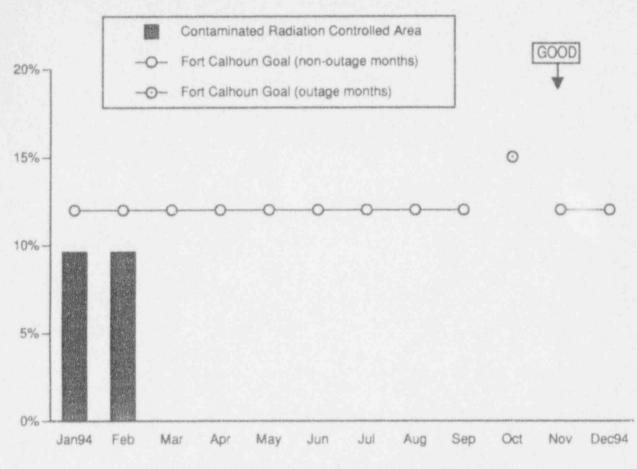

CONTAMINATED RADIATION CONTROLLED AREA


This indicator shows the percentage of the RCA that is contaminated based on the total square footage. The 1994 monthly non-outage goal is a maximum of 12% contaminated RCA and the monthly outage goal is a maximum of 15% contaminated RCA.

At the end of February 1994, the percentage of the total square footage of the RCA that was contaminated was 9.6%.

Data Source: Chase/Gundal (Manager/Source)

Accountability: Chase/Lovett

Adverse Trend: None

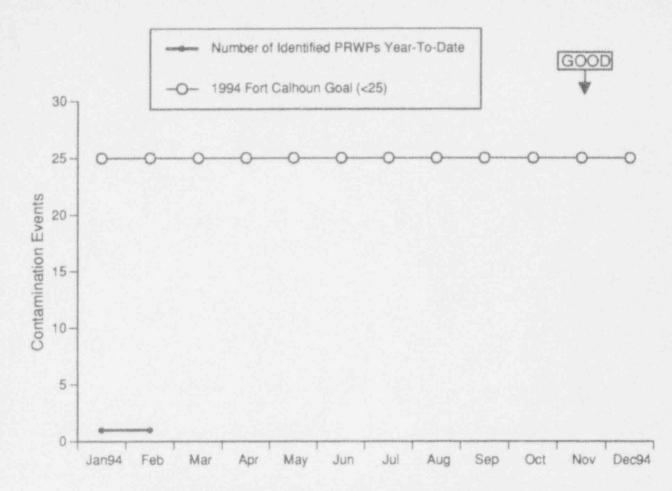

RADIOLOGICAL WORK PRACTICES PROGRAM


The Radiological Work Practices Program Indicator shows the number of Poor Radiological Work Practices (PRWPs) which were identified during the reporting month.

The number of PRWPs which are identified each month should indirectly provide a means to qualitatively assess supervisor accountability for their workers' radiological performance.

During the month of February 1994, there no PRWPs identified. There has been 1 PRWP in 1994.

The 1994 year-end goal for the number of PRWPs is a maximum of 25.

Data Source: Chase/Little (Manager/Source) Accountability: Chase/Lovett Adverse Trend: None

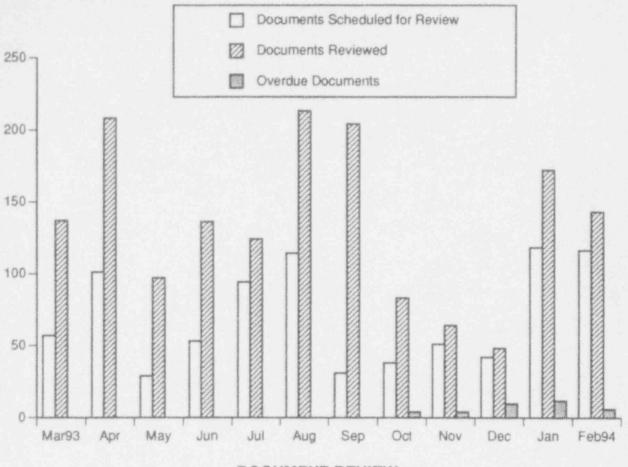


DOCUMENT REVIEW

This indicator shows the number of completed, scheduled, and overdue (greater than 6 months past the scheduled due date) biennial reviews for the reporting month. These document reviews are performed in-house and include Special Procedures, the Site Security Plan, Maintenance Procedures, Preventive Maintenance Procedures, and the Operating Manual.

During February 1994 there were 116 document reviews scheduled while 143 document reviews were completed. At the end of February, there were 6 document reviews more than 6 months overdue.

There were 19 new documents initiated in February.

Data Source: Chase/Keister (Manager/Source) Accountability: Chase/Jaworski Adverse Trend: An adverse trend is indicated based on more than 3 consecutive months with document reviews more than 6 months overdue.

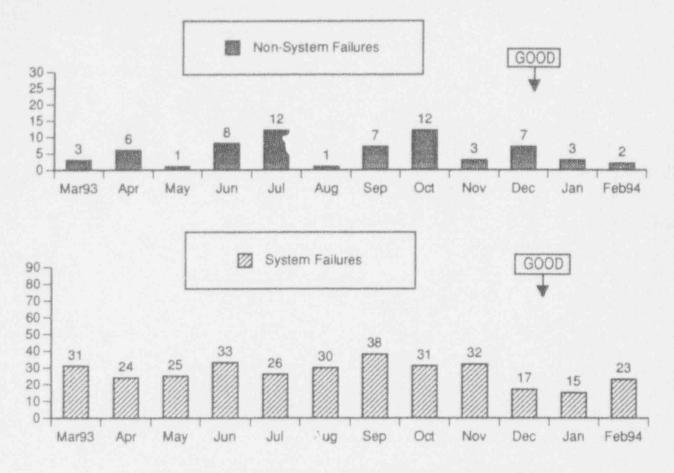

LOGGABLE/REPORTABLE INCIDENTS (SECURITY)


The Loggable/Reportable Incidents (Security) Indicator is depicted in two separate graphs. The top graph depicts the total number of loggable/reportable non-system failures concerning Security Badges, Access Control and Authorization, Security Force Error, and Unsecured Doors. The bottom graph shows the total number of loggable/ reportable incidents concerning system failures which occurred during the reporting month.

During the month of February 1994, there were 25 loggable/reportable incidents identified. System failures accounted for 23 (92%) of the loggable/reportable incidents. 17 of the 23 system failures were environmental failures due to inclement weather conditions (snow) during the reporting period. The 2 non-system failures involved a lost/unattended security badge and failure to follow escort procedures.

Data Source: Sefick/Woerner (Manager/Source)

Accountability: Sefick

Adverse Trend: None

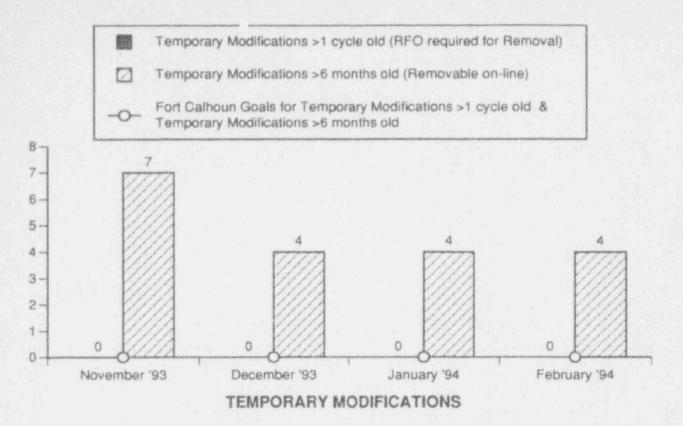

This indicator provides information on the number of temporary modifications greater than one fuel cycle old requiring a refueling outage (RFO) for removal and the number of temporary modifications removable on-line that are greater than six months old. The 1994 Fort Calhoun monthly goals for this indicator are 0.

There are currently no temporary modifications that are greater than one fuel cycle old requiring a refueling outage to remove. In addition, at the end of February 1994 there were 4 temporary modifications installed that were greater than six months old that can be removed on-line. These were: 1) Local indication for BAST CH-11A and CH-11B, in which Operations is reviewing a draft FLC. After review, Licensing is to issue an FLC, and the NRC is to approve; 2) LP-30 transformer, in which ECN 93-183 is approved for accomplishment prior to 8/31/94; 3) Refrigerated air dryer for Rm-057, which is awaiting installation of MR-FC-84-155D, scheduled completion date of 6/30/94; and 4) Epoxy repairs to ST-4B, which is awaiting completion of MWO 931325, scheduled start date 1995 Refueling Outage.


At the end of February 1994, there was a total of 25 TMs installed in the Fort Calhoun Station. 12 of the 25 installed TMs require an outage for removal and 13 are removable on-line. In 1994 a total of 14 temporary modifications have been installed.

Data Source: Jaworski/Turner (Manager/Source) Accountability: Jaworski/Gorence Adverse Trend: An adverse trend is indicated based on more than 3 consecutive

rend: An adverse trend is indicated based on more than 3 consecutive months of performance not meeting the established goal for the number of temporary modifications removable on-line that are greater than six months old. Actions to remove these are defined and no additional action plan will be prepared.

SEP 62 & 71

57

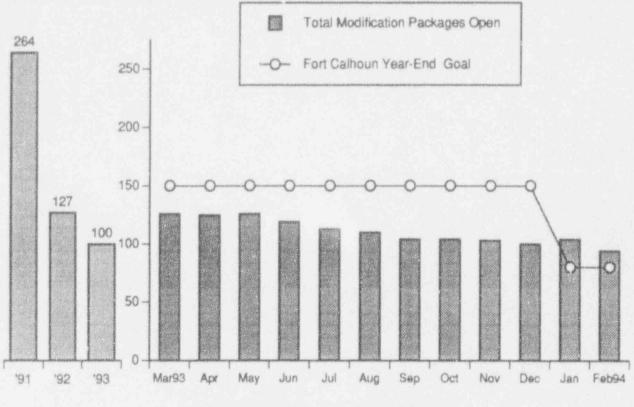

OUTSTANDING MODIFICATIONS

This indicator shows the total number of outstanding modifications (excluding outstanding modifications which are proposed to be cancelled).


Category	Reporting Month
Form FC-1133 Backlog/In Progress	1
Mod. Requests Being Reviewed	5
Design Engr. Backlog/In Progress	48
Construction Backlog/In Progress	30
Design Engr. Update Backlog/In Progres	s <u>10</u>
Total	94

At the end of February 1994, 3 additional modification requests had been issued this year and 28 modification requests had been cancelled. The Nuclear Projects Review Committee (NPRC) had completed 45 backlog modification request reviews this year. The Nuclear Projects Committee (NPC) had completed 4 backlog modification request reviews this year.

The 1994 year-end Fort Calhoun goal for this indicator is a maximum of 80 outstanding modifications.

Data Source: Jaworski/Turner (Manager/Source) Scofield/Lounsbery (Manager/Source) Accountability: Scofield/Phelps Adverse Trend: None

EARs Requiring Engineering Closeout - Not In Closeout

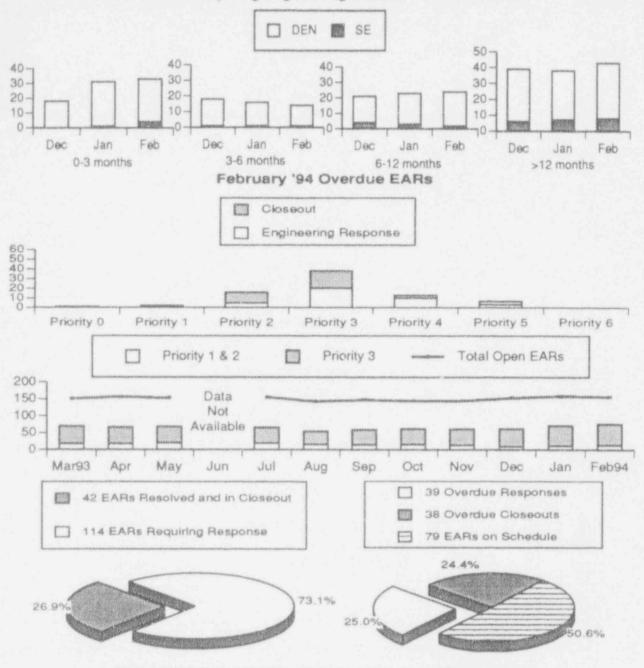


ENGINEERING ASSISTANCE REQUEST BREAKDOWN

This indicator shows a breakdown of the number of EARs assigned to Design Engineering and System Engineering. The 1994 year-end goal for this indicator is a maximum of 140 outstanding EARs.

Total EAR breakdown is as follows:		
EARs opened during the month	11	
EARs closed during the month		
Total EARs open as of the end of the month	156	
Data Source: Skiles/Pulverenti (Manager/Source)		

Accountability: Jaworski/Skiles Adverse Trend: None

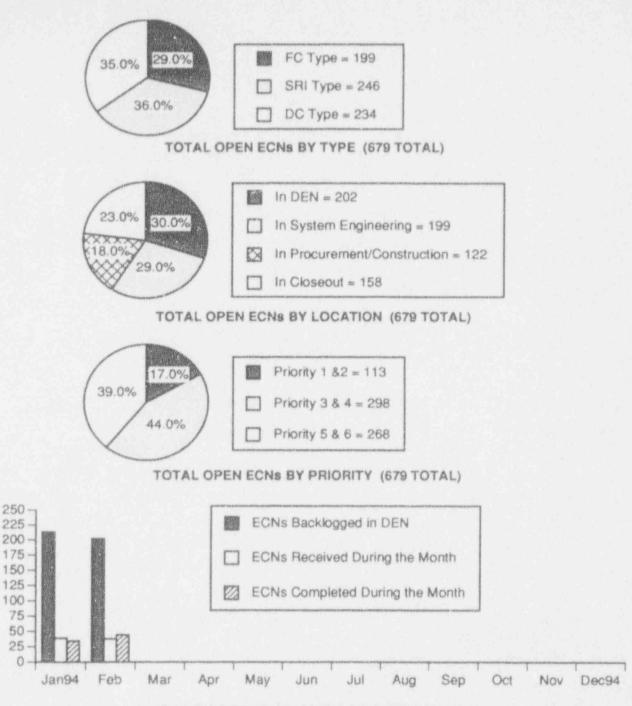


ENGINEERING CHANGE NOTICE STATUS


This indicator shows the number of Engineering Change Notices (ECNs) awaiting completion by DEN, the number of ECNs opened during the reporting month, and the number of ECNs completed by DEN during the reporting month.

At the end of February 1994, there was a total of 202 DEN backlogged open ECNs (50 Facility Change, 69 Substitute Replacement Items, and 83 Document Change type). There were 38 ECNs received by DEN, and 44 ECNs completed during the month. The year-to-date monthly average number of ECNs received was 38.5 at the end of the month.

Data Source: Skiles/McShannon (Manager/Source) Accountability: Skiles/Jaworski Adverse Trend: None 60

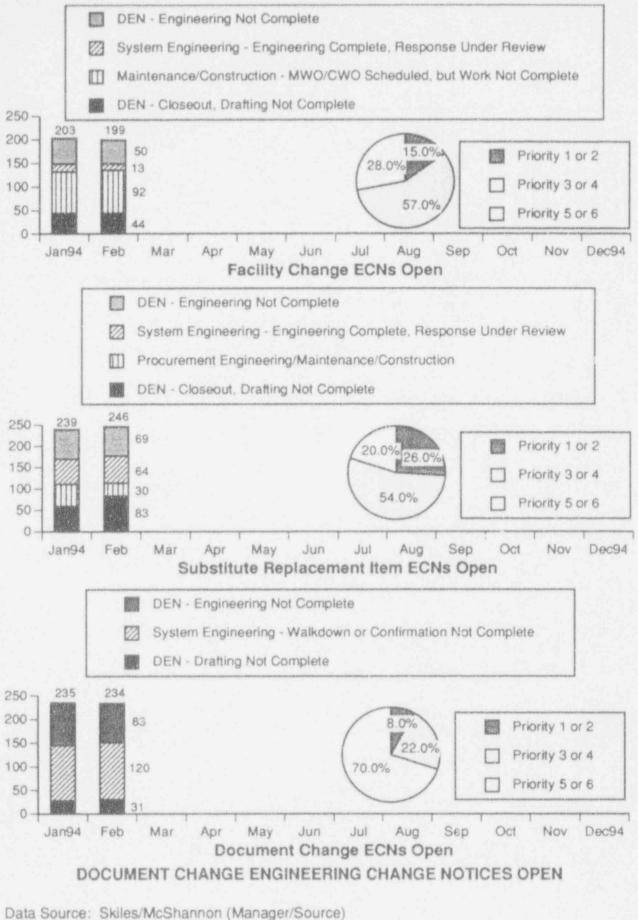

Data Source: Skiles/McShannon (Manager/Sourc Accountability: Skiles/Jaworski Adverse Trend: None

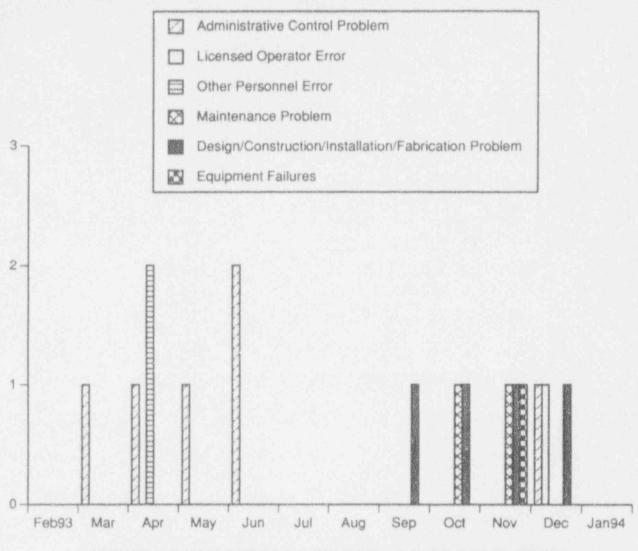

LICENSEE EVENT REPORT (LER) ROOT CAUSE BREAKDOWN

This indicator shows the LERs by event date broken down by Root Cause Code for each of the past twelve months from February 1, 1993 through January 31, 1994. To be consistent with the Preventable/Personnel Errors LER indicator, this indicator is reported by the LER event date as opposed to the LER report date.

The cause codes are intended to identify possible programmatic deficiencies. For detailed descriptions of these codes, see the "Performance Indicator Definitions" section of this report.


There were no events in January 1994 that resulted in LERs.

Data Source: Short/Cavanaugh (Manager/Source)

Accountability: Chase

Adverse Trend: None

62

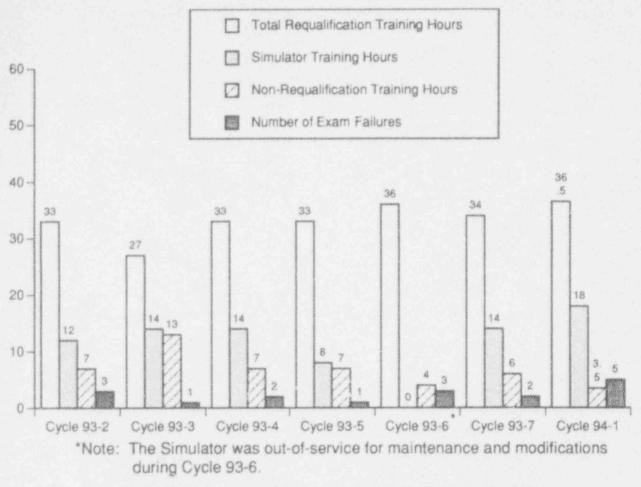

LICENSED OPERATOR REQUALIFICATION TRAINING

This indicator provides information on the total number of hours of training given to each crew during each cycle. The Simulator training hours shown on the graph are a subset of the total training hours. Non-Requalification Training Hours are used for AOP/EOP verification & validation, INPO commitments, GET, Fire Brigade, Safety Meetings, and Division Manager lunches.


Exam failures are defined as failures in the written, simulator, and Job Performance Measures (JPMs) segments of the Licensed Operator Requalification Training.

There were 3 written exam failures, and 2 individual simulator exam failures for Cycle 94-1. The failure of the 2 individuals in the simulator also caused that crew to fail. All individuals were remediated without impacting the Operations Department shift schedule.

Data Source: Gasper/Guliani (Manager/Source)

Accountability: Gasper/Guliani

Adverse Trend: None

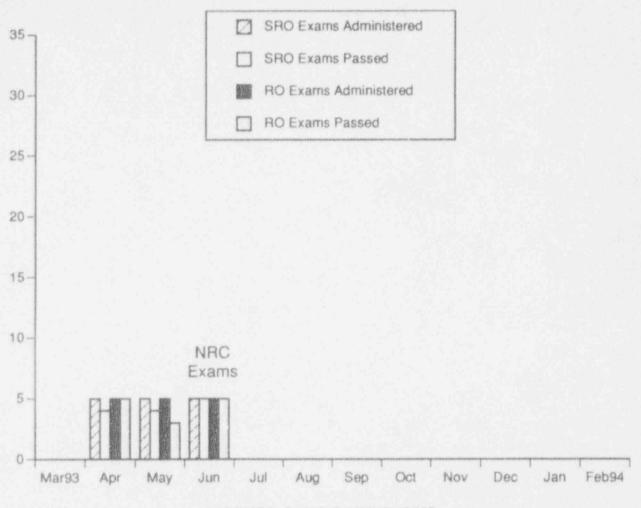

LICENSE CANDIDATE EXAMS


This indicator shows the number of Senior Reactor Operator (SRO) and Reactor Operator (RO) quizzes and exams taken and passed each month. These internally administered quizzes and exams are used to plot the SRO and RO candidates' monthly progress.

There were no OPPD Reactor Operator or Senior Reactor Operator exams administered during February 1994.

Currently, there is no Hot License class being conducted. The next Licensed Operator class will convene on April 11, 1994.

Data Source: Gasper/Guliani (Manager/Source) Accountability: Gasper/Guliani Adverse Trend: None

SEP 68

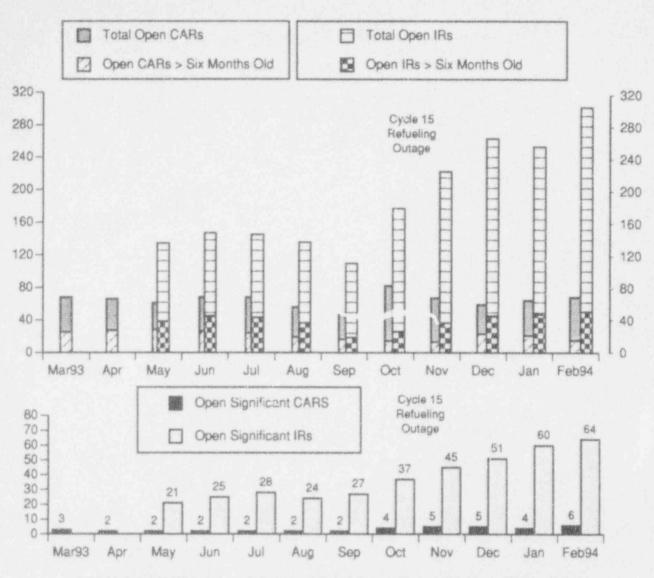

OPEN CORRECTIVE ACTION REPORTS AND INCIDENT REPORTS


This indicator shows the total number of open Corrective Action Reports (CARs), CARs >6 months old, the total number of Open IRs, IRs >6 months old, the number of open significant CARs and the number of open significant IRs.

At the end of February 1994 there were 68 open CARs. 15 of these CARs were greater than 6 months old. There were 6 Open Significant CARs at the end of the month.

Also, at the end of February there were 305 open IRs. 51 of these IRs were greater than 6 months old. There were 64 Open Significant IRs at the end of the month.

The 1994 monthly goal for the number of CARs greater than 6 months old is less than 30.

Data Source: Orr/Gurtis (Manager/Source) & CHAMPS Accountability: Andrews/Gambhir/Gates Adverse Trend: Although the number of IRs has increased in recent months, an adverse trend is not indicated because the increase is a result of the Cycle 15 Refueling Outage and a revision to Standing Order R-4.

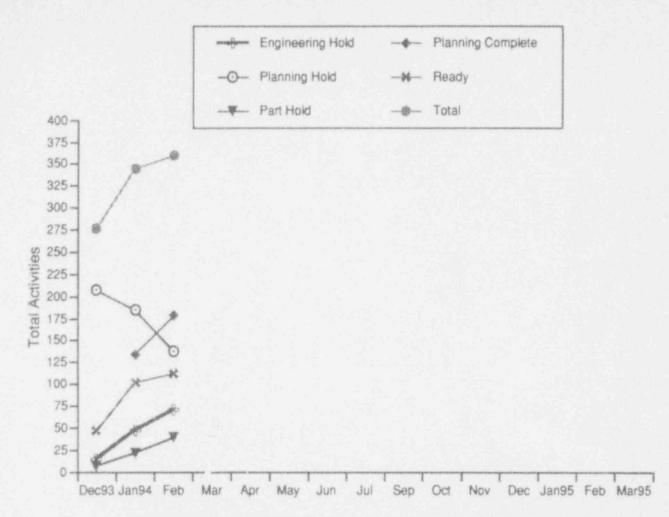

MWO PLANNING STATUS (CYCLE 16 REFUELING OUTAGE)

This indicator shows the total number of Maintenance Work Requests (MWRs) and Maintenance Work Orders (MWOs) that have been approved for inclusion in the Cycle 16 Refueling Outage. This graph indicates:

Parts Holds (part hold removed when parts are staged and ready for use)


*Engineering Holds (Engineering hold removed when appropriate engineering paperwork or support is received for the package)

•Planning Holds (Planning hold removed when planning is completed to the point when package is ready or other support is necessary to continue the planning process)

•Planning Complete (status given when only items keeping the job from being ready to work are parts or engineering support)

•Ready (status when all planning, supporting documentation, and parts are ready to go)

Data Source: Chase/Schmitz (Manager/Source) Accountability: Chase/Johansen Adverse Trend: None 66

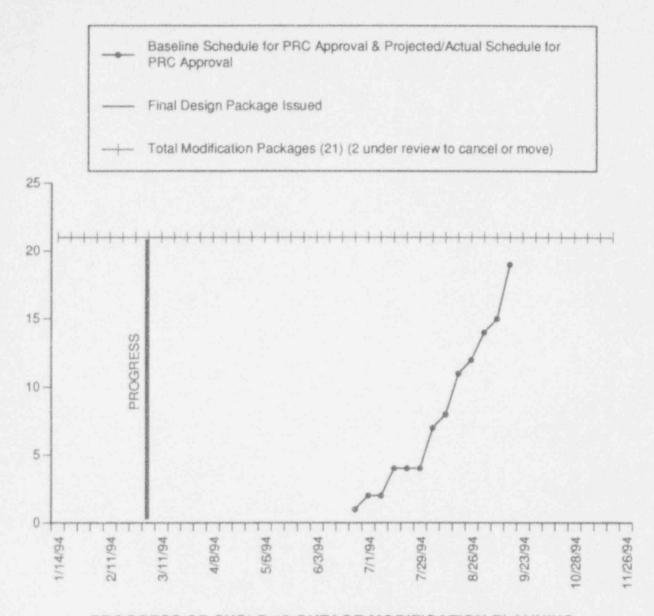


PROGRESS OF CYCLE 16 OUTAGE MODIFICATION PLANNING (FROZEN SCOPE OF 21 MODIFICATIONS)

This indicator shows the status of modifications approved for installation during the Cycle 16 Refueling Outage. The data is represented with respect to the baseline schedule (established 1/14/94) and the current schedule. This information is taken from the Modification Variation Report produced by the Design Engineering group.

The goal for this indicator is to have all modification packages PRC approved by October 15, 1994.

Data Source: Skiles/Ronne (Manager/Source) Accountability: Phelps/Skiles Adverse Trend: None

SEP 31

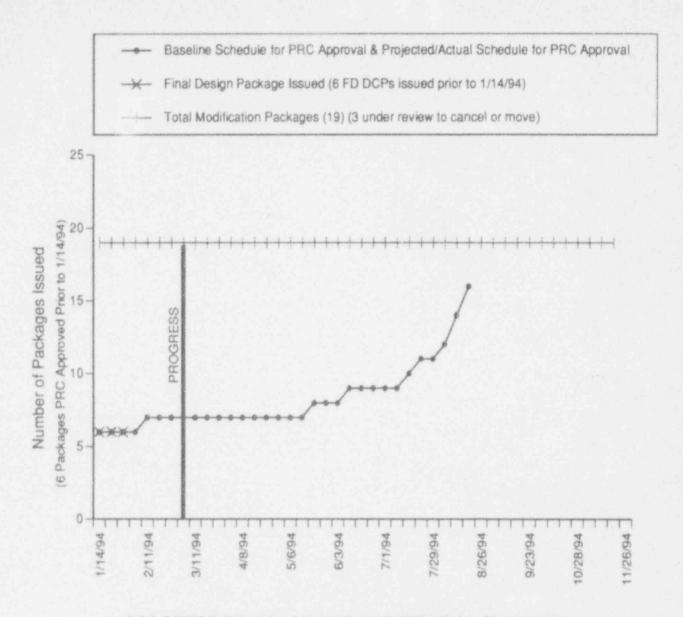

PROGRESS OF 1994 ON-LINE MODIFICATION PLANNING (FROZEN SCOPE OF 19 MODIFICATIONS)

This indicator shows the status of modifications approved for on-line installation during 1994. The data is represented with respect to the baseline schedule (established 1/14/94) and the current schedule. This information is taken from the Modification Variance Report produced by the Design Engineering Nuclear group.

The goal for this indicator is to have all modification packages PRC approved by August 15, 1994.

Data Source: Skiles/Ronne (Manager/Source) Accountability: Phelps/Skiles Adverse Trend: None

ACTION PLANS FOR ADVERSE TRENDS

ACTION PLANS FOR ADVERSE TRENDS

This section lists action plans that have been developed for the performance indicators cited as exhibiting adverse trends during the three months preceding this report.

The action plan for Engineering Change Notice Status follows:

Actions to reverse the Adverse Trend cited in the December 1993 Performance Indicators Report -

- 1) Focus resources on backlog reduction.
- 2) Reduce the number of ECNs entering the system.
- Implement a consistent method for tracking/counting ECNs that enter and exit the system.

Item 2) will be discussed to reach an agreement with Production Engineering Division and the NPRC to reduce the total number of ECNs entering the system to a maximum of 500 per year. Then DEN's goal will be to maintain the backlog to a level that precludes an adverse trend.

The action plan for Document Review follows:

Actions to reverse the Adverse Trend (cited in this report) for overdue document reviews are:

- 1) Continue to provide resources to perform biennial review assignments.
- A Facility License Change (FLC) request has been submitted to reduce the number of required periodic reviews.
- A PRC subcommittee has been formed to take the maximum advantage of the FLC request to reduce the number of periodic document review.

An overdue document review is not safety significant, in that OPPD's dynamic procedural review process ensures documents are kept up-to-date.

AUXILIARY FEEDWATER SYSTEM SAFETY SYSTEM PERFORMANCE

The sum of the known (planned and unplanned) unavailable hours and the estimated unavailable hours for the auxiliary feedwater system for the reporting period divided by the critical hours for the reporting period multiplied by the number of trains in the auxiliary feedwater system.

CHECK VALVE FAILURE RATE

Compares the Fort Calhoun check valve failure rate to the industry check valve failure rate (failures per 1 million component hours). The data for the industry failure rate is three months behind the PI Report reporting month. This indicator tracks performance for SEP #43.

COLLECTIVE RADIATION EXPOSURE

Collective radiation exposure is the total external wholebody dose received by all on-site personnel (including contractors and visitors) during a time period, as measured by the thermoluminescent dosimeter (TLD). Collective radiation exposure is reported in units of personrem. This indicator tracks radiological work performance for SEP #54.

COMPONENT FAILURE ANALYSIS REPORT (CFAR) SUMMARY

The number of INPO categories for Fort Calhoun Station with significantly higher (1.645 standard deviations) failure rates than the rest of the industry for an eighteen month time period. Failures are reported as component (i.e. pumps, motors, valves, etc.) and application (i.e. charging pumps, main steam stop valves, control element drive motors, etc.) categories.

Failure Cause Categories are:

Wear Out/Aging - a failure thought to be the consequence of expected wear or aging.

Manufacturing Defect - a failure attributable to inadequate assembly or initial quality of the responsible component or system.

Engineering/Design - a failure attributable to the inadequate design of the responsible component or system.

Other Devices - a failure attributable to a failure or misoperation of another component or system, including associated devices.

Maintenance/Testing - a failure that is a result of improper maintenance or testing, lack of maintenance, or personnel errors that occur during maintenance or testing activities performed on the responsible component or system, including failure to follow procedures.

Errors - failures attributable to incorrect procedures that were followed as written, improper installation of equipment, and personnel errors (including failure to follow procedures properly). Also included in this category are failures for which the cause is unknown or cannot be assigned to any of the preceding categories.

CENTS PER KILOWATT HOUR

The purpose of this indicator is to quantify the economical operation of Fort Calhoun Station. The cents per kilowatt hour indicator represents the budget and actual cents per kilowatt hour on a 12 month rolling average for the current year. The basis for the budget curve is the approved 1993 budget. The basis for the actual curve is the Financial and Operating Report.

CLEAN CONTROLLED AREA CONTAMINATIONS ≥1,000 DISINTEGRATIONS/MINUTE PER PROBE AREA

The personnel contamination events in the clean controlled area. This indicator tracks personnel performance for SEP #15 & 54.

CONTAMINATED RADIATION CONTROLLED AREA

The percentage of the Radiation Controlled Area, which includes the auxiliary building, the radwaste building, and areas of the C/RP building, that is contaminated based on the total square footage. This indicator tracks performance for SEP # 54.

DAILY THERMAL OUTPUT

This indicator shows the daily core thermal output as measured from computer point XC105 (in thermal megawatts). The 1500 MW Tech Spec limit, and the unmet portion of the 1495 MW FCS daily goal for the reporting month are also shown.

DIESEL GENERATOR RELIABILITY (25 DEMANDS)

This indicator shows the number of failures occurring for each emergency diesel generator during the last 25 start demands and the last 25 load-run demands.

DISABLING INJURY/ILLNESS FREQUENCY RATE (LOST TIME ACCIDENT RATE)

This indicator is defined as the number of accidents for all utility personnel permanently assigned to the station, involving days away from work per 200,000 man-hours worked (100 man-years). This does not include contractor personnel. This indicator tracks personnel performance for SEP #25 & 26.

DOCUMENT CHANGE ENGINEERING CHANGE NO-TICES OPEN

This indicator breaks down the number of Engineering Change Notices (ECNs) that are assigned to Design Engineering Nuclear (DEN), System Engineering, and Maintenance. The graphs provide data on ECN Facility Changes open, ECN Substitute Replacement Parts open, and ECN Document Changes open. This indicator tracks performance for SEP #62.

DOCUMENT REVIEW (BIENNIAL)

The Document Review Indicator shows the number of documents reviewed, the number of documents scheduled for review, and the number of document reviews that are overdue for the reporting month. A document review is considered overdue if the review is not complete within 6 months of the assigned due date. This indicator tracks performance for SEP #46.

EMERGENCY AC POWER SYSTEM SAFETY SYSTEM PERFORMANCE

The sum of the known (planned and unplanned) unavailable and the estimated unavailable hours for the emergency AC power system for the reporting period divided by the number of hours in the reporting period multiplied by the number of trains in the emergency AC power system.

EMERGENCY DIESEL GENERATOR UNIT RELIABIL-

This indicator shows the number of failures that were reported during the last 20, 50, and 100 emergency diesel generator demands at the Fort Calhoun Station. Also shown are trigger values which correlate to a high level of confidence that a unit's diesel generators have obtained a reliability of greater than or equal to 95% when the demand failures are less than the trigger values. 1) Number of Start Demands: All valid and inadvertent start demands, including all start-only demands and all start demands that are followed by load-run demands, whether by automatic or manual initiation. A start-only demand is a demand in which the emergency generator is started, but no attempt is made to load the generator. 2) Number of Start Failures: Any failure within the emergency generator system that prevents the generator from achieving specified frequency and voltage is classified as a valid start failure. This includes any condition identified in the course of maintenance inspections (with the emergency generator in standby mode) that definitely would have resulted in a start failure if a demand had occurred. 3) Number of Load-Run Demands: For a valid load-run demand to be counted the load-run attempt must meet one or more of the following criteria:

A) A load-run of any duration that results from a real automatic or manual initiation.

B) A load-run test to satisfy the plant's load and duration as stated in each test's specifications.

C) Other special tests in which the emergency generator is expected to be operated for at least one hour while loaded with at least 50% of its design load.

4) Number of Load-Run Failures: A load-run failure should be counted for any reason in which the emergency generator does not pick up load and run as predicted. Failures are counted during any valid load-run demands.

5) Exceptions: Unsuccessful attempts to start or load-run should not be counted as valid demands or failures when they can be attributed to any of the following:

A) Spurious trips that would be bypassed in the event of an emergency.

B) Malfunction of equipment that is not required during an emergency.

C) Intentional termination of a test because of abnormal conditions that would not have resulted in major diesel generator damage or repair.

D) Malfunctions or operating errors which would have not prevented the emergency generator from being restarted and brought to load within a few minutes.

E) A failure to start because a portion of the starting system was disabled for test purpose, if followed by a successful start with the starting system in its normal alignment. Each emergency generator failure that results in the generator being declared inoperable should be counted as one demand and one failure. Exploratory tests during corrective maintenance and the successful test that follows repair to verify operability should not be counted as demands or failures when the EDG has not been declared operable again.

EMERGENCY DIESEL GENERATOR UNRELIABILITY

This indicator measures the total unreliability of emergency diesel generators. In general, unreliability is the ratio of unsuccessful operations (starts or load-runs) to the number of valid demands. Total unreliability is a combination of start unreliability and load-run unreliability.

ENGINEERING ASSISTANCE REQUEST (EAR) BREAKDOWN

This indicator shows a breakdown, by age and priority of the EAR, of the number of EARs assigned to Design Engineering Nuclear and System Engineering. This indicator tracks performance for SEP #62.

ENGINEERING CHANGE NOTICE (ECN) STATUS

The number of ECNs that were opened, ECNs that were completed, and open backlog ECNs awaiting completion by DEN for the reporting month. This indicator tracks performance for SEP #62.

EQUIPMENT FORCED OUTAGES PER 1,000 CRITI-CAL HOURS

Equipment forced outages per 1000 critical hours is the inverse of the mean time between forced outages caused by equipment failures. The mean time is equal to the number of hours the reactor is critical in a period (1000 hours) divided by the number of forced outages caused by equipment failures in that period.

EQUIVALENT AVAILABILITY FACTOR

This indicator is defined as the ratio of gross available generation to gross maximum generation, expressed as a percentage. Available generation is the energy that can be produced if the unit is operated at the maximum power level permitted by equipment and regulatory limitations. Maximum generation is the energy that can be produced by a unit in a given period if operated continuously at maximum capacity.

FORCED OUTAGE RATE

This indicator is defined as the percentage of time that the unit was unavailable due to forced events compared to the time planned for electrical generation. Forced events are failures or other unplanned conditions that require removing the unit from service before the end of the next weekend. Forced events include start-up failures and events initiated while the unit is in reserve shutdown (i.e., the unit is available but not in service).

PERFORMANCE INDICATOR DEFINITIONS

FUEL RELIABILITY INDICATOR

This indicator is defined as the steady-state primary coolant I-131 activity, corrected for the tramp uranium contribution and normalized to a common purification rate. Tramp uranium is fuel which has been deposited on reactor core internals from previous defective fuel or is present on the surface of fuel elements from the manufacturing process. Steady state is defined as continuous operation for at least three days at a power level that does not vary more than + or - 5%. Plants should collect data for this indicator at a power level above 85%, when possible. Plants that did not operate at steady-state power above 85% should collect data for this indicator at the highest steady-state power level attained during the month.

The density correction factor is the ratio of the specific volume of coolant at the RCS operating temperature (540 degrees F., Vf = 0.02146) divided by the specific volume of coolant at normal letdown temperature (120 degrees F at outlet of the letdown cooling heat exchanger, Vf = 0.016204), which results in a density correction factor for FCS equal to 1.32.

GROSS HEAT RATE

Gross heat rate is defined as the ratio of total thermal energy in British Thermal Units (BTU) produced by the reactor to the total gross electrical energy produced by the generator in kilowatt-hours (KWH).

HAZARDOUS WASTE PRODUCED

The total amount (in Kilograms) of non-halogenated hazardous waste, halogenated hazardous waste, and other hazardous waste produced by FCS each month.

HIGH PRESSURE SAFETY INJECTION SYSTEM SAFETY SYSTEM PERFORMANCE

The sum of the known (planned and unplanned) unavailable hours and the estimated unavailable hours for the high pressure safety injection system for the reporting period divided by the critical hours for the reporting period multiplied by the number of trains in the high pressure safety injection system.

INDUSTRIAL SAFETY ACCIDENT RATE - INPO

This indicator is defined as the number of accidents per 200,000 man-hours worked for all utility personnel permanently assigned to the station that result in any of the following: 1) one or more days of restricted work (excluding the day of the accident), 2) one or more days away from work (excluding the day of the accident) and 3) fatalities. Contractor personnel are not included for this indicator.

IN-LINE CHEMISTRY INSTRUMENTS OUT OF SER-VICE

Total number of in-line chemistry instruments that are out-of-service in the Secondary System and the Post Accident Sampling System (PASS).

LICENSE CANDIDATE EXAMS

This indicator shows the number of SRO and/or RO guizzes and exams that are administered and passed each month. This indicator tracks training performance for SEP #68.

LICENSED OPERATOR REQUALIFICATION TRAIN-ING

The total number of hours of training given to each crew during each cycle. Also provided are the simulator training hours (which are a subset of the total training hours), the number of non-requalification training hours and the number of exam failures. This indicator tracks training performance for SEP #68.

LICENSEE EVENT REPORT (LER) ROOT CAUSE BREAKDOWN

This indicator shows the number and root cause code for Licensee Event Reports. The root cause codes are as follows:

1) Administrative Control Problem - Management and supervisory deficiencies that affect plant programs or activities (i.e., poor planning, breakdown or lack of adequate management or supervisory control, incorrect procedures, etc.)

 Licensed Operator Error - This cause code captures errors of omission/commission by licensed reactor operators during plant activities.

 Other Personnel Error - Errors of omission/commission committed by non-licensed personnel involved in plant activities.

4) Maintenance Problem - The intent of this cause code is to capture the full range of problems which can be attributed in any way to programmatic deficiencies in the maintenance functional organization. Activities included in this category are maintenance, testing, surveillance, calibration and radiation protection.

5) Design/Construction/Installation/Fabrication Problem - This cause code covers a full range of programmatic deficiencies in the areas of design, construction, installation, and fabrication (i.e., loss of control power due to underrated fuse, equipment not qualified for the environment, etc.).

6) Equipment Failures (Electronic Piece-Parts or Environmental-Related Failures) - This code is used for spurious failures of electronic piece-parts and failures due to meteorological conditions such as lightning, ice, high winds, etc. Generally, it includes spurious or one-time failures. Electric components included in this category are circuit cards, rectifiers, bistables, fuses, capacitors, diodes, resistors, etc.

LOGGABLE/REPORTABLE INCIDENTS (SECURITY)

The total number of security incidents for the reporting month depicted in two graphs. This indicator tracks security performance for SEP #58.

MAINTENANCE OVERTIME

The % of overtime hours compared to normal hours for maintenance. This includes OPPD personnel as well as contract personnel.

PERFORMANCE INDICATOR DEFINITIONS

MAINTENANCE WORKLOAD BACKLOGS

This indicator is a breakdown of the manhours associated corrective non-outage maintenance work orders by several categories. Safety related MWOs are those MWOs in which the Equipment Data Base in CHAMPS has identified the equipment as Critical Quality Equipment (CQE). Therefore, this indicator is identifying those MWOs that have been identified as CQE and reports the number of estimated manhours associated with the backlog. This indicator tracks maintenance performance for SEP #36.

MAXIMUM INDIVIDUAL RADIATION EXPOSURE

The total maximum amount of radiation received by an individual person working at FCS on a monthly, quarterly, and annual basis.

MWO PLANNING STATUS (CYCLE 15 REFUELING OUTAGE)

The total number of Maintenance Work Orders that have been approved for inclusion in the Cycle 15 Refueling Outage and the number that are ready to work (parts staged, planning complete, and all other paperwork ready for field use). Also included is the number of MWOs that have engineering holds (ECNs, procedures and other miscellaneous engineering holds), parts hold, (parts staged, not yet inspected, parts not yet arrived) and planning hold (job scope not yet completed). Maintenance Work Requests (MWRs) are also shown that have been identified for the Cycle 15 Refueling Outage and have not yet been converted to MWOs.

NUMBER OF CONTROL ROOM EQUIPMENT DEFI-CIENCIES

A control room equipment deficiency (CRD) is defined as any component which is operated or controlled from the Control Room, provides indication or alarm to the Control Room, provides testing capabilities from the Control Room, provides automatic actions from or to the Control Room, or provides a passive function for the Control Room and has been identified as deficient, i.e., does not perform under all conditions as designed. This definition also applies to the Alternate Shutdown Panels AI-179, AI-185, and AI-212.

A plant component which is deficient or inoperable is considered an "Operator Work Around (OWA) Item" if some other action is required by an operator to compensate for the condition of the component. Some examples of OWAs are: 1) The control room level indicator does not work but a local sightglass can be read by an Operato; out in the plant; 2) A deficient pump cannot be repaired because replacement parts require a long lead time for purchase/delivery, thus requiring the redundant pump to be operated continuously; 3) Special actions are required by an Operator because of equipment design problems. These actions may be described in Operations Memorandums, Operator Notes, or may require changes to Operating Procedures. 4) Deficient plant equipment that is required to be used during Emergency Operating Procedures or Abnormal Operating Procedures. 5) System indication that provides critical information during normal or abnormal operations.

NUMBER OF MISSED SURVEILLANCE TESTS RE-SULTING IN LICENSEE EVENT REPORTS

The number of Surveillance Tests (STs) that result in Licensee Event Reports (LERs) during the reporting month. This indicator tracks missed STs for SEP #60 & 61.

OPEN CORRECTIVE ACTION REPORTS & INCIDENT REPORTS

This indicator displays the total number of open Corrective Action Reports (CARs), the number of CARs that are obser than six months and the number of open significant C :Rs. Also displayed are the number of open Incident Heports (IRs), the number of IRs that are greater than six months old and the number of open significant IRs.

OUTSTANDING MODIFICATIONS

The number of Modification Requests (MRs) in any state between the issuance of a Modification Number and the completion of the drawing update.

1) Form FC-1133 Backlog/In Progress. This number represents modification requests that have not been plant approved during the reporting month.

2) Modification Requests Being Reviewed. This category includes:

A.) Modification Requests that are not yet reviewed.

B.) Modification Requests being reviewed by the Nuclear Projects Review Committee (NPRC).

C.) Modification Requests being reviewed by the Nuclear Projects Committee (NPC)

These Modification Requests may be reviewed several times before they are approved for accomplishment or cancelled. Some of these Modification Requests are returned to Engineering for more information, some approved for evaluation, some approved for study, and some approved for planning. Once planning is completed and the scope of the work is clearly defined, these Modification Requests may be approved for accomplishment with a year assigned for construction or they may be cancelled. All of these different phases require review.

 Design Engineering Backlog/In Progress. Nuclear Planning has assigned a year in which construction will be completed and design work may be in progress.
 Construction Backlog/In Progress. The Construction Package has been issued or construction has begun but the modification has not been accepted by the System Acceptance Committee (SAC).

5) Design Engineering Update Backlog/In Progress. PED has received the Modification Completion Report but the drawings have not been updated.

The above mentioned outstanding modifications do not include modifications which are proposed for cancellation.

OVERALL PROJECT STATUS (REFUELING OUTAGE)

This indicator shows the status of the projects which are in the scope of the Refueling Outage.

PERCENTAGE OF TOTAL MWO3 COMPLETED PER MONTH IDENTIFIED AS REWORK

The percentage of total MWOs completed per month identified as rework. Rework activities are identified by maintenance planning and craft. Rework is: Any maintenance work repeated to correct a deficiency which has re-occurred within 60 days following similar work activities. Any additional work required to correct deficiencies discovered during a failed Post Maintenance Test to ensure the component/system passes subsequent Post Maintenance Tests. This definition can be found in S. O. M-101.

PERCENT OF COMPLETED SCHEDULED MAINTE-NANCE ACTIVITIES

The % of the number of completed maintenance activities as compared to the number of scheduled maintenance activities each month. This % is shown for all maintenance crafts. Also shown are the number of emergent MWOs. Maintenance activitie: include MWRs, MWOs, STs, PMOs, calibrations, and other miscellaneous activities. This indicator tracks Maintenance performance for SEP #33.

PREVENTABLE/PERSONNEL ERROR LERS

This indicator is a breakdown of LERs. For purposes of LER event classification, a preventable LER is defined as: An overit for which the root cause is personnel error (i.e., inappropriate action by one or more individuals), inadequate administrative controls, a design/construction/installation/fabrication problem (involving work completed by or supervised by OPPD personnel) or a maintenance problem (attributed to inadequate or improper upkeep/repair of plant equipment). Also, the cause of the event must have occurred within approximately two years of the "Event Date" specified in the LER (e.g., an event for which the cause is attributed to a problem with the original design of the plant would not be considered preventable).

For purposes of LER event classification, a "Personnel Error" LER is defined as follows: An event for which the root cause is inappropriate action on the part of one or more individuals (as opposed to being attributed to a department or a general group). Also, the inappropriate action must have occurred within approximately two years of the "Event Date" specified in the LER. Additionally, each event classified as a "Personnel Error" should also be classified as "Preventable." This indicator trends personnel performance for SEP Item #15.

PRIMARY SYSTEM CHEMISTRY % OF HOURS OUT OF LIMIT

The % of hours out of limit are for six primary chemistry parameters divided by the total number of hours possible for the month. The key parameters used are: Lithium, Chloride, Hydrogen, Dissolved Oxygen, Fluoride, and Suspended Solids. EPRI limits are used.

PROCEDURAL NONCOMPLIANCE INCIDENTS (MAINTENANCE)

The number of identified incidents concerning maintenance procedural problems, the number of closed IRs related to the use of procedures (includes the number of closed IRs caused by procedural noncompliance), and the number of closed procedural noncompliance IRs. This indicator trends personnel performance for SEP #15, 41 & 44.

PROGRESS OF CYCLE 16 REFUELING OUTAGE MODIFICATION PLANNING (FROZEN SCOPE OF 21 MODIFICATIONS)

This indicator shows the status of modifications approved for completion during the Refueling Outage.

PROGRESS OF 1994 ON-LINE MODIFICATION PLAN-NING (FROZEN SCOPE OF 19 MODIFICATIONS)

This indicator shows the status of modifications approved for completion during 1994.

RADIOLOGICAL WORK PRACTICES PROGRAM

The number of identified poor radiological work practices (PRWPs) for the reporting month. This indicator tracks radiological work performance for SEP #52.

RATIO OF PREVENTIVE TO TOTAL MAINTENANCE & PREVENTIVE MAINTENANCE ITEMS OVERDUE

The ratio of preventive maintenance (including surveillance testing and calibration procedures) to the sum of non-outage corrective maintenance and preventive maintenance completed over the reporting period. The ratio, expressed as a percentage, is calculated based on manhours. Also displayed are the % of preventive maintenance items in the month that were not completed by the scheduled date plus a grace period equal to 25 % of the scheduled interval. This indicator tracks preventive maintenance activities for SEP #41.

RECORDABLE INJURY/ILLNESS CASES FRE-QUENCY RATE

The number of injuries requiring more than normal first aid per 200,000 man-hours worked. This indicator trends personnel performance for SEP #15, 25 & 26.

REPEAT FAILURES

The number of Nuclear Plant Reliability Data System (NPRDS) components with more than 1 failure and the number of NPRDS components with more than 2 failures for the last eighteen months.

SAFETY SYSTEM FAILURES

Safety system failures are any events or conditions that could prevent the fulfillment of the safety functions of structures or systems. If a system consists of multiple redundant subsystems or trains, failure of all trains constitutes a safety system failure. Failure of one of two or more trains is not counted as a safety system failure. The definition for the indicator parallels NRC reporting requirements in 10 CFR 50.72 and 10 CFR 50.73. The following is a list of the major safety systems, subsystems, and components monitored for this indicator: Accident Monitoring Instrumentation, Auxiliary (and

PERFORMANCE INDICATOR DEFINITIONS

Emergency) Feedwater System, Combustible Gas Control, Component Cooling Water System, Containment and Containment Isolation, Containment Coolant Systems, Control Room Emergency Ventilation System, Emergency Core Cooling Systems, Engineered Safety Features Instrumentation, Essential Compressed Air Systems, Essential or Emergency Service Water, Fire Detection or Suppression Systems, Isolation Condenser, Low Temperature Overpressure Protection, Main Steam Line Isolation Valves, Onsite Emergency AC & DC Power w/Distribution, Radiation Monitoring Instrumentation, Reactor Coolant System, Reactor Core Isolation Cooling System, Reactor Trip System and Instrumentation, Recirculation Pump Trip Actuation Instrumentation, Residual Heat Removal Systems, Safety Valves, Spent Fuel Systems, Standby Liquid Control System and Ultimate Heat Sink.

SECONDARY SYSTEM CHEMISTRY PERFORMANCE INDEX

The Chemistry Performance Index (CPI) is a calculation based on the concentration of key impurities in the secondary side of the plant. These key impurities are the most likely cause of deterioration of the steam generators. Criteria for calculating the CPI are: 1) The plant is at greater than 30 percent power; and 2) The power is changing less than 5% per day. The CPI is calculated using the following equation: CPI = (sodium/0.90) + (Chloride/1.70) + (Sulfate/1.90) + (Iron/4.40) + (Copper/ 0.30)/5. Where: Sodium, sulfate and chloride are the monthly average blowdown concentrations in ppb, iron and copper are monthly time weighted average feedwater concentrations in ppb. The denominator for each of the 5 factors is the INPO median value. If the monthly average for a specific parameter is less than the INPO median value, the median value is used in the calculation.

SIGNIFICANT EVENTS

Significant events are those events identified by NRC staff through detailed screening and evaluation of operating experience. The screening process includes the daily review and discussion of all reported operating reactor events, as well as other operational data such as special tests or construction activities. An event identified from the screening process as a significant event candidate is further evaluated to determine if any actual or potential threat to the health and safety of the public was involved. Specific examples of the type of criteria are summarized as follows: 1) Degradation of important safety equipment; 2) Unexpected plant response to a transient; 3) Degradation of fuel integrity, primary coolant pressure boundary, important associated features; 4) Scram with complication; 5) Unplanned release of radioactivity; 6) Operation outside the limits of the Technical Specifications; 7) Other.

INPO significant events reported in this indicator are SERs (Significant Event Reports) which inform utilities of significant events and lessons learned identified through the SEE-IN screening process.

SPARE PARTS INVENTORY VALUE

The dollar value of the spare parts inventory value for FCS during the reporting period.

STAFFING LEVEL

The actual staffing level and the authorized staffing level for the Nuclear Operations Division, the Production Engineering Division, and the Nuclear Services Division. This indicator tracks performance for SEP #24.

STATION NET GENERATION

The net generation (sum) produced by the FCS during the reporting month.

TEMPORARY MODIFICATIONS

The number of temporary mechanical and electrical configurations to the plant's systems.

 Temporary configurations are defined as electrical jumpers, electrical blocks, mechanical jumpers, or mechanical blocks which are installed in the plant operating systems and are not shown on the latest revision of the P&ID, schematic, connection, wiring, or flow diagrams.
 Jumpers and blocks which are installed for Surveillance Tests, Maintenance Procedures, Calibration Procedures, Special Procedures, or Operating Procedures are not considered as temporary modifications unless the jumper or block remains in place after the test or procedure is complete. Jumpers and blocks installed in test or lab instruments are not considered as temporary modifications.

3) Scaffolding is not considered a temporary modification. Jumpers and blocks which are installed and for which MRs have been submitted will be considered as temporary modifications until final resolution of the MR and the jumper or block is removed or is permanently recorded on the drawings. This indicator tracks temporary modifications for SEP #62 & 71.

THERMAL PERFORMANCE

The ratio of the design gross heat rate (corrected) to the adjusted actual gross heat rate, expressed as a percentage.

UNIT CAPABILITY FACTOR

The ratio of the available energy generation over a given time period to the reference energy generation (the energy that could be produced if the unit were operated continuously at full power under reference ambient conditions) over the same time period, expressed as a percentage.

PERFORMANCE INDICATOR DEFINITIONS

UNPLANNED AUTOMATIC REACTOR SCRAMS PER 7,000 CRITICAL HOURS

This indicator is defined as the number of unplanned automatic scrams (reactor protection system logic actuations) that occur per 7,000 hours of critical operation. The value for this indicator is calculated by multiplying the total number of unplanned automatic reactor scrams in a specific time period by 7,000 hours, then dividing that number by the total number of hours critical in the same time period. The indicator is further defined as follows:

1) Unplanned means that the scram was not an anticipated part of a planned test.

2) Scram means the automatic shutdown of the reactor by a rapid insertion of negative reactivity (e.g., by control rods, liquid injection system, etc.) that is caused by actuation of the reactor protection system. The scram signal may have resulted from exceeding a setpoint or may have been spuricus.

3) Automatic means that the initial signal that caused actuation of the reactor protection system logic was provided from one of the sensors monitoring plant parameters and conditions, rather than the manual scram switches or, in manual turbine trip switches (or push-buttons) provided in the main control room.

4) Critical means that during the steady-state condition of the reactor prior to the scram, the effective multiplication factor (k_e) was essentially equal to one.

UNPLANNED CAPABILITY LOSS FACTOR

The ratio of the unplanned energy losses during a given period of time, to the reference energy generation (the energy that could be produced if the unit were operated continuously at full power under reference ambient conditions) over the same time period, expressed as a percentage.

UNPLANNED SAFETY SYSTEM ACTUATIONS - (INPO DEFINITION)

This indicator is defined as the sum of the following safety system actuations:

1) The number of unplanned Emergency Core Cooling System (ECCS) actuations that result from reaching an ECCS actuation setpoint or from a spurious/inadvertent ECCS signal.

2) The number of unplanned emergency AC power system actuations that result from a loss of power to a safeguards bus. An unplanned safety system actuation occurs when an actuation setpoint for a safety system is reached or when a spurious or inadvertent signal is generated (ECCS only), and major equipment in the system is actuated. Unplanned means that the system actuation was not part of a planned test or evolution. The ECCS actuations to be counted are actuations of the high pressure injection system, the low pressure injection system, or the safety injection tanks.

UNPLANNED SAFETY SYSTEM ACTUATIONS (NRC DEFINITION)

The number of safety system actuations which include (only) the High Pressure Safety Injection System, the Low Pressure Safety Injection System, the Safety Injection Tanks, and the Emergency Diesel Generators. The NRC classification of safety system actuations includes actuations when major equipment is operated <u>and</u> when the logic systems for the above safety systems are challenged.

VIOLATIONS PER 1,000 INSPECTION HOURS

This indicator is defined as the number of violations sited in NRC inspection reports for FCS per 1,000 NRC inspection hours. The violations are reported in the year that the inspection was actually performed and not based on when the inspection report is received. The hours reported for each inspection report are used as the inspection hours.

VOLUME OF LOW-LEVEL SOLID RADIOACTIVE WASTE

This indicator is defined as the volume of low-level solid radioactive waste actually shipped for burial. This indicator also shows the volume of low-level radioactive waste which is in temporary storage, the amount of radioactive oil that has been shipped off-site for processing, and the volume of solid dry radioactive waste which has been shipped off-site for processing. Low-level solid radioactive waste consists of dry active waste, sludges, resins, and evaporator bottoms generated as a result of nuclear power plant operation and maintenance. Dry radioactive waste includes contaminated rags, cleaning materials, disposable protective clothing, plastic containers, and any other material to be disposed of at a low-level radioactive waste disposal site, except resin, sludge, or evaporator bottoms, Low-level refers to all radioactive waste that is not spent fuel or a by-product of spent fuel processing. This indicator tracks radiological work performance for SEP #54.

SAFETY ENHANCEMENT PROGRAM INDEX

The purpose of the Safety Enhancement Program (SEP) Performance Indicators Index is to list performance indicators related to SEP items with parameters that can be trended.

SEP Reference Number 15	Page
Increase HPES and IR Accountability Through Use of Performance Indicators	10
Procedural Noncompliance Incidents (Maintenance)	
Clean Controlled Area Contaminations ≥1,000 Disintegrations/Minute Per Probe Area	
Recordable Injury/Illness Cases Frequency Rate	4
Preventable/Personnel Error LERs	
SEP Reference Number 24	
Complete Staff Studies	
Staffing Level	42
SEP Reference Number 25	
Training Program for Managers and Supervisors Implemented	
Disabling Injury/Illness Frequency Rate	
Recordable Injury/Illness Cases Frequency Rate	
SEP Reference Number 26	
Evaluate and Implement Station Standards for Safe Work Practice Requirements	
Disabling Injury/Illness Frequency Rate	
Recordable Injury/Illness Cases Frequency Rate	
CED Delesance Number 07	
SEP Reference Number 27	
Implement Supervisory Enforcement of Industrial Safety Standards	
Disabling Injury/Illness Frequency Rate	
Recordable Injury/Illness Cases Frequency Rate	
SEP Reference Number 31	
Develop Outage and Maintenance Planning Manual and Conduct Project Management Ti	rainian
MWO Planning Status (Cycle 16 Refueling Outage)	
Overall Project Status (Cycle 16 Refueling Outage)	
Progress of Cycle 16 Outage Modification Planning	
righter of open to outage moundation righting management and an and an and an	
SEP Reference Number 33	
Develop On-Line Maintenance and Modification Schedule	
Percent of Completed Scheduled Maintenance Activities	
(All Maintenance Crafts)	50
SEP Reference Number 36	
Reduce Corrective Non-Outage Backlog	
Maintenance Workload Backlogs (Corrective Non-Outage)	45
SEP Reference Number 41	
Develop and Implement a Preventive Maintenance Schedule	
Ratio of Preventive to Total Maintenance & Preventive Maintenance Items Overdue	
Procedural Noncompliance Incidents	
SEP Reference Number 43	
Implement the Check Valve Test Program	
Check Valve Failure Rate	

SAFETY ENHANCEMENT PROGRAM INDEX (continued)

SEP Reference Number 44	Page
Compliance With and Use of Procedures	
Procedural Noncompliance Incidents (Maintenance)	
SEP Reference Number 46	
Design a Procedures Control and Administrative Program	
Document Review	
SEP Reference Number 52	
Establish Supervisory Accountability for Workers Radiological Practices	
Radiological Work Practices Program	
SEP Reference Number 54	
Complete implementation of Radiological Enhancement Program	
Collective Radiation Exposure	16
Volume of Low-Level Solid Radioactive Waste	
Clean Controlled Area Disintegrations ≥1,000 Counts/Minute Per Probe Area	
Contaminated Radiation Controlled Area	
SEP Reference Number 58	
Revise Physical Security Training and Procedure Program	
Loggable/Reportable Incidents (Security)	56
SEP Reference Number 60	
Improve Controls Over Surveillance Test Program	
Number of Missed Surveillance Tests Resulting in Licensee Event Reports	20
SEP Reference Number 61	
Modify Computer Program to Correctly Schedule Surveillance Tests	
Number of Missed Surveillance Tests Resulting in Licensee Event Reports	20
reaction of mission contentative reads mostining in Electrone Error reports and	ter transferre transferre field
SEP Reference Number 62	
Establish Interim System Engineers	
Temporary Modifications	
Engineering Assistance Request (EAR) Breakdown	59
Engineering Change Notice Status	60
Engineering Change Notice Breakdown	
SEP Reference Number 68	
Assess Root Cause of Poor Operator Training and Establish Means to Monitor Oper	ator Training
Licensed Operator Regualification Training	
License Candidate Exams	
SEP Reference Number 71	
Improve Controls over Temporary Modifications	
Temporary Modifications	57
reneviary moving and	

REPORT DISTRIBUTION LIST

R. L. Andrews G. L. Anglehart K. L. Belek B. H. Blorne C. E. Boughter C. J. Brunnert G. R. Cavanaugh J. W. Chase A. G. Christensen O. J. Clayton R. P. Clemens R. G. Conner J. L. Connolley G. M. Cook D.C. Dietz H. J. Faulhaber M. T. Frans D. P. Galle S. K. Gambhir J. K. Gasper W. G. Gates M. O. Gautier S. W. Gebers L. V. Goldberg R. H. Guy J. B. Herman K. C. Holthaus C. K. Huang C. J. Husk T. W. Jamieson R. L. Jaworski R. A. Johansen W. C. Jones J. D. Keppler D. D. Kloock L. T. Kusek

M. P. Lazar

B. R. Livingston D. L. Lovett J. H. MacKinnon J. W. Marcil N. L. Marfice R. D. Martin T. J. McIvor K. A. Miller Nuclear Licensing & Industry Affairs J. T. O'Connor W. W. Orr T. L. Patterson R. T. Pearce R. L. Phelps R. L. Plott W. J. Ponec C. R. Rice A. W. Richard D. G. Ried G. K. Samide M. J. Sandhoetner F. C. Scofield H. J. Selick J. W. Shannon R. W. Short C. F. Simmons E. L. Skaggs J. L. Skiles F. K. Smith R. L. Sorenson K. E. Steele M. A. Tesar J. J. Tesarek J. W. Tills J. M. Waszak

S. J. Willrett

80

OPERATING CYCLES AND REFUELING OUTAGE DATES								
 Event	Date Range	Production (MWH)	Cumulative (MWH)	-				
Cycle 1 1st Refueling	09/26/73 -02/01/75 02/01/75 -05/09/75	3,299,639	3,299,639					
Cycle 2 2nd Refueling	05/09/75 -10/01/76 10/01/76 -12/13/76	3,853,322	7,152,961					
Cycle 3	12/13/76 - 9/30/77	2,805,927	9,958,888					

*

3.026.832

3,882,734

. .

3,899,714

3,561,866

.

3,406.371

*

4,741,488

4,356,753

4,936,859

3,817,954

.

5,451,069

4,981,485

(Planned Dates)

*

*

12,985,720

16,868,454

20,768,168

24.130,034

17,736,405

32,477,893

36,834,646

41,771,505

45,589,459

51.040.528

56,022,013

FORT CALHOUN STATION

FORT CALHOUN STATION CURRENT PRODUCTION AND OPERATIONS "RECORDS"

First Sustaine, saction First Electricity 5.)lied to the System Commercial Operation (180,000 KWH) Achieved Full Power (100%) Longest Run (477 days) Highest Monthly Net Generation (364,468,800 KWH) Most Productive Fuel Cycle (5,451,069 MWH)(Cycle 13)

3rd Refueling

Cycle 4

4th Refueling

Cycle 5

5th Refueling

Cycle 6

6th Refueling

Cycle 7

7th Refueling

Cycle 8

Cycle 9

9th Refueling

Cycle 10

10th Refueling

Cycle 11

11th Refueling

Cycle 12

12th Refueling

Cycle 13 13th Refueling

Cycle 14

14th Refueling

Cycle 15

15th Retueling

8th Refueling

09/30/77 -12/09/77

12/09/77 - 10/14/78

10/14/78 - 12/24/78

12/24/78 - 01/18/80

01/18/80 - 06/11/80

06/11/80 - 09/18/81

09/18/81 - 12/21/81

12/21/81 - 12/06/82

12/06/82 - 04/07/83

04/07/83 - 03/03/84

03/03/84 - 07/12/84

07/12/84 - 09/28/85

09/28/85 - 01/16/86

01/16/86 - 03/07/87

03/07/87 - 06/08/87

06/08/87 - 09/27/88

09/27/88 - 01/31/89

01/31/89 - 02/17/90

02/17/90 - 05/29/90

05/29/90 - 02/01/92

02/01/92 - 05/03/92

05/03/92 -09/25/93

09/25/93 - 11/26/93

11/26/93 - 03/11/95

03/11/95 - 04/29/95

August 5, 1973 (5:47 p.m.) August 25, 1973 September 26, 1973 May 4, 1974 June 8, 1987-Sept. 27,1988 October 1987 May 29, 1990-Feb. 1,1992