



UNITED STATES
NUCLEAR REGULATORY COMMISSION
WASHINGTON, D. C. 20555

ALABAMA POWER COMPANY

DOCKET NO. 50-364

JOSEPH M. FARLEY NUCLEAR PLANT, UNIT NO. 2

AMENDMENT TO FACILITY OPERATING LICENSE

Amendment No. 17
License No. NPF-8

1. The Nuclear Regulatory Commission (the Commission) has found that:
 - A. The application for amendment by Alabama Power Company (the licensee) dated August 2, 1982, complies with the standards and requirements of the Atomic Energy Act of 1954, as amended (the Act) and the Commission's rules and regulations set forth in 10 CFR Chapter I;
 - B. The facility will operate in conformity with the application, the provisions of the Act, and the rules and regulations of the Commission;
 - C. There is reasonable assurance (i) that the activities authorized by this amendment can be conducted without endangering the health and safety of the public, and (ii) that such activities will be conducted in compliance with the Commission's regulations;
 - D. The issuance of this amendment will not be inimical to the common defense and security or to the health and safety of the public; and
 - E. The issuance of this amendment is in accordance with 10 CFR Part 51 of the Commission's regulations and all applicable requirements have been satisfied.

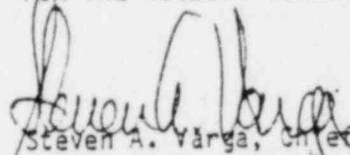
2. Accordingly, the license is amended by changes to the Technical Specifications as indicated in the attachment to this license amendment, and paragraph 2.C.(2) of Facility Operating License No. NPF-8 is hereby amended to read as follows:

(2) Technical Specifications

The Technical Specifications contained in Appendices A and B, as revised through Amendment No. 17, are hereby incorporated in the license. The licensee shall operate the facility in accordance with the Technical Specifications.

3. This license amendment is effective as of the date of its issuance.

FOR THE NUCLEAR REGULATORY COMMISSION


Steven A. Varga, Chief
Operating Reactors Branch #1
Division of Licensing

Attachment:
Changes to the Technical
Specifications

Date of Issuance: September 22, 1982

ATTACHMENT TO LICENSE AMENDMENT

AMENDMENT NO. 17 TO FACILITY OPERATING LICENSE NO. NPF-8

DOCKET NO. 50-364

Revise Appendix A as follows:

Remove Page

3/4 7-20

Insert Page

3/4 7-20

PLANT SYSTEMS

3/4.7.9 SNUBBERS

LIMITING CONDITION FOR OPERATION

3.7.9 All snubbers listed in Tables 3.7-4a and 3.7-4b shall be OPERABLE.

APPLICABILITY: MODES 1, 2, 3 and 4. (MODES 5 and 6 for snubbers located on systems required OPERABLE in those MODES).

ACTION:

With one or more snubbers inoperable, within 72 hours replace or restore the inoperable snubber(s) to OPERABLE status and perform an engineering evaluation per Specification 4.7.9.c on the supported component or declare the supported system inoperable and follow the appropriate ACTION statement for that system.

SURVEILLANCE REQUIREMENTS

4.7.9 Each snubber shall be demonstrated OPERABLE by performance of the following augmented inservice inspection program and the requirements of Specification 4.0.5.

a. Visual Inspections

The first inservice visual inspection of snubbers shall be performed after four months but within 10 months of POWER OPERATION and shall include all snubbers listed in Tables 3.7-4a and 3.7-4b. If less than two (2) snubbers are found inoperable during the first inservice visual inspection, the second inservice visual inspection shall be performed 12 months \pm 25% from the date of the first inspection. Otherwise, subsequent visual inspections shall be performed in accordance with the following schedule:

<u>No. Inoperable Snubbers per Inspection Period</u>	<u>Subsequent Visual Inspection Period*#</u>
0	18 months \pm 25%
1	12 months \pm 25%
2	6 months \pm 25%**
3,4	124 days \pm 25%
5,6,7	62 days \pm 25%
8 or more	31 days \pm 25%

The snubbers may be categorized into two groups: Those accessible and those inaccessible during reactor operation. Each group may be inspected independently in accordance with the above schedule.

*The inspection interval shall not be lengthened more than one step at a time.

#The provisions of Specification 4.0.2 are not applicable.

**This period is extended on a one-time basis until the first refueling outage scheduled to begin October 22, 1962, for inaccessible snubbers.