

### LICENSEE EVENT REPORT

CONTROL BLOCK: \_\_\_\_\_ (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

[0] [1] [W] [I] [L] [B] [R] [1] [2] [0] [0] [ - ] [0] [0] [0] [0] [0] [0] [ - ] [0] [0] [3] [4] [1] [1] [1] [1] [4] [5]  
7 8 9 14 15 25 26 30 57 58  
 LICENSEE CODE LICENSE NUMBER LICENSE TYPE CAT 58

CON'T  
 [0] [1] REPORT SOURCE [L] [6] [0] [5] [0] [ - ] [0] [4] [0] [9] [7] [1] [0] [0] [1] [8] [2] [8] [1] [0] [2] [8] [8] [2] [9]  
7 8 60 61 68 69 74 75 80  
 DOCKET NUMBER EVENT DATE REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)  
 [0] [2] DURING NORMAL OPERATION THE MECHANICAL INTERLOCK PREVENTING BOTH DOORS O  
 [0] [3] F THE CONTAINMENT BUILDING PERSONNEL AIRLOCK FROM OPENING SIMULTANEOUSLY  
 [0] [4] WAS NOT OPERABLE FOR APPROXIMATELY 4 HOURS. AT NO TIME WERE BOTH DOORS  
 [0] [5] OPENED SIMULTANEOUSLY. CONTAINMENT INTEGRITY WAS NOT BREACHED. SIMILA  
 [0] [6] R INCIDENTS: RO 81-10 AND 80-09.  
 [0] [7]  
 [0] [8]

[0] [9] SYSTEM CODE [S] [D] [11] CAUSE CODE [E] [12] CAUSE SUBCODE [B] [13] COMPONENT CODE [P] [E] [N] [E] [T] [R] [14] COMP. SUBCODE [A] [15] VALVE SUBCODE [Z] [16]  
7 8 9 10 11 12 13 18 19 20  
 SEQUENTIAL REPORT NO. [0] [1] [8] OCCURRENCE CODE [0] [3] REPORT TYPE [L] REVISION NO [0]  
21 22 23 24 25 26 27 28 29 30 31 32  
 ACTION TAKEN [A] [18] FUTURE ACTION [D] [19] EFFECT ON PLANT [Z] [20] SHUTDOWN METHOD [Z] [21] HOURS [0] [0] [0] [0] [22] ATTACHMENT SUBMITTED [Y] [23] NPRD-4 FORM SUB. [N] [24] PRIME COMP. SUPPLIER [N] [25] COMPONENT MANUFACTURER [C] [3] [1] [0] [26]  
33 34 35 36 37 40 41 42 43 44 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)  
 [1] [0] PERSONNEL AIRLOCK INTERIOR DOOR GEAR KEYS ALMOST SHEARED. GEAR KEYS REP  
 [1] [1] LACED AND LINKAGE ADJUSTED. GUARD POSTED OR EXTERIOR DOOR PADLOCKED SHU  
 [1] [2] T UNTIL MAINTENANCE COMPLETED. AIRLOCK WILL BE OVERHAULED NEXT REFUELIN  
 [1] [3] G OUTAGE. MEMO SENT TO PERSONNEL AND SIGN POSTED REQUESTING DOORS BE OP  
 [1] [4] ERATED CAREFULLY.  
7 8 9 80

[1] [5] FACILITY STATUS [F] [28] % POWER [0] [5] [7] [29] OTHER STATUS [NA] [30] METHOD OF DISCOVERY [A] [31] DISCOVERY DESCRIPTION [SUPERVISOR OBSERVATION] [32]  
7 8 9 10 12 13 44 45 46 80

[1] [6] ACTIVITY CONTENT [Z] [33] [Z] [34] RELEASED OF RELEASE [NA] AMOUNT OF ACTIVITY [35] LOCATION OF RELEASE [36]  
7 8 9 10 11 44 45 80

[1] [7] PERSONNEL EXPOSURES NUMBER [0] [0] [0] [37] TYPE [0] [38] DESCRIPTION [NA] [39]  
7 8 9 11 12 13 80

[1] [8] PERSONNEL INJURIES NUMBER [0] [0] [0] [40] DESCRIPTION [NA] [41]  
7 8 9 11 12 80

[1] [9] LOSS OF OR DAMAGE TO FACILITY TYPE [Z] [42] DESCRIPTION [NA] [43]  
7 8 9 10 80

[2] [0] PUBLICITY ISSUED [N] [44] DESCRIPTION [NA] [45]  
7 8 9 10 80

8211060016 821028  
 PDR ADDOCK 05000409  
 S PDR

NRC USE ONLY  
68 69 80

NAME OF PREPARER L. S. GOODMAN PHONE: 608-689-2331

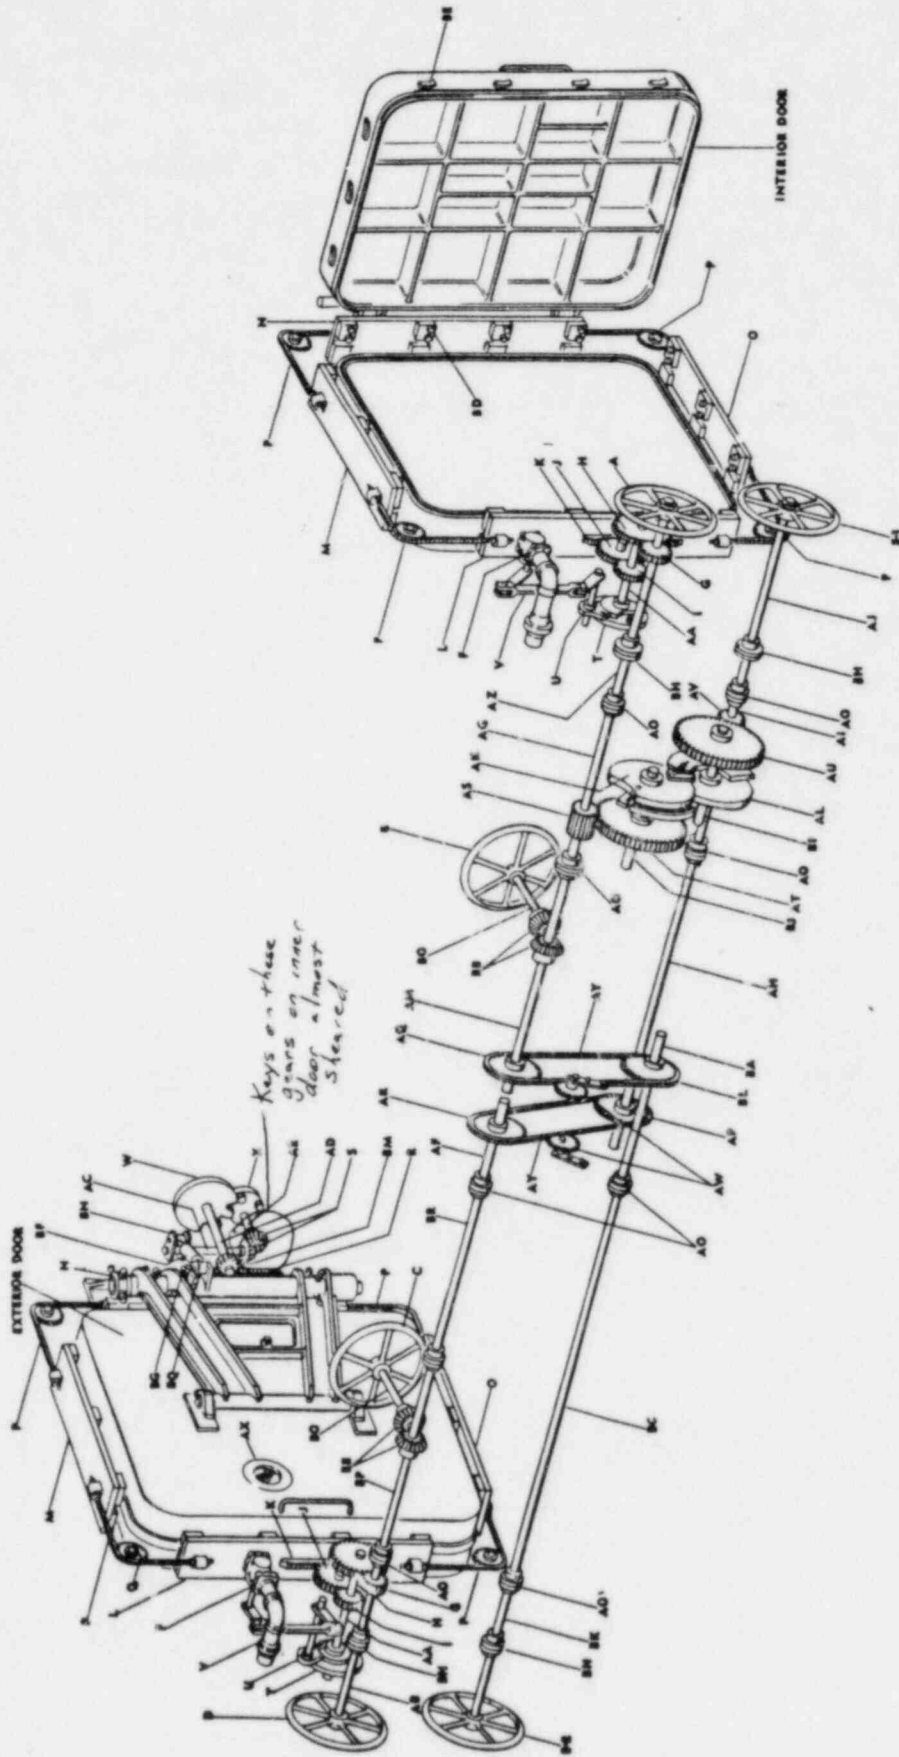


FIG. 6.7

PERSONNEL AIRLOCK