

Commonwealth Edison Company
LaSalle Generating Station
2601 North 21st Road
Marseilles, IL 61341-9757
Tel 815-357-6761



October 4, 1995

**United States Nuclear Regulatory Commission
Washington, D.C. 20555**

Attention: Document Control Desk

This Special Report is submitted in accordance with LaSalle Unit 1 Operating Licenses NPF-18, Technical Specification 4.8.1.1.3 and 6.6.C regarding Unit 1B Diesel Generator (E22, ...22-3001); manufactured by Electro-Motive Division of General Motors Corp. (Model EMD 20645/34). The original submittal date for this special report was September 29, 1995, This date was missed due to administrative errors.

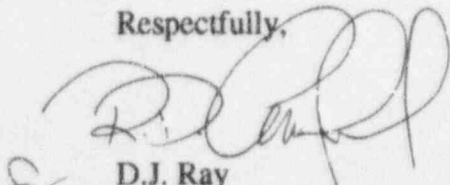
On August 30, 1995, with LaSalle Unit 1 at 100% power, the Unit 1B Diesel Generator (DG) was operating in accordance with LaSalle Operating Surveillance LOS-DG-M3, "1B(2B) Diesel Generator Operability Test". At approximately 13:09, the Nuclear Station Operator (NSO) attempted to synchronize the 1B DG with the offsite power source. At approximately 13:10, the 1B DG tripped due to Reverse Power. This failure was not a valid failure in accordance with Regulatory Guide 1.108 and Technical Specification 4.8.1.1.3.

The 1B DG trip due to Reverse Power is most likely due to an improper setting on the paralleling circuit of the 1B DG voltage regulator. Conversations were held with voltage regulator experts within the company, and it was determined that these personnel would adjust the regulator during the next refueling outage.

The 1B DG was operated successfully and declared operable on August 30, 1995.

If there are any questions or comments concerning this letter, please refer them to me at (815) 357-6761, extension 2212.

Respectfully,


D.J. Ray
Station Manager
LaSalle County Station

100035

9510110220 951004
PDR ADDCK 05000373
S PDR

A Unicom Company

IF22
/10

cc: H.J. Miller, Regional Administrator, Region III
P. G. Brochman, Senior Resident Inspector, LaSalle
R.J. Zuffa, IDNS Resident Inspector
INPO - Records Center
D. L. Farrar, Nuclear Regulatory Services Manager, NORS
Central file