

NIAGARA MOHAWK POWER CORPORATION

NIAGARA  MOHAWK

300 ERIE BOULEVARD, WEST
SYRACUSE, N. Y. 13202

July 26, 1984

Director
Office of Inspection and Enforcement
U.S. Nuclear Regulatory Commission
Washington, DC 20555
Attention: Document and Control Desk


RE: Docket No. 50-220
DPR-65

Dear Sir:

Submitted herewith is the Report of Operating Statistics and Shutdown Experience for July 1983 for the Nine Mile Point Nuclear Station Unit #1.

Also included is a Narrative Report⁺ of Operating Experience for July 1983. The Narrative Report of Operating Experience has been revised to include a challenge to Electromatic Relief Valve #111.

Sincerely,

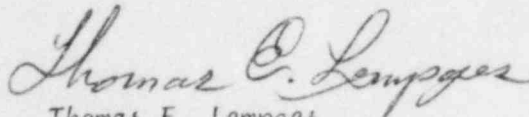

Thomas E. Lempges
Vice President
Nuclear Generation

TEL/lo
attachments
cc: Director, Office of I & E (10 copies)

8408020115 840726
PDR ADOCK 05000220
R PDR

IE2A
||

NIAGARA MOHAWK POWER CORPORATION

NARRATIVE OF OPERATING EXPERIENCE

July 1983

The Station operated during the month of July 1983 with a monthly availability factor of 85.3%, and a net design electrical capacity factor of 77.2%. The Station experienced an Auto Reactor Trip on July 16, 1983, caused by a broken weld on a turbine oil relief valve. During this transient, Electromatic Relief Valve #111 lifted and reset. The Station was restarted on July 16, 1983.

On July 28, 1983, the Station was removed from service to replace the seal on #11 recirculation pump and other station maintenance. The Station was restarted on July 31, 1983.

CLASS I WORK - INSTRUMENTATION AND CONTROL - JULY 1983

- WR #21895 LPRM Detectors 04-33D, 20-49D, 28-17B, 36-14A - replaced pin in connector and recrimped.
- #20493 Check #11 HPCI Loop Controls for correct operation. Found reversed leads on module (ID90C).

CLASS I WORK - ELECTRICAL MAINTENANCE - JULY 1983

- N1-MST-M1 125VDC batteries, cell specific gravities and battery voltage.
- WR #22205 RRP #15 Cooling Water Solenoid - replaced micro switches.
- #22204 FW IV 31-03 - replaced limitorque barrel assembly.
- #22383 Clean-up 33-01 - replaced limitorque barrel assembly.

CLASS I WORK - MAINTENANCE - JULY 1983

- WR #22171 CRD Accumulator 30-35 - replaced packing - 7/5/83.
- #22169 Inspected #13 Condensate Demineralizer and strainer - 7/7/83.
- #19611 Replaced seal across bottom of Peele door - 7/14/83.
- #22200 Replaced CRD filters - 7/19/83.
- #20552 Repaired union on inlet to air filter #113-83 (air to screen accum.) - 7/29/83.
- #21842 Replaced stem and packing on CRD Accum - 30-35 - 7/29/83.
- #22361 Tightened all studs and placed new gaskets in 39-04 valve - 7/29/83.
- #20525 Replaced flex gasket on bypass valve at flow check to X71-D - 7/30/83.
- #21343 Repaired 39-05 (lapping) - 7/30/83.