
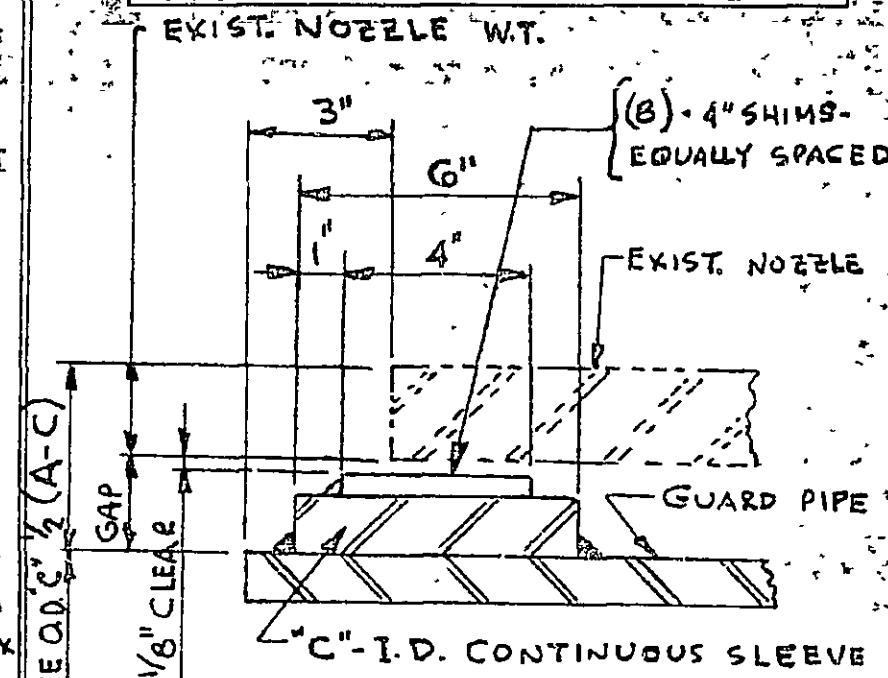


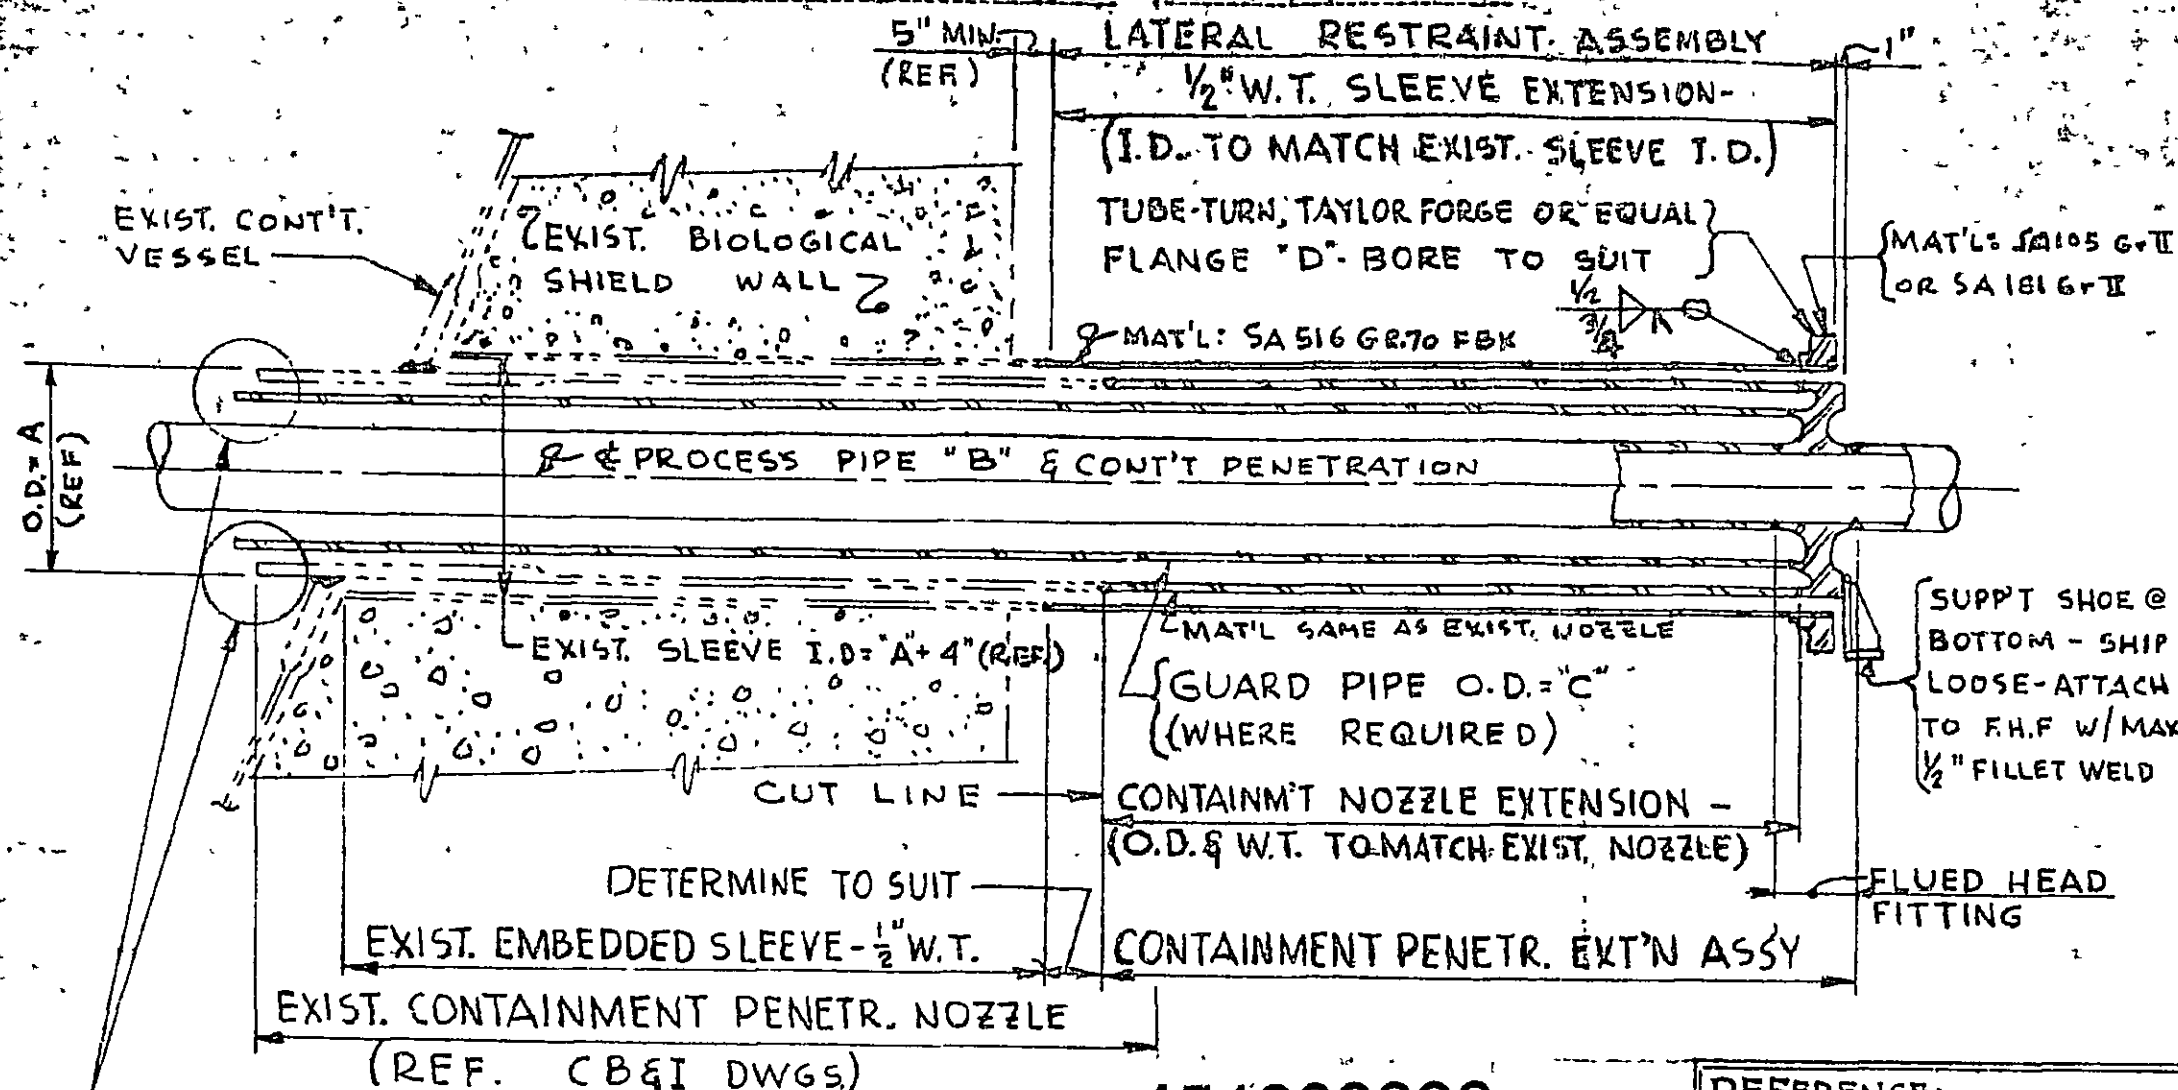

NOTE: THIS DETAIL NOT REQ'D
FOR X7A-D & 9A & B.

GUARD PIPE GUIDE DETAIL

-SEE GUARD PIPE GUIDE DETAIL

45 1200306

REFERENCE:
I. APPENDIX ENCL. VII Pg 63006
OF SPEC. E 69-4

NOTE: THIS SKETCH PROVIDES INFORMATION
REFERENCED IN REF.1-NOTE 2

CONTAINMENT PENETRATION ASSEMBLY

PENETR. No.	A	PROCESS PIPE B	GUARD PIPE C	FLANGE D	REMARKS
X 8	18	3" SCH.	12	LAT REST ASSY NOT REQ.	ATTACH F.H.F. @ CUT LINE
X 10	18	3" SCH.	12	" " " " "	ATTACH F.H.F. @ CUT LINE
X 11	26	10" SCH.	20	32" CL 350 SLIP ON	
X 12	36	20" O.D.	NONE	48" CL 350 SLIP ON	
X 13A & B	42	24" O.D.	NONE	60" CL 350 SLIP ON	
X 14	22	6" SCH.	16	28" CL 175 SLIP ON	
X 16A & B	26	10" SCH.	NONE	32" CL 350 SLIP ON	SEE NOTE 1
X 17 Δ	22	6" SCH.	NONE	28" CL 175 SLIP ON	
X 23	12 SCH.	8" SCH.	NONE		
X 24	12 SCH.	8" SCH.	NONE		
X 7A - D	42	24	SEE SKETCH M 200 FOR SPECIAL DETAILS		

PENETR. No.	A	PROCESS PIPE B	GUARD PIPE C	FLANGE D	REMARKS
X 18	6 SCH	3" SCH.	NONE	LAT. RESTR. ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 19	6 SCH	3" SCH	NONE	LAT RESTR ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 20	8 SCH	4" SCH.	NONE		
X 21	3 SCH	1" SCH	NONE		
X 22	3 SCH.	1" SCH.	NONE		
X 36	6 SCH	3" SCH	NONE	LAT. RESTR ASSY NOT REQ'D	ATTACH FHF @ CUTLINE
X 41	6 SCH	1" SCH	NONE	LAT. RESTRAINT ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 42	4 SCH	1 1/2 SCH.	NONE	LAT RESTR. ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 43	18	4 SCH.	NONE	LAT. RESTR ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 44	18	4 SCH	NONE	LAT RESTR ASSY NOT REQ'D	ATTACH FHF @ CUT LINE
X 45	34	18	SEE SKETCH M 200 FOR		SPECIAL DETAILS

SK 101670 R

NPPD - CNS

CONT'T PENETR.

ASS'Y & EKT.

PENETRATION

CONTROLS

ISSUE/DATE

1 OCT 16, 1970

2 NOV 23 1970

REV NO2