


North Anna 1

1Q/2001 Performance Indicators

Licensee's General Comments: none

Unplanned Scrams per 7000 Critical Hrs

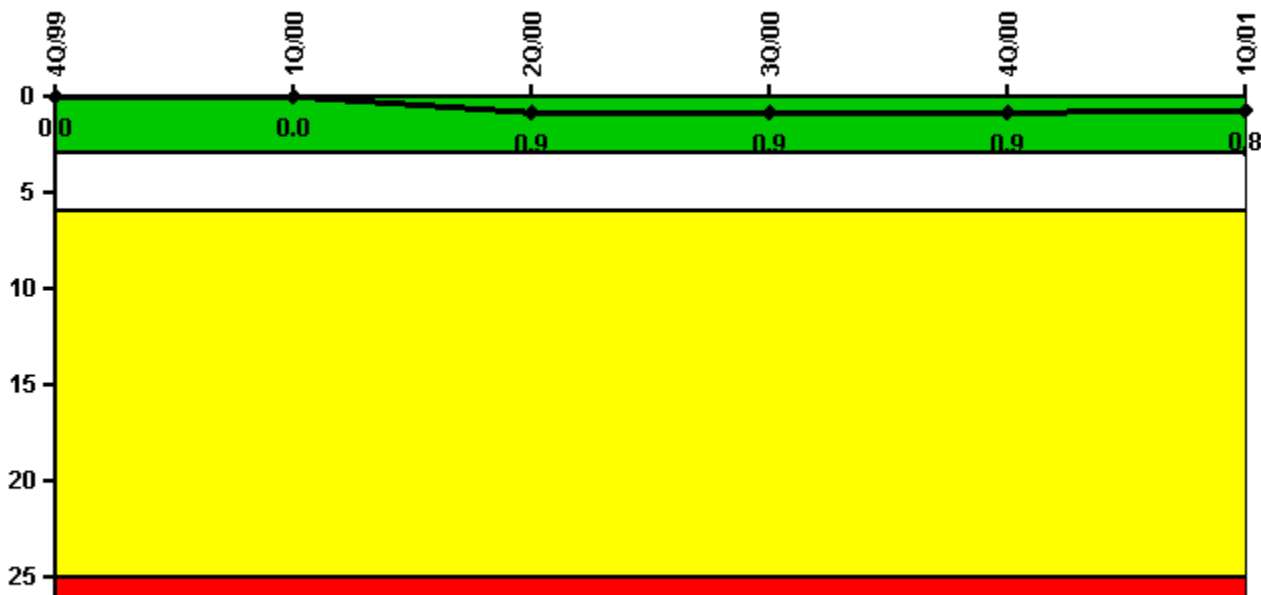


Thresholds: White > 3.0 Yellow > 6.0 Red > 25.0

Notes

Unplanned Scrams per 7000 Critical Hrs	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Unplanned scrams	0	0	1.0	0	0	0
Critical hours	2209.0	1705.5	1959.7	2208.0	2209.0	2160.0
Indicator value	0	0	0.9	0.9	0.9	0.8

Licensee Comments: none

Scrams with Loss of Normal Heat Removal

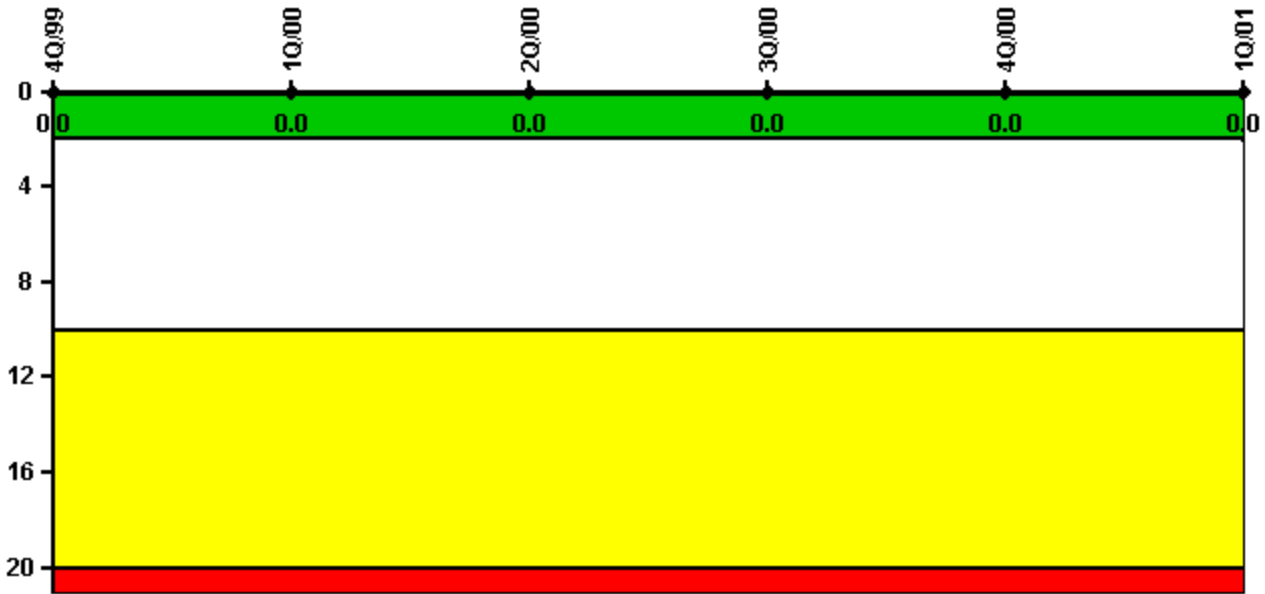


Thresholds: White > 2.0 Yellow > 10.0 Red > 20.0

Notes

Scrams with Loss of Normal Heat Removal	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Scrams	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0

Licensee Comments: none

Unplanned Power Changes per 7000 Critical Hrs

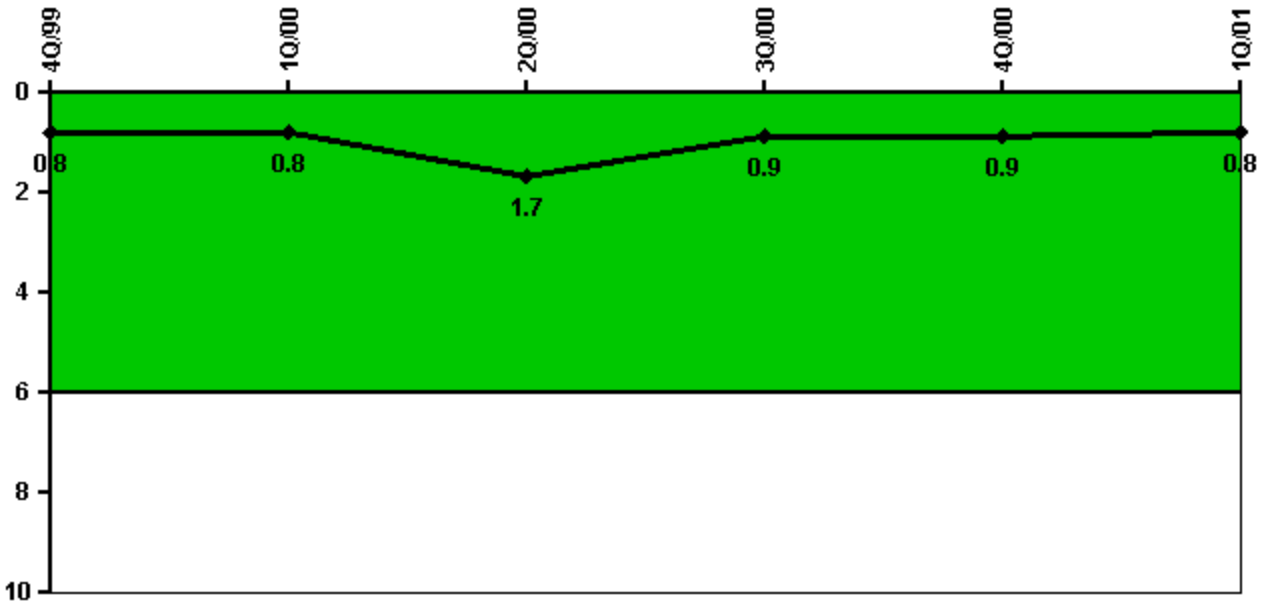


Thresholds: White > 6.0

Notes

Unplanned Power Changes per 7000 Critical Hrs	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Unplanned power changes	0	0	1.0	0	0	0
Critical hours	2209.0	1705.5	1959.7	2208.0	2209.0	2160.0
Indicator value	0.8	0.8	1.7	0.9	0.9	0.8

Licensee Comments: none

Safety System Unavailability, Emergency AC Power

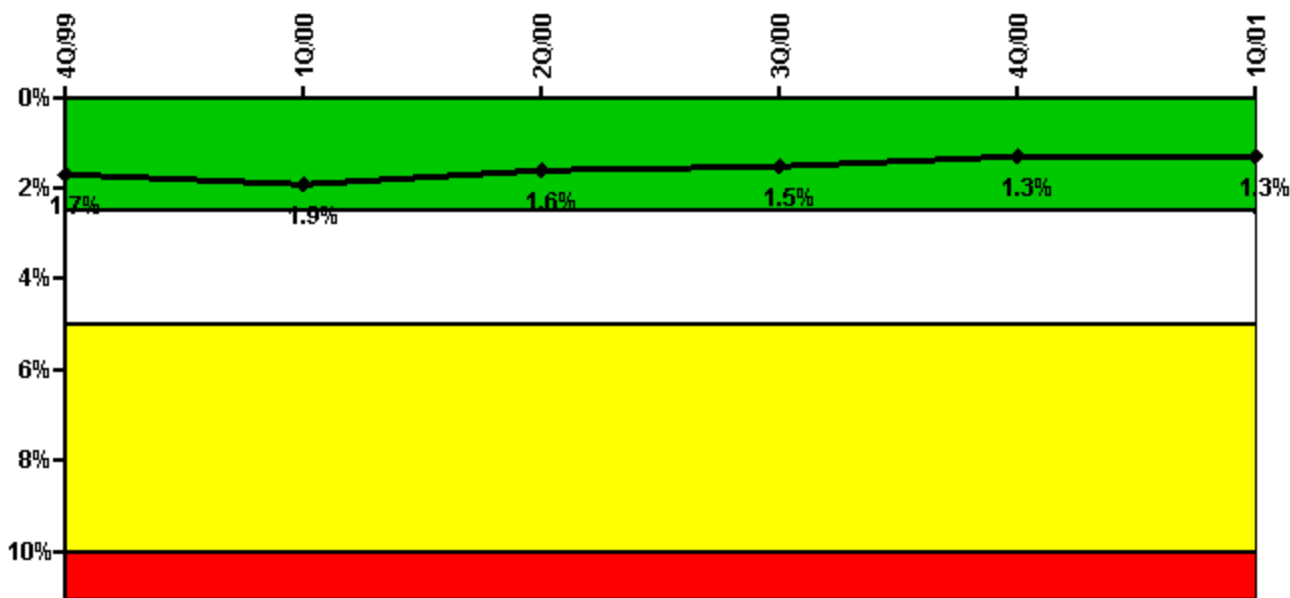


Thresholds: White > 2.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Emergency AC Power	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Train 1						
Planned unavailable hours	64.46	14.43	7.73	23.33	45.15	8.10
Unplanned unavailable hours	0	0	0.30	0	0	0
Fault exposure hours	0	95.52	3.92	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1815.70	2054.74	2208.00	2209.00	2160.00
Train 2						
Planned unavailable hours	70.57	12.27	14.00	9.23	48.38	6.32
Unplanned unavailable hours	0	0	8.92	0	0	34.00
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	2088.50	2179.08	2208.00	2209.00	2160.00
Indicator value	1.7%	1.9%	1.6%	1.5%	1.3%	1.3%

Licensee Comments: none

Safety System Unavailability, High Pressure Injection System (HPSI)

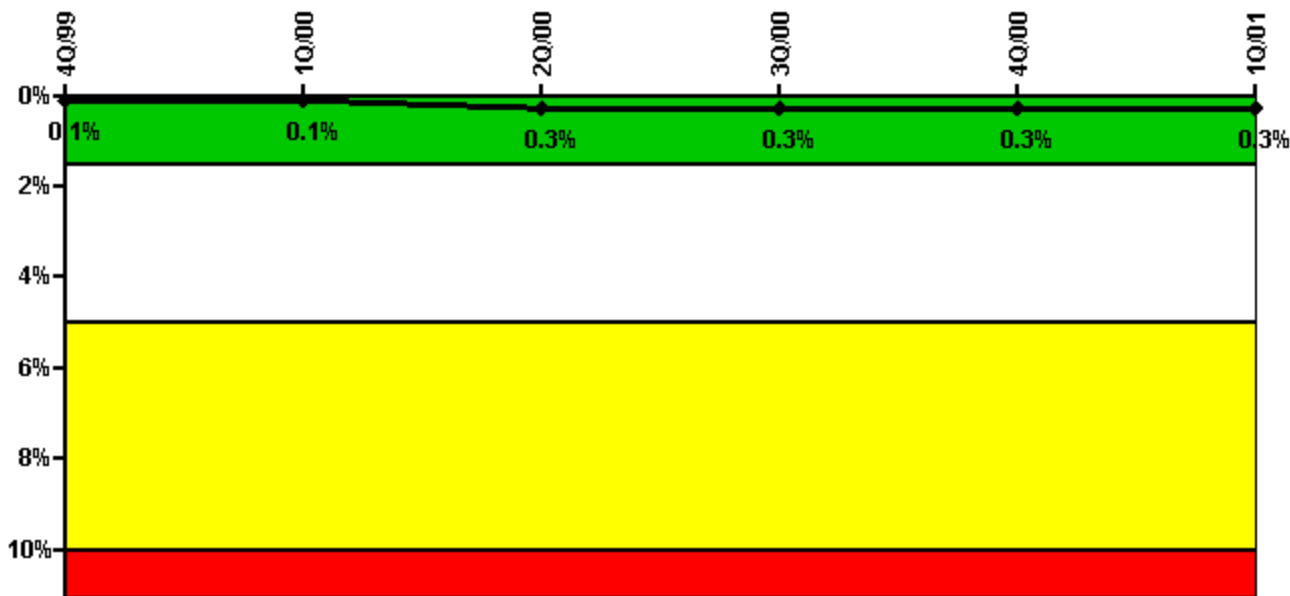


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, High Pressure Injection System (HPSI)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Train 1						
Planned unavailable hours	10.29	0.58	6.52	6.37	4.08	0.93
Unplanned unavailable hours	0	0	39.11	0.95	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1720.20	2101.73	2208.00	2209.00	2160.00
Train 2						
Planned unavailable hours	2.43	1.02	7.07	2.73	3.80	0.12
Unplanned unavailable hours	0	0	33.46	0.87	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	2034.78	2132.08	2208.00	2209.00	2160.00
Indicator value	0.1%	0.1%	0.3%	0.3%	0.3%	0.3%

Licensee Comments: none

Safety System Unavailability, Heat Removal System (AFW)

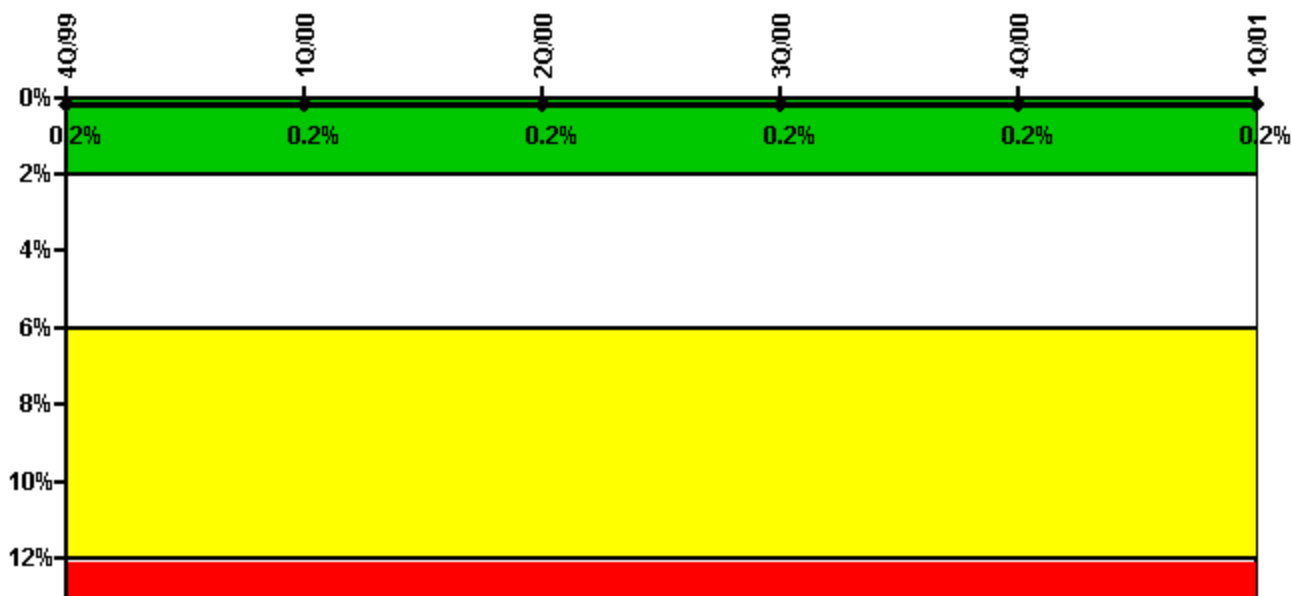


Thresholds: White > 2.0% Yellow > 6.0% Red > 12.0%

Notes

Safety System Unavailability, Heat Removal System (AFW)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Train 1						
Planned unavailable hours	2.23	0	1.17	1.10	1.87	14.02
Unplanned unavailable hours	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1715.78	2046.23	2208.00	2209.00	2160.00
Train 2						
Planned unavailable hours	1.58	9.75	0	6.29	11.83	0.48
Unplanned unavailable hours	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1715.78	2046.23	2208.00	2209.00	2160.00
Train 3						
Planned unavailable hours	5.15	4.82	7.98	13.92	5.00	3.97
Unplanned unavailable hours	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1715.78	2046.23	2208.00	2209.00	2160.00
Indicator value	0.2%	0.2%	0.2%	0.2%	0.2%	0.2%

Licensee Comments: none

Safety System Unavailability, Residual Heat Removal System

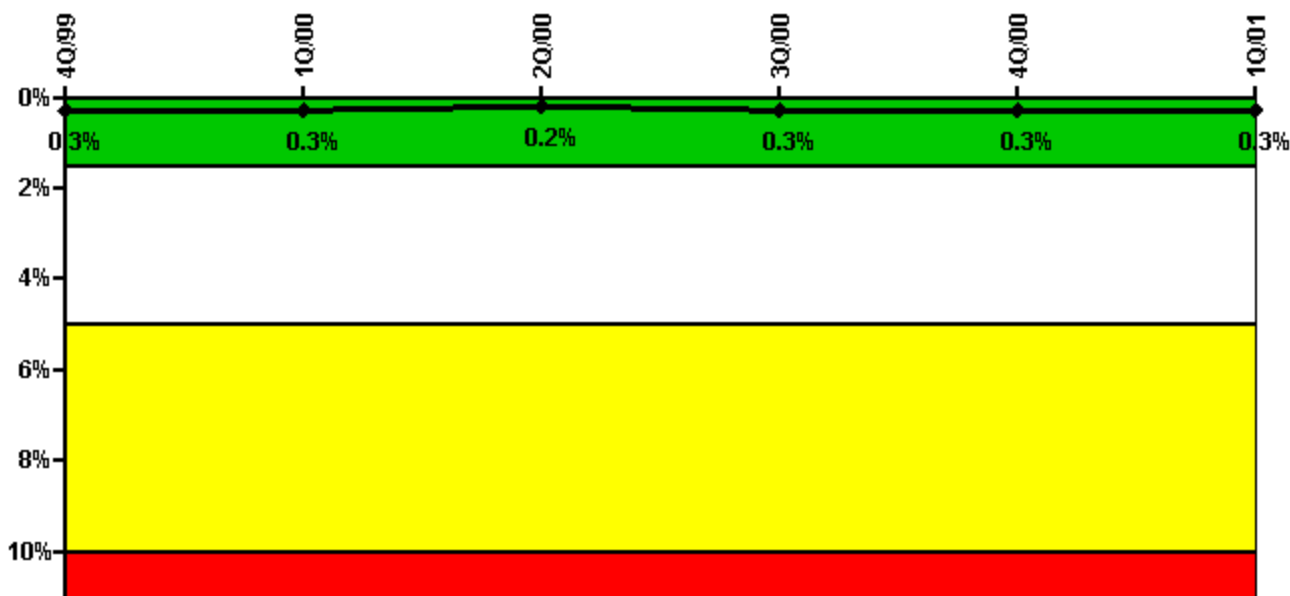


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Residual Heat Removal System	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Train 1						
Planned unavailable hours	0.90	11.40	8.03	37.79	5.68	4.72
Unplanned unavailable hours	0	0	28.95	2.55	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1720.20	2050.82	2208.00	2209.00	2160.00
Train 2						
Planned unavailable hours	26.20	21.02	11.70	16.74	3.57	9.24
Unplanned unavailable hours	0	0	0	2.98	0	5.62
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	1720.20	2050.82	2208.00	2209.00	2160.00
Train 3						
Planned unavailable hours	0	2.58	0	0	0	0
Unplanned unavailable hours	0	0	12.62	0	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	2034.78	2183.00	2208.00	2209.00	2160.00
Train 4						
Planned unavailable hours	0	3.67	0	0	0	0
Unplanned unavailable hours	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0
Required hours	2209.00	2034.78	2183.00	2208.00	2209.00	2160.00
Indicator value	0.3%	0.3%	0.2%	0.3%	0.3%	0.3%

Licensee Comments: none

Safety System Functional Failures (PWR)

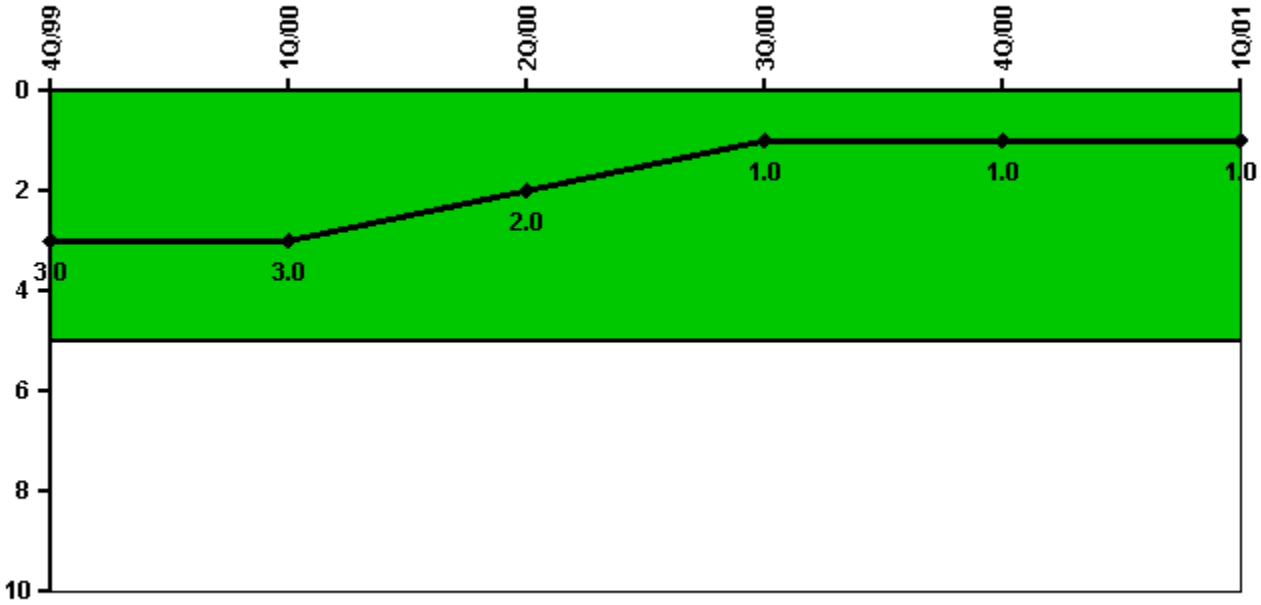


Thresholds: White > 5.0

Notes

Safety System Functional Failures (PWR)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Safety System Functional Failures	0	0	1	0	0	0
Indicator value	3	3	2	1	1	1

Licensee Comments: none

Reactor Coolant System Activity

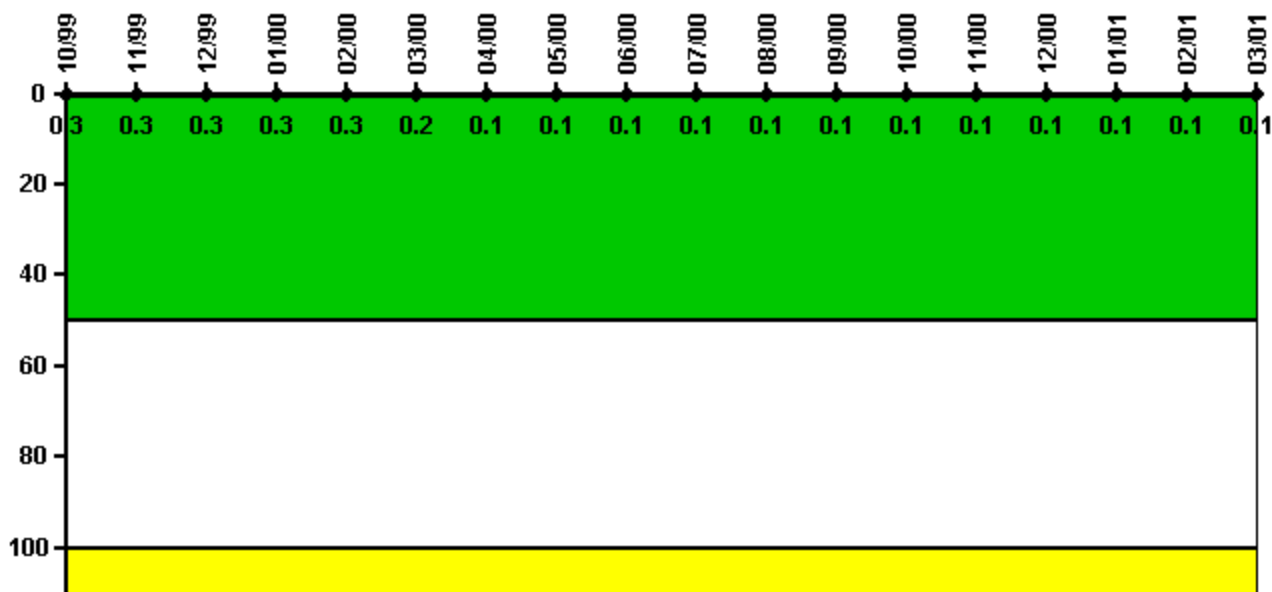

Thresholds: White > 50.0 Yellow > 100.0


Notes

Reactor Coolant System Activity	10/99	11/99	12/99	1/00	2/00	3/00	4/00	5/00	6/00	7/00	8/00	9/00
Maximum activity	0.002960	0.002860	0.003070	0.002920	0.003050	0.002040	0.000579	0.000632	0.000832	0.000709	0.000717	0.000830
Technical specification limit	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
Indicator value	0.3	0.3	0.3	0.3	0.3	0.2	0.1	0.1	0.1	0.1	0.1	0.1

Reactor Coolant System Activity	10/00	11/00	12/00	1/01	2/01	3/01
Maximum activity	0.000777	0.001460	0.000833	0.000854	0.000880	0.000999
Technical specification limit	1.0	1.0	1.0	1.0	1.0	1.0
Indicator value	0.1	0.1	0.1	0.1	0.1	0.1

Licensee Comments: none

Reactor Coolant System Leakage

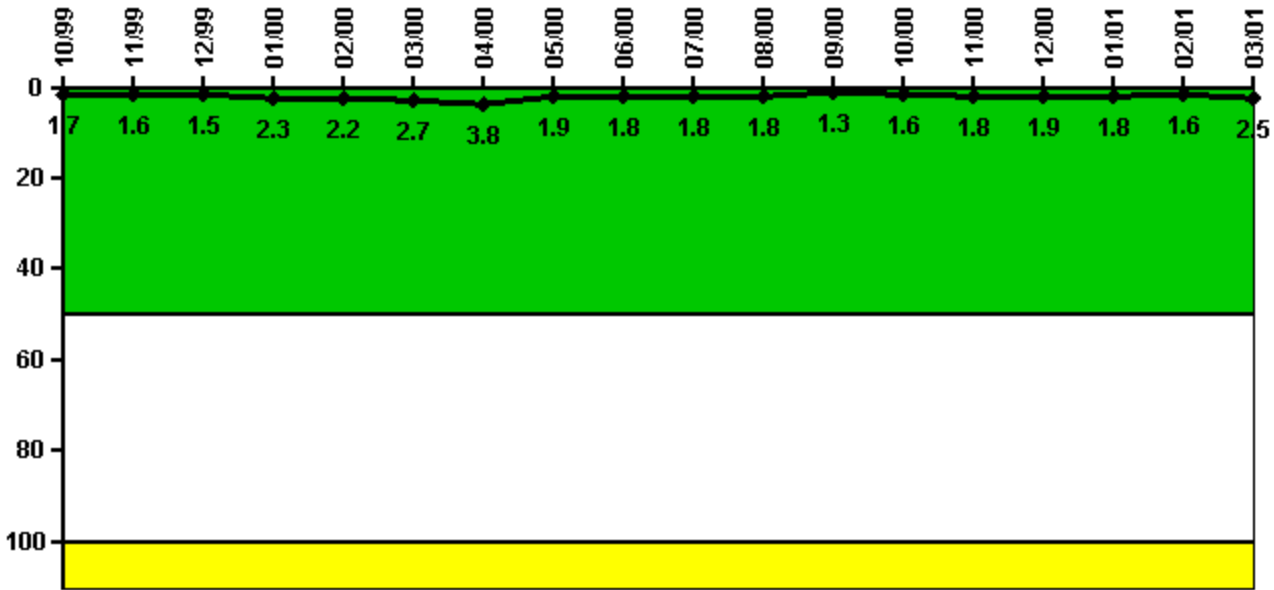

Thresholds: White > 50.0 Yellow > 100.0


Notes

Reactor Coolant System Leakage	10/99	11/99	12/99	1/00	2/00	3/00	4/00	5/00	6/00	7/00	8/00	9/00
Maximum leakage	0.165	0.159	0.149	0.230	0.222	0.268	0.384	0.187	0.176	0.175	0.183	0.132
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	1.7	1.6	1.5	2.3	2.2	2.7	3.8	1.9	1.8	1.8	1.8	1.3

Reactor Coolant System Leakage	10/00	11/00	12/00	1/01	2/01	3/01
Maximum leakage	0.160	0.182	0.189	0.179	0.159	0.246
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	1.6	1.8	1.9	1.8	1.6	2.5

Licensee Comments: none

Drill/Exercise Performance

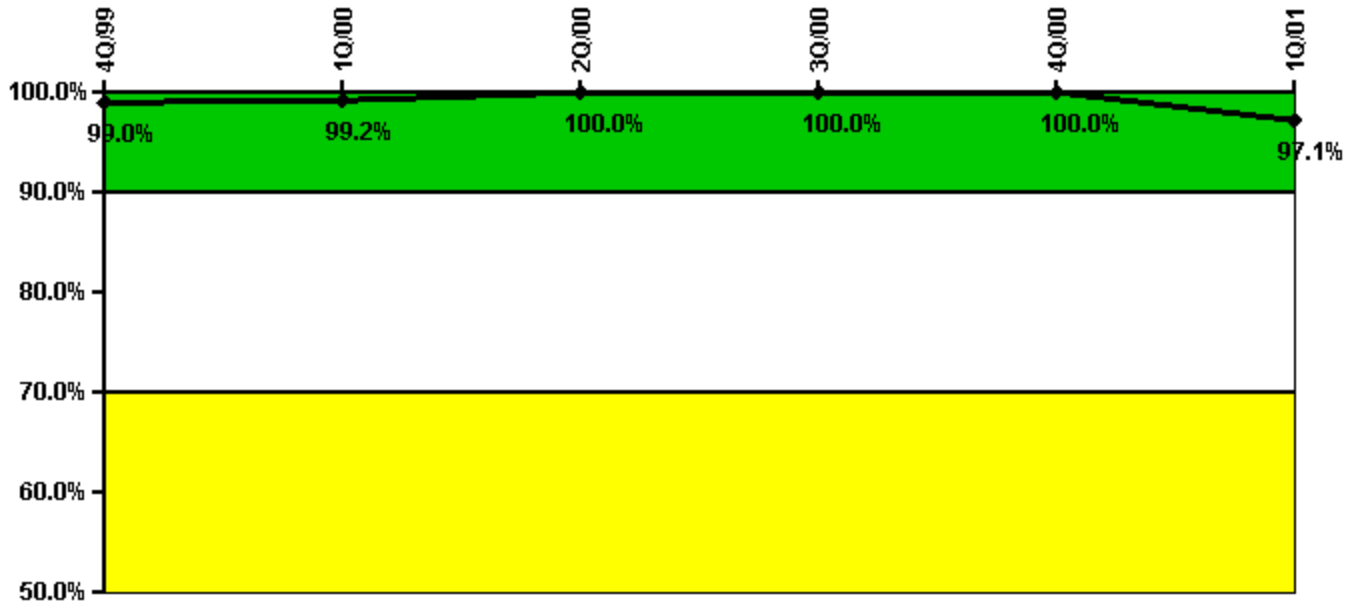


Thresholds: White < 90.0% Yellow < 70.0%

Notes

Drill/Exercise Performance	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Successful opportunities	78.0	25.0	2.0	4.0	18.0	30.0
Total opportunities	78.0	25.0	2.0	4.0	18.0	35.0
Indicator value	99.0%	99.2%	100.0%	100.0%	100.0%	97.1%

Licensee Comments: none

ERO Drill Participation

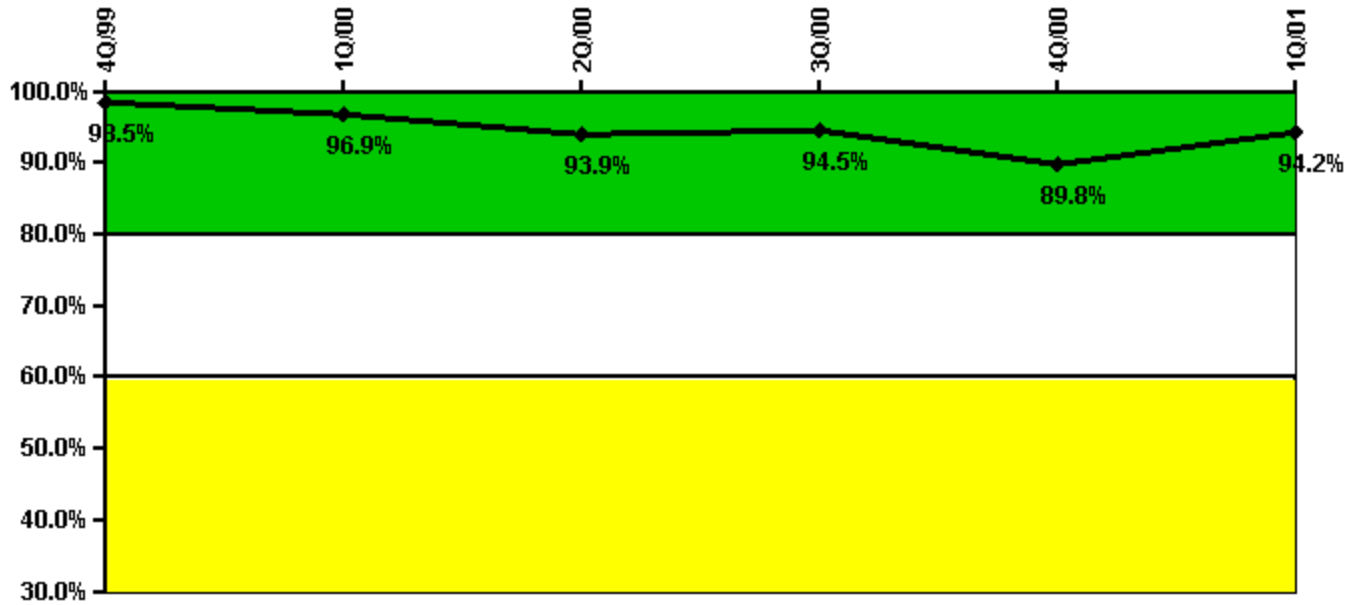


Thresholds: White < 80.0% Yellow < 60.0%

Notes

ERO Drill Participation	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Participating Key personnel	128.0	125.0	123.0	121.0	115.0	98.0
Total Key personnel	130.0	129.0	131.0	128.0	128.0	104.0
Indicator value	98.5%	96.9%	93.9%	94.5%	89.8%	94.2%

Licensee Comments: none

Alert & Notification System

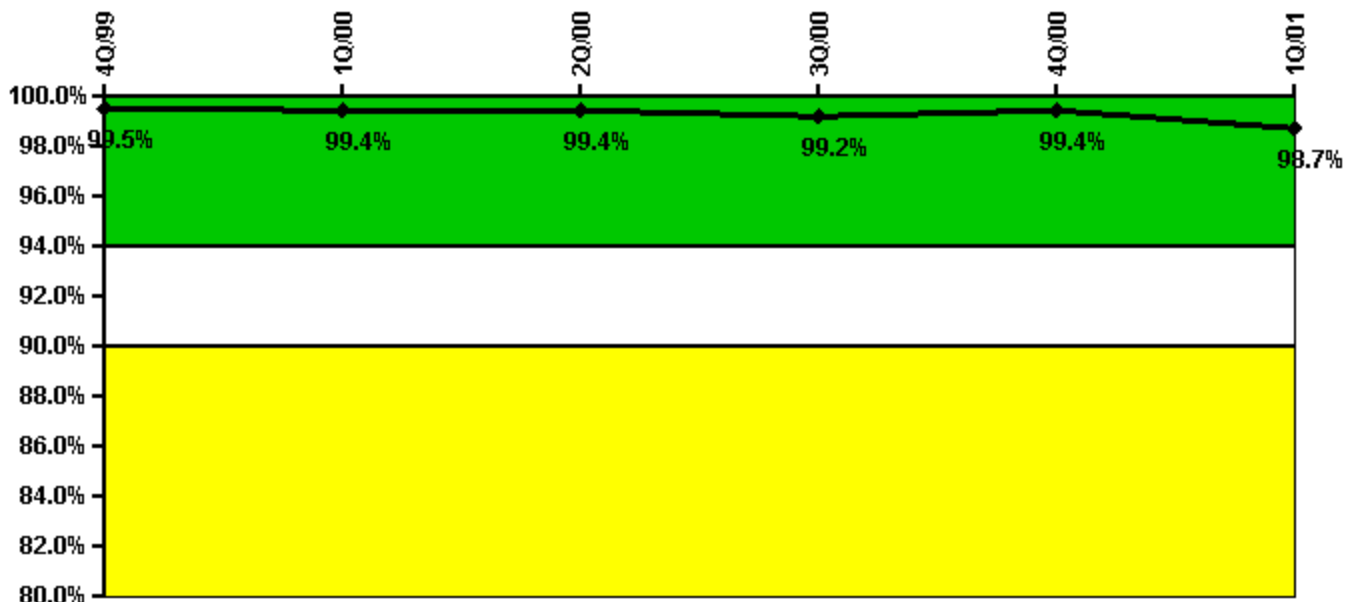

Thresholds: White < 94.0% Yellow < 90.0%

Notes

Alert & Notification System	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Successful siren-tests	382	382	384	380	384	414
Total sirens-tests	385	385	385	385	385	427
Indicator value	99.5%	99.4%	99.4%	99.2%	99.4%	98.7%

Licensee Comments:

1Q/01: 2/2001 data over-reported; Successful siren tests were 171 vs 232; Total tested 183 vs 244. This revision had no effect on GREEN color assignment.

1Q/00: 1/2000 data revised to exclude 55 sirens that were part of a non-routine, unscheduled, Y2K siren poll. Deletion of these 55 sirens from the total number had no effect on the "Green" indicator.

Occupational Exposure Control Effectiveness



Thresholds: White > 2.0 Yellow > 5.0

Notes

Occupational Exposure Control Effectiveness	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
High radiation area occurrences	0	0	0	0	0	0
Very high radiation area occurrences	0	0	0	0	0	0
Unintended exposure occurrences	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0

Licensee Comments: none

RETS/ODCM Radiological Effluent




Thresholds: White > 1.0 Yellow > 3.0

Notes

RETS/ODCM Radiological Effluent	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
RETS/ODCM occurrences	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0

Licensee Comments: none

Protected Area Security Performance Index

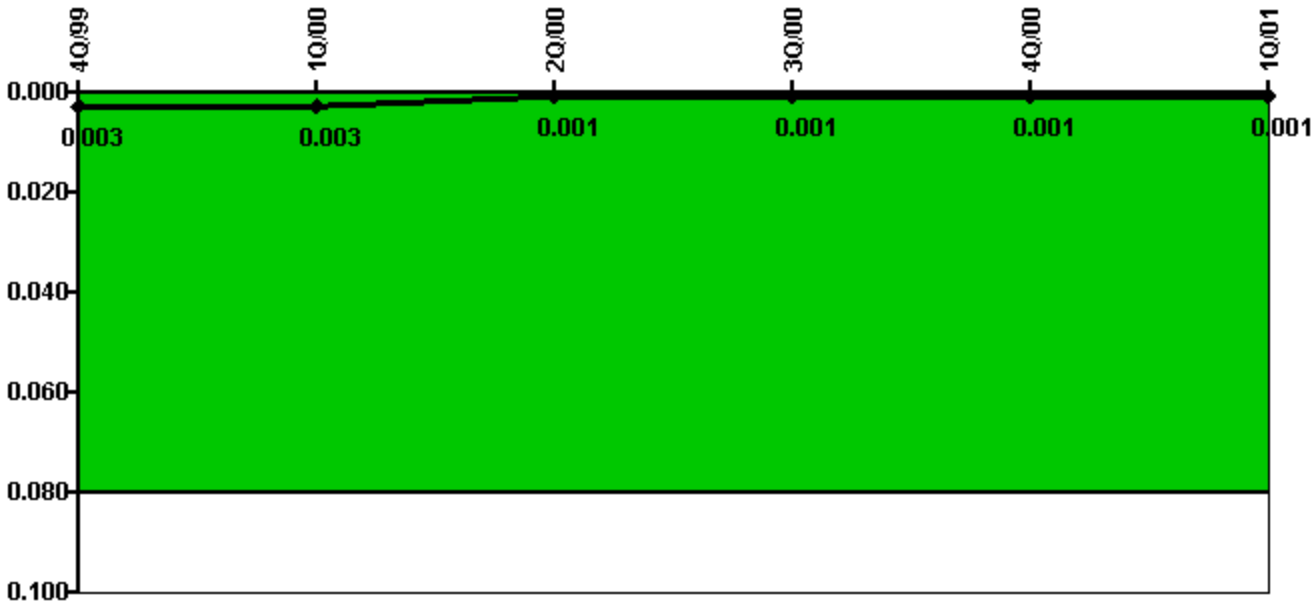

Thresholds: White > 0.080

Notes

Protected Area Security Performance Index	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
IDS compensatory hours	5.00	5.00	0	0	10.30	6.20
CCTV compensatory hours	0	0	0	0	0	0
IDS normalization factor	1.00	1.00	1.00	1.00	1.00	1.00
CCTV normalization factor	1.0	1.0	1.0	1.0	1.0	1.0
Index Value	0.003	0.003	0.001	0.001	0.001	0.001

Licensee Comments: none

Personnel Screening Program



Thresholds: White > 2.0 Yellow > 5.0

Notes

Personnel Screening Program	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Program failures	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0

Licensee Comments: none

FFD/Personnel Reliability



Thresholds: White > 2.0 Yellow > 5.0

Notes

FFD/Personnel Reliability	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01
Program Failures	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0

Licensee Comments: none

▲ [PI Summary](#) | [Inspection Findings Summary](#) | [Action Matrix Summary](#) | [Reactor Oversight Process](#)

Last Modified: March 28, 2002