


Beaver Valley 1

2Q/2001 Performance Indicators

Licensee's General Comments: none

Unplanned Scrams per 7000 Critical Hrs

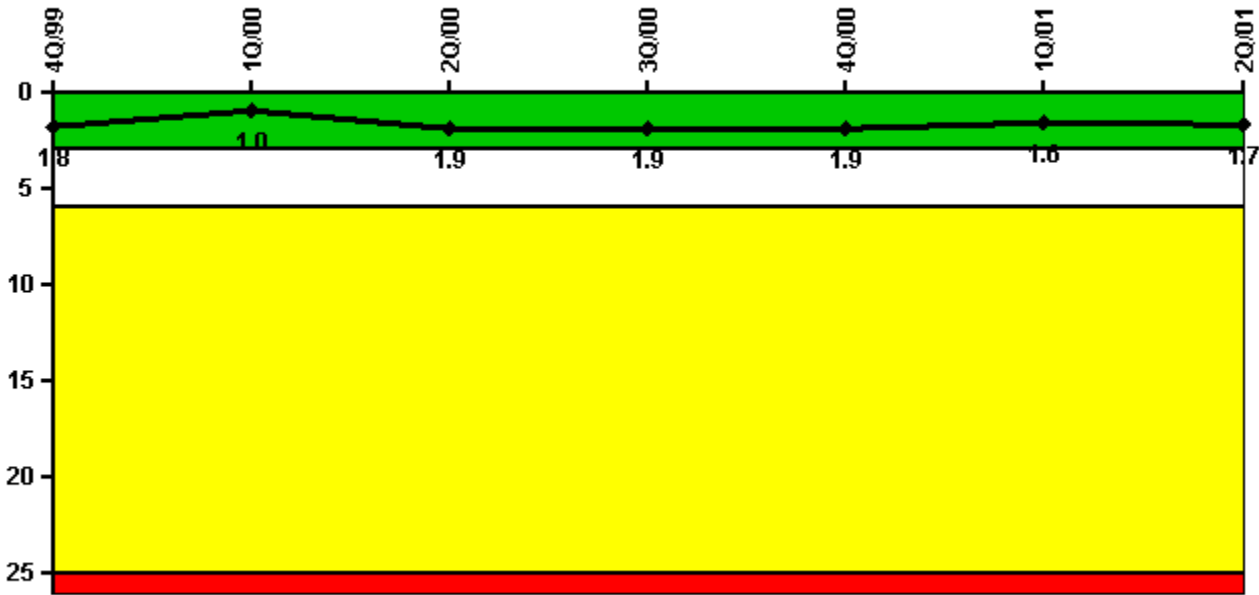

Thresholds: White > 3.0 Yellow > 6.0 Red > 25.0

Notes

Unplanned Scrams per 7000 Critical Hrs	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Unplanned scrams	0	0	1.0	1.0	0	0	1.0
Critical hours	2209.0	1092.5	2022.2	2174.3	2209.0	2160.0	1905.1
Indicator value	1.8	1.0	1.9	1.9	1.9	1.6	1.7

Licensee Comments: none

Scrams with Loss of Normal Heat Removal




Thresholds: White > 2.0 Yellow > 10.0 Red > 20.0

Notes

Scrams with Loss of Normal Heat Removal	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Scrams	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0

Licensee Comments: none

Unplanned Power Changes per 7000 Critical Hrs

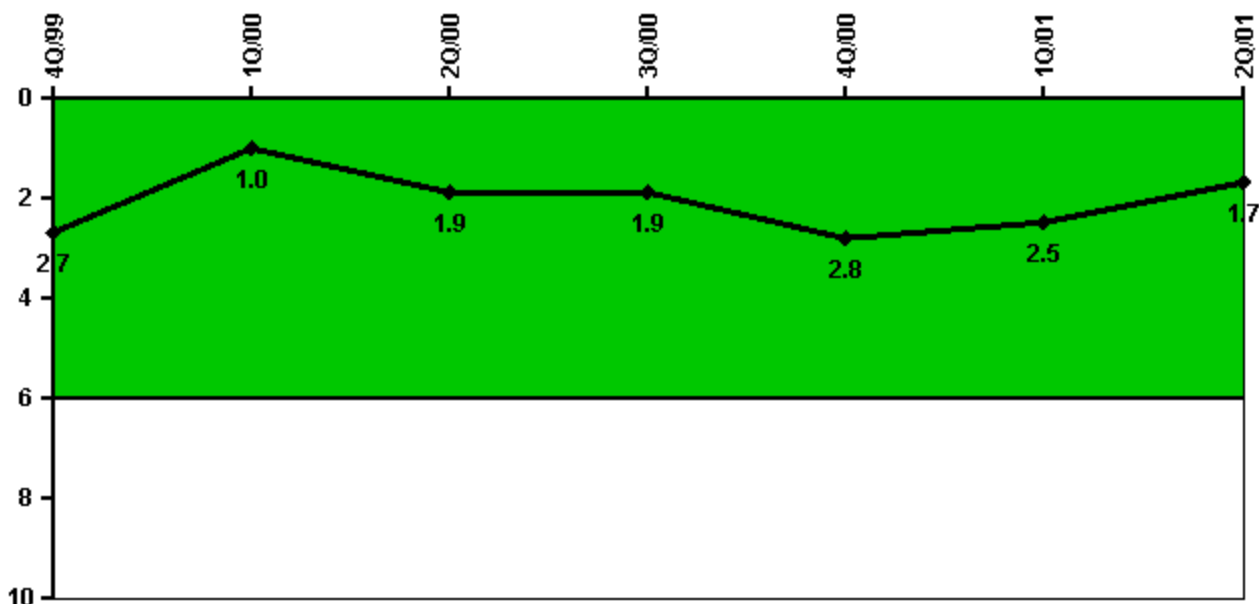


Thresholds: White > 6.0

Notes

Unplanned Power Changes per 7000 Critical Hrs	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Unplanned power changes	0	0	1.0	1.0	1.0	0	0
Critical hours	2209.0	1092.5	2022.2	2174.3	2209.0	2160.0	1905.1
Indicator value	2.7	1.0	1.9	1.9	2.8	2.5	1.7

Licensee Comments: none

Safety System Unavailability, Emergency AC Power

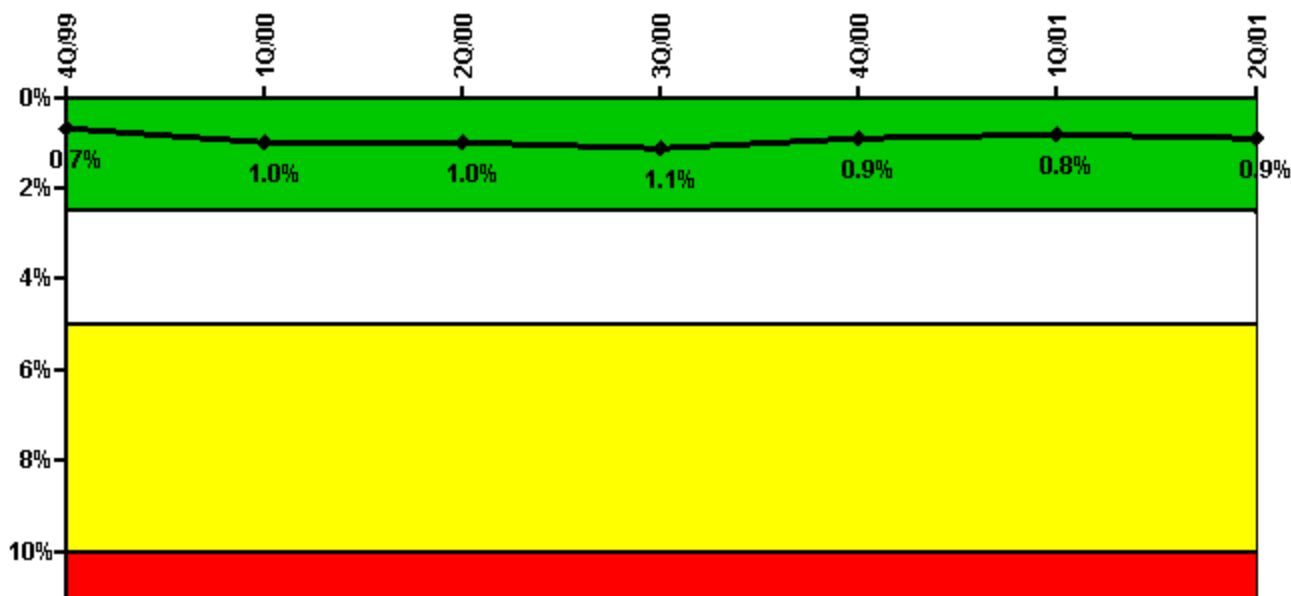


Thresholds: White > 2.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Emergency AC Power	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Train 1							
Planned unavailable hours	15.10	67.20	17.50	12.10	8.80	5.20	26.80
Unplanned unavailable hours	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	2184.00	2183.00	2208.00	2209.00	2160.00	2183.00
Train 2							
Planned unavailable hours	22.00	28.70	27.00	5.80	5.60	43.80	6.20
Unplanned unavailable hours	0	48.00	0	0	0	0.10	0
Fault exposure hours	0	62.00	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	2184.00	2183.00	2208.00	2209.00	2160.00	2183.00
Indicator value	0.7%	1.0%	1.0%	1.1%	0.9%	0.8%	0.9%

Licensee Comments: none

Safety System Unavailability, High Pressure Injection System (HPSI)

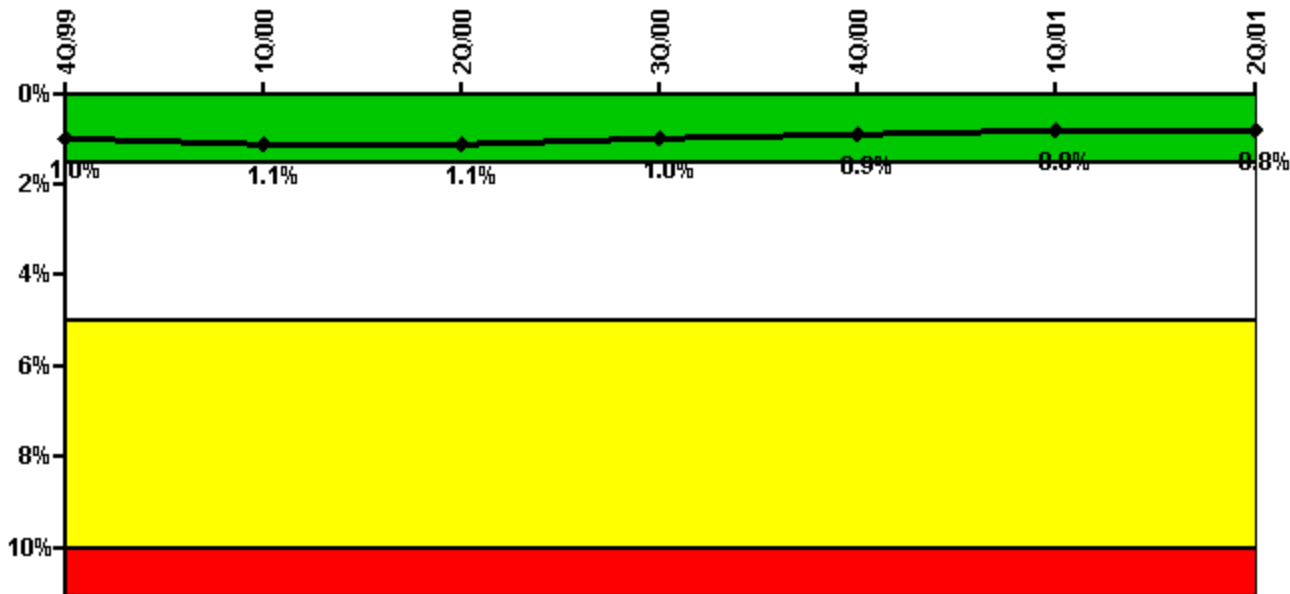


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, High Pressure Injection System (HPSI)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Train 1							
Planned unavailable hours	14.40	7.44	11.81	2.21	6.37	13.32	9.04
Unplanned unavailable hours	0	2.00	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1092.20	2022.20	2174.30	2209.00	2160.00	2001.70
Train 2							
Planned unavailable hours	16.20	1.57	10.53	0.95	1.86	2.28	2.09
Unplanned unavailable hours	0	46.00	0	0	0	0	0
Fault exposure hours	0	62.00	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1092.20	2022.20	2174.30	2209.00	2160.00	2001.70
Indicator value	1.0%	1.1%	1.1%	1.0%	0.9%	0.8%	0.8%

Licensee Comments: none

Safety System Unavailability, Heat Removal System (AFW)

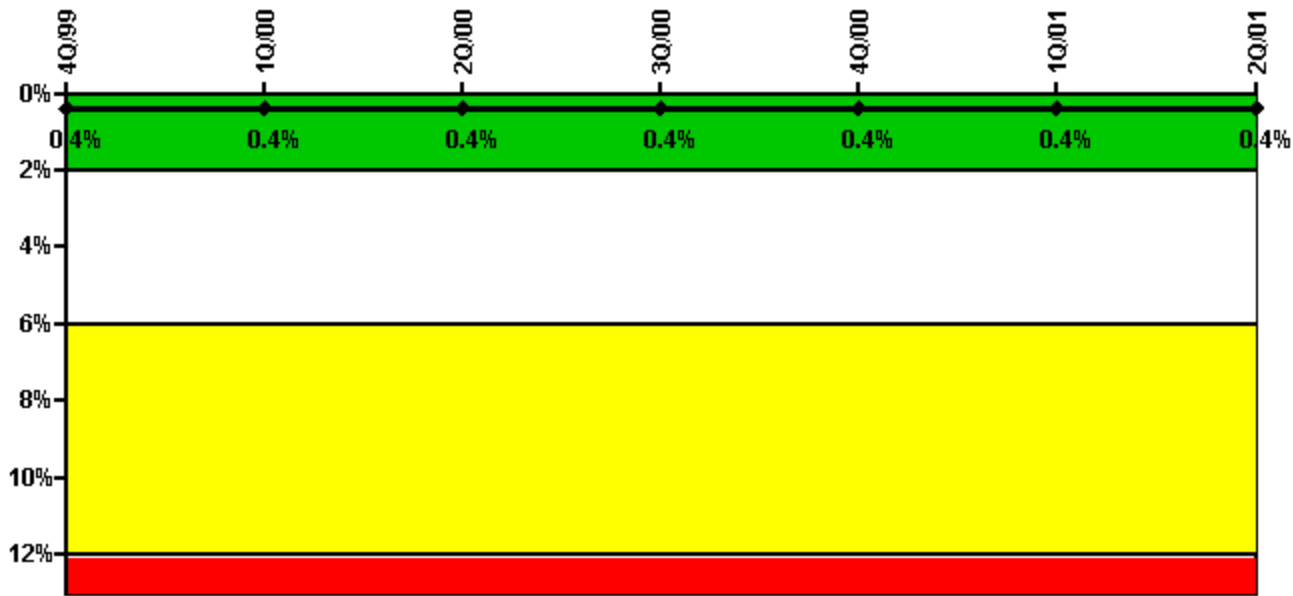


Thresholds: White > 2.0% Yellow > 6.0% Red > 12.0%

Notes

Safety System Unavailability, Heat Removal System (AFW)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Train 1							
Planned unavailable hours	39.70	0	0	0	14.02	0	1.50
Unplanned unavailable hours	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1099.48	2040.00	2174.30	2209.00	2160.00	2001.70
Train 2							
Planned unavailable hours	0	1.75	14.14	0	17.72	0	12.87
Unplanned unavailable hours	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1099.48	2040.00	2174.30	2209.00	2160.00	2001.70
Train 3							
Planned unavailable hours	1.20	0.67	19.59	0.10	16.90	2.28	11.80
Unplanned unavailable hours	0	0	0	0	33.30	10.08	0
Fault exposure hours	0	0	0	0	0.42	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1099.48	2040.00	2174.30	2209.00	2160.00	2001.70
Indicator value	0.4%	0.4%	0.4%	0.4%	0.4%	0.4%	0.4%

Licensee Comments: none

Safety System Unavailability, Residual Heat Removal System

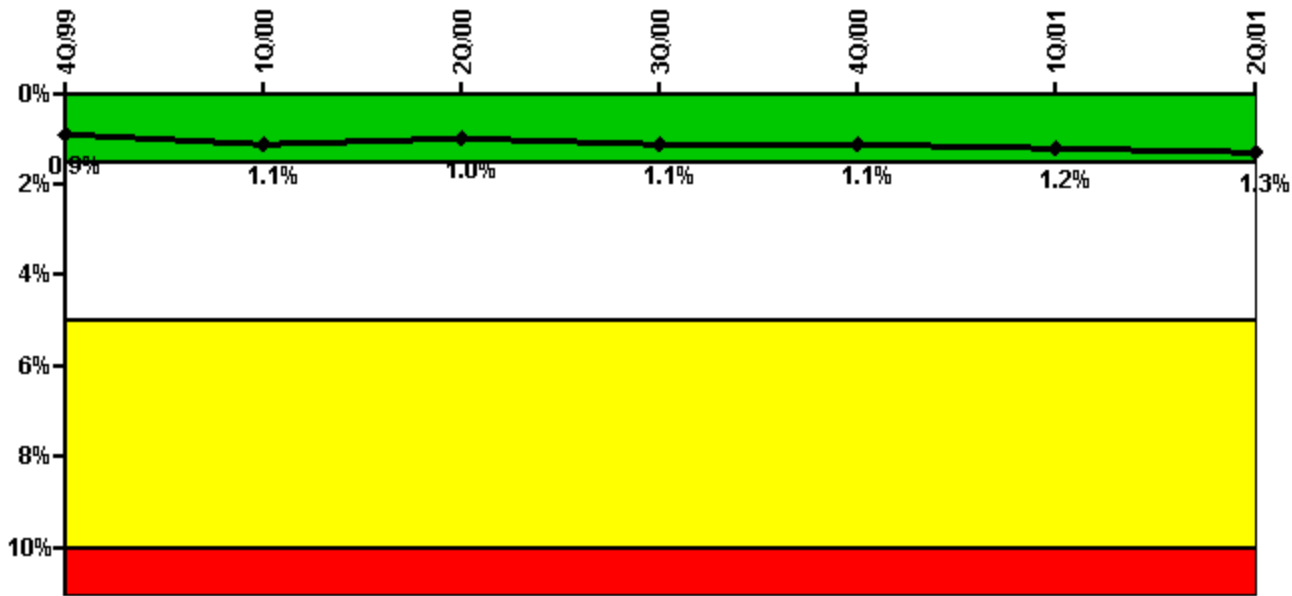


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, Residual Heat Removal System	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Train 1							
Planned unavailable hours	23.60	53.16	10.62	31.11	18.70	1.72	10.63
Unplanned unavailable hours	0	2.00	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1107.10	2105.50	2174.30	2209.00	2160.00	2001.70
Train 2							
Planned unavailable hours	26.20	1.25	6.12	5.82	41.30	0.65	0.33
Unplanned unavailable hours	0	43.10	0	0	0	0	0
Fault exposure hours	0	62.00	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	1107.10	2105.50	2174.30	2209.00	2160.00	2001.70
Train 3							
Planned unavailable hours	23.60	0	0	0	0	0	0
Unplanned unavailable hours	0	0.40	0	0	0	0	0.60
Fault exposure hours	0	0	0	0	0	0	0.80
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	841.24	90.10	0	0	0	194.12
Train 4							
Planned unavailable hours	26.20	0	0	0	0	0	0
Unplanned unavailable hours	0	0	0	0	0	0	0.60
Fault exposure hours	0	0	0	0	0	0	0.80
Effective Reset hours	0	0	0	0	0	0	0
Required hours	2209.00	841.24	90.10	0	0	0	194.12
Indicator value	0.9%	1.1%	1.0%	1.1%	1.1%	1.2%	1.3%

Licensee Comments: none

Safety System Functional Failures (PWR)

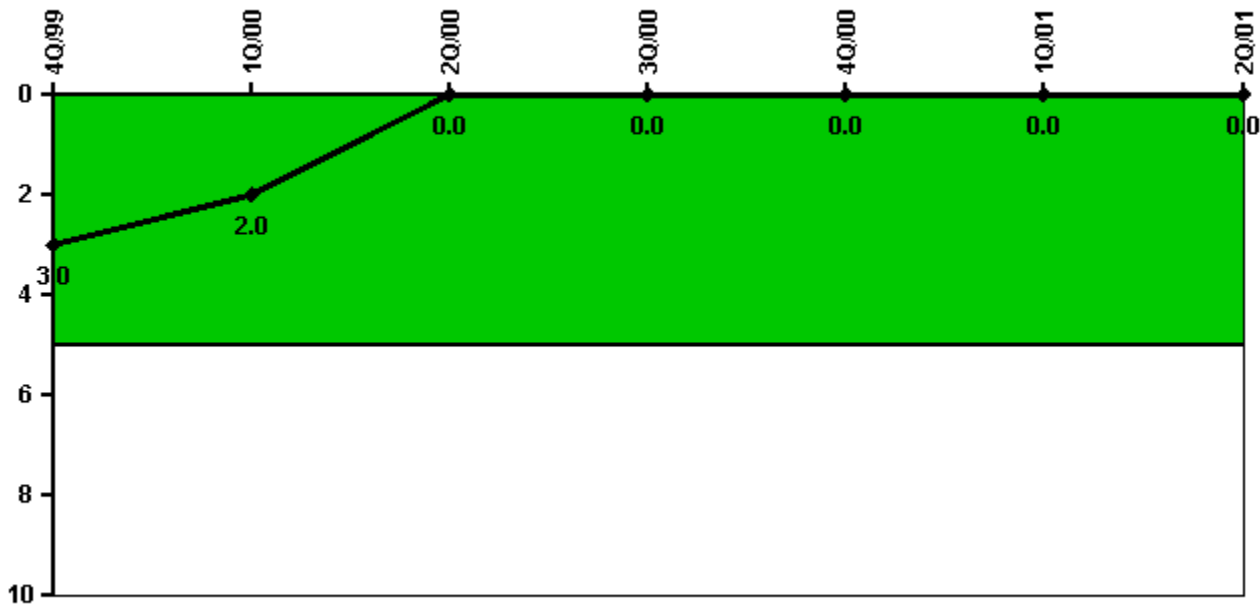


Thresholds: White > 5.0

Notes

Safety System Functional Failures (PWR)	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Safety System Functional Failures	0	0	0	0	0	0	0
Indicator value	3	2	0	0	0	0	0

Licensee Comments: none

Reactor Coolant System Activity

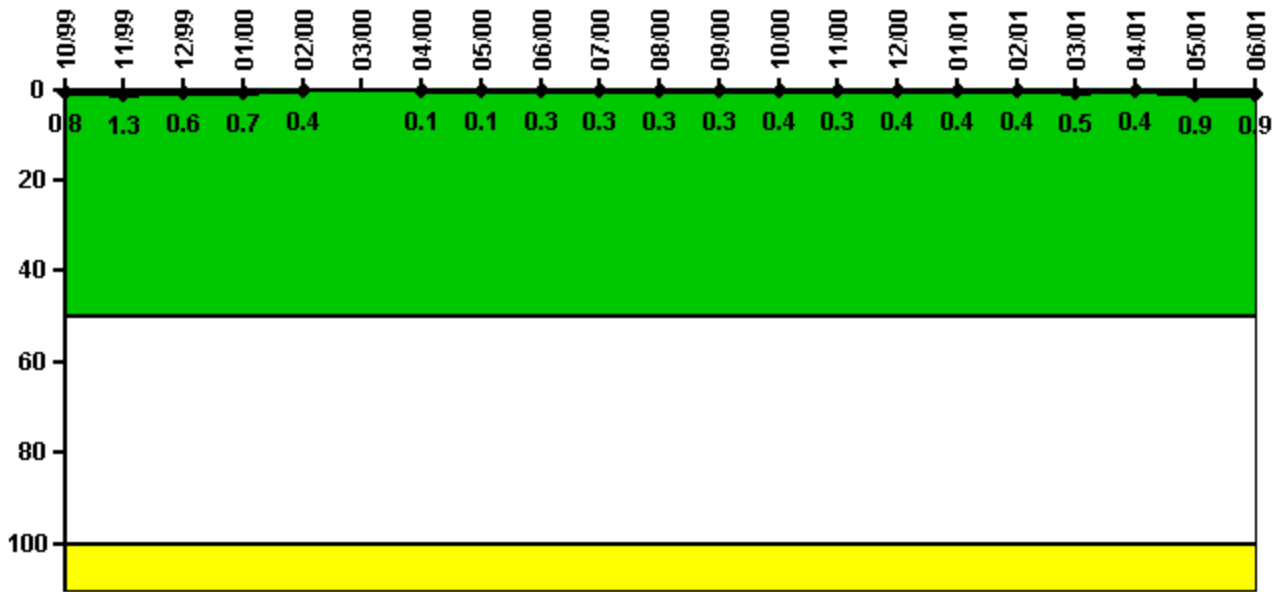

Thresholds: White > 50.0 Yellow > 100.0

Notes


Reactor Coolant System Activity	10/99	11/99	12/99	1/00	2/00	3/00	4/00	5/00	6/00	7/00	8/00	9/00
Maximum activity	0.002660	0.004580	0.002140	0.002280	0.001496	N/A	0.000467	0.000512	0.000529	0.000581	0.000609	0.000649
Technical specification limit	0.4	0.4	0.4	0.4	0.4	N/A	0.4	0.4	0.2	0.2	0.2	0.2
Indicator value	0.8	1.3	0.6	0.7	0.4	N/A	0.1	0.1	0.3	0.3	0.3	0.3

Reactor Coolant System Activity	10/00	11/00	12/00	1/01	2/01	3/01	4/01	5/01	6/01
Maximum activity	0.000743	0.000654	0.000793	0.000874	0.000739	0.000982	0.000779	0.000917	0.000854
Technical specification limit	0.2	0.2	0.2	0.2	0.2	0.2	0.2	0.1	0.1
Indicator value	0.4	0.3	0.4	0.4	0.4	0.5	0.4	0.9	0.9

Licensee Comments:

6/01: TS limit was administratively changed from 0.20 to 0.10 in May.

Reactor Coolant System Leakage

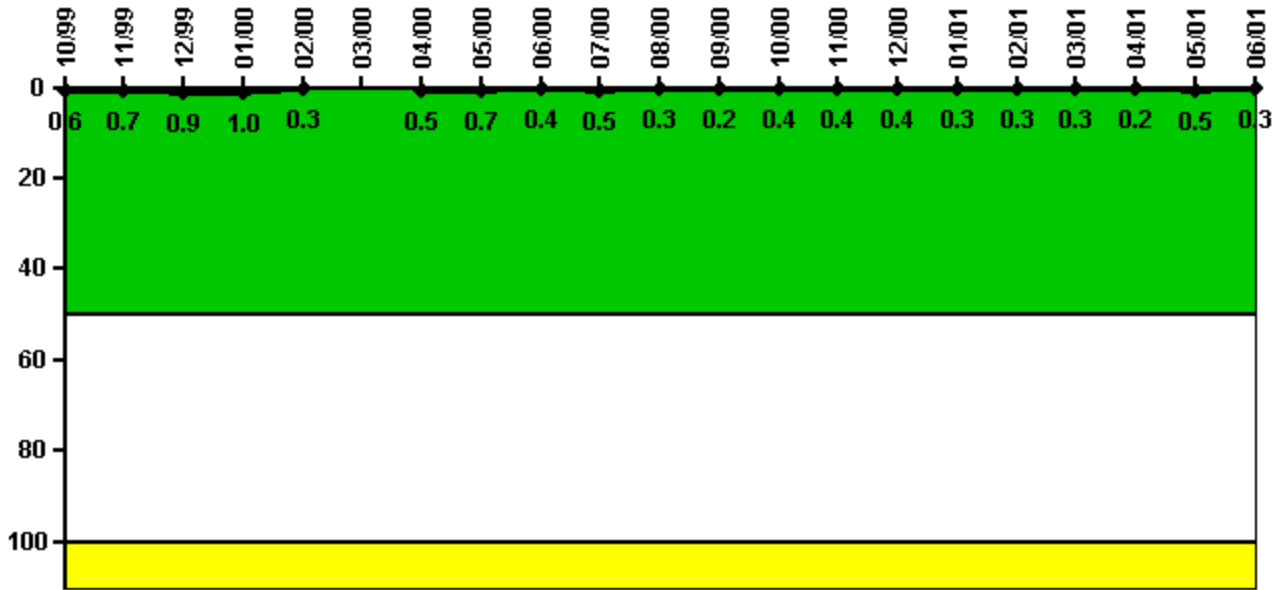

Thresholds: White > 50.0 Yellow > 100.0


Notes

Reactor Coolant System Leakage	10/99	11/99	12/99	1/00	2/00	3/00	4/00	5/00	6/00	7/00	8/00	9/00
Maximum leakage	0.060	0.070	0.090	0.100	0.030	N/A	0.050	0.070	0.040	0.050	0.030	0.020
Technical specification limit	10.0	10.0	10.0	10.0	10.0	N/A	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	0.6	0.7	0.9	1.0	0.3	N/A	0.5	0.7	0.4	0.5	0.3	0.2

Reactor Coolant System Leakage	10/00	11/00	12/00	1/01	2/01	3/01	4/01	5/01	6/01
Maximum leakage	0.040	0.040	0.040	0.030	0.030	0.030	0.020	0.050	0.030
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	0.4	0.4	0.4	0.3	0.3	0.3	0.2	0.5	0.3

Licensee Comments: none

Drill/Exercise Performance

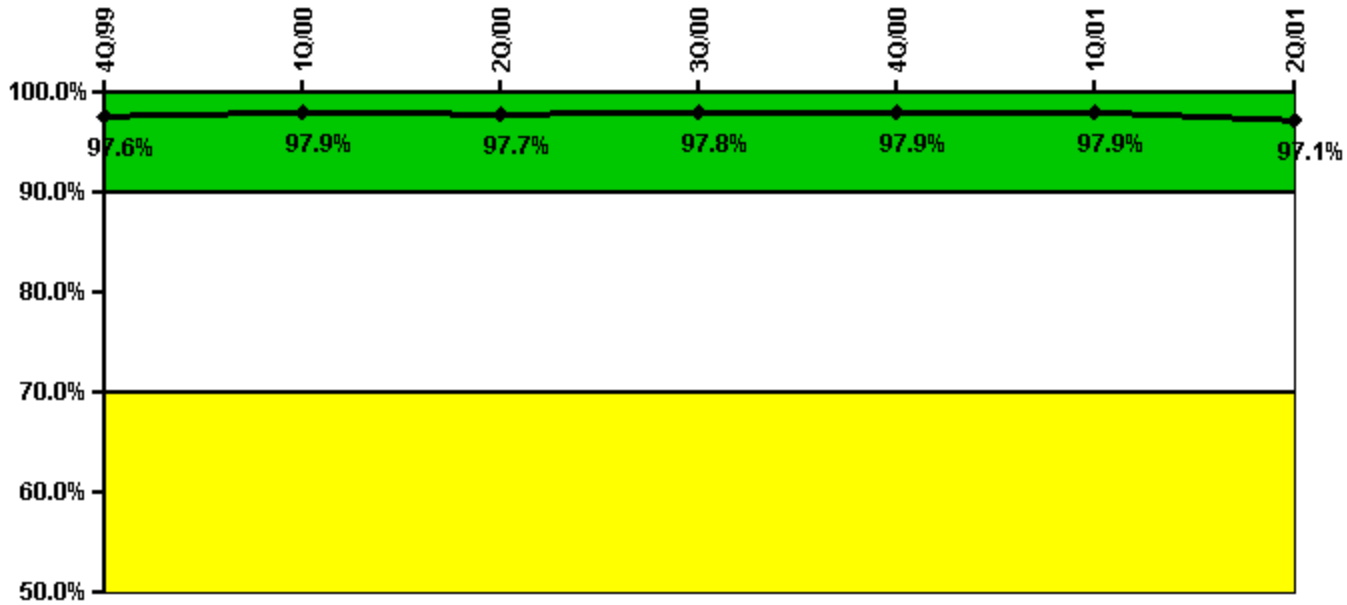


Thresholds: White < 90.0% Yellow < 70.0%

Notes

Drill/Exercise Performance	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Successful opportunities	18.0	16.0	76.0	50.0	46.0	8.0	71.0
Total opportunities	18.0	16.0	78.0	52.0	47.0	8.0	75.0
Indicator value	97.6%	97.9%	97.7%	97.8%	97.9%	97.9%	97.1%

Licensee Comments: none

ERO Drill Participation

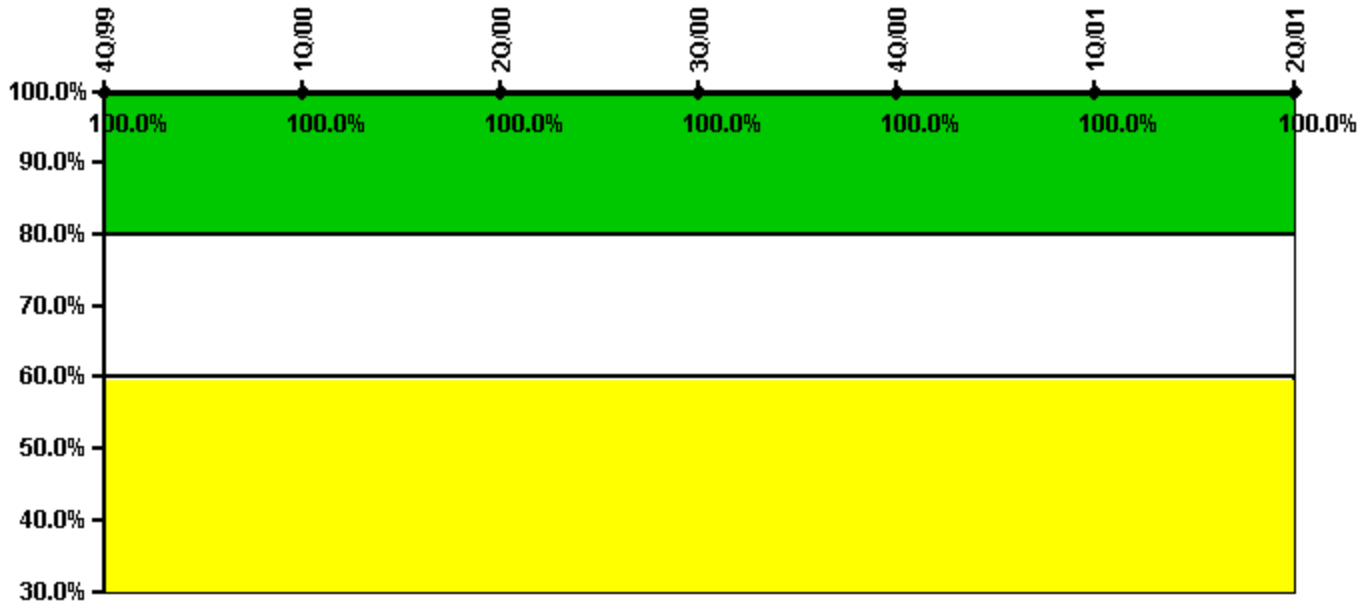


Thresholds: White < 80.0% Yellow < 60.0%

Notes

ERO Drill Participation	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Participating Key personnel	87.0	86.0	84.0	83.0	85.0	85.0	91.0
Total Key personnel	87.0	86.0	84.0	83.0	85.0	85.0	91.0
Indicator value	100.0%	100.0%	100.0%	100.0%	100.0%	100.0%	100.0%

Licensee Comments: none

Alert & Notification System

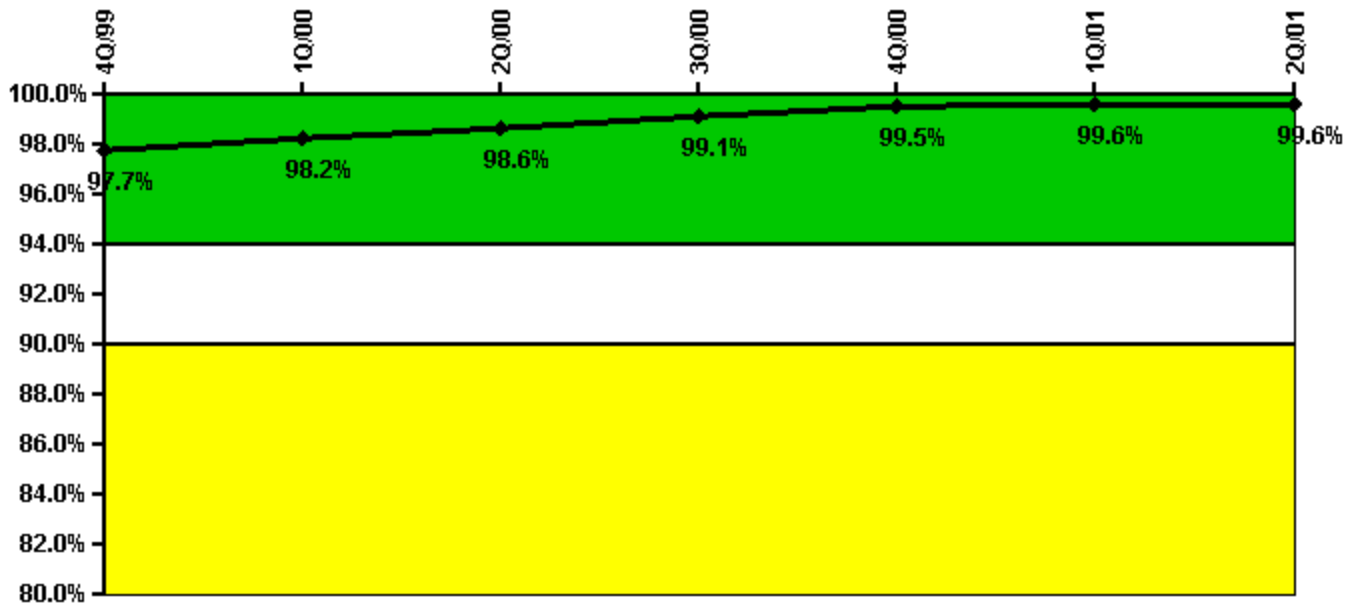


Thresholds: White < 94.0% Yellow < 90.0%

Notes

Alert & Notification System	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Successful siren-tests	108	109	110	218	110	110	110
Total sirens-tests	110	110	110	220	110	110	110
Indicator value	97.7%	98.2%	98.6%	99.1%	99.5%	99.6%	99.6%

Licensee Comments: none

Occupational Exposure Control Effectiveness

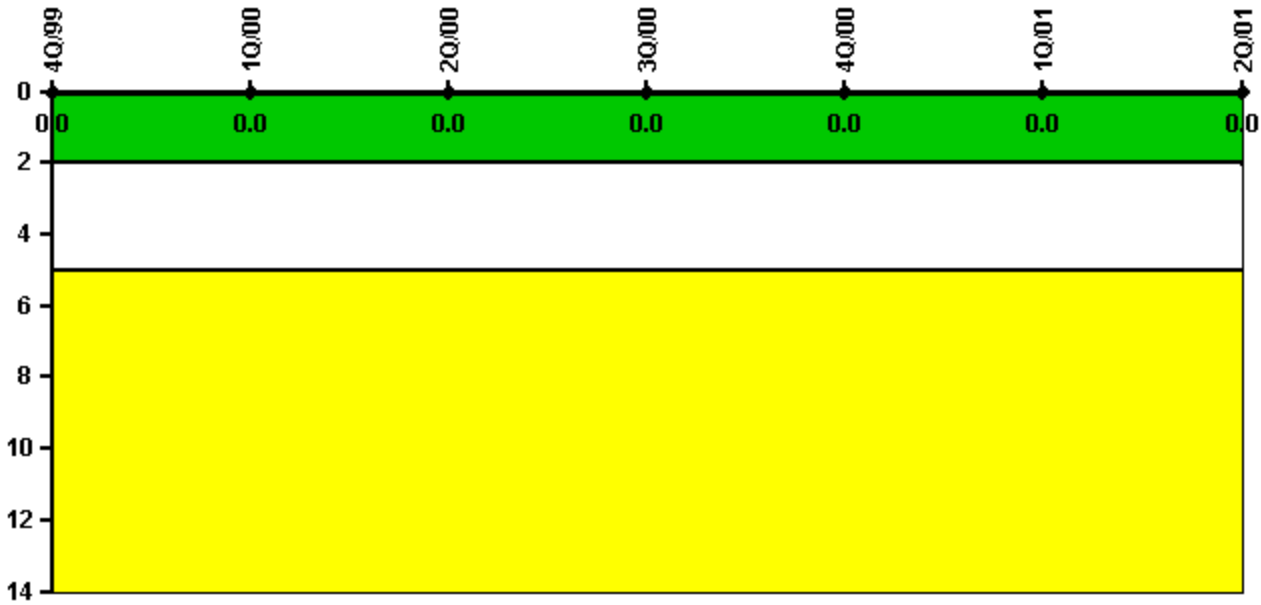

Thresholds: White > 2.0 Yellow > 5.0

Notes

Occupational Exposure Control Effectiveness	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
High radiation area occurrences	0	0	0	0	0	0	0
Very high radiation area occurrences	0	0	0	0	0	0	0
Unintended exposure occurrences	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0

Licensee Comments: none

RETS/ODCM Radiological Effluent




Thresholds: White > 1.0 Yellow > 3.0

Notes

RETS/ODCM Radiological Effluent	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
RETS/ODCM occurrences	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0

Licensee Comments: none

Protected Area Security Performance Index

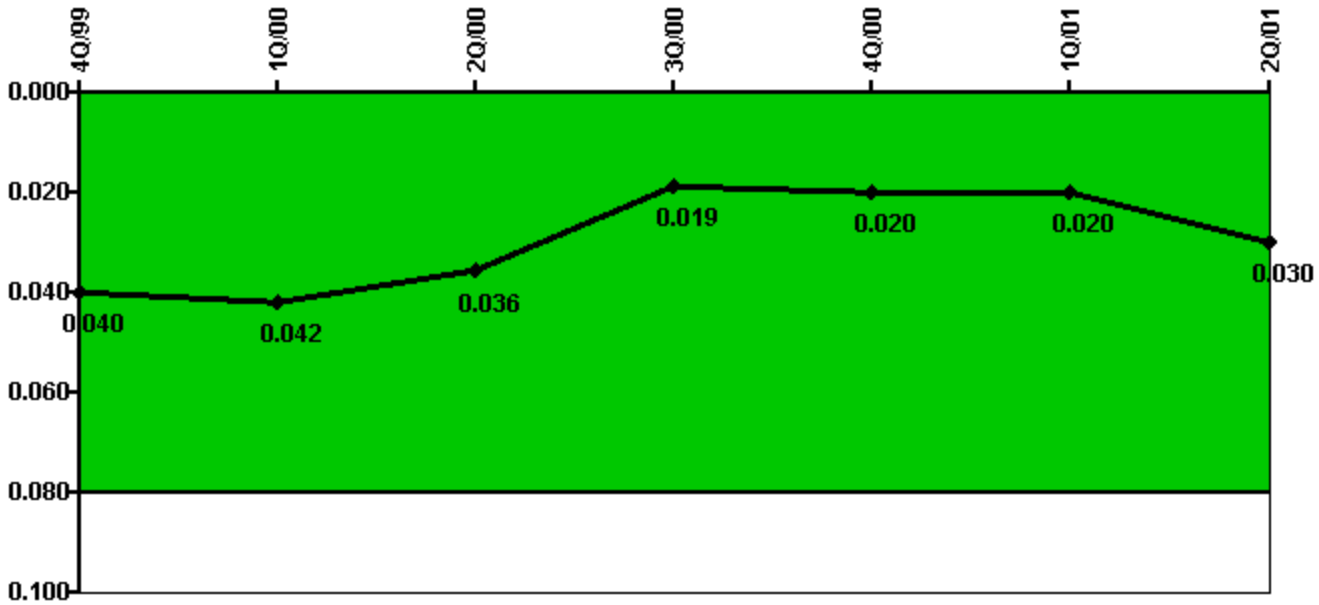

Thresholds: White > 0.080


Notes

Protected Area Security Performance Index	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
IDS compensatory hours	333.60	147.23	110.02	364.68	373.33	155.00	584.02
CCTV compensatory hours	0	0	0	0	0	1.6	0
IDS normalization factor	2.85	2.85	2.85	2.85	2.85	2.85	2.82
CCTV normalization factor	1.5	1.5	1.5	1.5	1.5	1.5	1.5
Index Value	0.040	0.042	0.036	0.019	0.020	0.020	0.030

Licensee Comments:

2Q/01: IDS Normalization Factor changed from 2.85 (for April and May) to 2.75 for June. Average of 2.8167 was used for Q2.

Personnel Screening Program

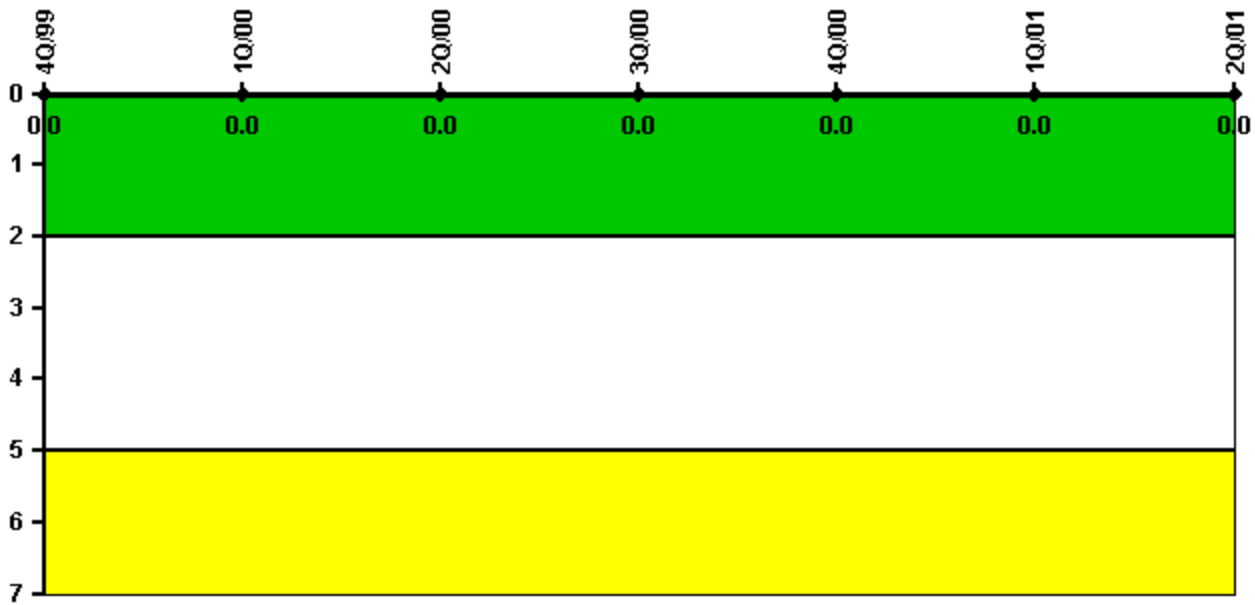


Thresholds: White > 2.0 Yellow > 5.0

Notes

Personnel Screening Program	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Program failures	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0

Licensee Comments: none

FFD/Personnel Reliability

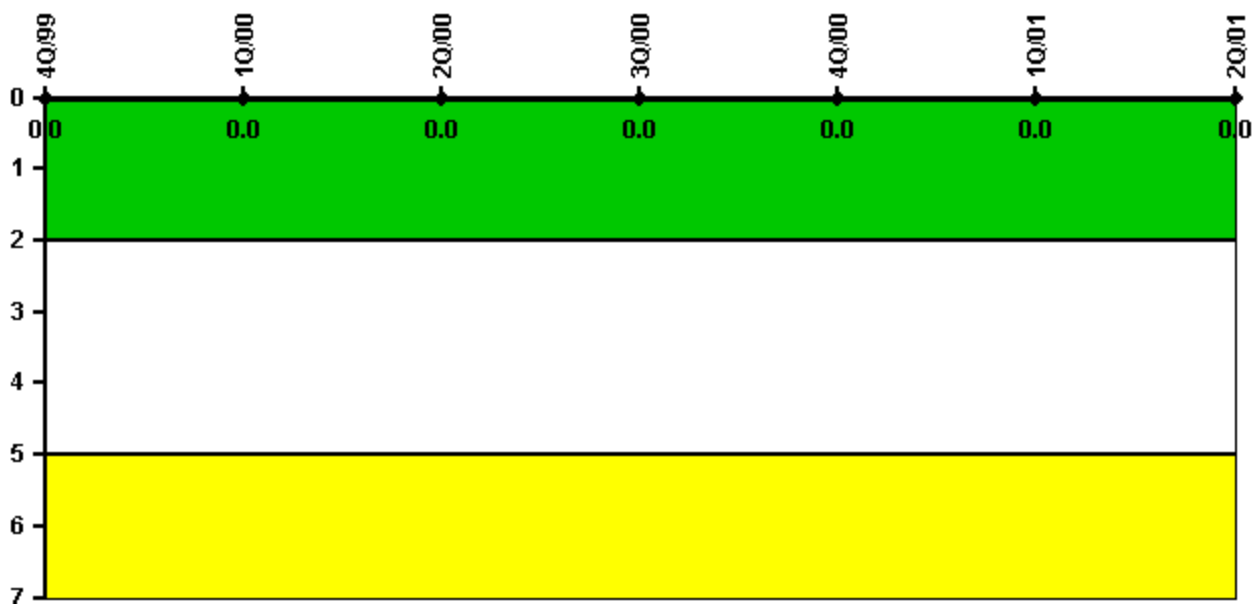

Thresholds: White > 2.0 Yellow > 5.0

Notes

FFD/Personnel Reliability	4Q/99	1Q/00	2Q/00	3Q/00	4Q/00	1Q/01	2Q/01
Program Failures	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0

Licensee Comments: none

▲ [PI Summary](#) | [Inspection Findings Summary](#) | [Action Matrix Summary](#) | [Reactor Oversight Process](#)

Last Modified: March 27, 2002