


Ocone 1

1Q/2004 Performance Indicators

Licensee's General Comments: none

Unplanned Scrams per 7000 Critical Hrs

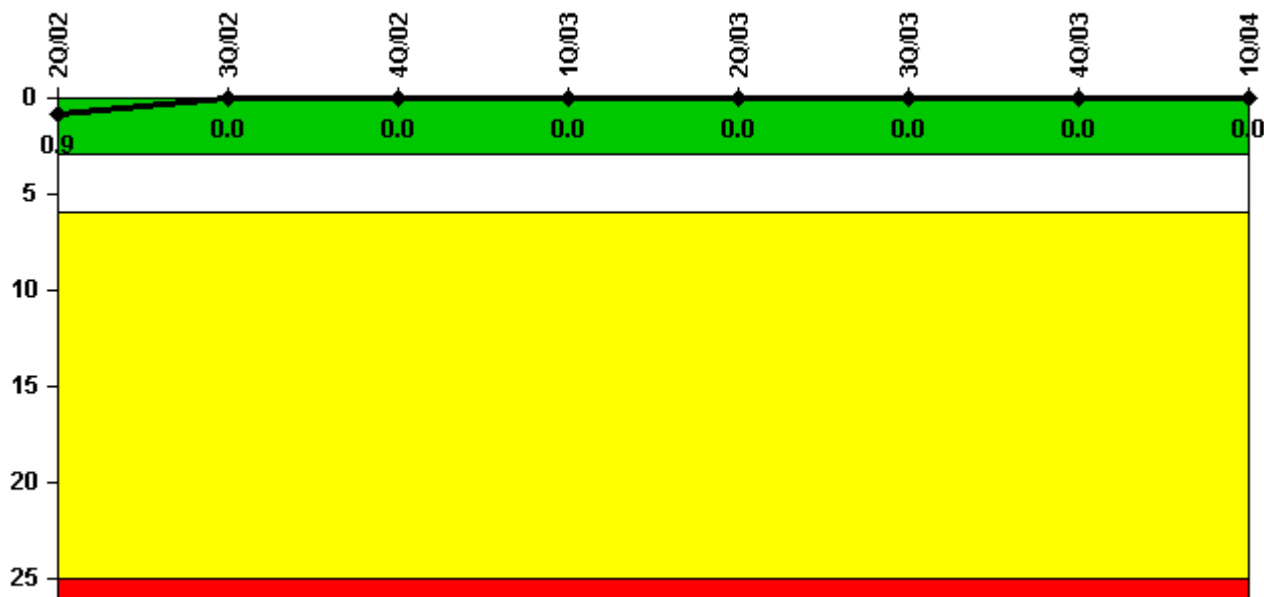


Thresholds: White > 3.0 Yellow > 6.0 Red > 25.0

Notes

Unplanned Scrams per 7000 Critical Hrs	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Unplanned scrams	0	0	0	0	0	0	0	0
Critical hours	1529.2	2162.0	2210.0	2160.0	2183.0	1946.1	57.1	2073.6
Indicator value	0.9	0	0	0	0	0	0	0

Licensee Comments: none

Scrams with Loss of Normal Heat Removal

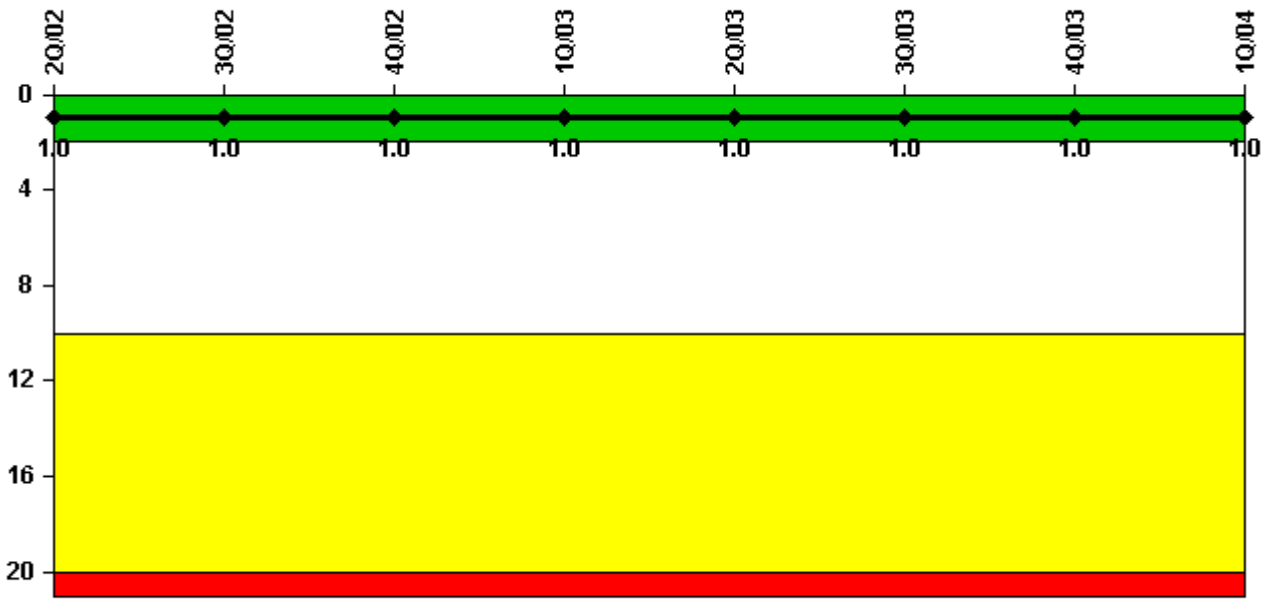


Thresholds: White > 2.0 Yellow > 10.0 Red > 20.0

Notes

Scrams with Loss of Normal Heat Removal	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Scrams	0	0	0	0	0	0	0	0
Indicator value	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0

Licensee Comments: none

Unplanned Power Changes per 7000 Critical Hrs

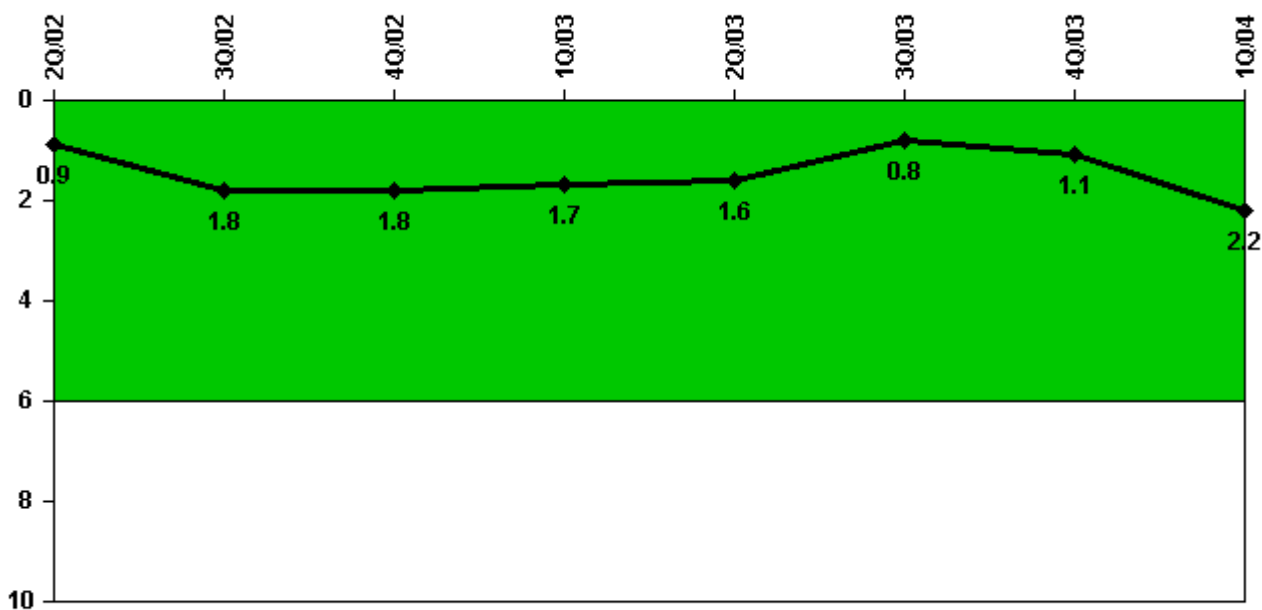

Thresholds: White > 6.0


Notes

Unplanned Power Changes per 7000 Critical Hrs	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Unplanned power changes	1.0	1.0	0	0	1.0	0	0	1.0
Critical hours	1529.2	2162.0	2209.0	2160.0	2183.0	1946.1	57.1	2073.6
Indicator value	0.9	1.8	1.8	1.7	1.6	0.8	1.1	2.2

Licensee Comments:

1Q/04: 1/08/04 Shutdown to locate the unidentified Reactor Coolant System leak in the Unit 1 Reactor Building. PIP O-04-00101

Safety System Unavailability, Emergency AC Power

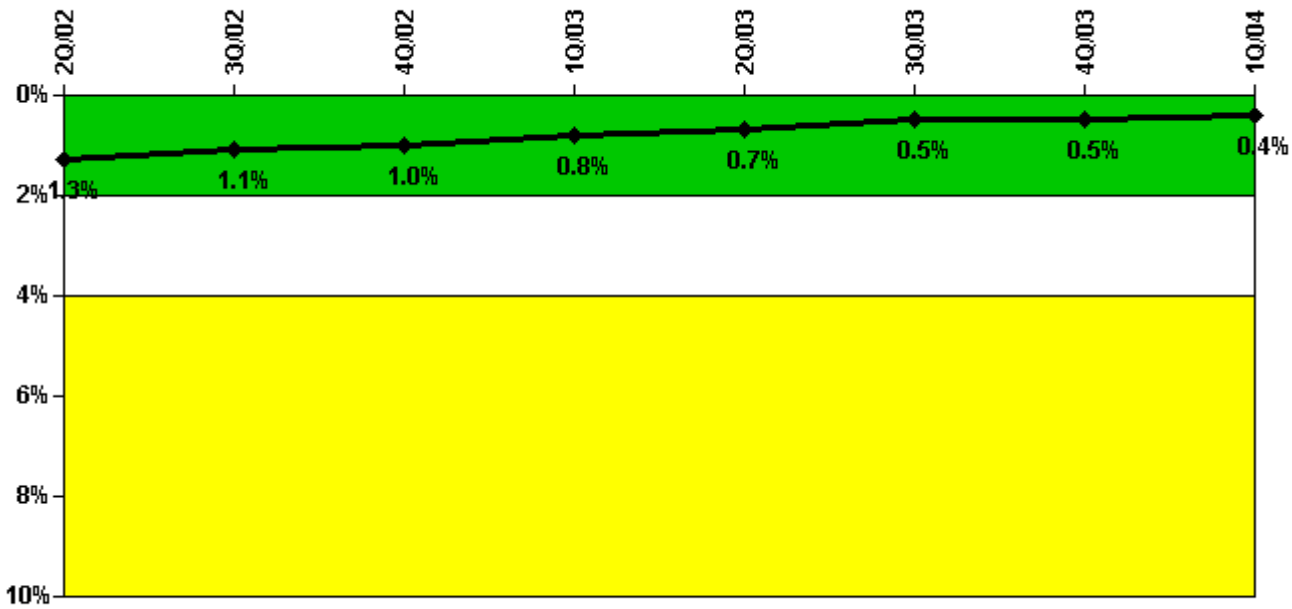


Thresholds: White > 2.0% Yellow > 4.0% Red > 10.0%

Notes

Safety System Unavailability, Emergency AC Power	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Train 1								
Planned unavailable hours	0	0	0	10.19	0.84	0	0	0
Unplanned unavailable hours	0	0	0	0	0	2.08	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	1584.14	2208.00	2209.00	2160.00	2183.00	2208.00	145.33	2172.00
Indicator value	1.3%	1.1%	1.0%	0.8%	0.7%	0.5%	0.5%	0.4%

Licensee Comments: none

Safety System Unavailability, High Pressure Injection System (HPSI)

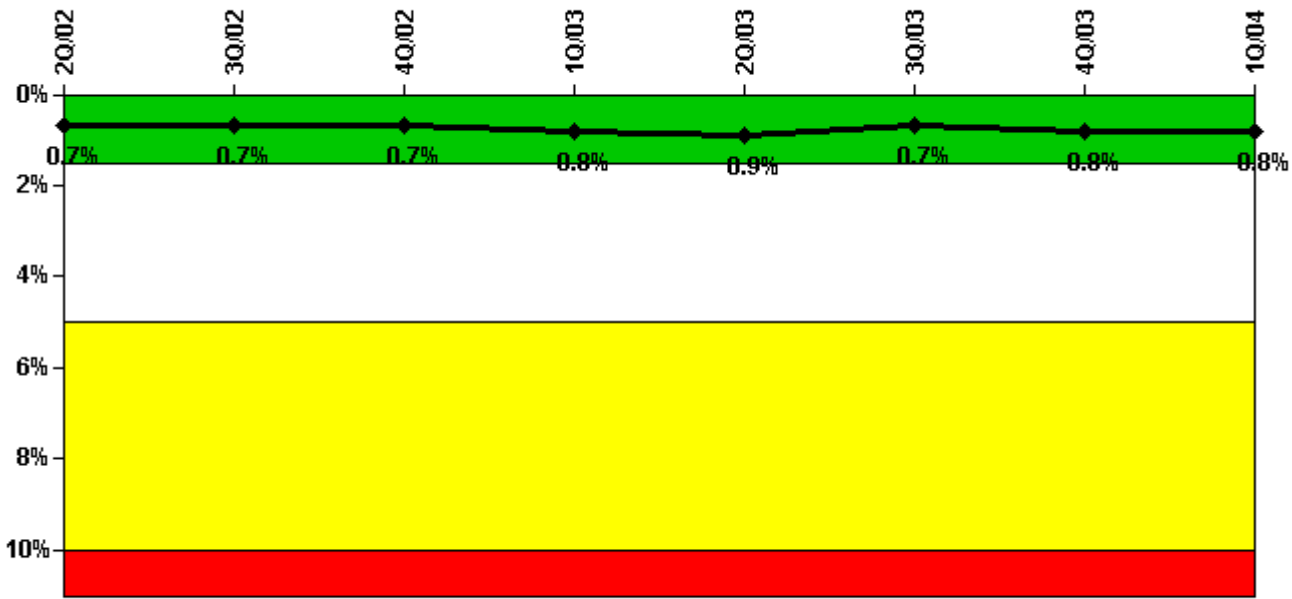


Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%

Notes

Safety System Unavailability, High Pressure Injection System (HPSI)	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Train 1								
Planned unavailable hours	4.46	1.19	0.43	36.32	33.16	9.79	2.03	13.83
Unplanned unavailable hours	0	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	1560.00	2208.00	2209.00	2160.00	2183.00	1952.60	111.00	2155.00
Train 2								
Planned unavailable hours	5.17	2.52	21.37	40.40	18.27	10.79	4.73	15.16
Unplanned unavailable hours	0	0	0	0	14.58	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	1560.00	2208.00	2209.00	2160.00	2183.00	1952.60	111.00	2155.00
Indicator value	0.7%	0.7%	0.7%	0.8%	0.9%	0.7%	0.8%	0.8%

Licensee Comments: none

Safety System Unavailability, Heat Removal System (AFW)

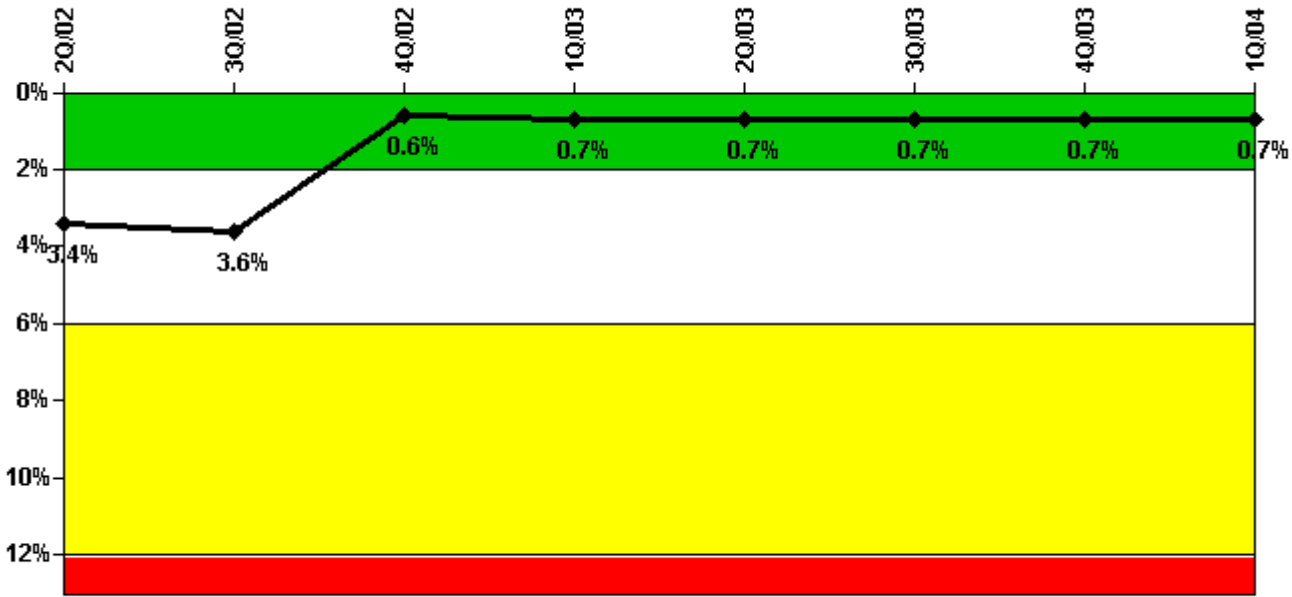


Thresholds: White > 2.0% Yellow > 6.0% Red > 12.0%

Notes

Safety System Unavailability, Heat Removal System (AFW)	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Train 1								
Planned unavailable hours	1.80	3.08	9.00	40.50	1.70	6.40	1.00	10.23
Unplanned unavailable hours	0	0	0	26.10	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	1572.00	2208.00	2209.00	2160.00	2183.00	1958.20	125.70	2163.00
Train 2								
Planned unavailable hours	3.80	5.10	8.20	24.10	1.70	10.80	0	5.04
Unplanned unavailable hours	0	114.10	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	2018.50	0	0	0	0	0
Required hours	1572.00	2208.00	2209.00	2160.00	2183.00	1958.20	125.70	2163.00
Train 3								
Planned unavailable hours	6.25	7.63	12.20	3.40	6.17	27.50	1.00	21.30
Unplanned unavailable hours	0	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	1572.00	2208.00	2209.00	2160.00	2183.00	1958.20	125.70	2163.00
Indicator value	3.4%	3.6%	0.6%	0.7%	0.7%	0.7%	0.7%	0.7%

Licensee Comments: none

Safety System Unavailability, Residual Heat Removal System

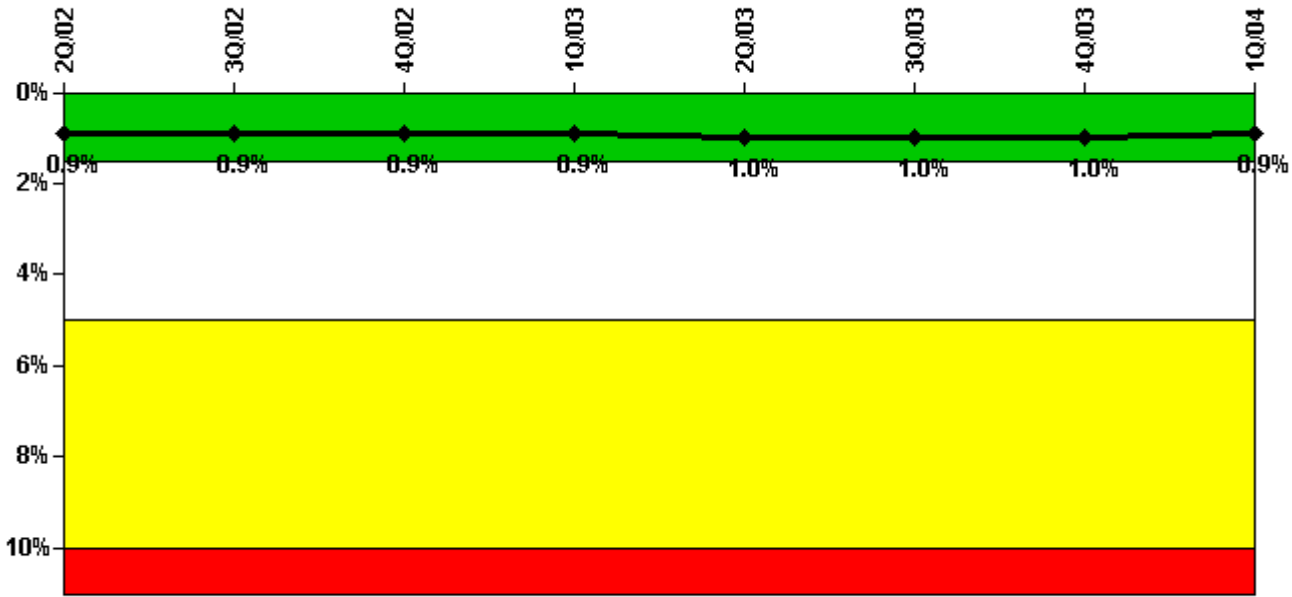

Thresholds: White > 1.5% Yellow > 5.0% Red > 10.0%


Notes

Safety System Unavailability, Residual Heat Removal System	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Train 1								
Planned unavailable hours	25.00	13.60	39.30	42.00	34.78	22.05	3.90	2.39
Unplanned unavailable hours	0	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2183.00	2208.00	2209.00	2160.00	2183.00	2184.58	939.25	2184.00
Train 2								
Planned unavailable hours	25.20	27.10	15.30	33.00	31.33	10.62	0	1.88
Unplanned unavailable hours	0	0	0	0	0	0	0	0
Fault exposure hours	0	0	0	0	0	0	0	0
Effective Reset hours	0	0	0	0	0	0	0	0
Required hours	2183.00	2208.00	2209.00	2160.00	2183.00	2184.58	939.25	2184.00
Indicator value	0.9%	0.9%	0.9%	0.9%	1.0%	1.0%	1.0%	0.9%

Licensee Comments:

4Q/03: This is an increase from the previously reported 0 hours. Mode 6 was entered at 20:45:11 on 11/22/03. Residual Heat Removal System was required starting at this time.

Safety System Functional Failures (PWR)

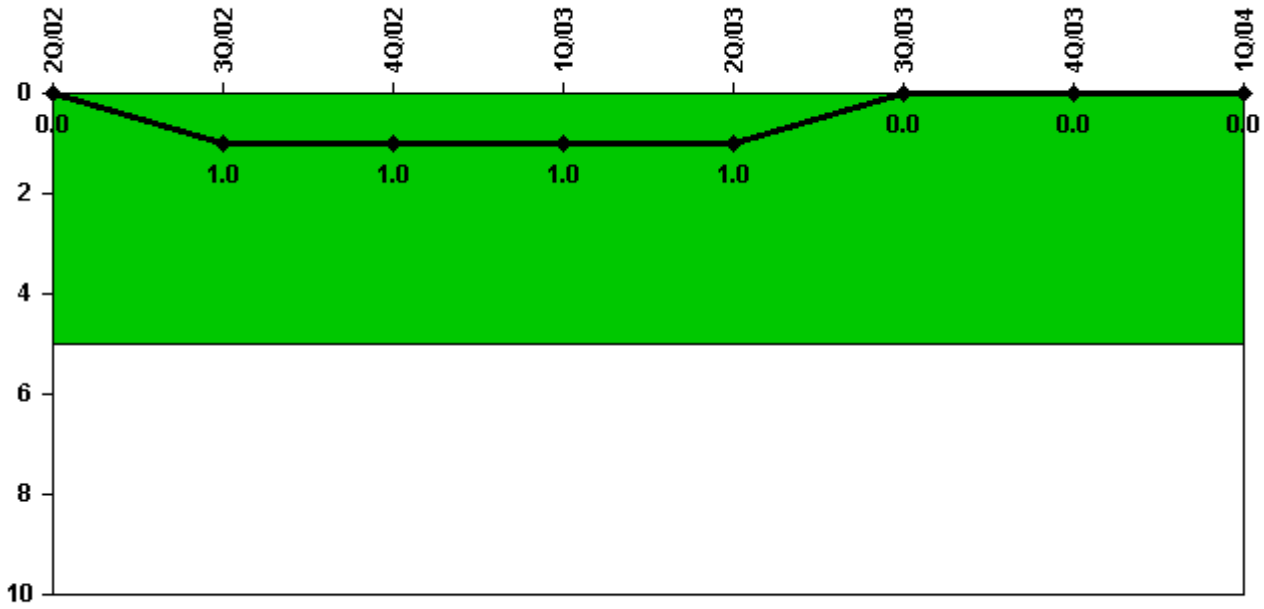


Thresholds: White > 5.0

Notes

Safety System Functional Failures (PWR)	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Safety System Functional Failures	0	1	0	0	0	0	0	0
Indicator value	0	1	1	1	1	0	0	0

Licensee Comments: none

Reactor Coolant System Activity

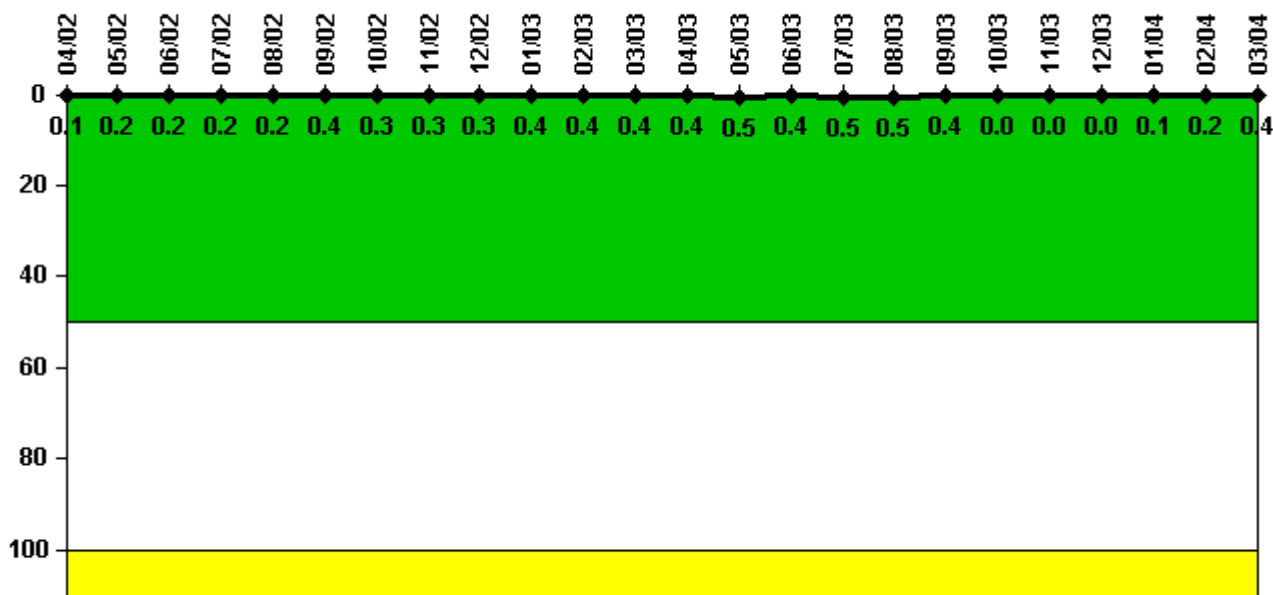

Thresholds: White > 50.0 Yellow > 100.0


Notes

Reactor Coolant System Activity	4/02	5/02	6/02	7/02	8/02	9/02	10/02	11/02	12/02	1/03	2/03	3/03
Maximum activity	0.000900	0.001900	0.002000	0.002100	0.002400	0.004400	0.003100	0.003000	0.003400	0.003700	0.004100	0.004200
Technical specification limit	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
Indicator value	0.1	0.2	0.2	0.2	0.2	0.4	0.3	0.3	0.3	0.4	0.4	0.4

Reactor Coolant System Activity	4/03	5/03	6/03	7/03	8/03	9/03	10/03	11/03	12/03	1/04	2/04	3/04
Maximum activity	0.004000	0.004500	0.004400	0.004700	0.004500	0.004100	0	0	0.000270	0.001400	0.001600	0.004200
Technical specification limit	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
Indicator value	0.4	0.5	0.4	0.5	0.5	0.4	0	0	0	0.1	0.2	0.4

Licensee Comments: none

Reactor Coolant System Leakage

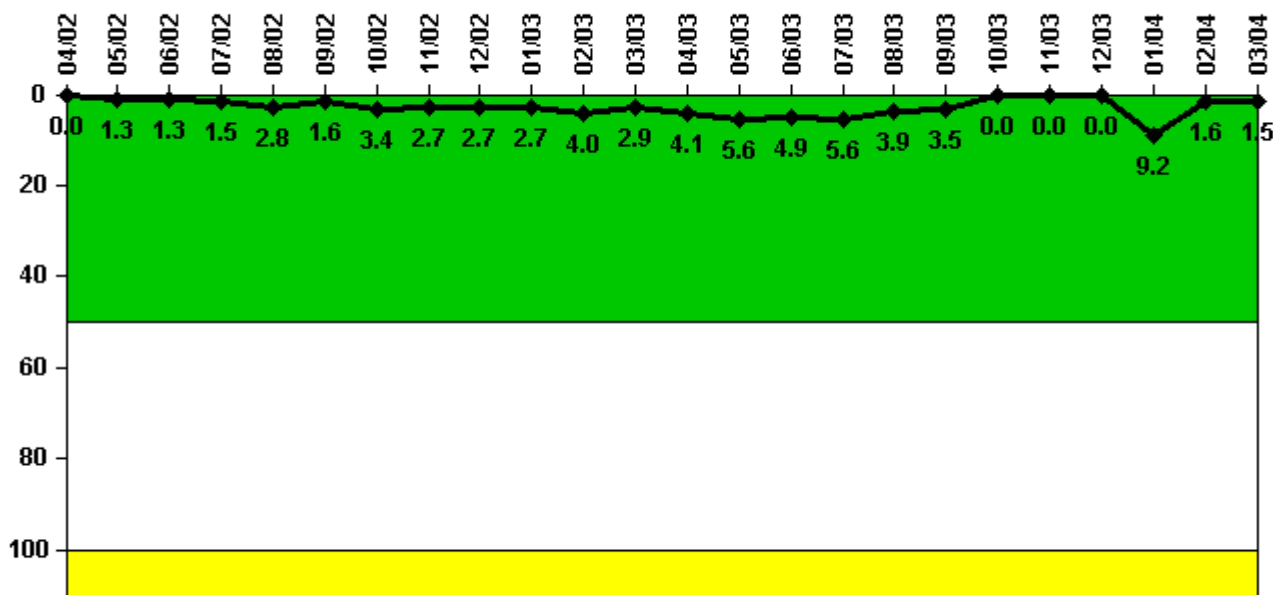

Thresholds: White > 50.0 Yellow > 100.0

Notes


Reactor Coolant System Leakage	4/02	5/02	6/02	7/02	8/02	9/02	10/02	11/02	12/02	1/03	2/03	3/03
Maximum leakage	0	0.130	0.130	0.150	0.280	0.160	0.340	0.270	0.270	0.270	0.400	0.290
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	0	1.3	1.3	1.5	2.8	1.6	3.4	2.7	2.7	2.7	4.0	2.9

Reactor Coolant System Leakage	4/03	5/03	6/03	7/03	8/03	9/03	10/03	11/03	12/03	1/04	2/04	3/04
Maximum leakage	0.410	0.560	0.490	0.560	0.391	0.348	0	0	0.002	0.916	0.161	0.150
Technical specification limit	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0	10.0
Indicator value	4.1	5.6	4.9	5.6	3.9	3.5	0	0	0	9.2	1.6	1.5

Licensee Comments:

3/04: The January leakage value was due to a crack in 3/8 inch diameter tubing at a fitting on a Reactor Vessel Level Instrument line the 'B' side. PIP O-04-00101

Drill/Exercise Performance

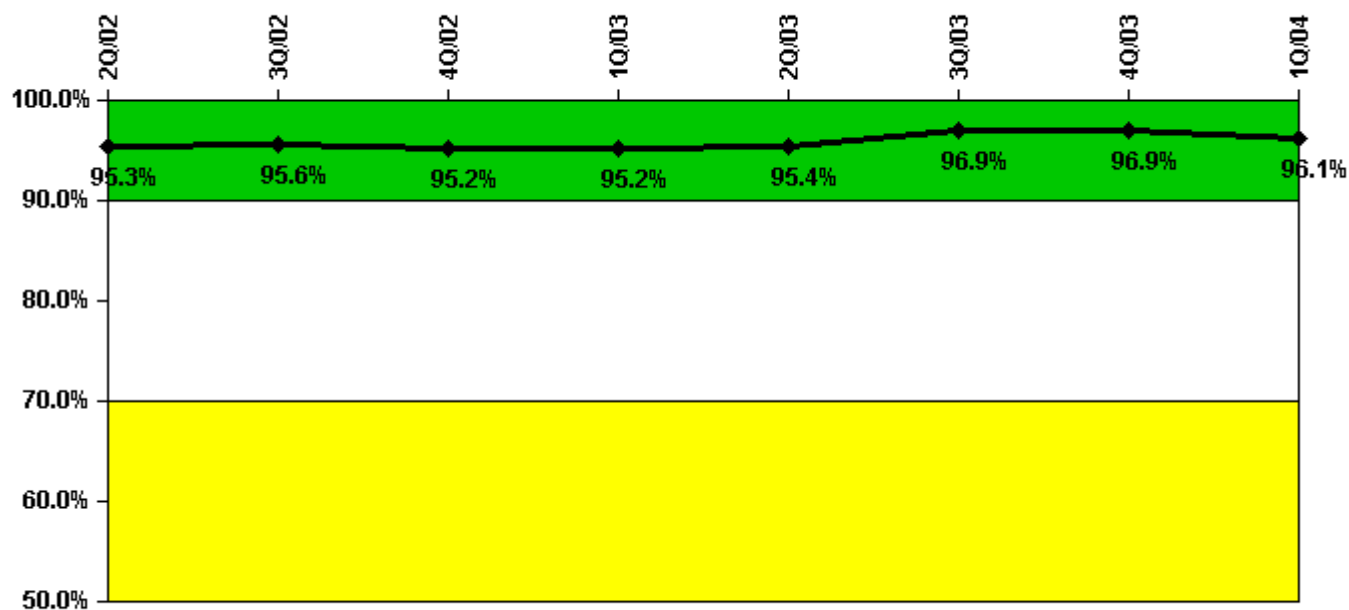

Thresholds: White < 90.0% Yellow < 70.0%


Notes

Drill/Exercise Performance	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Successful opportunities	32.0	55.0	16.0	22.0	13.0	57.0	9.0	42.0
Total opportunities	34.0	56.0	17.0	22.0	14.0	58.0	10.0	45.0
Indicator value	95.3%	95.6%	95.2%	95.2%	95.4%	96.9%	96.9%	96.1%

Licensee Comments:

4Q/01: Historical data update.

ERO Drill Participation

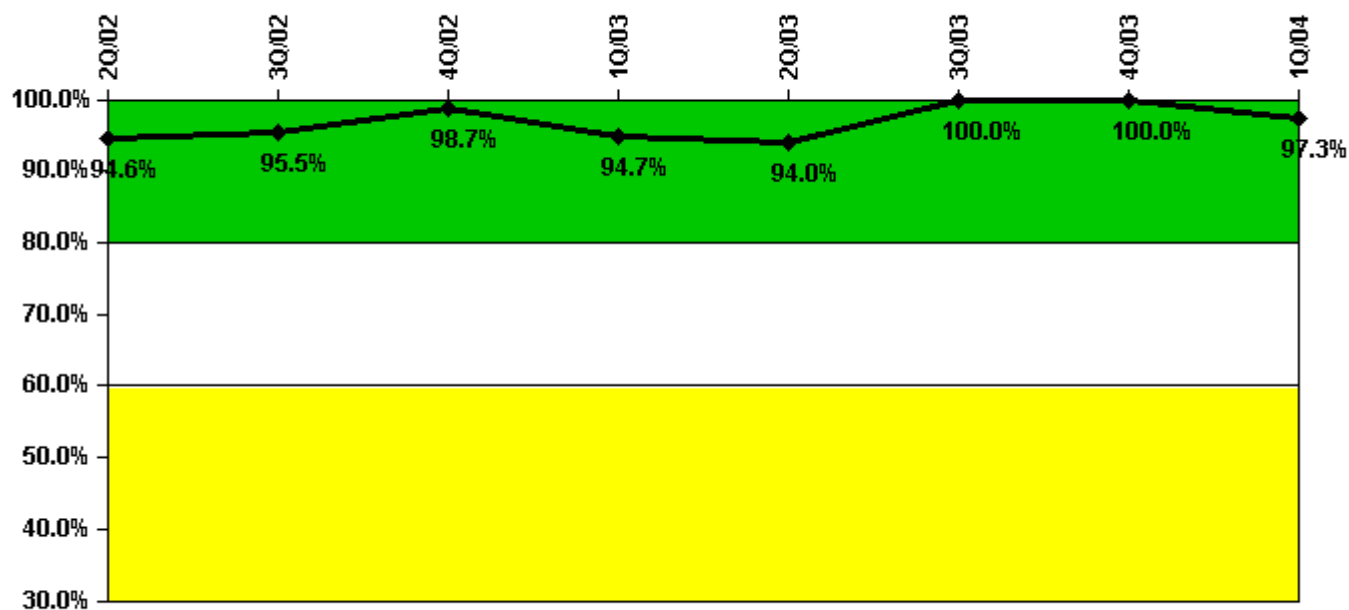


Thresholds: White < 80.0% Yellow < 60.0%

Notes

ERO Drill Participation	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Participating Key personnel	141.0	149.0	151.0	142.0	141.0	151.0	142.0	145.0
Total Key personnel	149.0	156.0	153.0	150.0	150.0	151.0	142.0	149.0
Indicator value	94.6%	95.5%	98.7%	94.7%	94.0%	100.0%	100.0%	97.3%

Licensee Comments: none

Alert & Notification System

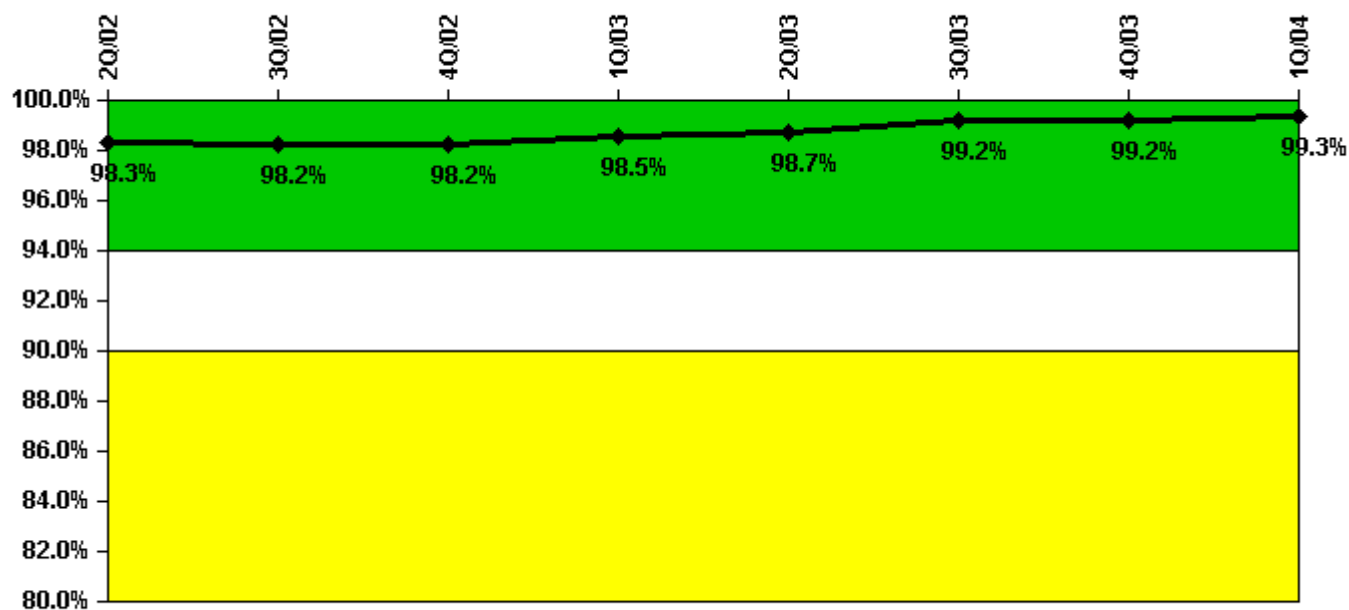

Thresholds: White < 94.0% Yellow < 90.0%

Notes

Alert & Notification System	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Successful siren-tests	1092	1092	1142	1291	1481	1358	1546	1554
Total sirens-tests	1111	1121	1157	1300	1495	1365	1560	1560
Indicator value	98.3%	98.2%	98.2%	98.5%	98.7%	99.2%	99.2%	99.3%

Licensee Comments: none

Occupational Exposure Control Effectiveness



Thresholds: White > 2.0 Yellow > 5.0

Notes

Occupational Exposure Control Effectiveness	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
High radiation area occurrences	0	0	0	0	0	0	0	0
Very high radiation area occurrences	0	0	0	0	0	0	0	0
Unintended exposure occurrences	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

RETS/ODCM Radiological Effluent




Thresholds: White > 1.0 Yellow > 3.0

Notes

RETS/ODCM Radiological Effluent	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
RETS/ODCM occurrences	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

Protected Area Security Performance Index

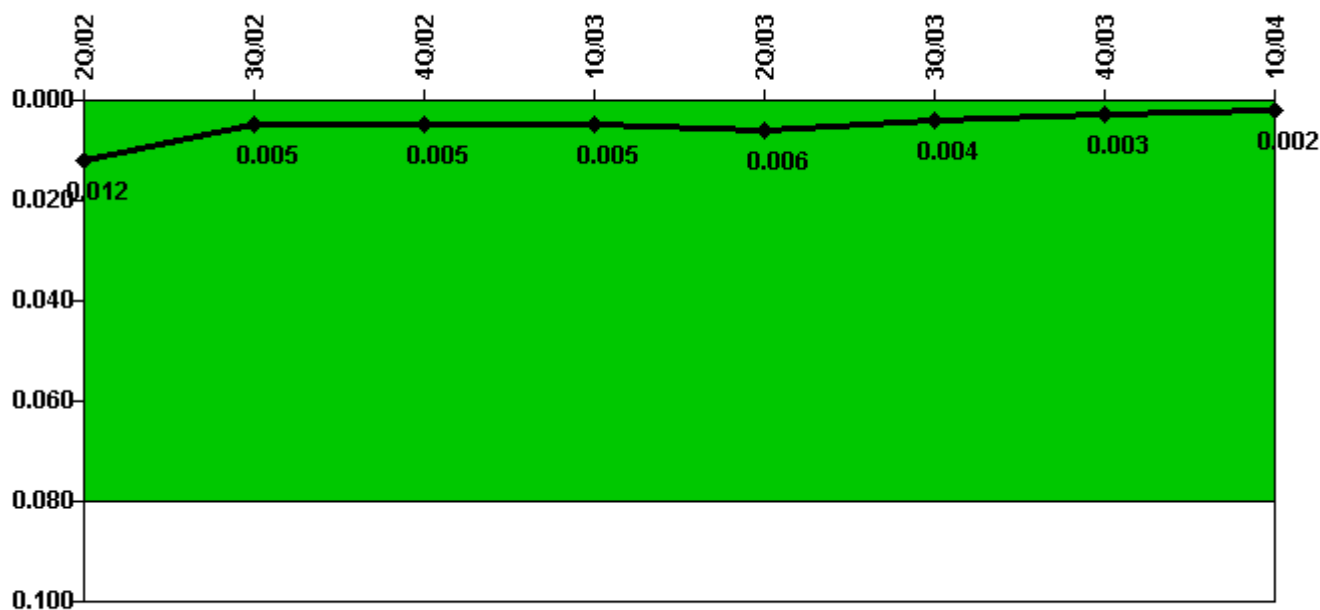

Thresholds: White > 0.080

Notes

Protected Area Security Performance Index	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
IDS compensatory hours	47.00	96.00	31.00	20.00	54.00	22.00	8.00	4.00
CCTV compensatory hours	0	9.0	6.0	3.0	12.0	0	0	0
IDS normalization factor	2.80	2.80	2.80	2.80	2.80	2.80	2.80	2.80
CCTV normalization factor	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
Index Value	0.012	0.005	0.005	0.005	0.006	0.004	0.003	0.002

Licensee Comments: none

Personnel Screening Program



Thresholds: White > 2.0 Yellow > 5.0

Notes

Personnel Screening Program	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Program failures	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

FFD/Personnel Reliability



Thresholds: White > 2.0 Yellow > 5.0

Notes

FFD/Personnel Reliability	2Q/02	3Q/02	4Q/02	1Q/03	2Q/03	3Q/03	4Q/03	1Q/04
Program Failures	0	0	0	0	0	0	0	0
Indicator value	0	0	0	0	0	0	0	0

Licensee Comments: none

▲ [PI Summary](#) | [Inspection Findings Summary](#) | [Reactor Oversight Process](#)

Last Modified: April 22, 2004