



Department of Energy
Office of Legacy Management

DEC 29 2004

Ms. Susan Frant, Chief
Fuel Cycle Facilities Branch, NMSS
U.S. Nuclear Regulatory Commission
Mail Stop T8A33
Washington, D.C. 20555-0001

Subject: Transmittal of the *Verification Monitoring Report for the Gunnison, Colorado, UMTRCA Title I Processing Site.*

Dear Ms. Frant:

Enclosed is a copy of the *Verification Monitoring Report for the Gunnison, Colorado, UMTRCA Title I Processing Site.* This report assesses the status of the natural flushing compliance strategy using ground water and surface water data collected from 1997 through 2004. Annual updates to this report will be produced as additional data are collected.

Concentrations of uranium and manganese in ground water beneath the Gunnison site are still above the relevant maximum concentration limit and risk-based concentration, respectively, but are generally decreasing with time as predicted, indicating that natural flushing is occurring in the alluvial aquifer. Concentrations of uranium in ground water downgradient from the site and deeper in the alluvial aquifer in some areas are still elevated, as expected. As the plume migrates downgradient, concentrations of uranium and manganese in ground water from the domestic wells sampled are below the maximum concentration limit and the Colorado Department of Public Health and Environment action level for uranium, and below the risk-based concentration for manganese.

If you have any questions, please call me at 970/248-6197.

Sincerely,

Tracy Plessinger
Site Manager

cc w/enclosure:
W. Naugle, CDPHE
J. DeVore, Gunnison County
Gunnison County Public Library


cc w/o enclosure:
W. Von Till, NRC
S. Campbell, Stoller
File Project GUN 410.00 (Thru D. Roberts)

tbp/GunVerMontRpt.doc



Verification Monitoring Report for the Gunnison, Colorado, UMTRCA Title I Processing Site

September 2004

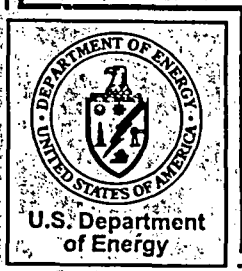

**Verification Monitoring Report for the
Gunnison, Colorado, UMTRCA Title I Processing Site**

September 2004

Work Performed by S.M. Stoller Corporation under DOE Contract No. DE-AC01-02GJ79491
for the U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado

Contents

| | |
|--|----|
| Acronyms and Abbreviations | v |
| 1.0 Introduction..... | 1 |
| 1.1 Purpose of Report | 1 |
| 1.2 Site Status..... | 1 |
| 1.3 Ground Water Quality..... | 4 |
| 1.4 Land and Water Use..... | 4 |
| 2.0 Monitoring Program..... | 7 |
| 2.1 Monitoring Network | 7 |
| 2.2 Results of 2004 Monitoring Program | 7 |
| 2.2.1 DOE Monitor Wells..... | 7 |
| 2.2.2 Domestic Wells..... | 10 |
| 2.2.3 Surface Water..... | 13 |
| 3.0 Conclusions..... | 13 |
| 4.0 References..... | 14 |

Figures

| | |
|--|----|
| Figure 1. Aerial Photograph of the Gunnison, Colorado, Area | 2 |
| Figure 2. Proposed Institutional Control Boundary at the Gunnison, Colorado, Processing Site .. | 3 |
| Figure 3. Uranium Distribution from May 2004 Sampling, Gunnison, Colorado..... | 5 |
| Figure 4. Manganese Distribution from May 2004 Sampling, Gunnison, Colorado..... | 6 |
| Figure 5. Uranium Concentrations in Ground Water in DOE Monitor Wells at the Gunnison, Colorado, Site | 9 |
| Figure 6. Manganese Concentrations in Ground Water for DOE Monitor Wells at the Gunnison, Colorado, Site..... | 10 |
| Figure 7. Uranium Concentrations in Ground Water in Domestic Wells at the Gunnison, Colorado, Site | 11 |
| Figure 8. Manganese Concentrations in Ground Water in Domestic Wells at the Gunnison, Colorado, Site | 11 |
| Figure 9. Uranium Concentrations in Surface Water at the Gunnison, Colorado, Site | 12 |
| Figure 10. Manganese Concentrations in Surface Water at the Gunnison, Colorado, Site | 12 |
| Figure 11. Uranium Concentration—Monitor Well 0113 at the Gunnison, Colorado, Site..... | 14 |

Tables

| | |
|--|---|
| Table 1. Ground Water and Surface Water Monitoring at the Gunnison Site..... | 8 |
|--|---|

Appendices

Appendix A—Ground Water Quality Data by Parameter for DOE Monitor Wells

Appendix B—Ground Water Quality Data by Parameter for Domestic Wells

Appendix C—Surface Water Quality Data by Parameter

Acronyms and Abbreviations

| | |
|--------|--|
| CDPHE | Colorado Department of Public Health and Environment |
| COPC | constituent of potential concern |
| DOE | U.S. Department of Energy |
| EA | Environmental Assessment |
| EPA | U.S. Environmental Protection Agency |
| FONSI | Finding of no Significant Impact |
| ft | foot (feet) |
| GCAP | Ground Water Compliance Action Plan |
| IC | institutional control(s) |
| MCL | maximum concentration limit |
| mg/L | milligram(s) per liter |
| NRC | U.S. Nuclear Regulatory Commission |
| RBC | risk-based concentration |
| RRM | residual radioactive material |
| SOWP | Site Observational Work Plan |
| UMTRCA | Uranium Mill Tailings Radiation Control Act |
| VMR | Verification Monitoring Report |

End of current text

1.0 Introduction

1.1 Purpose of Report

The purpose of this Verification Monitoring Report (VMR) is to evaluate ground water and surface water monitoring data collected during the annual 2004 sampling event at the Gunnison, Colorado, Uranium Mill Tailings Radiation Control Act (UMTRCA) Title I processing site and to assess the status of the compliance strategy for ground water cleanup (Figure 1). Detailed information for the Gunnison processing site and water quality data through 1999 are found in the Final Site Observational Work Plan (SOWP) (DOE 2001a). Water quality data from 2000 through 2003 are found in the previous VMR (DOE 2003). Water quality data for 2004 are provided in Appendices A through C of this report. All water quality data for the Gunnison processing site are archived in the SEEPro database at the U.S. Department of Energy (DOE) Grand Junction Office.


Information regarding monitoring and compliance with water quality standards at the Gunnison disposal site (6 miles east of the processing site) is reported in the 2003 Annual Site Inspection and Monitoring Report for Uranium Mill Tailings Radiation Control Act Title I Disposal Sites (DOE 2004).

1.2 Site Status

The SOWP (DOE 2001a) is complete and has been conditionally accepted by the U.S. Nuclear Regulatory Commission (NRC) and the Colorado Department of Public Health and Environment (CDPHE). The conditions are that DOE shall install two additional monitor wells in the network downgradient from the site and implement institutional controls (IC) in the potentially affected area (NRC 2002) (Figure 2). A draft Ground Water Compliance Action Plan (GCAP) was completed based on information in the SOWP (DOE 2001b).

Additional review of the monitoring network was initiated by a letter from DOE to NRC and CDPHE dated August 26, 2003 and a follow-up site visit on September 11, 2003. This led to a letter and Technical Evaluation Report from NRC to DOE dated July 9, 2004 where NRC (1) accepted the proposed locations of the above-mentioned monitor wells; (2) determined locations for 3 additional monitor wells to be installed north of Tomichi Creek upstream from its confluence with the South Fork of the Gunnison River; (3) added 3 existing domestic wells south of Tomichi Creek to the ground water monitoring network; (4) concluded that 36 unneeded monitor wells could be decommissioned; and (5) added 10 existing monitor wells to the monitoring network (NRC 2004). Installation of the additional monitor wells and decommissioning activities are scheduled to be conducted before the end of Fiscal Year 2004. Modifications to the monitoring program will be implemented in Fiscal Year 2005.

Discussions with Gunnison County officials and CDPHE regarding ICs and expansion of the existing domestic water supply system are in progress. The final Environmental Assessment (EA) (DOE 2002) and Finding of No Significant Impact (FONSI) have been completed and distributed.

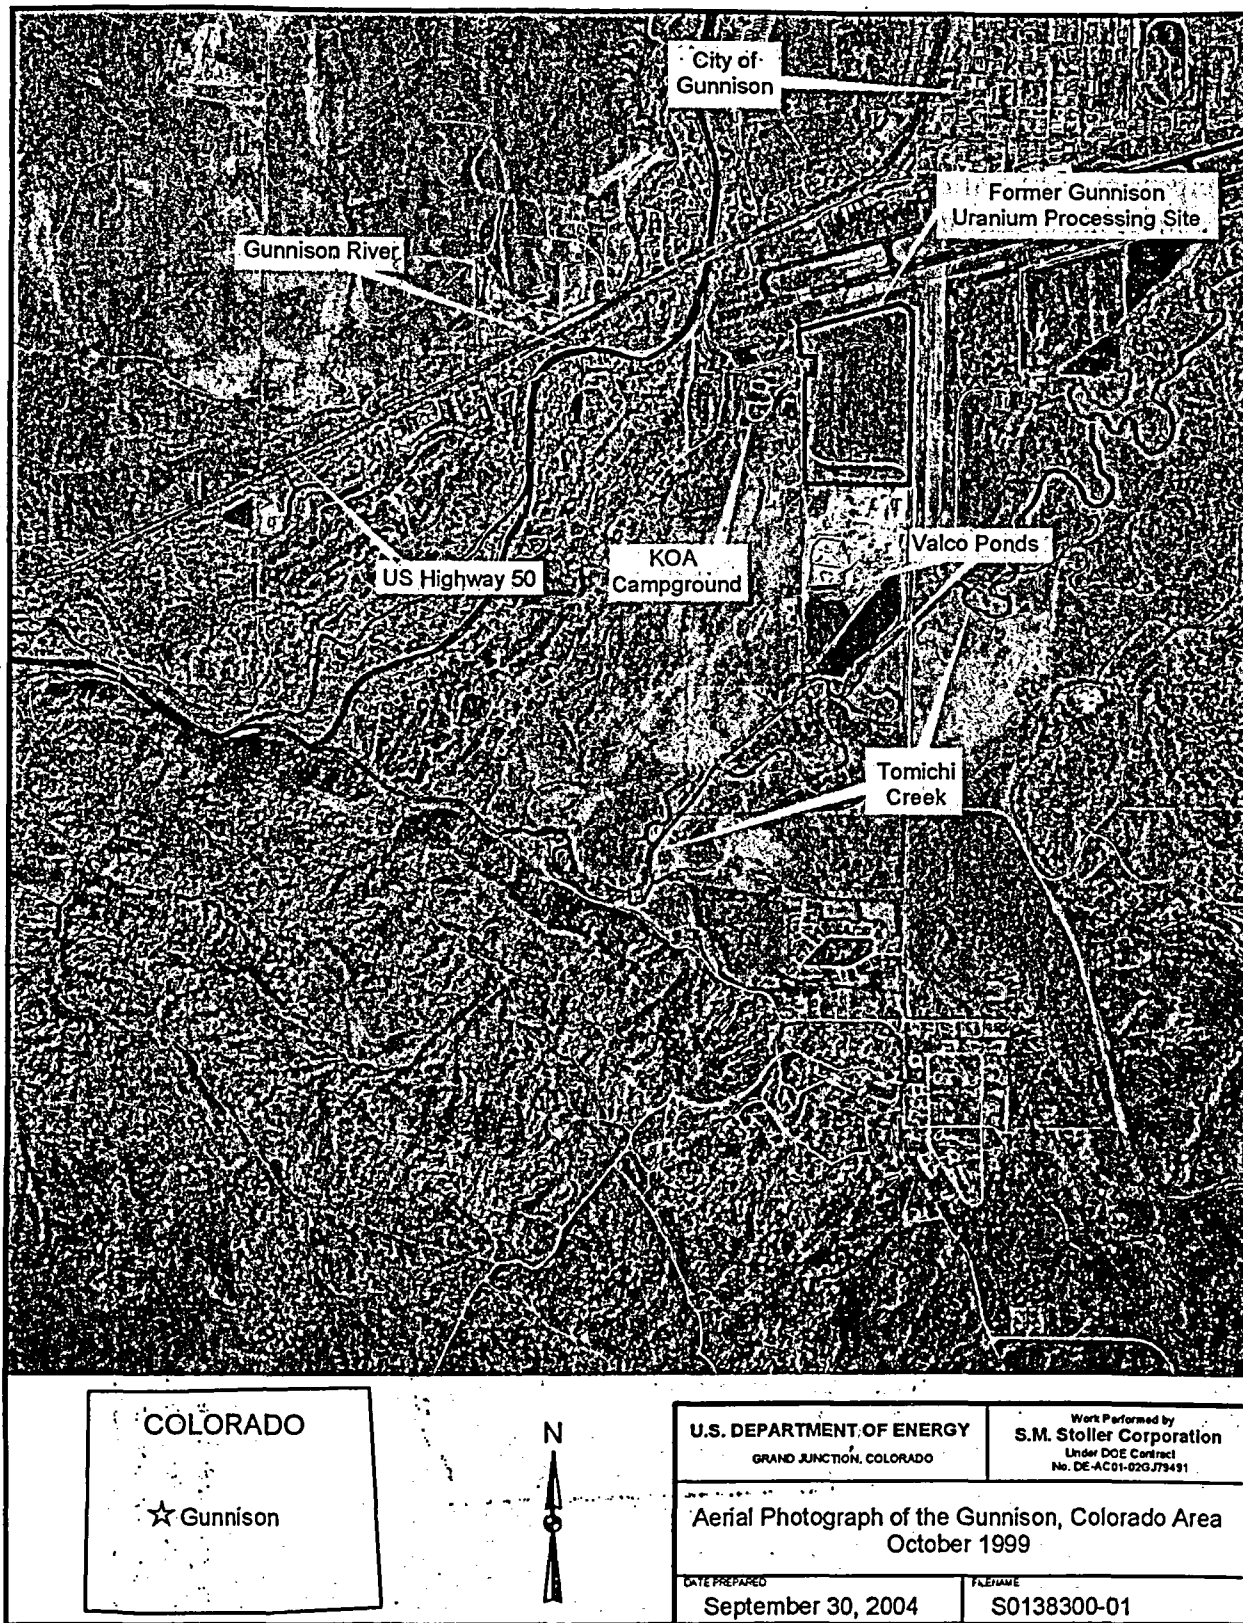

\\MS1111\0064\01001\w01383\w0138300.apr carverm 9/30/2004, 16:23

Figure 1. Aerial Photograph of the Gunnison, Colorado, Area

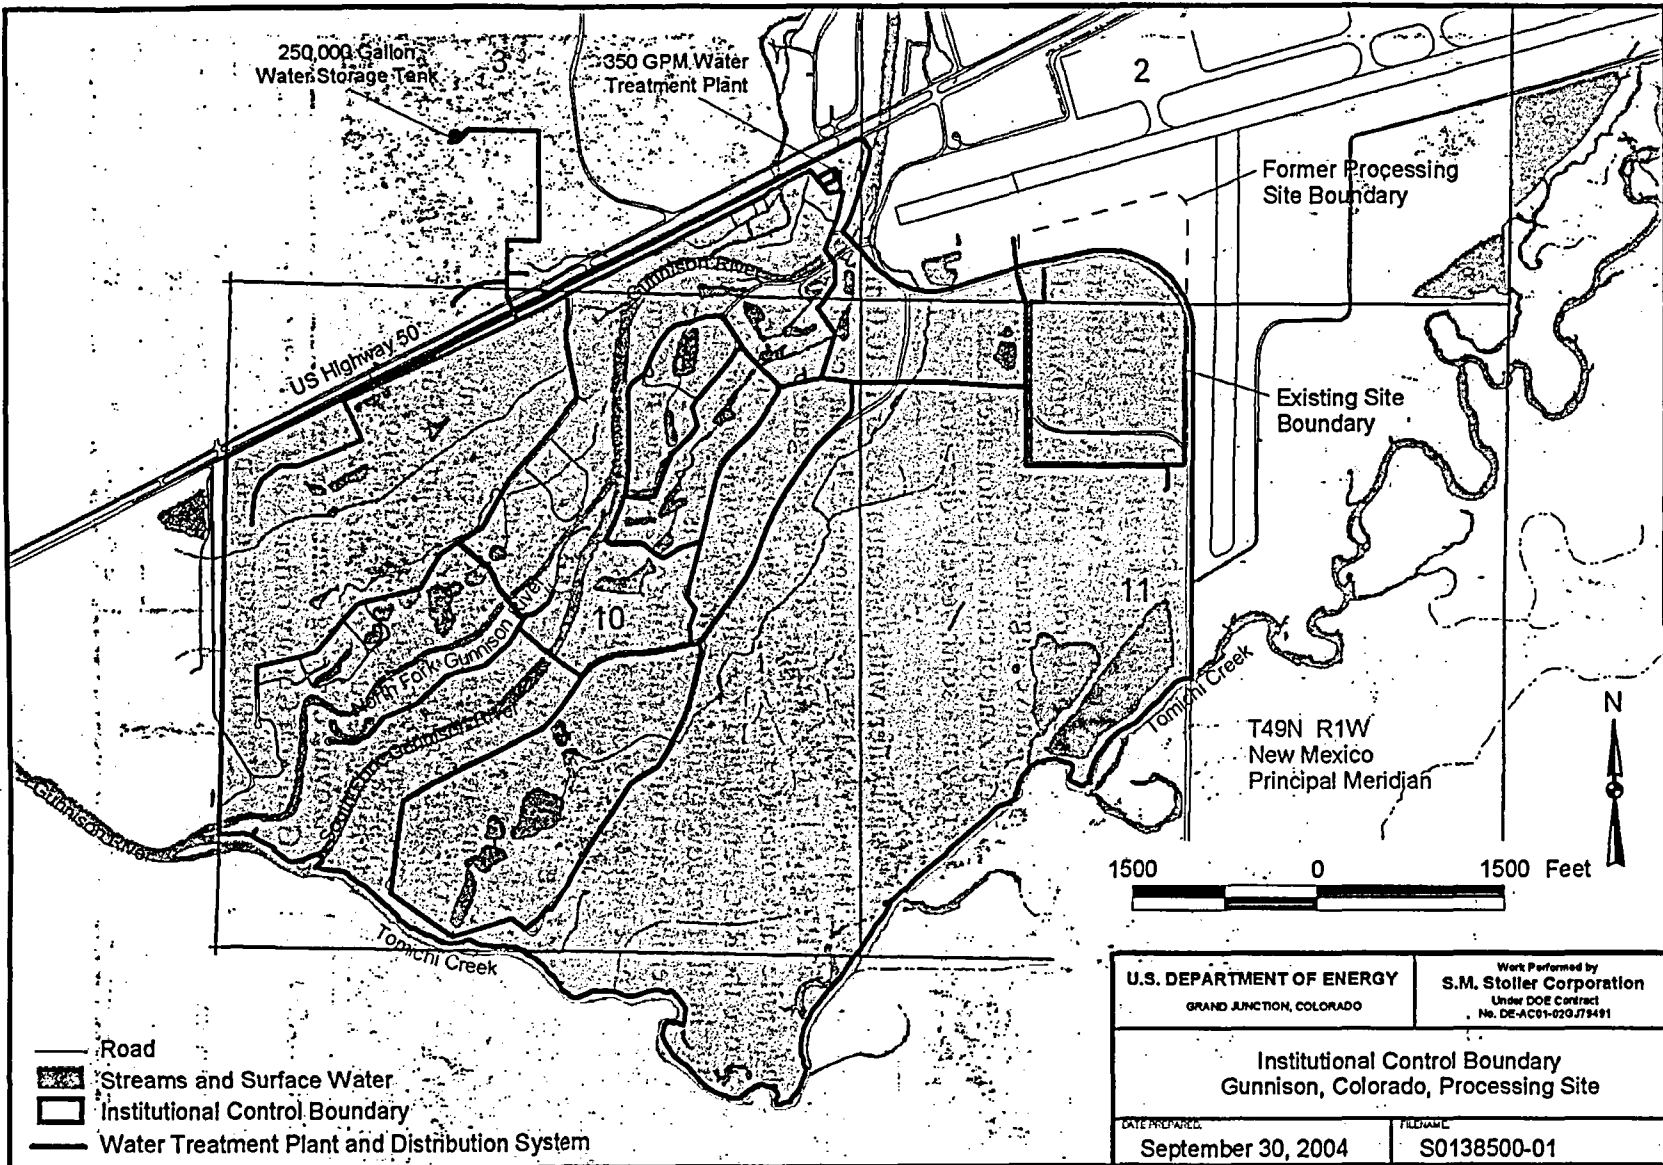


Figure 2. Proposed Institutional Control Boundary at the Gunnison, Colorado, Processing Site

The GCAP will be revised when the above monitoring conditions are met and ICs are in place. The final GCAP will be submitted to NRC for concurrence and will provide the guidance for long-term management activities at the Gunnison processing site.

1.3 Ground Water Quality

Ground water in the alluvial aquifer beneath and downgradient from the Gunnison processing site was contaminated by uranium processing activities. Uranium mill tailings and other residual radioactive material (RRM) were removed from the millsite between 1992 and 1995 and stabilized in a disposal cell 6 miles east of Gunnison. RRM beneath the site was cleaned up to just below the water table with some contaminated material left in place. Clean fill was placed above these areas to prevent radiation from emanating to the surface.

Uranium is the primary constituent of potential concern (COPC) in ground water, with concentrations up to 0.680 milligrams per liter (mg/L) beneath the site, and exceeding the uranium maximum concentration limit (MCL) of 0.044 mg/L (40 CFR 192) several thousand feet downgradient from the site boundary (Figure 3 and Appendix A). Concentrations of uranium in ground water below the MCL, but above background, extend approximately 7,000 feet (ft) downgradient from the site boundary and have migrated beneath the Gunnison River just beyond the confluence with Tomichi Creek. The zone of contamination attenuates and migrates deeper into the aquifer as it progresses laterally in a southwesterly direction.

Manganese is also a COPC in ground water, with concentrations up to 10.0 mg/L beneath the site (Figure 4 and Appendix A). There is no MCL for manganese, but an acceptable human health risk-based concentration (RBC) is 1.7 mg/L (DOE 2001a). Manganese does not appear to be widespread in the aquifer and concentrations beneath the site are decreasing. Concentrations of manganese are above the RBC beneath and immediately downgradient from site. Concentrations are below the RBC in all other downgradient monitor wells. The presence of manganese above the RBC in ground water in the area of the processing site does not represent a risk to human health and the environment because of ground water use restrictions (DOE 2001a).

1.4 Land and Water Use

The former uranium-ore processing site is owned by Gunnison County. Adjacent properties are owned by Gunnison County, Valco, Inc., and other private parties. Valco, Inc. is involved in commercial aggregate mining operations just south of the Gunnison site. Some of the adjacent area most likely will be subject to residential development in the future. A domestic water supply system was constructed in 1994 to provide drinking water to potentially impacted users in the area (Figure 2). Discussions with Gunnison County officials and CDPHE regarding ICs and expansion of the existing domestic water supply system are in progress.

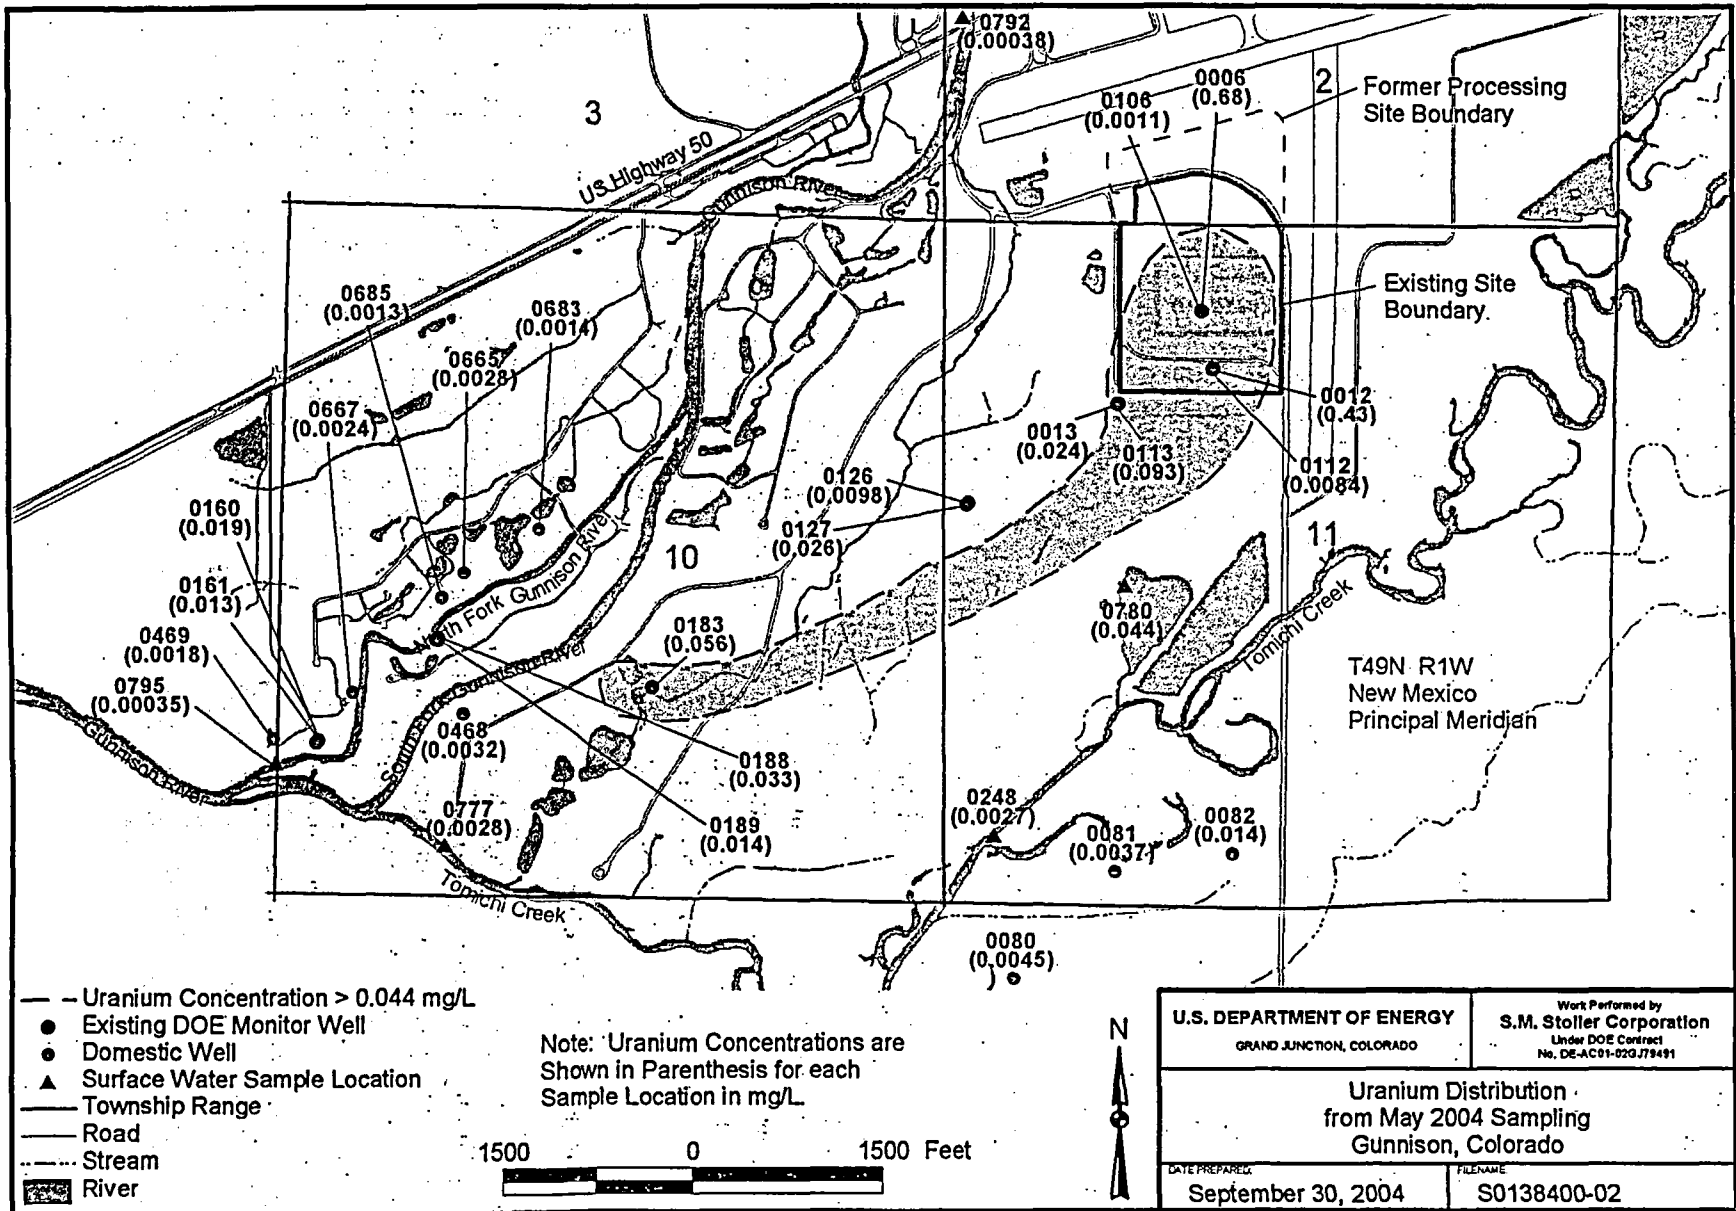


Figure 3. Uranium Distribution from May 2004 Sampling, Gunnison, Colorado

m:\s11110064011001w0138400.apr carverh 8/30/2004, 16:06

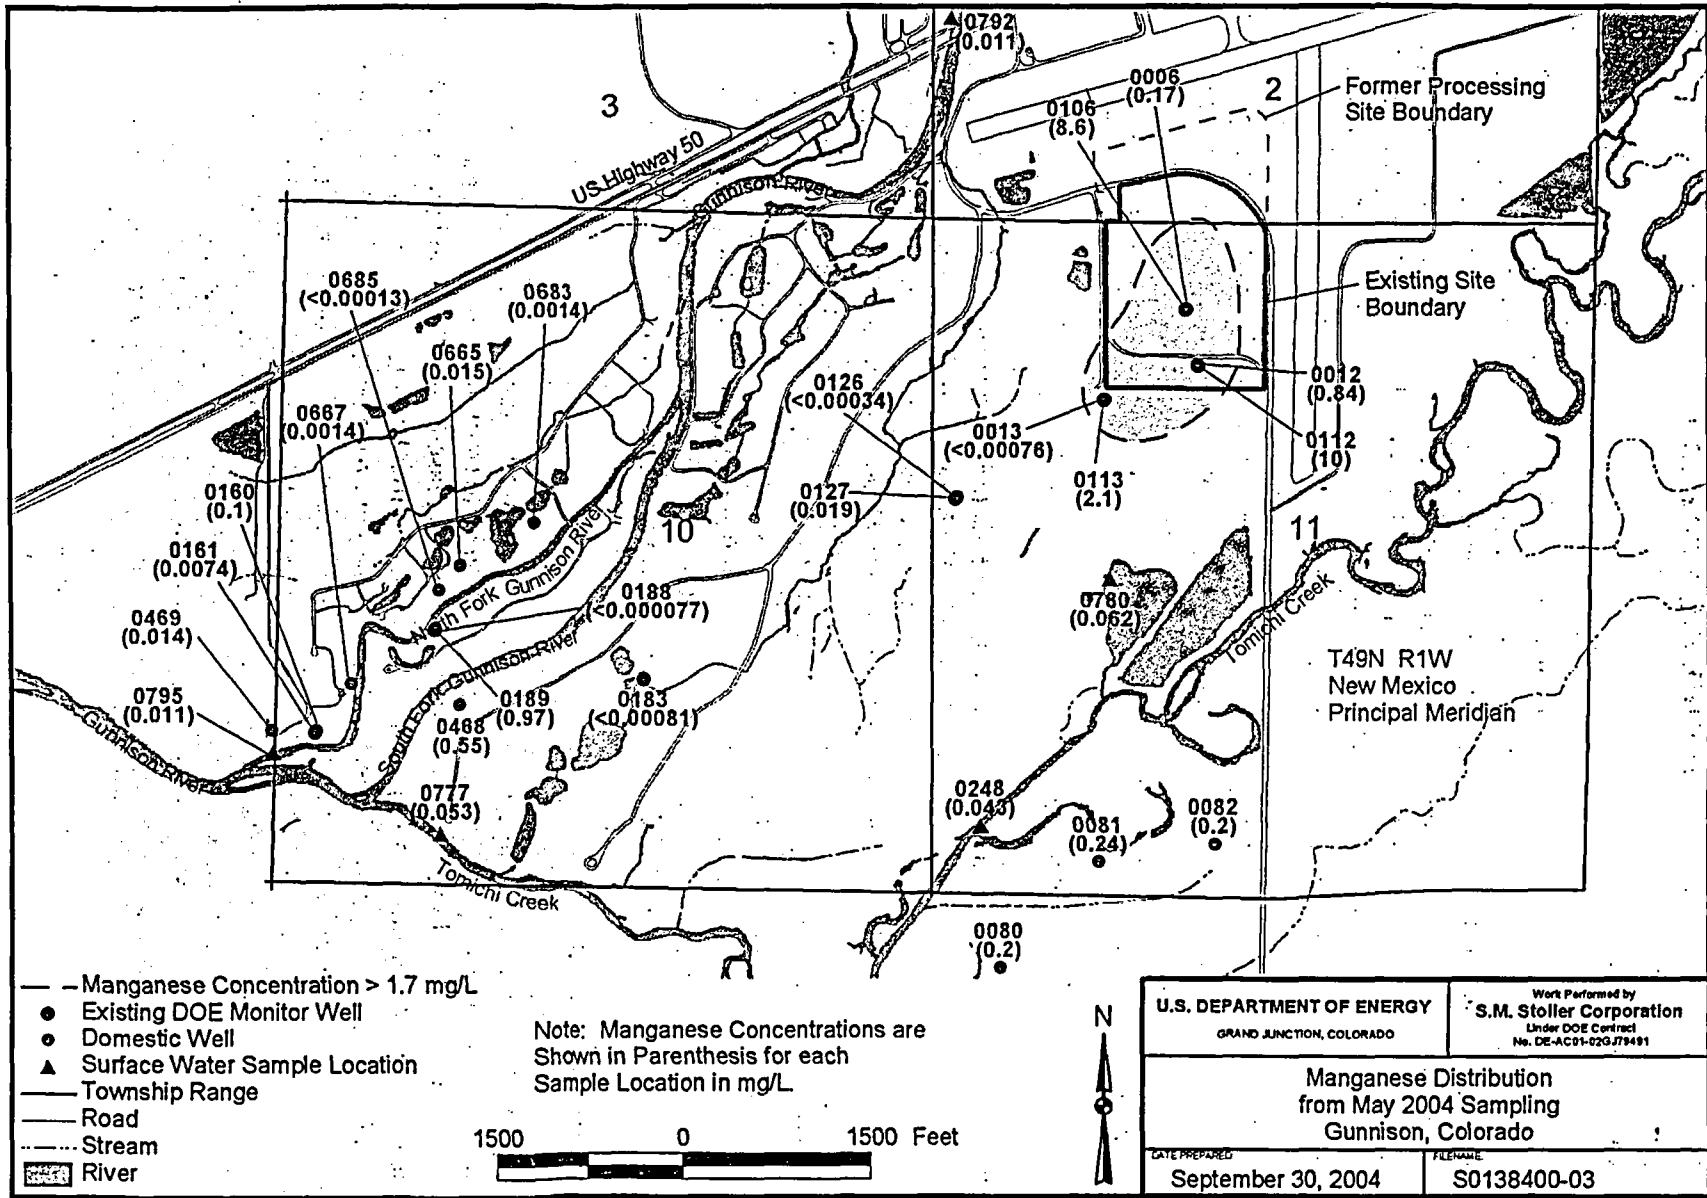


Figure 4. Manganese Distribution from May 2004 Sampling, Gunnison, Colorado

2.0 Monitoring Program

2.1 Monitoring Network

Locations in the monitoring network at the Gunnison processing site sampled during May 2004 included thirteen DOE monitor wells, five surface water locations, and nine domestic wells in the area (Figure 3 and Table 1) (DOE 2001a and 2001b). Uranium and manganese are the COPCs that were analyzed during this period. Annual ground water and surface water verification monitoring as proposed in the SOWP and GCAP was implemented in May 2000. Results for the May 2004 sampling event are presented in this report. The next update to this report will be compiled after ground water and surface water monitoring in May 2005.

Verification monitoring will be performed annually for the first 5 years after NRC concurrence with the GCAP (revision in progress) to ascertain that natural flushing is progressing as predicted by ground water flow and transport modeling (DOE 2001a). Ongoing monitoring requirements will be periodically evaluated and modified as determined by DOE and the regulators.

2.2 Results of 2004 Monitoring Program

Ground water and surface water analytical results through October 1999 are discussed in the SOWP (DOE 2001a), and results from 2000 through 2003 are presented and discussed in the previous VMR (DOE 2003). Only concentrations of uranium and manganese in ground water and surface water are discussed in this report since they are the COPCs. Concentration versus time plots for uranium and manganese in DOE monitor wells, domestic wells, and surface water, from 1997 (post-remedial action) through 2004, are shown in Figure 5 through Figure 10, respectively. The alluvial aquifer has been divided into three zones: (1) shallow zone from 10 to 15 ft; (2) intermediate zone from 35 to 60 ft; and (3) deep zone from 90 to 100 ft (Table 1). Analytical data for uranium and manganese in ground water in DOE monitor wells and domestic wells, and surface water for 2004 are provided in Appendices A through C, respectively.

2.2.1 DOE Monitor Wells

Concentrations of uranium in ground water in DOE monitor wells are shown in Figure 5. Concentrations of uranium in the shallow zone beneath the site (monitor wells 0006 and 0012) are still above the MCL of 0.044 mg/L. Concentrations have decreased since 2003 and the overall trend indicates that natural flushing in ground water in the alluvial aquifer is progressing. Concentrations of uranium in ground water in the intermediate zone beneath the site (monitor well 0106 and 0112) remain at or below background levels. Uranium concentrations in ground water just off the southwest corner of the site are elevated deeper in the alluvium, with levels below the MCL in the shallow zone (monitor well 0013) and above the MCL in the intermediate zone (monitor well 0113). Concentrations are below the MCL and decreasing in monitor wells 0126 (intermediate zone) and 0127 (deep zone), with concentrations slightly more elevated in the deep zone. Concentrations are above the MCL in monitor well 0183 in the deep zone and are decreasing slightly. Concentrations are less than the MCL, but also decreasing in monitor well 0188 (intermediate zone), and are relatively constant in monitor well 0189 (deep zone). Concentrations are less than the MCL and slowly decreasing in monitor wells 0160 (intermediate zone) and 0161 (deep zone) across the Gunnison River. This pattern of concentration intensity and distribution

shows that uranium in ground water is migrating deeper in the alluvial sequence while progressing downgradient from the site, as predicted.

Table 1. Summary of Ground Water and Surface Water Monitoring Network at the Gunnison, Colorado, Processing Site

| Sample Location ID | Aquifer Zone | Screened Interval (ft) | Location | Rationale for Inclusion (Uranium) |
|---|--------------|------------------------|----------------------------|-----------------------------------|
| Ground Water – DOE Monitor Wells | | | | |
| 0006 | Shallow | 10–15 | On site | Above MCL |
| 0106 | Intermediate | 34–39 | On site | Background |
| 0012 | Shallow | 10–15 | On site | Above MCL |
| 0112 | Intermediate | 40–45 | On site | Background |
| 0013 | Shallow | 11–16 | Just off site | Below MCL |
| 0113 | Intermediate | 41–46 | Just off site | Above MCL |
| 0126 | Intermediate | 54–59 | Downgradient | Below MCL |
| 0127 | Deep | 94–99 | Downgradient | Below MCL |
| 0183 | Deep | 93–98 | Beneath golf course | Above MCL |
| 0188 | Intermediate | 53–58 | West of Gunnison River | Above background |
| 0189 | Deep | 93–98 | West of Gunnison River | Above background |
| 0160 | Intermediate | 51–56 | West of Gunnison River | Above background |
| 0161 | Deep | 93–98 | West of Gunnison River | Above background |
| Surface Water | | | | |
| 0248 | | | Tomichi Creek | Near Valco gravel pit |
| 0777 | | | Tomichi Creek | Downstream |
| 0780 | | | Valco gravel pit | At MCL |
| 0792 | | | Gunnison River | Upstream |
| 0795 | | | Gunnison River | Downstream |
| Ground Water – Domestic Wells | | | | |
| 0080 | Shallow | Unknown | Southeast of Tomichi Creek | Subdivision |
| 0081 | Shallow | Unknown | Southeast of Tomichi Creek | Subdivision |
| 0082 | Shallow | Unknown | Southeast of Tomichi Creek | Subdivision |
| 0468 | Shallow | Unknown | East of Gunnison River | Subdivision |
| 0469 | Shallow | Unknown | West of Gunnison River | Subdivision |
| 0665 | Shallow | Unknown | West of Gunnison River | Subdivision |
| 0667 | Shallow | Unknown | West of Gunnison River | Subdivision |
| 0683 | Shallow | Unknown | West of Gunnison River | Subdivision |
| 0685 | Shallow | Unknown | West of Gunnison River | Subdivision |

Concentrations of manganese in ground water beneath the site are above the RBC of 1.7 mg/L in the intermediate zone, with concentrations below the RBC in the shallow zone (Figure 6). All exceedences of the RBC are beneath or immediately adjacent to the south end of the site. Concentrations are generally decreasing over time.

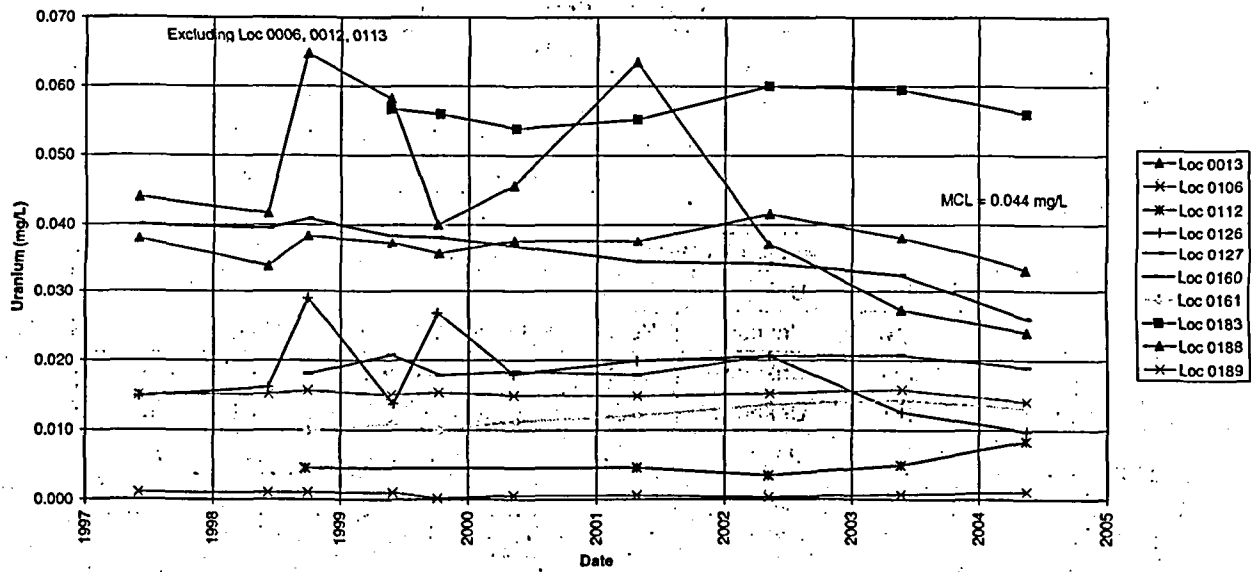
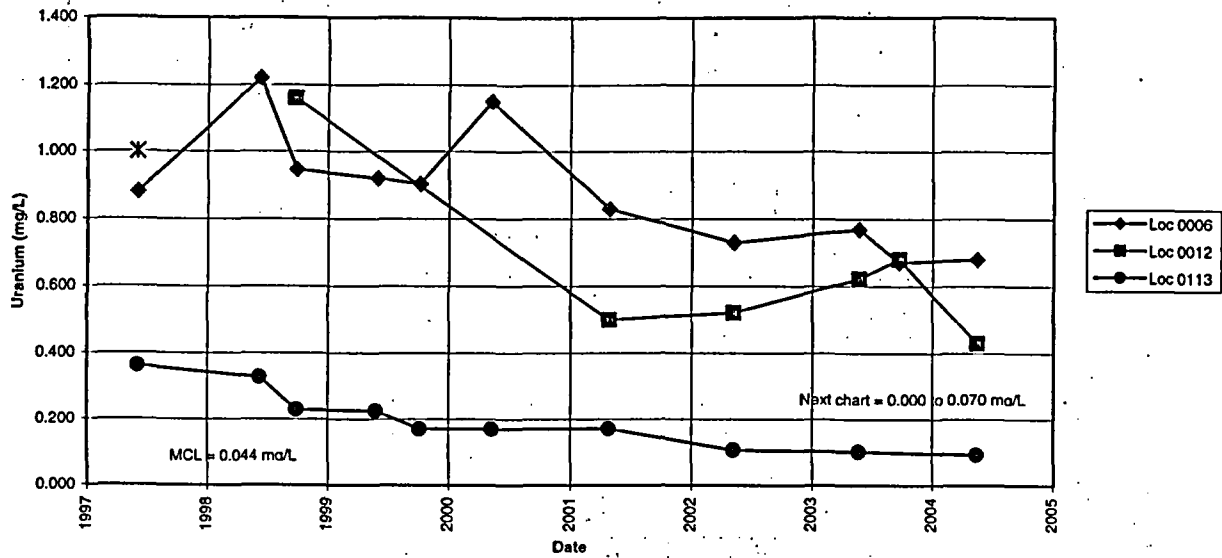


Figure 5. Uranium Concentrations in Ground Water in DOE Monitor Wells at the Gunnison, Colorado, Site

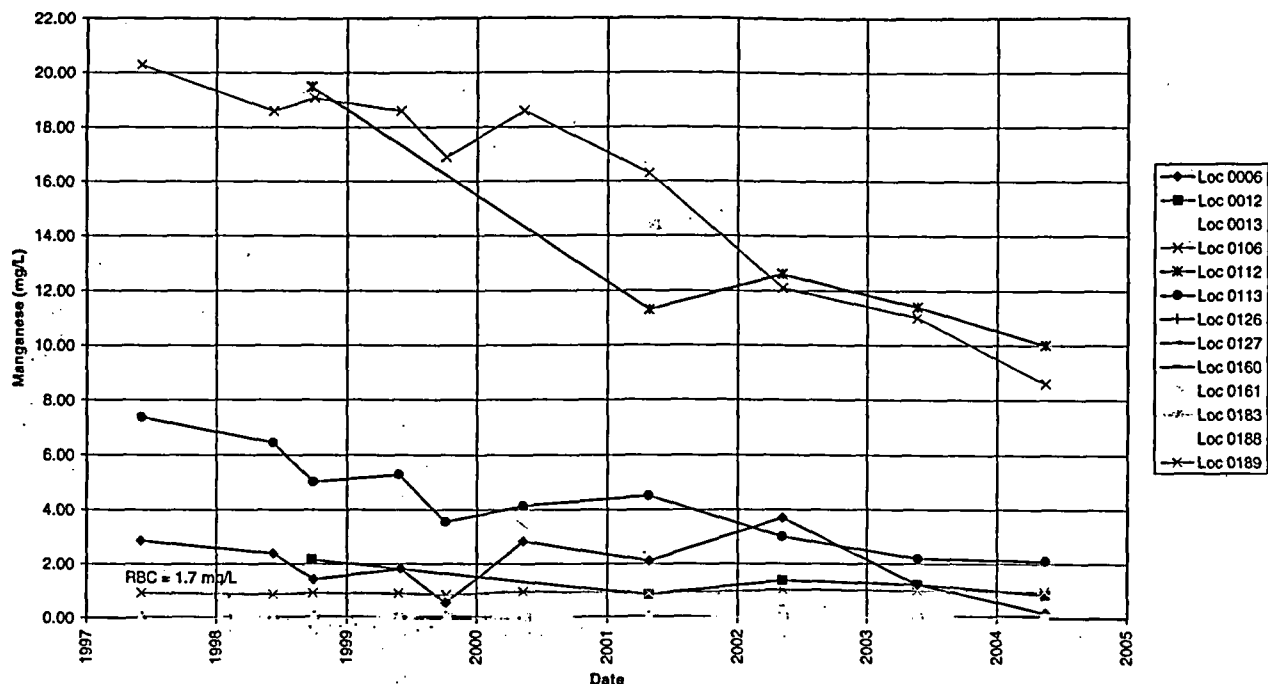


Figure 6. Manganese Concentrations in Ground Water for DOE Monitor Wells at the Gunnison, Colorado, Site

2.2.2 Domestic Wells

Concentrations of uranium in ground water in the domestic wells downgradient from the site are well below the MCL of 0.044 mg/L and below the action level set by CDPHE of 0.020 mg/L (Figure 7). Concentration of uranium in the agricultural well (0468) is well below the CDPHE action level of 0.200 mg/L.

Ground water has been sampled since 2002 in three new domestic wells (0080, 0081, and 0082) installed just southeast of Tomichi Creek in the new Tomichi Creek Preserve subdivision. The wells are approximately 44 ft deep and the open interval in the casing is unknown. Concentrations of uranium in ground water in these three wells during the past three years has ranged from 0.002 to 0.0155 mg/L, with the maximum below the CDPHE action level of 0.020 mg/L for domestic wells. The uranium concentration in ground water in well 0082 was slightly above the upper range of background (0.0085 mg/L) (DOE 1996) during May 2003 (0.016 mg/L) and May 2004 (0.014 mg/L). It was resampled in September 2003 and the uranium concentration was below background at 0.0064 mg/L. The validity and consistency of results from the domestic well may be questionable as the turbidity of the water from the well was elevated above that normally required during sampling of DOE monitor wells. Also, the construction of the well is unknown, and may have an impact on water quality results. DOE does not use results from domestic wells for characterization activities because of these uncertainties. To assess ground water quality in this part of the aquifer, DOE will install a monitor well adjacent to domestic well 0082 in 2004.

Concentrations of manganese in ground water in the domestic wells are well below the RBC of 1.7 mg/L (Figure 8).

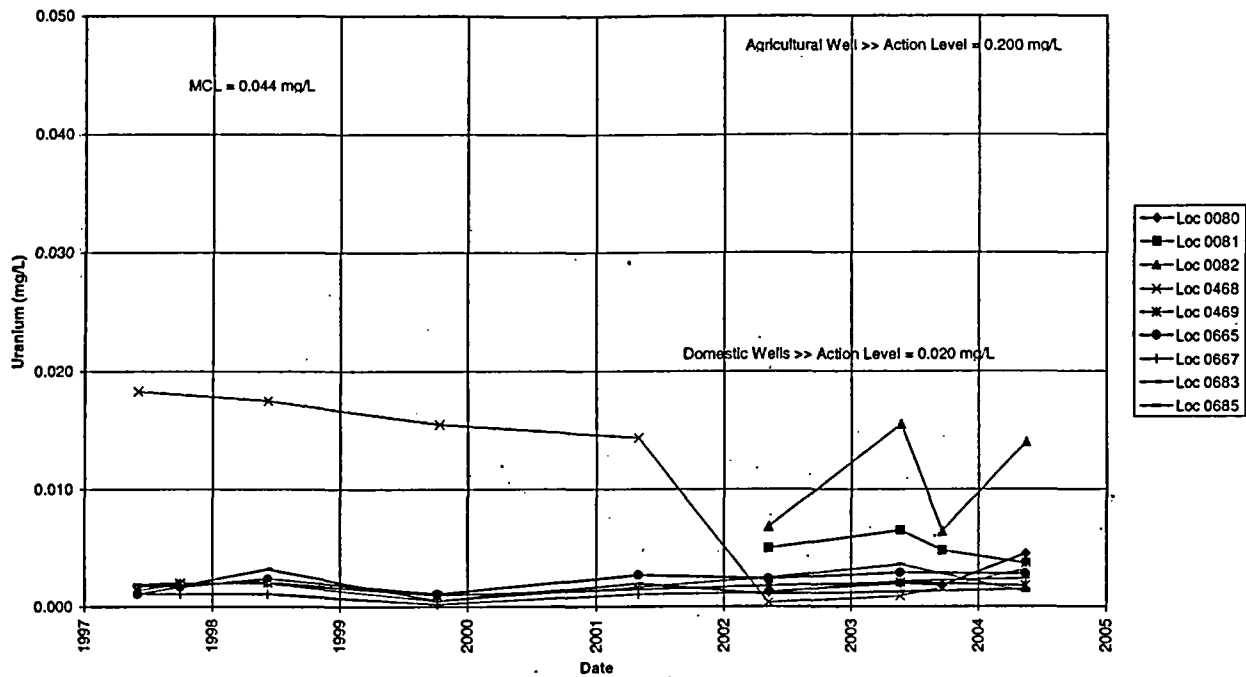


Figure 7. Uranium Concentrations in Ground Water in Domestic Wells at the Gunnison, Colorado, Site

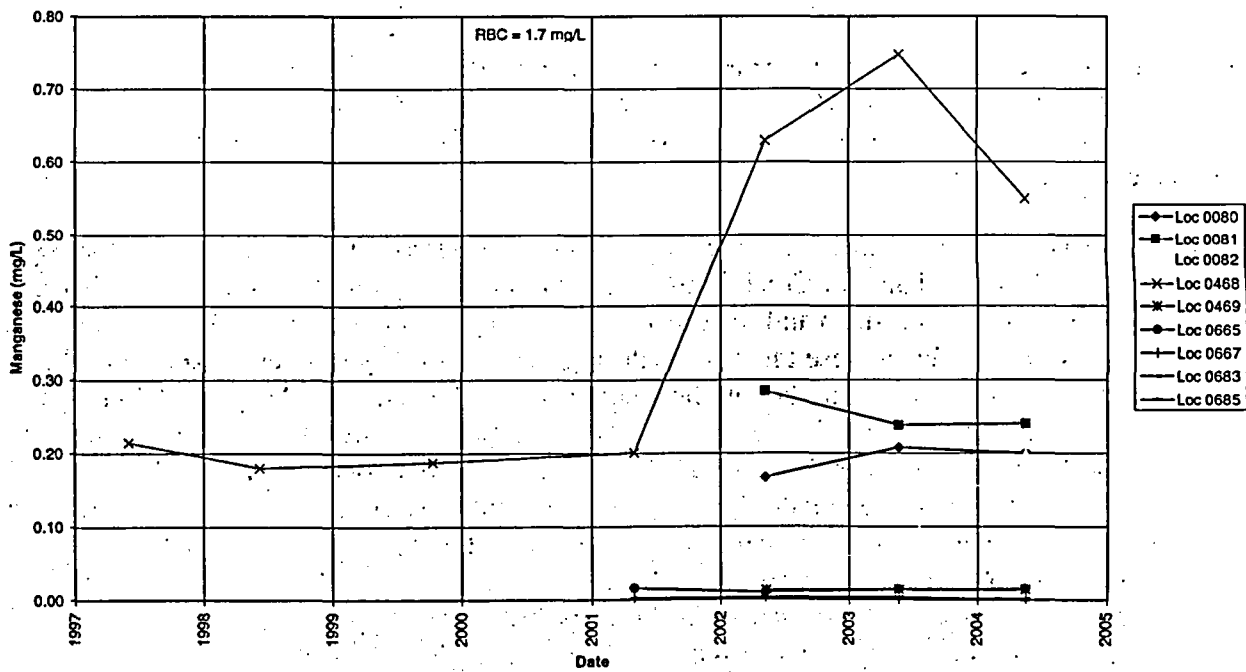


Figure 8. Manganese Concentrations in Ground Water in Domestic Wells at the Gunnison, Colorado, Site

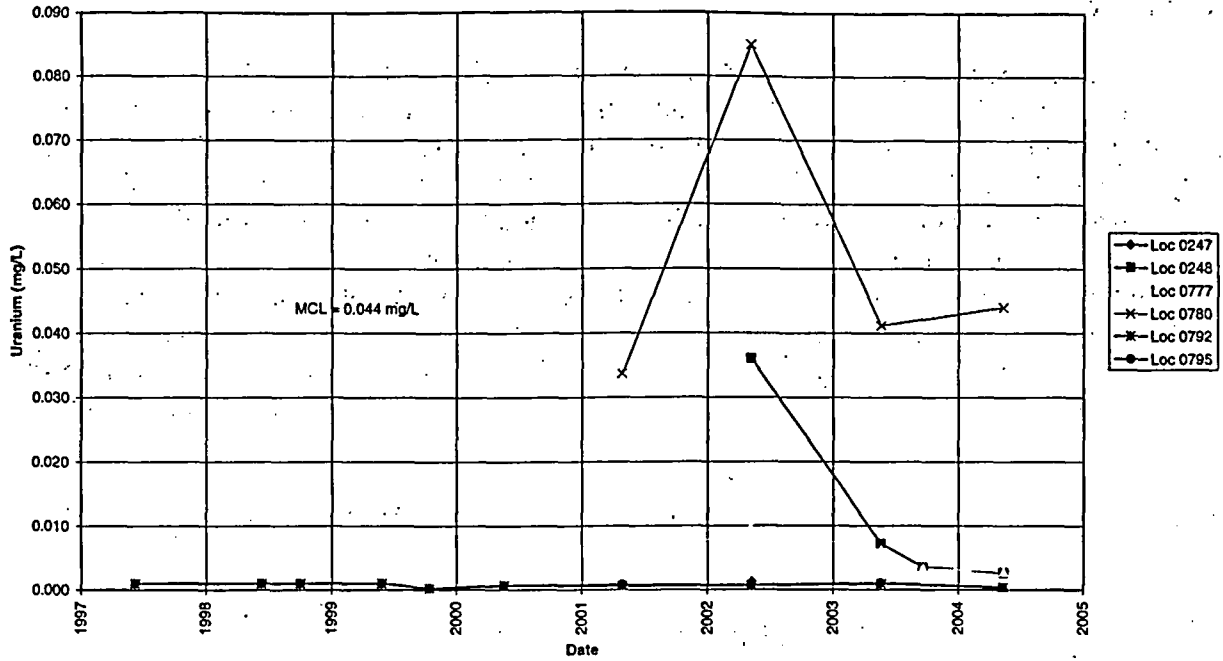


Figure 9. Uranium Concentrations in Surface Water at the Gunnison, Colorado, Site

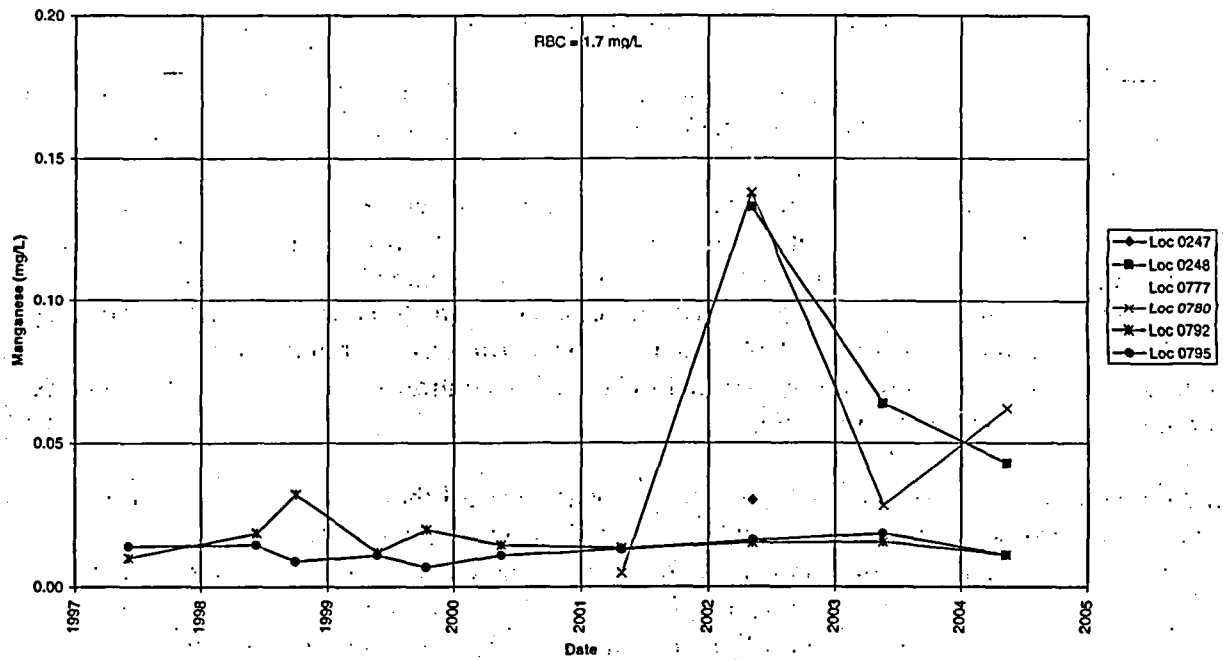


Figure 10. Manganese Concentrations in Surface Water at the Gunnison, Colorado, Site

2.2.3 Surface Water

Concentrations of uranium in surface water in the Gunnison River during 2004 were at or below the background level of 0.003 mg/L, indicating no site-related contamination in the river (Figure 9). Concentration of uranium in surface water in the Valco, Inc. pond (0780) increased slightly during 2004 and is just at the MCL for ground water. Variable concentrations of uranium in surface water in the pit are expected since it is recharged by contaminated ground water; concentrations vary depending on the area and depth of pumping, the rate of discharge, and seasonal interactions between ground water and surface water. Concentration of uranium in Tomichi Creek approximately 1,500 ft downstream from the Valco, Inc. pond discharge point (0248) was below background levels for ground water during 2004. Concentration farther down Tomichi Creek, before the confluence with the Gunnison River, was also below background levels.

Concentrations of manganese in surface water are well below the RBC of 1.7 mg/L (Figure 10).

3.0 Conclusions

Concentrations of uranium and manganese in ground water beneath the Gunnison processing site are still above the relevant MCLs and RBCs, but are decreasing with time, indicating that natural flushing is occurring in the alluvial aquifer (Figure 5 and Figure 6). Concentrations of uranium in ground water downgradient from the site and deeper in the alluvial aquifer in some areas are still elevated, as expected, as the plume migrates downgradient.

Concentrations of COPCs in ground water in the domestic wells are below the MCL and CDPHE action levels for uranium, and below the RBC for manganese (Figure 7 and Figure 8).

Concentrations of uranium in surface water of the Gunnison River are below 0.001 mg/L, indicating no site-related contamination of the river (Figure 9). Concentrations of uranium in surface water in the Valco, Inc. pond are variable, which is expected because the pit is recharged by contaminated ground water. Based on a risk assessment in the SOWP, there is no unacceptable risk to human health at these levels (DOE 2001a). Concentrations of uranium are below background levels for ground water in Tomichi Creek. Concentrations of manganese in surface water are at or less than 0.05 mg/L (Figure 10).

Comparison of uranium concentrations in ground water just off the southwest corner of the site in the intermediate zone in the alluvial aquifer predicted by ground water flow and transport modeling, versus actual concentrations determined by analysis of ground water samples from monitor well 0113, are shown in Figure 11. There is good correlation between the predicted and actual results, showing that the natural flushing process is working in ground water in the alluvial aquifer.

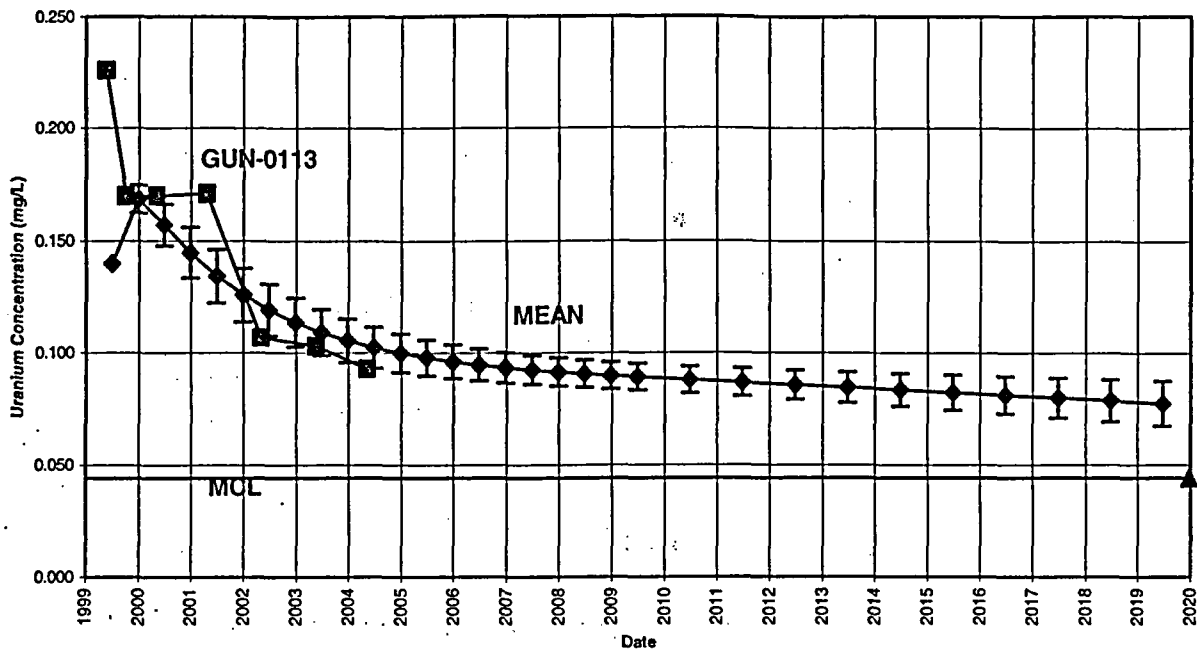


Figure 11. Uranium Concentration—Monitor Well 0113 at the Gunnison, Colorado, Site

4.0 References

U.S. Department of Energy (DOE), 1996. *Baseline Risk Assessment of Ground Water Contamination at the Uranium Mill Tailings Site Near Gunnison, Colorado*, DOE/AL/62350-57, Rev.2, June.

_____, 2001a. *Final Site Observational Work Plan for the Gunnison, Colorado, UMTRA Project Site*, GJO-2001-214-TAR, March.

_____, 2001b. *Ground Water Compliance Action Plan for the Gunnison, Colorado, UMTRA Project Site*, draft, GJO-2001-233-TAR, July; revision in progress.

_____, 2002. *Environmental Assessment of Ground Water Compliance at the Gunnison, Colorado, UMTRA Project Site*, DOE/EA-1399, Final, July.

_____, 2003. *Verification Monitoring Report for the Gunnison, Colorado, UMTRA Project Site*, GJO-2003-469-TAC, August.

_____, 2004. *2003 Annual Site Inspection and Monitoring Report for Uranium Mill Tailings Radiation Control Act Title I Disposal Sites*, GJO-2003-528-TAC, January.

U.S. Nuclear Regulatory Commission (NRC), 2002. "Review of the Final Site Observational Work Plan for the Uranium Mill Tailings Remedial Action Project Site at Gunnison, Colorado", letter from NRC to DOE dated January 29, 2002.

_____, 2004. "DOE Request to Decommission Monitor Wells at the Gunnison, Colorado, Uranium Mill Tailings Remedial Action Project Site (TAC L51108)", letter from NRC to DOE dated July 9, 2004.

Appendix A

Ground Water Quality Data by Parameter for DOE Monitor Wells

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16'am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE DATE | SAMPLE ID | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: LAB DATA QA | DETECTION LIMIT | UN-CERTAINTY |
|------------------------------|-----------|-------------|---------------|-------------|---------------|----------------------|---------------|-------------------------|-----------------|--------------|
| Alkalinity, Total (As CaCO3) | mg/L | 0006 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 224 | FQ # | - | - |
| | mg/L | 0013 | WL | 05/13/2004 | 0001 | 11.00 - 16.00 | 227 | F # | - | - |
| | mg/L | 0106 | WL | 05/13/2004 | 0001 | 34.00 - 39.00 | 45 | F # | - | - |
| | mg/L | 0112 | WL | 05/13/2004 | 0001 | 40.00 - 45.00 | 92 | F # | - | - |
| | mg/L | 0113 | WL | 05/13/2004 | 0001 | 41.00 - 46.00 | 182 | F # | - | - |
| | mg/L | 0126 | WL | 05/13/2004 | 0001 | 54.00 - 59.00 | 232 | F # | - | - |
| | mg/L | 0127 | WL | 05/13/2004 | 0001 | 94.00 - 99.00 | 234 | F # | - | - |
| | mg/L | 0160 | WL | 05/11/2004 | 0001 | 51.00 - 56.00 | 258 | F # | - | - |
| | mg/L | 0161 | WL | 05/11/2004 | 0001 | 93.00 - 98.00 | 202 | F # | - | - |
| | mg/L | 0183 | WL | 05/13/2004 | 0001 | 93.00 - 98.00 | 277 | F # | - | - |
| | mg/L | 0188 | WL | 05/12/2004 | 0001 | 53.00 - 58.00 | 169 | F # | - | - |
| | mg/L | 0189 | WL | 05/12/2004 | 0001 | 93.00 - 98.00 | 887 | FQ # | - | - |
| | Manganese | mg/L | 0006 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 0.170 | FQ # | 7.7E-05 |
| mg/L | | 0012 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 0.840 | F # | 7.7E-05 | - |
| mg/L | | 0013 | WL | 05/13/2004 | 0001 | 11.00 - 16.00 | 0.00076 B | UF # | 7.7E-05 | - |
| mg/L | | 0013 | WL | 05/13/2004 | 0002 | 11.00 - 16.00 | 0.00008 B | UF # | 7.7E-05 | - |
| mg/L | | 0106 | WL | 05/13/2004 | 0001 | 34.00 - 39.00 | 8.600 | F # | 7.7E-05 | - |
| mg/L | | 0112 | WL | 05/13/2004 | 0001 | 40.00 - 45.00 | 10.000 | F # | 0.00039 | - |
| mg/L | | 0113 | WL | 05/13/2004 | 0001 | 41.00 - 46.00 | 2.100 | F # | 7.7E-05 | - |
| mg/L | | 0126 | WL | 05/13/2004 | 0001 | 54.00 - 59.00 | 0.00034 B | UF # | 7.7E-05 | - |
| mg/L | | 0127 | WL | 05/13/2004 | 0001 | 94.00 - 99.00 | 0.019 | F # | 7.7E-05 | - |
| mg/L | | 0160 | WL | 05/11/2004 | 0001 | 51.00 - 56.00 | 0.100 | F # | 7.7E-05 | - |
| mg/L | | 0161 | WL | 05/11/2004 | 0001 | 93.00 - 98.00 | 0.0074 | F # | 7.7E-05 | - |
| mg/L | | 0183 | WL | 05/13/2004 | 0001 | 93.00 - 98.00 | 0.00081 B | UF # | 7.7E-05 | - |
| mg/L | | 0188 | WL | 05/12/2004 | 0001 | 53.00 - 58.00 | 0.00007 U | F # | 7.7E-05 | - |
| mg/L | 0189 | WL | 05/12/2004 | 0001 | 93.00 - 98.00 | 0.970 | FQ # | 7.7E-05 | - | |

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: | | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: | | | UN-CERTAINTY |
|----------------------------|-------|-------------|---------------|------------|------|----------------------|--------|-------------|------|----|--------------|
| | | | | DATE | ID | | | LAB | DATA | QA | |
| Oxidation Reduction Potent | mV | 0006 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 95.7 | FQ | # | - | - |
| | mV | 0012 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | -0.7 | F | # | - | - |
| | mV | 0013 | WL | 05/13/2004 | N001 | 11.00 - 16.00 | 97 | F | # | - | - |
| | mV | 0106 | WL | 05/13/2004 | N001 | 34.00 - 39.00 | 146.5 | F | # | - | - |
| | mV | 0112 | WL | 05/13/2004 | N001 | 40.00 - 45.00 | 120.5 | F | # | - | - |
| | mV | 0113 | WL | 05/13/2004 | N001 | 41.00 - 46.00 | 148 | F | # | - | - |
| | mV | 0126 | WL | 05/13/2004 | N001 | 54.00 - 59.00 | 118.2 | F | # | - | - |
| | mV | 0127 | WL | 05/13/2004 | N001 | 94.00 - 99.00 | -44.5 | F | # | - | - |
| | mV | 0160 | WL | 05/11/2004 | N001 | 51.00 - 56.00 | 87 | F | # | - | - |
| | mV | 0161 | WL | 05/11/2004 | N001 | 93.00 - 98.00 | 105 | F | # | - | - |
| | mV | 0183 | WL | 05/13/2004 | N001 | 93.00 - 98.00 | 31.9 | F | # | - | - |
| | mV | 0188 | WL | 05/12/2004 | N001 | 53.00 - 58.00 | 152.4 | F | # | - | - |
| | mV | 0189 | WL | 05/12/2004 | N001 | 93.00 - 98.00 | -11 | FQ | # | - | - |
| pH | s.u. | 0006 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 7.07 | FQ | # | - | - |
| | s.u. | 0012 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 6.97 | F | # | - | - |
| | s.u. | 0013 | WL | 05/13/2004 | N001 | 11.00 - 16.00 | 7.40 | F | # | - | - |
| | s.u. | 0106 | WL | 05/13/2004 | N001 | 34.00 - 39.00 | 6.19 | F | # | - | - |
| | s.u. | 0112 | WL | 05/13/2004 | N001 | 40.00 - 45.00 | 6.13 | F | # | - | - |
| | s.u. | 0113 | WL | 05/13/2004 | N001 | 41.00 - 46.00 | 6.97 | F | # | - | - |
| | s.u. | 0126 | WL | 05/13/2004 | N001 | 54.00 - 59.00 | 7.23 | F | # | - | - |
| | s.u. | 0127 | WL | 05/13/2004 | N001 | 94.00 - 99.00 | 7.33 | F | # | - | - |
| | s.u. | 0160 | WL | 05/11/2004 | N001 | 51.00 - 56.00 | 6.84 | F | # | - | - |
| | s.u. | 0161 | WL | 05/11/2004 | N001 | 93.00 - 98.00 | 6.84 | F | # | - | - |
| | s.u. | 0183 | WL | 05/13/2004 | N001 | 93.00 - 98.00 | 6.79 | F | # | - | - |
| | s.u. | 0188 | WL | 05/12/2004 | N001 | 53.00 - 58.00 | 7.20 | F | # | - | - |
| | s.u. | 0189 | WL | 05/12/2004 | N001 | 93.00 - 98.00 | 6.37 | FQ | # | - | - |

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: | | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: | | DETECTION LIMIT | UN-CERTAINTY |
|----------------------|----------|-------------|---------------|------------|------------|----------------------|---------------|-------------|---------|-----------------|--------------|
| | | | | DATE | ID | | | LAB | DATA QA | | |
| Specific Conductance | umhos/cm | 0006 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 2300 | FQ | # | - | - |
| | umhos/cm | 0012 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 1446 | F | # | - | - |
| | umhos/cm | 0013 | WL | 05/13/2004 | N001 | 11.00 - 16.00 | 557 | F | # | - | - |
| | umhos/cm | 0106 | WL | 05/13/2004 | N001 | 34.00 - 39.00 | 1899 | F | # | - | - |
| | umhos/cm | 0112 | WL | 05/13/2004 | N001 | 40.00 - 45.00 | 1150 | F | # | - | - |
| | umhos/cm | 0113 | WL | 05/13/2004 | N001 | 41.00 - 46.00 | 615 | F | # | - | - |
| | umhos/cm | 0126 | WL | 05/13/2004 | N001 | 54.00 - 59.00 | 511 | F | # | - | - |
| | umhos/cm | 0127 | WL | 05/13/2004 | N001 | 94.00 - 99.00 | 1120 | F | # | - | - |
| | umhos/cm | 0160 | WL | 05/11/2004 | N001 | 51.00 - 56.00 | 840 | F | # | - | - |
| | umhos/cm | 0161 | WL | 05/11/2004 | N001 | 93.00 - 98.00 | 8255 | F | # | - | - |
| | umhos/cm | 0183 | WL | 05/13/2004 | N001 | 93.00 - 98.00 | 1138 | F | # | - | - |
| | umhos/cm | 0188 | WL | 05/12/2004 | N001 | 53.00 - 58.00 | 873 | F | # | - | - |
| | umhos/cm | 0189 | WL | 05/12/2004 | N001 | 93.00 - 98.00 | 2083 | FQ | # | - | - |
| | Sulfate | mg/L | 0006 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 1200 | FQ | # | 10 |
| mg/L | | 0012 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 580 | F | # | 10 | - |
| mg/L | | 0013 | WL | 05/13/2004 | 0001 | 11.00 - 16.00 | 41 | F | # | 2.5 | - |
| mg/L | | 0013 | WL | 05/13/2004 | 0002 | 11.00 - 16.00 | 41 | F | # | 2.5 | - |
| mg/L | | 0106 | WL | 05/13/2004 | 0001 | 34.00 - 39.00 | 1100 | F | # | 10 | - |
| mg/L | | 0112 | WL | 05/13/2004 | 0001 | 40.00 - 45.00 | 520 | F | # | 5 | - |
| mg/L | | 0113 | WL | 05/13/2004 | 0001 | 41.00 - 46.00 | 120 | F | # | 2.5 | - |
| mg/L | | 0126 | WL | 05/13/2004 | 0001 | 54.00 - 59.00 | 26 | F | # | 2.5 | - |
| mg/L | | 0127 | WL | 05/13/2004 | 0001 | 94.00 - 99.00 | 370 | F | # | 5 | - |
| mg/L | | 0160 | WL | 05/11/2004 | 0001 | 51.00 - 56.00 | 110 | F | # | 5 | - |
| mg/L | | 0161 | WL | 05/11/2004 | 0001 | 93.00 - 98.00 | 150 | F | # | 5 | - |
| mg/L | | 0183 | WL | 05/13/2004 | 0001 | 93.00 - 98.00 | 340 | F | # | 5 | - |
| mg/L | | 0188 | WL | 05/12/2004 | 0001 | 53.00 - 58.00 | 230 | F | # | 5 | - |

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: DATE | ID | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: LAB DATA QA | DETECTION LIMIT | UN-CERTAINTY |
|-------------|-------|-------------|---------------|--------------|------|----------------------|--------|-------------------------|-----------------|--------------|
| Sulfate | mg/L | 0189 | WL | 05/12/2004 | 0001 | 93.00 - 98.00 | 150 | FQ # | 10 | - |
| Temperature | C | 0006 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 9.74 | FQ # | - | - |
| | C | 0012 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 8.39 | F # | - | - |
| | C | 0013 | WL | 05/13/2004 | N001 | 11.00 - 16.00 | 7.60 | F # | - | - |
| | C | 0106 | WL | 05/13/2004 | N001 | 34.00 - 39.00 | 9.68 | F # | - | - |
| | C | 0112 | WL | 05/13/2004 | N001 | 40.00 - 45.00 | 9.24 | F # | - | - |
| | C | 0113 | WL | 05/13/2004 | N001 | 41.00 - 46.00 | 8.68 | F # | - | - |
| | C | 0126 | WL | 05/13/2004 | N001 | 54.00 - 59.00 | 6.45 | F # | - | - |
| | C | 0127 | WL | 05/13/2004 | N001 | 94.00 - 99.00 | 8.12 | F # | - | - |
| | C | 0160 | WL | 05/11/2004 | N001 | 51.00 - 56.00 | 8.46 | F # | - | - |
| | C | 0161 | WL | 05/11/2004 | N001 | 93.00 - 98.00 | 8.63 | F # | - | - |
| | C | 0183 | WL | 05/13/2004 | N001 | 93.00 - 98.00 | 8.89 | F # | - | - |
| | C | 0188 | WL | 05/12/2004 | N001 | 53.00 - 58.00 | 7.32 | F # | - | - |
| | C | 0189 | WL | 05/12/2004 | N001 | 93.00 - 98.00 | 7.10 | FQ # | - | - |
| Turbidity | NTU | 0006 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 3.81 | FQ # | - | - |
| | NTU | 0012 | WL | 05/13/2004 | N001 | 10.00 - 15.00 | 2.01 | F # | - | - |
| | NTU | 0013 | WL | 05/13/2004 | N001 | 11.00 - 16.00 | 0.48 | F # | - | - |
| | NTU | 0106 | WL | 05/13/2004 | N001 | 34.00 - 39.00 | 0.23 | F # | - | - |
| | NTU | 0112 | WL | 05/13/2004 | N001 | 40.00 - 45.00 | 0.61 | F # | - | - |
| | NTU | 0113 | WL | 05/13/2004 | N001 | 41.00 - 46.00 | 1.10 | F # | - | - |
| | NTU | 0126 | WL | 05/13/2004 | N001 | 54.00 - 59.00 | 1.89 | F # | - | - |
| | NTU | 0127 | WL | 05/13/2004 | N001 | 94.00 - 99.00 | 1.44 | F # | - | - |
| | NTU | 0160 | WL | 05/11/2004 | N001 | 51.00 - 56.00 | 9.00 | F # | - | - |
| | NTU | 0161 | WL | 05/11/2004 | N001 | 93.00 - 98.00 | 6.64 | F # | - | - |
| | NTU | 0183 | WL | 05/13/2004 | N001 | 93.00 - 98.00 | 1.20 | F # | - | - |
| | NTU | 0188 | WL | 05/12/2004 | N001 | 53.00 - 58.00 | 0.370 | F # | - | - |

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: | | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: | | | DETECTION LIMIT | UN-CERTAINTY |
|-----------|-------|-------------|---------------|------------|------|----------------------|--------|-------------|------|---------|-----------------|--------------|
| | | | | DATE | ID | | | LAB | DATA | QA | | |
| Turbidity | NTU | 0189 | WL | 05/12/2004 | N001 | 93.00 - 98.00 | 8.24 | FQ | # | - | - | |
| Uranium | mg/L | 0006 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 0.680 | FQ | # | 6.9E-05 | - | |
| | mg/L | 0012 | WL | 05/13/2004 | 0001 | 10.00 - 15.00 | 0.430 | F | # | 6.9E-05 | - | |
| | mg/L | 0013 | WL | 05/13/2004 | 0001 | 11.00 - 16.00 | 0.024 | E F | # | 6.9E-06 | - | |
| | mg/L | 0013 | WL | 05/13/2004 | 0002 | 11.00 - 16.00 | 0.024 | F | # | 6.9E-06 | - | |
| | mg/L | 0106 | WL | 05/13/2004 | 0001 | 34.00 - 39.00 | 0.0011 | F | # | 6.9E-06 | - | |
| | mg/L | 0112 | WL | 05/13/2004 | 0001 | 40.00 - 45.00 | 0.0084 | F | # | 6.9E-06 | - | |
| | mg/L | 0113 | WL | 05/13/2004 | 0001 | 41.00 - 46.00 | 0.093 | F | # | 6.9E-06 | - | |
| | mg/L | 0126 | WL | 05/13/2004 | 0001 | 54.00 - 59.00 | 0.0098 | F | # | 6.9E-06 | - | |
| | mg/L | 0127 | WL | 05/13/2004 | 0001 | 94.00 - 99.00 | 0.026 | F | # | 6.9E-06 | - | |
| | mg/L | 0160 | WL | 05/11/2004 | 0001 | 51.00 - 56.00 | 0.019 | F | # | 6.9E-06 | - | |
| | mg/L | 0161 | WL | 05/11/2004 | 0001 | 93.00 - 98.00 | 0.013 | F | # | 6.9E-06 | - | |
| | mg/L | 0183 | WL | 05/13/2004 | 0001 | 93.00 - 98.00 | 0.056 | F | # | 6.9E-06 | - | |
| | mg/L | 0188 | WL | 05/12/2004 | 0001 | 53.00 - 58.00 | 0.033 | F | # | 6.9E-06 | - | |
| | mg/L | 0189 | WL | 05/12/2004 | 0001 | 93.00 - 98.00 | 0.014 | FQ | # | 6.9E-06 | - | |

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:16 am

| PARAMETER | UNITS | LOCATION | | SAMPLE: | | DEPTH RANGE (FT BLS) | RESULT | QUALIFIERS: | | DETECTION LIMIT | UN- CERTAINTY |
|-----------|-------|----------|------|---------|----|-------------------------|--------|-------------|---------|--------------------|------------------|
| | | ID | TYPE | DATE | ID | | | LAB | DATA QA | | |

RECORDS: SELECTED FROM USEE200 WHERE site_code='GUN01' AND location_code in('0006','0012','0013','0106','0112','0113','0126','0127','0160','0161','0183','0188','0189') AND quality_assurance = TRUE AND (data_validation_qualifiers IS NULL OR data_validation_qualifiers NOT LIKE '%R%' AND data_validation_qualifiers NOT LIKE '%X%') AND DATE_SAMPLED between #5/1/2004# and #5/30/2004#

SAMPLE ID CODES: 000X = Filtered sample (0.45 µm). N00X = Unfiltered sample. X = replicate number.

LOCATION TYPES: WL WELL

LAB QUALIFIERS:

- * Replicate analysis not within control limits.
- + Correlation coefficient for MSA < 0.995.
- > Result above upper detection limit.
- A TIC is a suspected aldol-condensation product.
- B Inorganic: Result is between the IDL and CRDL. Organic: Analyte also found in method blank.
- C Pesticide result confirmed by GC-MS.
- D Analyte determined in diluted sample.
- E Inorganic: Estimate value because of interference, see case narrative. Organic: Analyte exceeded calibration range of the GC-MS.
- H Holding time expired, value suspect.
- I Increased detection limit due to required dilution.
- J Estimated
- M GFAA duplicate injection precision not met.
- N Inorganic or radiochemical: Spike sample recovery not within control limits. Organic: Tentatively identified compound (TIC).
- P > 25% difference in detected pesticide or Arochlor concentrations between 2 columns.
- S Result determined by method of standard addition (MSA).
- U Analytical result below detection limit.
- W Post-digestion spike outside control limits while sample absorbance < 50% of analytical spike absorbance.
- X Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Y Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Z Laboratory defined (USEPA CLP organic) qualifier, see case narrative.

DATA QUALIFIERS:

- | | | |
|--|--|--------------------|
| F Low flow sampling method used. | G Possible grout contamination, pH > 9. | J Estimated value. |
| L Less than 3 bore volumes purged prior to sampling. | Q Qualitative result due to sampling technique | R Unusable result. |
| U Parameter analyzed for but was not detected. | X Location is undefined. | |

QA QUALIFIER: # = validated according to Quality Assurance guidelines.

Appendix B

Ground Water Quality Data by Parameter for Domestic Wells

CLASSIC GROUND WATER QUALITY DATA BY PARAMETER WITH ZONE (USEE201) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: DATE | ID | ZONE COMPL | FLOW REL. | RESULT | QUALIFIERS: LAB DATA QA | DETECTION LIMIT | UN-CERTAINTY |
|------------------------------|-------|-------------|---------------|--------------|------|------------|-----------|---------|-------------------------|-----------------|--------------|
| Alkalinity, Total (As CaCO3) | mg/L | 0080 | WL | 05/12/2004 | N001 | NR | | 119 | # | - | - |
| | mg/L | 0081 | WL | 05/12/2004 | N001 | NR | | 149 | F # | - | - |
| | mg/L | 0082 | WL | 05/12/2004 | N001 | NR | | 226 | F # | - | - |
| | mg/L | 0468 | WL | 05/12/2004 | N001 | AL | D | 74 | F # | - | - |
| | mg/L | 0469 | WL | 05/11/2004 | N001 | AL | D | 98 | # | - | - |
| | mg/L | 0665 | WL | 05/11/2004 | N001 | AL | C | 114 | # | - | - |
| | mg/L | 0667 | WL | 05/12/2004 | N001 | AL | N | 123 | # | - | - |
| | mg/L | 0683 | WL | 05/11/2004 | N001 | NR | N | 101 | # | - | - |
| | mg/L | 0685 | WL | 05/11/2004 | N001 | NR | N | 106 | # | - | - |
| Manganese | mg/L | 0080 | WL | 05/12/2004 | N001 | NR | | 0.200 | # | 7.7E-05 | - |
| | mg/L | 0081 | WL | 05/12/2004 | N001 | NR | | 0.240 | F # | 7.7E-05 | - |
| | mg/L | 0082 | WL | 05/12/2004 | N001 | NR | | 0.200 | F # | 7.7E-05 | - |
| | mg/L | 0468 | WL | 05/12/2004 | N001 | AL | D | 0.550 | F # | 7.7E-05 | - |
| | mg/L | 0469 | WL | 05/11/2004 | N001 | AL | D | 0.014 | E # | 7.7E-05 | - |
| | mg/L | 0665 | WL | 05/11/2004 | N001 | AL | C | 0.015 | # | 7.7E-05 | - |
| | mg/L | 0667 | WL | 05/12/2004 | N001 | AL | N | 0.0014 | B # | 7.7E-05 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N001 | NR | N | 0.0014 | B # | 7.7E-05 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N002 | NR | N | 0.0014 | B # | 7.7E-05 | - |
| | mg/L | 0685 | WL | 05/11/2004 | N001 | NR | N | 0.00013 | B U # | 7.7E-05 | - |
| Oxidation Reduction Potent | mV | 0080 | WL | 05/12/2004 | N001 | NR | | -106.6 | # | - | - |
| | mV | 0081 | WL | 05/12/2004 | N001 | NR | | -202.3 | F # | - | - |
| | mV | 0082 | WL | 05/12/2004 | N001 | NR | | -241.2 | F # | - | - |
| | mV | 0468 | WL | 05/12/2004 | N001 | AL | D | -319.4 | F # | - | - |
| | mV | 0469 | WL | 05/11/2004 | N001 | AL | D | 84 | # | - | - |
| | mV | 0665 | WL | 05/11/2004 | N001 | AL | C | 92 | # | - | - |
| | mV | 0667 | WL | 05/12/2004 | N001 | AL | N | 143.5 | # | - | - |

CLASSIC GROUND WATER QUALITY DATA BY PARAMETER WITH ZONE (USEE201) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: | | ZONE COMPL | FLOW REL. | RESULT | QUALIFIERS: | | | DETECTION LIMIT | UN-CERTAINTY |
|----------------------------|----------|-------------|---------------|------------|------|------------|-----------|--------|-------------|------|----|-----------------|--------------|
| | | | | DATE | ID | | | | LAB | DATA | QA | | |
| Oxidation Reduction Potent | mV | 0683 | WL | 05/11/2004 | N001 | NR | N | 112 | | | # | - | - |
| | mV | 0685 | WL | 05/11/2004 | N001 | NR | N | 28 | | | # | - | - |
| pH | s.u. | 0080 | WL | 05/12/2004 | N001 | NR | | 7.43 | | | # | - | - |
| | s.u. | 0081 | WL | 05/12/2004 | N001 | NR | | 7.66 | F | | # | - | - |
| | s.u. | 0082 | WL | 05/12/2004 | N001 | NR | | 7.89 | F | | # | - | - |
| | s.u. | 0468 | WL | 05/12/2004 | N001 | AL | D | 8.71 | F | | # | - | - |
| | s.u. | 0469 | WL | 05/11/2004 | N001 | AL | D | 7.20 | | | # | - | - |
| | s.u. | 0665 | WL | 05/11/2004 | N001 | AL | C | 7.33 | | | # | - | - |
| | s.u. | 0667 | WL | 05/12/2004 | N001 | AL | N | 7.25 | | | # | - | - |
| | s.u. | 0683 | WL | 05/11/2004 | N001 | NR | N | 7.53 | | | # | - | - |
| | s.u. | 0685 | WL | 05/11/2004 | N001 | NR | N | 7.46 | | | # | - | - |
| Specific Conductance | umhos/cm | 0080 | WL | 05/12/2004 | N001 | NR | | 489 | | | # | - | - |
| | umhos/cm | 0081 | WL | 05/12/2004 | N001 | NR | | 513 | F | | # | - | - |
| | umhos/cm | 0082 | WL | 05/12/2004 | N001 | NR | | 524 | F | | # | - | - |
| | umhos/cm | 0468 | WL | 05/12/2004 | N001 | AL | D | 329 | F | | # | - | - |
| | umhos/cm | 0469 | WL | 05/11/2004 | N001 | AL | D | 378 | | | # | - | - |
| | umhos/cm | 0665 | WL | 05/11/2004 | N001 | AL | C | 350 | | | # | - | - |
| | umhos/cm | 0667 | WL | 05/12/2004 | N001 | AL | N | 310 | | | # | - | - |
| | umhos/cm | 0683 | WL | 05/11/2004 | N001 | NR | N | 328 | | | # | - | - |
| | umhos/cm | 0685 | WL | 05/11/2004 | N001 | NR | N | 345 | | | # | - | - |
| Sulfate | mg/L | 0080 | WL | 05/12/2004 | N001 | NR | | 19 | | | # | 0.5 | - |
| | mg/L | 0081 | WL | 05/12/2004 | N001 | NR | | 12 | F | | # | 0.5 | - |
| | mg/L | 0082 | WL | 05/12/2004 | N001 | NR | | 18 | F | | # | 2.5 | - |
| | mg/L | 0468 | WL | 05/12/2004 | N001 | AL | D | 76 | F | | # | 0.5 | - |
| | mg/L | 0469 | WL | 05/11/2004 | N001 | AL | D | 28 | | | # | 2.5 | - |
| | mg/L | 0665 | WL | 05/11/2004 | N001 | AL | C | 25 | | | # | 2.5 | - |

CLASSIC GROUND WATER QUALITY DATA BY PARAMETER WITH ZONE (USEE201) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: | | ZONE COMPL | FLOW REL. | RESULT | QUALIFIERS: | | | DETECTION LIMIT | UN-CERTAINTY |
|-------------|-------|-------------|---------------|------------|------|------------|-----------|--------|-------------|------|----|-----------------|--------------|
| | | | | DATE | ID | | | | LAB | DATA | QA | | |
| Sulfate | mg/L | 0667 | WL | 05/12/2004 | N001 | AL | N | 26 | | | # | 2.5 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N001 | NR | N | 25 | | | # | 2.5 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N002 | NR | N | 26 | | | # | 2.5 | - |
| | mg/L | 0685 | WL | 05/11/2004 | N001 | NR | N | 26 | | | # | 2.5 | - |
| Temperature | C | 0080 | WL | 05/12/2004 | N001 | NR | | 9.75 | | | # | - | - |
| | C | 0081 | WL | 05/12/2004 | N001 | NR | | 10.26 | F | | # | - | - |
| | C | 0082 | WL | 05/12/2004 | N001 | NR | | 7.84 | F | | # | - | - |
| | C | 0468 | WL | 05/12/2004 | N001 | AL | D | 5.82 | F | | # | - | - |
| | C | 0469 | WL | 05/11/2004 | N001 | AL | D | 10.39 | | | # | - | - |
| | C | 0665 | WL | 05/11/2004 | N001 | AL | C | 8.39 | | | # | - | - |
| | C | 0667 | WL | 05/12/2004 | N001 | AL | N | 7.93 | | | # | - | - |
| | C | 0683 | WL | 05/11/2004 | N001 | NR | N | 10.33 | | | # | - | - |
| | C | 0685 | WL | 05/11/2004 | N001 | NR | N | 18.36 | | | # | - | - |
| Turbidity | NTU | 0080 | WL | 05/12/2004 | N001 | NR | | 2.60 | | | # | - | - |
| | NTU | 0081 | WL | 05/12/2004 | N001 | NR | | 45.3 | F | | # | - | - |
| | NTU | 0082 | WL | 05/12/2004 | N001 | NR | | 131 | F | | # | - | - |
| | NTU | 0468 | WL | 05/12/2004 | N001 | AL | D | 52.8 | F | | # | - | - |
| | NTU | 0469 | WL | 05/11/2004 | N001 | AL | D | 3.88 | | | # | - | - |
| | NTU | 0665 | WL | 05/11/2004 | N001 | AL | C | 0.86 | | | # | - | - |
| | NTU | 0667 | WL | 05/12/2004 | N001 | AL | N | 3.96 | | | # | - | - |
| | NTU | 0683 | WL | 05/11/2004 | N001 | NR | N | 0.53 | | | # | - | - |
| | NTU | 0685 | WL | 05/11/2004 | N001 | NR | N | 0.59 | | | # | - | - |
| Uranium | mg/L | 0080 | WL | 05/12/2004 | N001 | NR | | 0.0045 | | | # | 6.9E-06 | - |
| | mg/L | 0081 | WL | 05/12/2004 | N001 | NR | | 0.0037 | F | | # | 6.9E-06 | - |
| | mg/L | 0082 | WL | 05/12/2004 | N001 | NR | | 0.014 | F | | # | 6.9E-06 | - |
| | mg/L | 0468 | WL | 05/12/2004 | N001 | AL | D | 0.0032 | F | | # | 6.9E-06 | - |

CLASSIC GROUND WATER QUALITY DATA BY PARAMETER WITH ZONE (USEE201) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: DATE | ID | ZONE COMPL | FLOW REL. | RESULT | QUALIFIERS: LAB DATA QA | DETECTION LIMIT | UN-CERTAINTY |
|-----------|-------|-------------|---------------|--------------|------|------------|-----------|--------|-------------------------|-----------------|--------------|
| Uranium | mg/L | 0469 | WL | 05/11/2004 | N001 | AL | D | 0.0018 | E # | 6.9E-06 | - |
| | mg/L | 0665 | WL | 05/11/2004 | N001 | AL | C | 0.0028 | # | 6.9E-06 | - |
| | mg/L | 0667 | WL | 05/12/2004 | N001 | AL | N | 0.0024 | # | 6.9E-06 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N001 | NR | N | 0.0014 | # | 6.9E-06 | - |
| | mg/L | 0683 | WL | 05/11/2004 | N002 | NR | N | 0.0015 | # | 6.9E-06 | - |
| | mg/L | 0685 | WL | 05/11/2004 | N001 | NR | N | 0.0013 | # | 6.9E-06 | - |

CLASSIC GROUND WATER QUALITY DATA BY PARAMETER WITH ZONE (USEE201) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | LOCATION TYPE | SAMPLE: DATE | ZONE COMPL | FLOW REL. | QUALIFIERS: LAB DATA QA | DETECTION LIMIT | UN-CERTAINTY |
|-----------|-------|-------------|---------------|--------------|------------|-----------|-------------------------|-----------------|--------------|
|-----------|-------|-------------|---------------|--------------|------------|-----------|-------------------------|-----------------|--------------|

RECORDS: SELECTED FROM USEE200 WHERE site_code='GUN01' AND location_code in ('0080','0081','0082','0468','0469','0665','0667','0683','0685') AND quality_assurance = TRUE AND (data_validation_qualifiers IS NULL OR data_validation_qualifiers NOT LIKE '%R%' AND data_validation_qualifiers NOT LIKE '%X%') AND DATE_SAMPLED between #5/1/2004# and #5/30/2004#

SAMPLE ID CODES: 000X = Filtered sample (0.45 µm). N00X = Unfiltered sample. X = replicate number.

LOCATION TYPES: WL WELL

ZONES OF COMPLETION:

AL ALLUVIUM

NR NO RECOVERY OF DATA FOR CLASSIFYING

FLOW CODES: C CROSS GRADIENT D DOWN GRADIENT N UNKNOWN

LAB QUALIFIERS:

- * Replicate analysis not within control limits.
- + Correlation coefficient for MSA < 0.995.
- > Result above upper detection limit.
- A TIC is a suspected aldol-condensation product.
- B Inorganic: Result is between the IDL and CRDL. Organic: Analyte also found in method blank.
- C Pesticide result confirmed by GC-MS.
- D Analyte determined in diluted sample.
- E Inorganic: Estimate value because of interference, see case narrative. Organic: Analyte exceeded calibration range of the GC-MS.
- H Holding time expired, value suspect.
- I Increased detection limit due to required dilution.
- J Estimated
- M GFAA duplicate injection precision not met.
- N Inorganic or radiochemical: Spike sample recovery not within control limits. Organic: Tentatively identified compound (TIC).
- P > 25% difference in detected pesticide or Arochlor concentrations between 2 columns.
- S Result determined by method of standard addition (MSA).
- U Analytical result below detection limit.
- W Post-digestion spike outside control limits while sample absorbance < 50% of analytical spike absorbance.
- X Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Y Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Z Laboratory defined (USEPA CLP organic) qualifier, see case narrative.

DATA QUALIFIERS:

- | | | |
|--|--|--------------------|
| F Low flow sampling method used. | G Possible grout contamination, pH > 9. | J Estimated value. |
| L Less than 3 bore volumes purged prior to sampling. | Q Qualitative result due to sampling technique | R Unusable result. |
| U Parameter analyzed for but was not detected. | X Location is undefined. | |

QA QUALIFIER: # = validated according to Quality Assurance guidelines.

Appendix C

Surface Water Quality Data by Parameter

SURFACE WATER QUALITY DATA BY PARAMETER (USEE800) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | SAMPLE: | | RESULT | QUALIFIERS: | | DETECTION LIMIT | UN- CERTAINTY |
|-----------------------------|----------|----------------|------------|------|---------|-------------|---------|--------------------|------------------|
| | | | DATE | ID | | LAB | DATA QA | | |
| Alkalinity, Total (As CaCO3 | mg/L | 0248 | 05/12/2004 | 0001 | 98 | | # | - | - |
| | mg/L | 0777 | 05/12/2004 | 0001 | 117 | | # | - | - |
| | mg/L | 0780 | 05/13/2004 | 0001 | 158 | | # | - | - |
| | mg/L | 0792 | 05/11/2004 | 0001 | 64 | | # | - | - |
| | mg/L | 0795 | 05/11/2004 | 0001 | 67 | | # | - | - |
| Manganese | mg/L | 0248 | 05/12/2004 | 0001 | 0.043 | | # | 7.7E-05 | - |
| | mg/L | 0777 | 05/12/2004 | 0001 | 0.053 | | # | 7.7E-05 | - |
| | mg/L | 0780 | 05/13/2004 | 0001 | 0.062 | | # | 7.7E-05 | - |
| | mg/L | 0792 | 05/11/2004 | 0001 | 0.011 | | # | 7.7E-05 | - |
| | mg/L | 0795 | 05/11/2004 | 0001 | 0.011 E | | # | 7.7E-05 | - |
| Oxidation Reduction Potent | mV | 0248 | 05/12/2004 | N001 | -72.5 | | # | - | - |
| | mV | 0777 | 05/12/2004 | N001 | -13.0 | | # | - | - |
| | mV | 0780 | 05/13/2004 | N001 | 105.6 | | # | - | - |
| | mV | 0792 | 05/11/2004 | N001 | 126 | | # | - | - |
| | mV | 0795 | 05/11/2004 | N001 | 181 | | # | - | - |
| pH | s.u. | 0248 | 05/12/2004 | N001 | 8.21 | | # | - | - |
| | s.u. | 0777 | 05/12/2004 | N001 | 7.87 | | # | - | - |
| | s.u. | 0780 | 05/13/2004 | N001 | 7.99 | | # | - | - |
| | s.u. | 0792 | 05/11/2004 | N001 | 8.51 | | # | - | - |
| | s.u. | 0795 | 05/11/2004 | N001 | 8.49 | | # | - | - |
| Specific Conductance | umhos/cm | 0248 | 05/12/2004 | N001 | 292 | | # | - | - |
| | umhos/cm | 0777 | 05/12/2004 | N001 | 344 | | # | - | - |
| | umhos/cm | 0780 | 05/13/2004 | N001 | 665 | | # | - | - |
| | umhos/cm | 0792 | 05/11/2004 | N001 | 265 | | # | - | - |
| | umhos/cm | 0795 | 05/11/2004 | N001 | 247 | | # | - | - |
| Sulfate | mg/L | 0248 | 05/12/2004 | 0001 | 24 | | # | 0.5 | - |
| | mg/L | 0777 | 05/12/2004 | 0001 | 25 | | # | 0.5 | - |
| | mg/L | 0780 | 05/13/2004 | 0001 | 160 | | # | 2.5 | - |
| | mg/L | 0792 | 05/11/2004 | 0001 | 14 | | # | 0.5 | - |
| | mg/L | 0795 | 05/11/2004 | 0001 | 14 | | # | 0.5 | - |
| Temperature | C | 0248 | 05/12/2004 | N001 | 9.84 | | # | - | - |
| | C | 0777 | 05/12/2004 | N001 | 9.03 | | # | - | - |
| | C | 0780 | 05/13/2004 | N001 | 12.28 | | # | - | - |
| | C | 0792 | 05/11/2004 | N001 | 12.26 | | # | - | - |
| | C | 0795 | 05/11/2004 | N001 | 11.49 | | # | - | - |
| Turbidity | NTU | 0248 | 05/12/2004 | N001 | 21.7 | | # | - | - |
| | NTU | 0777 | 05/12/2004 | N001 | 18.7 | | # | - | - |

SURFACE WATER QUALITY DATA BY PARAMETER (USEE800) FOR SITE GUN01, Gunnison Processing Site
 REPORT DATE: 9/13/2004 11:31 am

| PARAMETER | UNITS | LOCATION ID | SAMPLE: | | RESULT | QUALIFIERS: | | DETECTION LIMIT | UN-CERTAINTY |
|-----------|-------|-------------|------------|------|--------|-------------|----|-----------------|--------------|
| | | | DATE | ID | | LAB DATA | QA | | |
| Turbidity | NTU | 0780 | 05/13/2004 | N001 | 25.9 | | # | - | - |
| | NTU | 0792 | 05/11/2004 | N001 | 13.4 | | # | - | - |
| | NTU | 0795 | 05/11/2004 | N001 | 14.6 | | # | - | - |
| Uranium | mg/L | 0248 | 05/12/2004 | 0001 | 0.0027 | | # | 6.9E-06 | - |
| | mg/L | 0777 | 05/12/2004 | 0001 | 0.0028 | | # | 6.9E-06 | - |
| | mg/L | 0780 | 05/13/2004 | 0001 | 0.044 | | # | 6.9E-06 | - |
| | mg/L | 0792 | 05/11/2004 | 0001 | 0.0003 | | # | 6.9E-06 | - |
| | mg/L | 0795 | 05/11/2004 | 0001 | 0.0003 | | # | 6.9E-06 | - |

RECORDS: SELECTED FROM USEE800 WHERE site_code='GUN01' AND quality_assurance = TRUE AND (data_validation_qualifiers IS NULL OR data_validation_qualifiers NOT LIKE '%R%' AND data_validation_qualifiers NOT LIKE '%X%') AND DATE_SAMPLED between #5/1/2004# and #5/30/2004#

SAMPLE ID CODES: 000X = Filtered sample (0.45 µm). N00X = Unfiltered sample. X = replicate number.

LAB QUALIFIERS:

- Replicate analysis not within control limits.
- + Correlation coefficient for MSA < 0.995.
- > Result above upper detection limit.
- A TIC is a suspected aldol-condensation product.
- B Inorganic: Result is between the IDL and CRDL. Organic: Analyte also found in method blank.
- C Pesticide result confirmed by GC-MS.
- D Analyte determined in diluted sample.
- E Inorganic: Estimate value because of interference, see case narrative. Organic: Analyte exceeded calibration range of the GC-MS.
- H Holding time expired, value suspect.
- I Increased detection limit due to required dilution.
- J Estimated
- M GFAA duplicate injection precision not met.
- N Inorganic or radiochemical: Spike sample recovery not within control limits. Organic: Tentatively identified compound (TIC).
- P > 25% difference in detected pesticide or Arochlor concentrations between 2 columns.
- S Result determined by method of standard addition (MSA).
- U Analytical result below detection limit.
- W Post-digestion spike outside control limits while sample absorbance < 50% of analytical spike absorbance.
- X Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Y Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Z Laboratory defined (USEPA CLP organic) qualifier, see case narrative.

DATA QUALIFIERS:

- F Low flow sampling method used.
- J Estimated value.
- Q Qualitative result due to sampling technique
- U Parameter analyzed for but was not detected.
- G Possible grout contamination, pH > 9.
- L Less than 3 bore volumes purged prior to sampling.
- R Unusable result.
- X Location is undefined.

QA QUALIFIER: # = validated according to Quality Assurance guidelines.