



Department of Energy
Office of Legacy Management

JUN 23 2008

Ms. Wendy Naugle
Colorado Department of Public Health and Environment
Remedial Programs Section
Hazardous Materials & Waste Management Division
4300 Cherry Creek Drive South
Denver, CO 80246-1530

Subject: Transmittal of the *Verification Monitoring Report for the Slick Rock, Colorado, Processing Sites*

Dear Ms. Naugle:

Enclosed for your review is a copy of the *Verification Monitoring Report for the Slick Rock, Colorado, Processing Sites*. This report presents the data results of the sampling event conducted at the Slick Rock sites during September 2007 and evaluates the status of the site's compliance strategy.

Contaminant concentrations at the Slick Rock East (SRE) site have been decreasing in recent years. The spike in uranium concentrations noted in various wells at the SRE site during the 2005 sampling event has decreased during the last two sampling rounds and are expected to continue decreasing in the future as additional flushing occurs.

Similar conditions have been noted at the Slick Rock West (SRW) site; however, contaminant concentrations at well 0318 have been sporadic during the last three sampling rounds. Selenium concentrations have increased continuously and are now three times higher than they were in 2004, and molybdenum concentrations have bounced to levels nearly eight times higher than were seen in 2004.

Results for surface water samples collected from the Dolores River adjacent to and downstream from the sites indicate that the sites are having no measurable effect on the river's water quality.

Please contact me at (970) 248-6073 if you have any questions.

Sincerely,

Richard P. Bush
Site Manager

Enclosure

2597 B 3/4 Road, Grand Junction, CO 81503	<input type="checkbox"/>	3600 Collins Ferry Road, Morgantown, WV 26505
626 Cochran's Mill Road, P.O. Box 10940, Pittsburgh, PA 15236	<input type="checkbox"/>	1000 Independence Ave., S.W., Washington, DC 20585
11025 Dover St., Suite 1000, Westminster, CO 80021	<input type="checkbox"/>	10995 Hamilton-Cleves Highway, Harrison, OH 45030
955 Mound Road, Miamisburg, OH 45342	<input type="checkbox"/>	232 Energy Way, N. Las Vegas, NV 89030

REPLY TO: Grand Junction Office

cc w/enclosure:

B. von Till, NRC

C. Crocker-Bedford

J. Dufficy

cc w/o enclosure:

C. Carpenter, Stoller (e)

E Cotter, Stoller (e)

File SRE 410.02 (Roberts)

Bush/6-19-08 Slick Rock VMR Sept 2007.doc



Verification Monitoring Report for the Slick Rock, Colorado, Processing Sites, 2007 Update

June 2008



U.S. Department
of Energy

Office of Legacy Management

*Work Performed Under DOE Contract No. DE-AM01-07LM00060
for the U.S. Department of Energy Office of Legacy Management.
Approved for public release; distribution is unlimited.*

Office of Legacy Management

**Verification Monitoring Report for the Slick Rock, Colorado,
Processing Sites**

2007 Update

June 2008

Work Performed by S.M. Stoller Corporation under DOE Contract No: DE-AM01-07LM00060
for the U.S. Department of Energy Office of Legacy Management, Grand Junction, Colorado

Contents

1.0	Introduction	1
1.1	Purpose of Report	1
1.2	Compliance Strategy	1
2.0	Site Conditions	4
2.1	Hydrogeology	4
2.2	Groundwater Quality	4
2.2.1	SRE Site	4
2.2.2	SRW Site	4
2.3	Surface Water Quality	5
2.4	Remediation Activities	5
2.5	Land and Water Use	5
3.0	Monitoring Program	6
3.1	Monitoring Network	6
3.2	Results of Monitoring Program	6
3.2.1	SRE Site	10
3.2.2	SRW Site	12
3.3	Surface Water	16
4.0	Conclusions	17
4.1	Status of Site Compliance	17
4.2	Recommendations	17
5.0	References	17

Figures

Figure 1.	Slick Rock, Colorado, Processing Sites Location Map	2
Figure 2.	Aerial Photograph of the Slick Rock, Colorado, Processing Sites	3
Figure 3.	Groundwater and Surface Water Monitoring Locations at the SRE Site	7
Figure 4.	Groundwater and Surface Water Monitoring Locations at the SRW Site	8
Figure 5.	Uranium Concentrations Versus Time in the Middle of the SRE Site	10
Figure 6.	Uranium Concentrations Versus Time in the Downgradient Portion of the SRE Site	11
Figure 7.	Uranium Concentrations in Well 0305 Versus Groundwater Model Predictions at the SRE Site	11
Figure 8.	Selenium Concentrations Versus Time at the SRW Site	13
Figure 9.	Nitrate Concentrations Versus Time at the SRW Site	13
Figure 10.	Molybdenum Concentrations Versus Time at the SRW Site	14
Figure 11.	Predicted Nitrate Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site	15
Figure 12.	Predicted Molybdenum Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site	15
Figure 13.	Selenium Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site	16

Tables

Table 1. Monitoring Program at the SRE Site	9
Table 2. Monitoring Program at the SRW Site.....	9
Table 3. Comparison of COPC Concentrations in the Alluvial Aquifer to Benchmark Values..	12
Table 4. Comparison of COPC Concentrations in the Dolores River to CDPHE Benchmarks ..	16

Appendixes

Appendix A—Groundwater Quality Data by Parameter
Appendix B—Surface Water Quality Data by Parameter
Appendix C—Hydrographs and Static Water Level Data

1.0 Introduction

The Slick Rock, Colorado, Processing sites consist of two former uranium-ore processing facilities, which are referred to as the Slick Rock East (SRE) site (formerly the North Continent site) and the Slick Rock West (SRW) site (formerly the Union Carbide site). The Slick Rock sites are located along the banks of the Dolores River in San Miguel County, Colorado (Figure 1). Steep, juniper-covered hillsides and cliffs of the Dolores River Canyon surround the sites. The SRW site is approximately 1 mile downstream from the SRE site (Figure 2). Surface remediation of the two sites was completed in 1996; mill tailings and other residual radioactive materials were disposed of in a cell located approximately 5 miles east of the processing sites.

1.1 Purpose of Report

The purpose of this verification monitoring report is to evaluate groundwater and surface water monitoring data collected at the Slick Rock, Colorado, processing sites since 2000 and assess the status of the compliance strategy for groundwater cleanup.

1.2 Compliance Strategy

The proposed compliance strategy for the Slick Rock sites is natural flushing in conjunction with institutional controls and compliance monitoring as stated in the *Draft Final Groundwater Compliance Action Plan for the Slick Rock, Colorado, UMTRA Project Sites* (GCAP) (DOE 2006). Except for manganese and selenium, constituents of potential concern (COPC) concentrations at the Slick Rock sites will be compared to their respective maximum concentration limit (MCL) to assess compliance with Title 40, *Code of Federal Regulations*, Part 192 (40 CFR 192). Because manganese does not have an MCL, manganese concentrations will be compared to the maximum background concentration (3.5 milligrams per liter [mg/L]) to assess compliance. Groundwater modeling predicts that selenium concentrations at the SRW site will not be reduced to below the MCL within 100 years; therefore, a human-health risk-based alternate concentration limit (ACL) of 0.18 mg/L is proposed in the GCAP for selenium. Groundwater modeling predicts that natural flushing will be completed within the 100-year regulatory time frame. Public health will be protected during the natural flushing process through institutional controls, which will restrict access to contaminated alluvial groundwater. The institutional controls that will be used for the Slick Rock sites are environmental covenants between the State of Colorado, represented by the Colorado Department of Public Health and Environment (CDPHE), and the landowner, Umetco Minerals Corporation (Umetco). Umetco and CDPHE are finalizing the respective environmental covenants. In 2005, a draft version of the GCAP was reviewed by the U.S. Nuclear Regulatory Commission (NRC), which requested that additional information be provided for clarification of several issues. That information has been compiled and forwarded to DOE for review and transmittal to NRC. The draft final GCAP was revised accordingly.

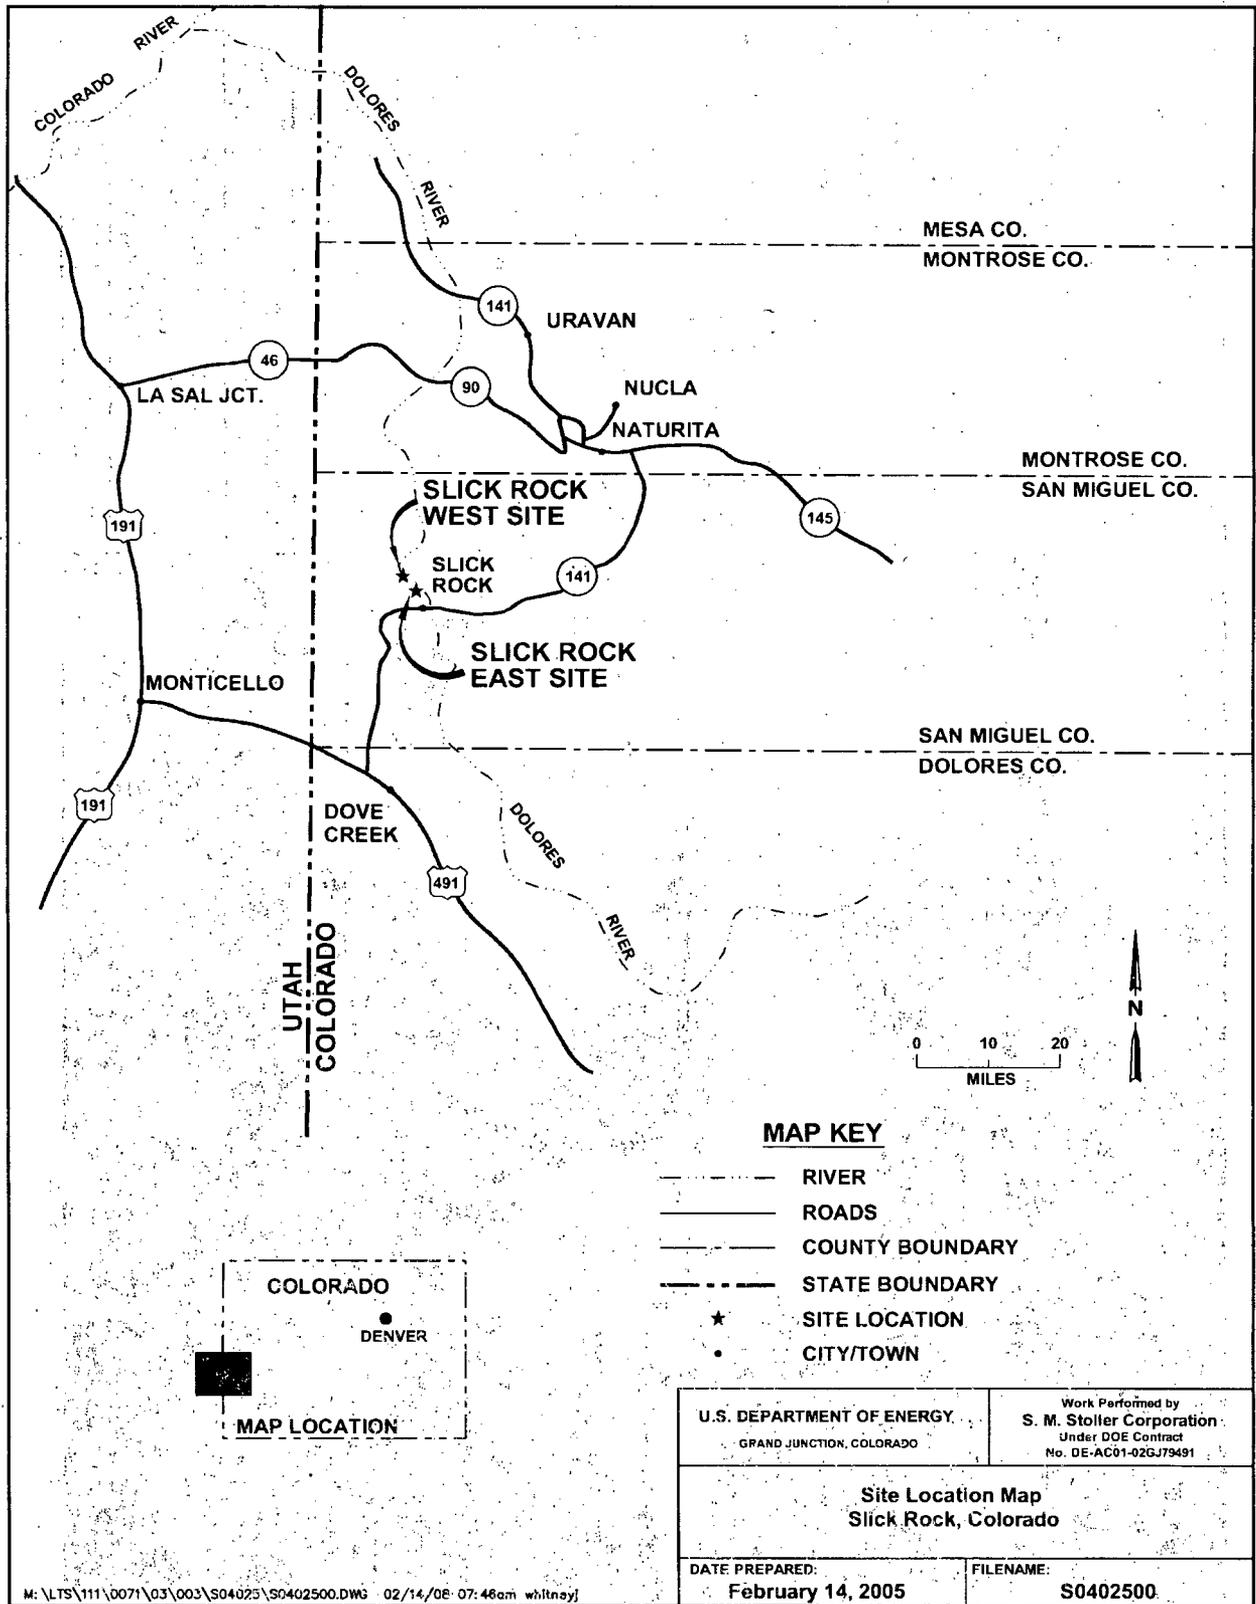


Figure 1. Slick Rock, Colorado, Processing Sites Location Map

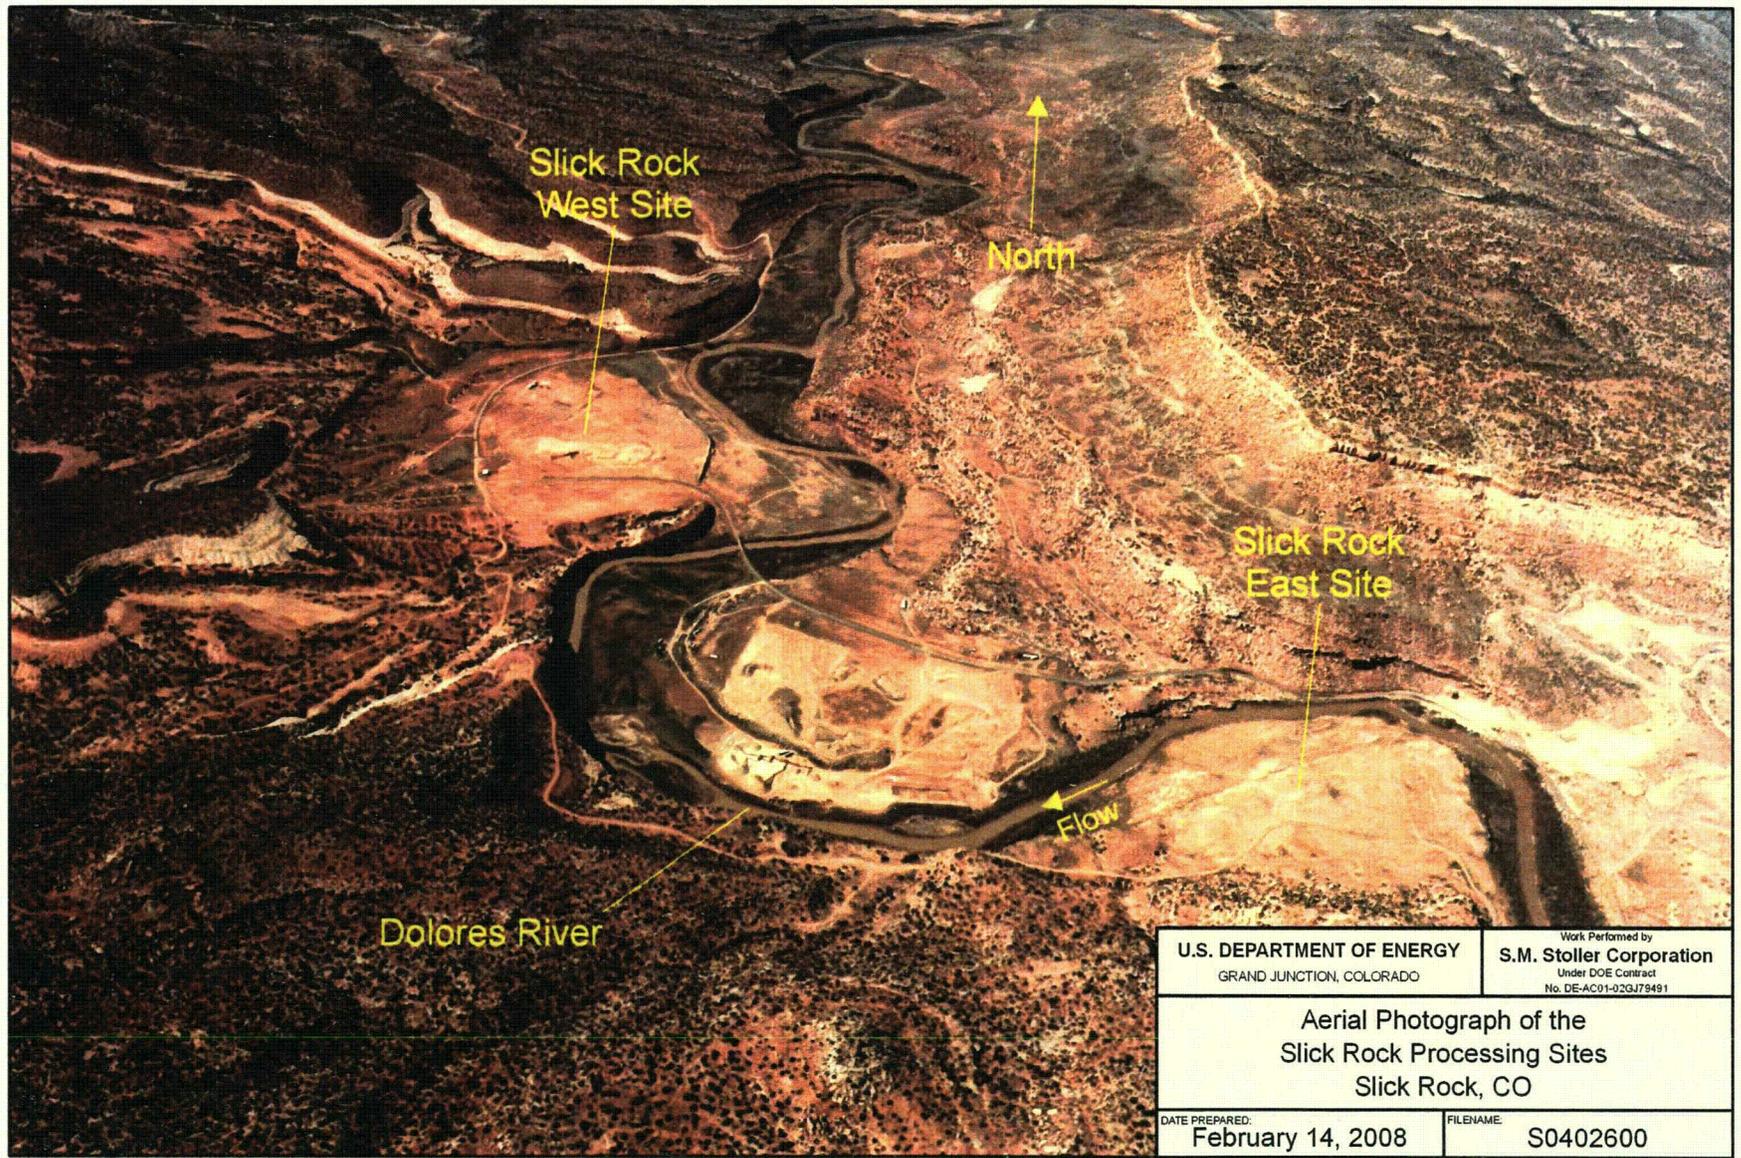


Figure 2. Aerial Photograph of the Slick Rock, Colorado, Processing Sites

2.0 Site Conditions

2.1 Hydrogeology

The Slick Rock sites overlie an alluvial aquifer deposited by the Dolores River. The alluvial aquifer consists of unconsolidated material ranging in thickness from 15 to 20 feet (ft) and consists primarily of silty sands and silty sandy gravels with an occasional interbedded clay lens.

The Dolores River alluvium is laterally restricted by bedrock that forms the terraces and canyon walls adjacent to the Dolores River. In addition, the Dolores River floodplain is discontinuous and pinches out in areas where the Dolores River meets the canyon wall. Depth to groundwater in the unconfined alluvial aquifer ranges from 7 to 15 ft below ground surface (bgs).

The Salt Wash Member of the Jurassic Morrison Formation and the Jurassic Summerville Formation underlie the Quaternary Dolores River alluvium at the SRE site. Because the Morrison Formation and the Summerville Formation have an abundance of fine-grained, low-permeability units, these formations are considered aquitards at the SRE site (DOE 2002).

The hydrostratigraphic units at the SRW site are, in descending stratigraphic order, the Quaternary Dolores River alluvium (the uppermost aquifer), the Jurassic Entrada Sandstone, and the Jurassic Navajo Sandstone. The Entrada Sandstone ranges from 40 to 60 ft thick in the floodplain area, with depths to groundwater ranging from 6 to 8 ft bgs. The thickness of the Navajo Sandstone is approximately 180 ft in the Slick Rock area (DOE 2002). Wells completed in the Navajo Sandstone and located on the floodplain at the SRW site have an upward vertical gradient with respect to the alluvial aquifer and the Entrada Sandstone; therefore, contamination in the alluvial aquifer will not cross-contaminate the Navajo Sandstone aquifer.

The Dolores River alluvium is the only unit affected by site-related contamination and is therefore the primary subject of this verification monitoring report. Groundwater flow direction in the alluvial aquifer generally follows the downstream direction of the Dolores River.

2.2 Groundwater Quality

2.2.1 SRE Site

Alluvial groundwater beneath the SRE site was contaminated as a result of former uranium processing activities. COPC in the uppermost (alluvial) aquifer at the SRE site are selenium and uranium (DOE 2002). Uranium concentrations in the alluvial aquifer are up to two orders of magnitude greater than the MCL of 0.044 mg/L established by the U.S. Environmental Protection Agency (EPA) at 40 CFR 192. Elevated selenium at the SRE site is confined to one well (0305) and is not considered a major contaminant at the SRE site. While concentrations at this well are about twice the UMTRA groundwater standard of 0.01 mg/L, they are well below the primary drinking water standard of 0.05 mg/L.

2.2.2 SRW Site

The former uranium processing activities also contaminated the groundwater beneath the SRW site. COPC in the uppermost (alluvial) aquifer at the SRW site include manganese, molybdenum, nitrate, selenium, uranium, radium-226, radium-228, benzene, and toluene. All of

these COPC have been found in concentrations greater than the MCL or background concentrations (in the case of manganese) in the alluvial aquifer. Contaminant plumes in the alluvial aquifer are all contained on site. The radium-226, radium-228, benzene, and toluene contamination is isolated to one well (0319); radium 226+228 concentration dropped below the MCL in 2005 but rose slightly higher than the MCL in 2006; concentrations remained near the MCL in 2007. Manganese concentrations tend to be near background levels. The most pervasive contaminants in the alluvial aquifer are molybdenum, nitrate, selenium, and uranium, with concentrations as high as two orders of magnitude greater than their respective MCLs.

Samples from wells completed in the Entrada Sandstone on the floodplain at the SRW site have contained elevated concentrations of COPC. Historically, concentrations of molybdenum (well 0317), nitrate (well 0324), and selenium (well 0324) exceeded their respective MCLs.

These concentrations are thought to be a product of drilling and installing monitor wells through the contaminated alluvial aquifer. This theory is supported by hydrologic data that indicate there is slight upward vertical gradient between the alluvial and Entrada aquifers and that the hydraulic conductivity in the alluvial aquifer is two orders of magnitude greater than the Entrada aquifer. These hydrologic conditions should inhibit groundwater from flowing vertically downward into the Entrada aquifer. Sampling of well 0324 was discontinued in 2004 because the nitrate and selenium concentrations were below the MCLs for three consecutive rounds of sampling.

Results of the 2007 groundwater monitoring program are provided in Appendix A.

2.3 Surface Water Quality

The Dolores River is the only perennial surface water feature in the vicinity of the Slick Rock sites. Results from surface-water sampling have demonstrated minimal impact to the Dolores River from site contamination. Concentrations of COPC in samples collected from the Dolores River have not exceeded their respective CDPHE water-quality benchmark (CDPHE 1998).

Results of the 2007 surface water monitoring program are provided in Appendix B.

2.4 Remediation Activities

Surface remediation at the Slick Rock sites commenced in 1995 and was completed in 1996. Abandoned uranium mill tailings and other contaminated surface residual radioactive material associated with the former milling operations were relocated to the Slick Rock Disposal Cell (formerly the Burro Canyon disposal cell), approximately 5 miles east of the Slick Rock sites. The sites were regraded with on-site material, and subsequent revegetation efforts have been deemed successful.

2.5 Land and Water Use

The SRE and SRW sites are currently owned by Umetco. The SRE site is not fenced and is currently used for livestock grazing. The majority of the SRW site is enclosed with a barbed-wire fence. Land between the two sites is privately owned. Land use between the two sites includes irrigated alfalfa fields, livestock grazing, and gravel mining operations. Water used to irrigate the alfalfa is pumped from the Dolores River.

There is no current use of alluvial groundwater beneath the former processing sites. Historically, a hand-dug alluvial well located between the two sites was used as a domestic source, but the well is no longer used. Recent water level measurements show the well is dry.

Groundwater use from the Entrada Sandstone in the area near the sites is limited. Water from the Entrada Sandstone is used to water livestock via a "collector system" located northwest and upgradient of the SRW site. The collector system consists of a plastic pipe installed into the cliff face formed by the Entrada Sandstone. Water discharges from the pipe into a stock tank at a rate of approximately 1 liter per minute.

Groundwater used in the Slick Rock area is primarily supplied by the Navajo Sandstone aquifer. Currently, domestic wells completed in the Navajo Sandstone provide water to three residences and their livestock. At least one of these wells, located between the two sites, has been monitored periodically since 1986 (DOE 2002); no evidence of site-related contamination has been detected. Historically, wells completed in the Navajo Sandstone provided water for the milling operations and for the mill community at the SRW site.

3.0 Monitoring Program

3.1 Monitoring Network

Monitoring is to be performed annually for the first 10 years after NRC concurrence with the GCAP to ascertain that natural flushing is progressing as predicted by groundwater flow and transport modeling (DOE 2006). After 10 years, the monitoring frequency will decrease to every 5 years.

At the SRE site, the monitoring network consists of seven monitor wells and three surface water locations (Figure 3 and Table 1). Two monitoring wells (0310 and 0312) and one surface water location (0700) were added to the sampling scheme in 2005 in an effort to better delineate the extent of contamination seen at and adjacent to well 0311. These locations will be sampled for the next several rounds of sampling to collect the data needed to assess the contaminant behavior.

At the SRW site, the monitoring network consists of seven monitor wells and four surface water locations (Figure 4 and Table 2). Monitoring is to be conducted until analytical data demonstrate that groundwater contaminants in the alluvial aquifer have decreased to acceptable levels (MCLs, ACLs, or background).

3.2 Results of Monitoring Program

Results from groundwater sampling at the SRE and SRW sites are presented in Appendix A.


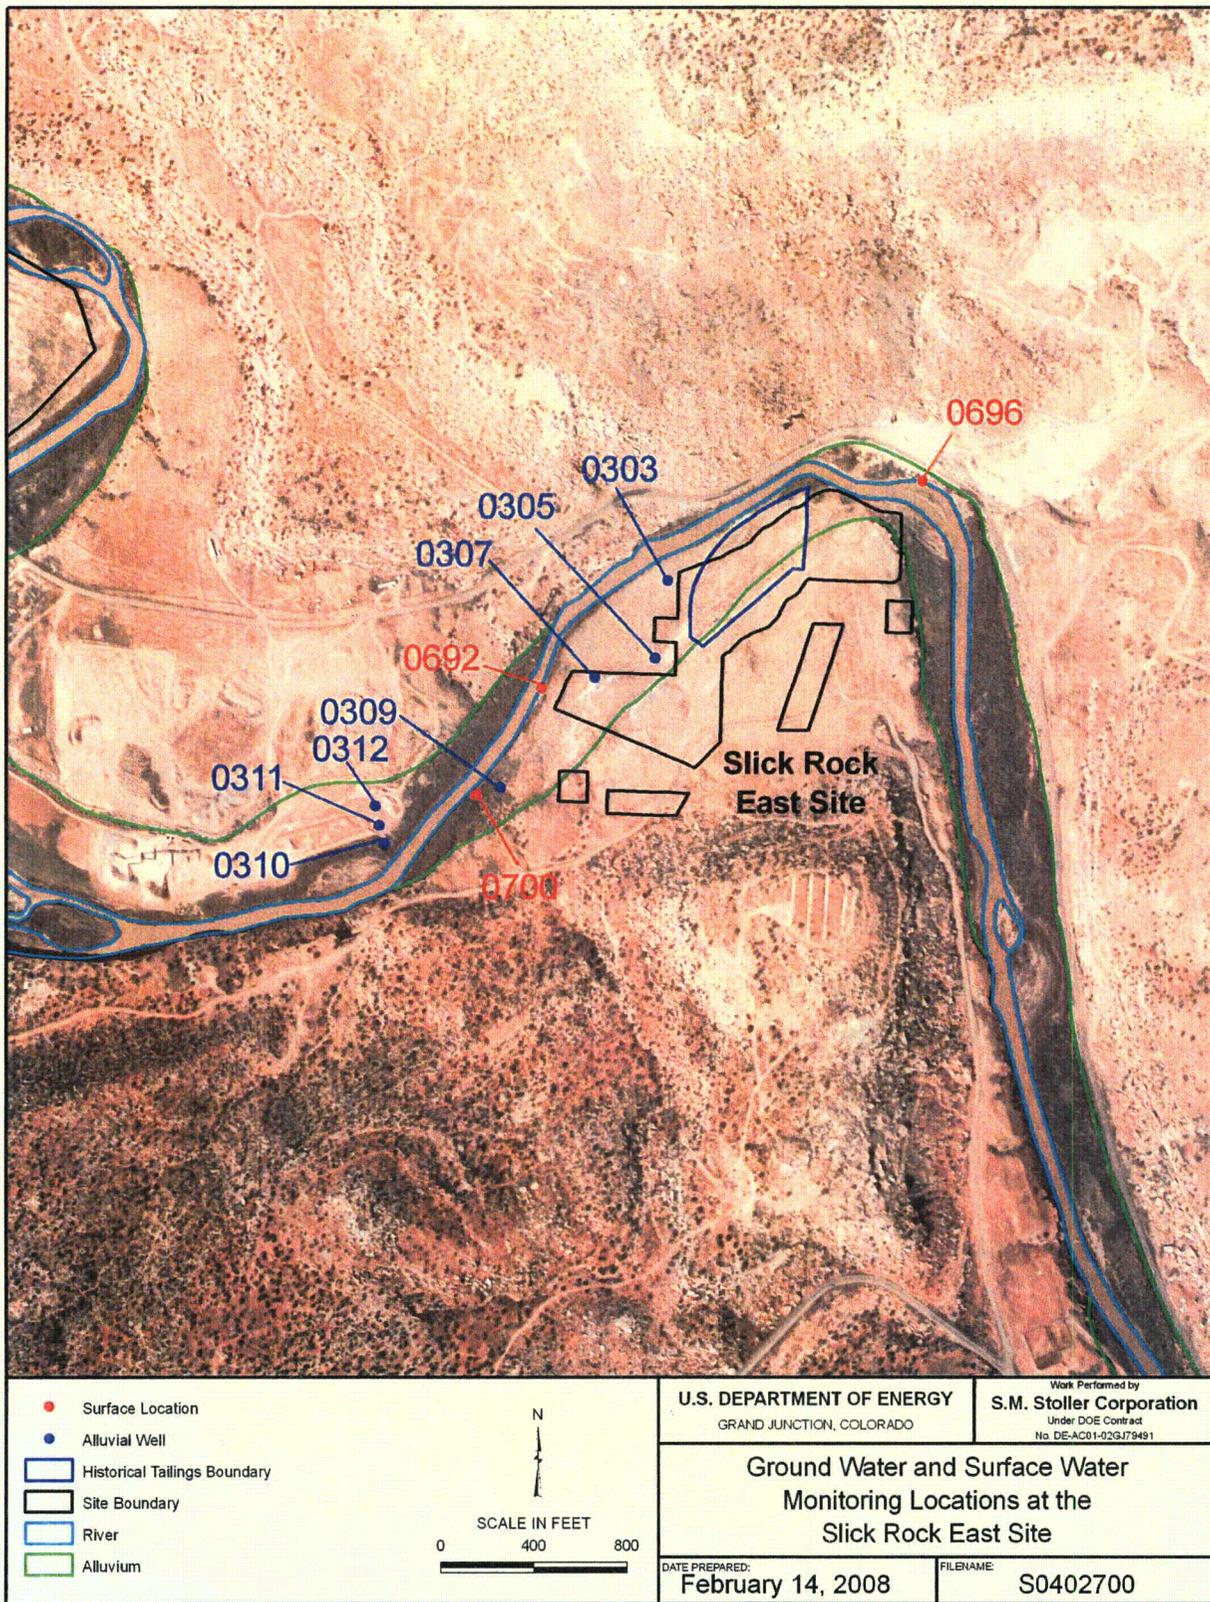


Figure 3. Groundwater and Surface Water Monitoring Locations at the SRE Site

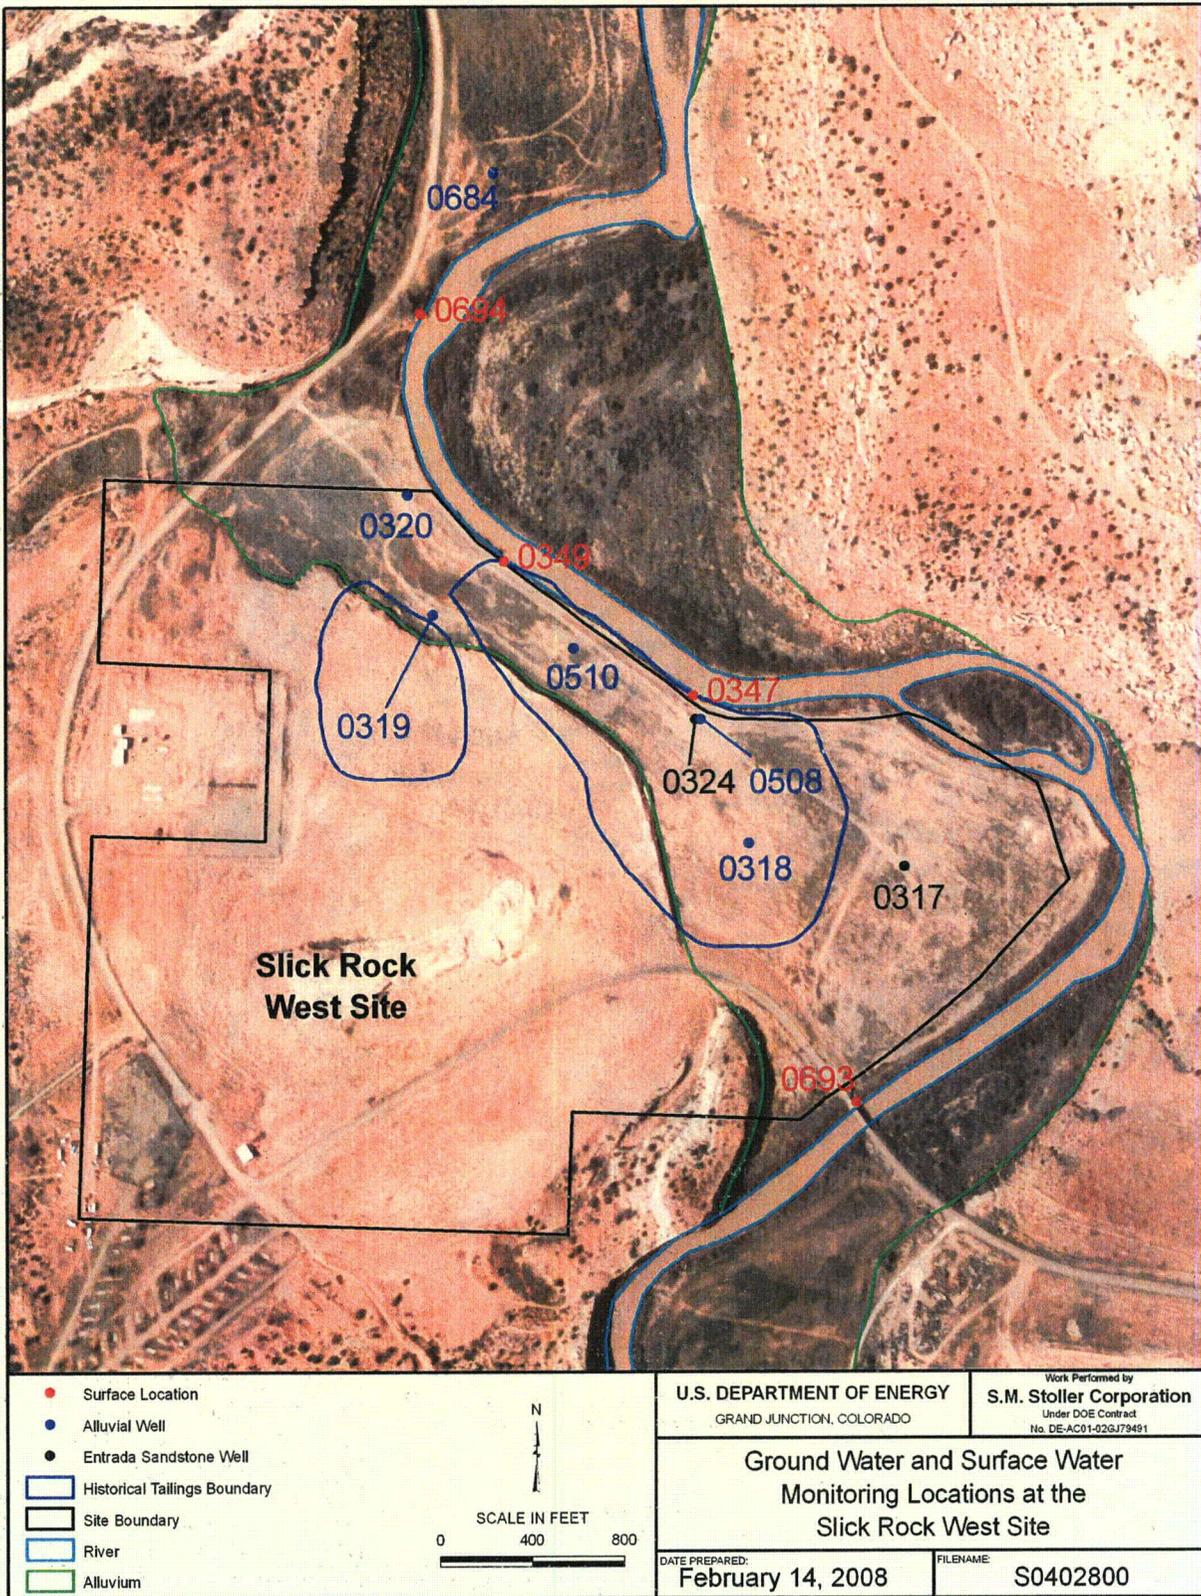

M:\LTS\111\0071\031003\S04028\S0402800.mxd smithw 2/14/2008 10:43:05 AM

Figure 4. Groundwater and Surface Water Monitoring Locations at the SRW Site

Table 1. Monitoring Program at the SRE Site

ID	Matrix	Location	Rationale	Analytes
0696	Surface Water	Upstream	Background for SRE site.	Uranium
0692	Surface Water	Adjacent to site	Predicted location where the centroid of the uranium plume intersects the river.	Uranium
0700	Surface Water	Downstream	Across river from well 0311.	Uranium
0303	Groundwater	On site	Hot spot for uranium.	Uranium
0305	Groundwater	On site	Hot spot for uranium; selenium above the MCL.	Uranium, Selenium
0307	Groundwater	On site	Downgradient of hot spots, monitor plume migration.	Uranium, Selenium
0309	Groundwater	On site	Farthest downgradient well on site.	Uranium
0310	Groundwater	Downgradient	Adjacent and south of well 0311.	Uranium
0311	Groundwater	Downgradient	Off site across the river. Monitor migration of the uranium plume between sites.	Uranium
0312	Groundwater	Downgradient	Adjacent and north of well 0311.	Uranium

Table 2. Monitoring Program at the SRW Site

ID	Matrix	Location	Rationale	Analytes
0693	Surface Water	Upstream	Background for SRW site.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0347	Surface Water	Adjacent to site	Predicted location where the centroid of the selenium plume intersects the river. Point of exposure for selenium.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0349	Surface Water	Adjacent to site	Predicted location where the centroids of the contaminant plumes intersect the river. Potential point of exposure.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0694	Surface Water	Downstream	Potential for contaminant plumes to discharge to the river at this location.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0318	Groundwater	On site	Hot spot for several COPC.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0508	Groundwater	On site	High selenium, nitrate, molybdenum, and uranium.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0510	Groundwater	On site	Edge of former tailings pile, high COPC concentrations.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0317	Groundwater	On site	Entrada Sandstone well, exceeds molybdenum MCL.	Molybdenum
0324	Groundwater	On site	Entrada Sandstone well, previously exceeded nitrate and selenium MCLs.	Removed from sampling network in 2004 because contaminant concentrations dropped below MCLs.
0319	Groundwater	On site	Hot spot for benzene, toluene, and radium-226/radium-228.	Benzene, Toluene, Ethylbenzene, Xylene, Radium-226, and Radium-228
0320	Groundwater	On site	Farthest downgradient well on site; monitor plume movement.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium
0684	Groundwater	Off site	Verify that contaminants are not migrating off site.	Manganese, Molybdenum, Nitrate, Selenium, and Uranium

3.2.1 SRE Site

At the SRE site, results of the monitoring program indicate that concentrations of uranium in wells 0303, 0305, 0307 and 0309 have returned to their approximate 2001/2002 levels after considerable fluctuations in recent years (Figure 5 and Figure 6). In previous verification monitoring reports it has been suggested that drought conditions and fluctuating water levels have been responsible for variability in concentrations observed in some wells. Hydrographs in Appendix C do show that the wells with the greatest variation in concentrations also tend to vary the most in water level, though no year-by-year correlation is obvious.

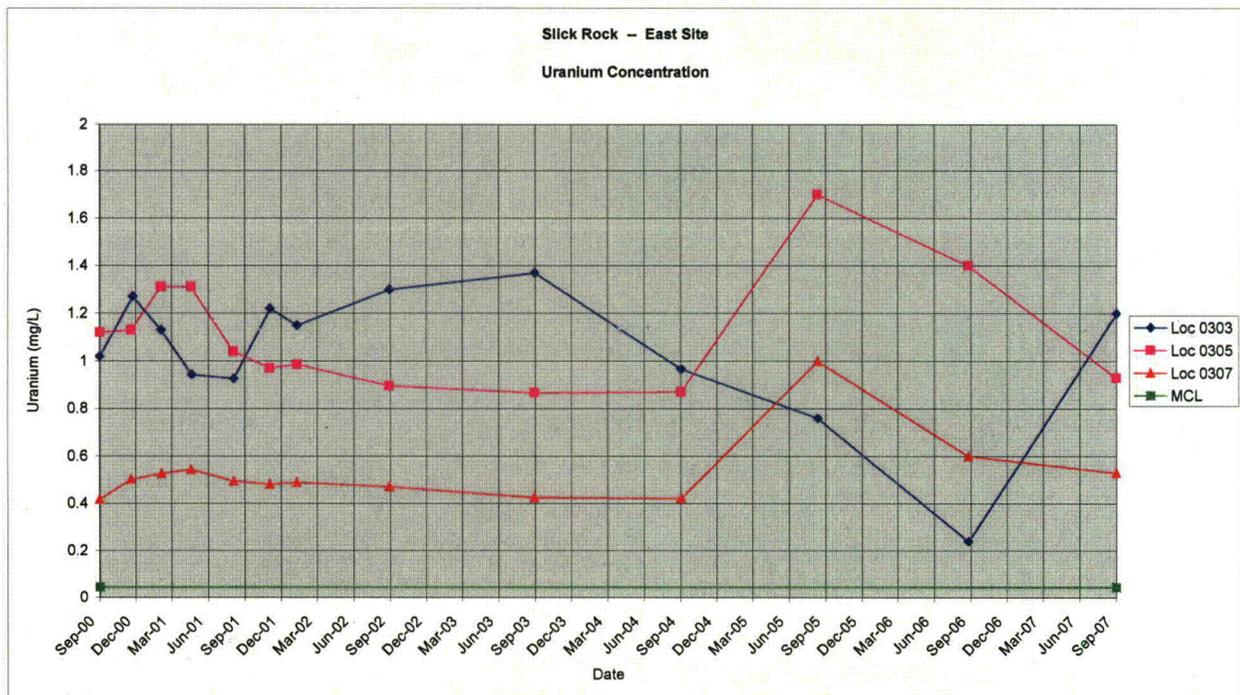


Figure 5. Uranium Concentrations Versus Time in the Middle of the SRE Site

Concentrations of uranium in well 0305 versus groundwater model predictions are shown in Figure 7. Obviously, observed concentrations are not consistent with modeled concentrations. Lower amounts of groundwater flow through the system during drought years may have resulted in contaminant adsorption to soils. Subsequent desorption as groundwater levels rebound could explain these discrepancies.

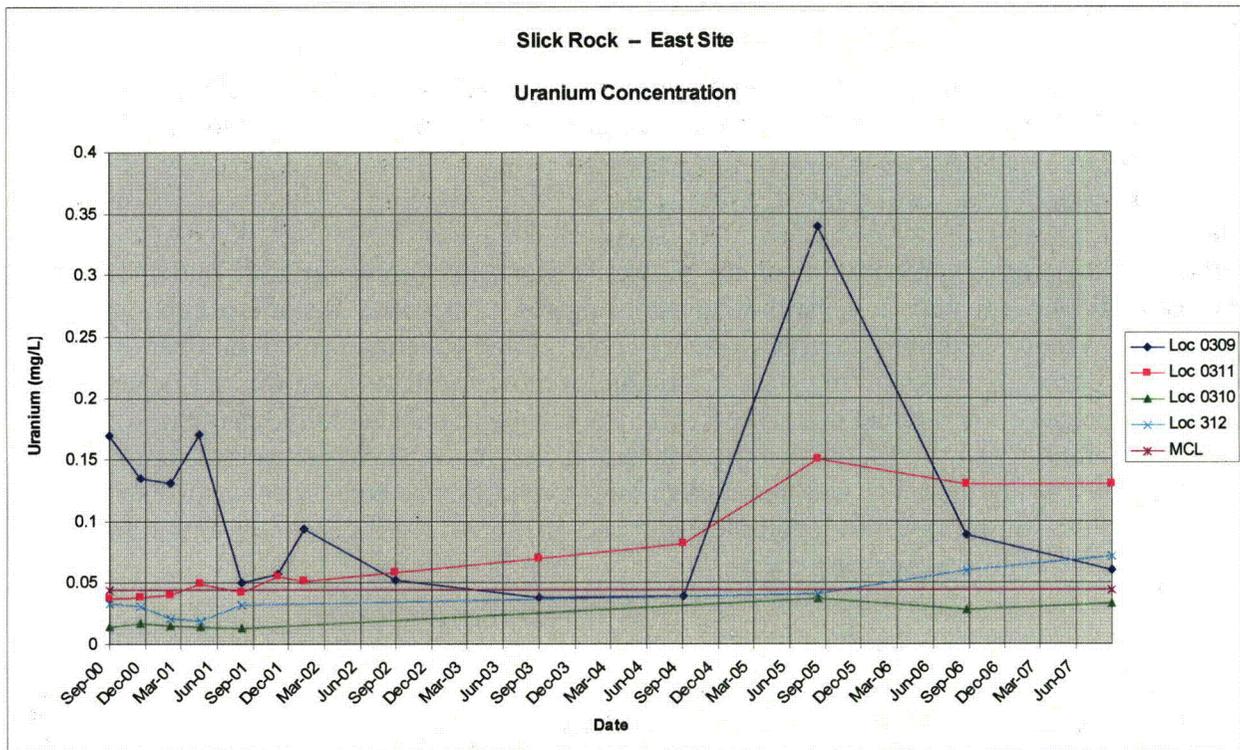


Figure 6. Uranium Concentrations Versus Time in the Downgradient Portion of the SRE Site

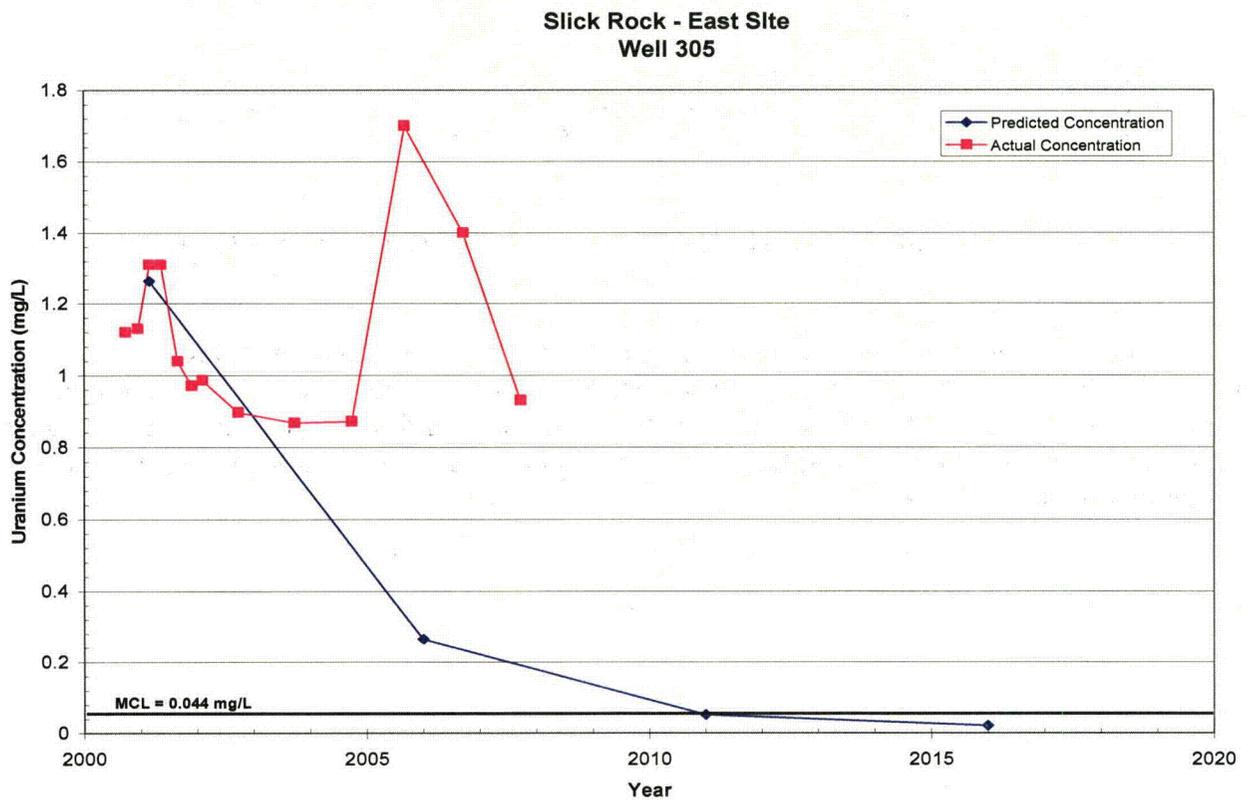


Figure 7. Uranium Concentrations in Well 0305 Versus Groundwater Model Predictions at the SRE Site

Trends for uranium in wells 0310, 0311, and 0312 indicate that some contaminated groundwater may be flowing under the river. These wells will continue to be monitored. If it is determined that site-related contamination is affecting the alluvial aquifer across the river, any necessary action(s) will be addressed in the final GCAP for the site.

3.2.2 SRW Site

Results of the monitoring program from the SRW site show that two wells, 0508 and 0510, continue to display concentrations within historical ranges. Concentrations of most contaminants are lower than their maximum observed values (Table 3), and constituents in a number of wells appear to be declining or remaining steady. Results for most constituents in well 0318 have varied significantly; selenium and molybdenum have increased substantially in recent years. As noted above, it has been postulated that these increases may have been the result of recent (over the last few years) site flooding with remobilization of vadose-zone constituents. As discussed below, it could also be a result of incomplete characterization of the highest concentration portion of the groundwater plume.

Table 3. Comparison of COPC Concentrations in the Alluvial Aquifer to Benchmark Values

COPC	Benchmark ^a	Maximum Concentration ^b	Maximum 2005 Concentration ^c	Maximum 2006 Concentration ^d	Maximum 2007 Concentration ^e
Benzene	0.005	19.8	12.0	9.5	6.9
Manganese	3.5	12.80	4.8	5.2	6.1
Molybdenum	0.10	1.83	4.4	1.9	1.3
Nitrate	44.27	4,090	725	390	430
Radium-226 + Radium-228	5	7.21	4.28	6.07	5.06
Toluene	1	13.7	8.5	6.3	4.1
Selenium	0.18	2.57	3.5	4.6	5.2
Uranium	0.044	1.37	1.7	1.4	1.2

^aBenchmark values are MCLs except for selenium (ACL) and manganese (background). Units are in mg/L, except for radium-226 and radium-228, which are in picoCuries per liter (pCi/L).

^bMaximum concentration in the alluvial aquifer from September 2000 to September 2002.

^cConcentration in September 2005.

^dConcentration in September 2006.

^eConcentrations in September 2007.

Concentrations of selenium and nitrate in the alluvial groundwater have generally decreased over time as shown in Figure 8 and Figure 9, respectively; however, well 0318 has shown a significant increase in selenium in recent years. Historically, concentrations of molybdenum in the Entrada Sandstone well (well 0317) have been slightly above the MCL, and the levels continue to remain stable (Figure 10).

Slick Rock -- West Site

Selenium Concentration

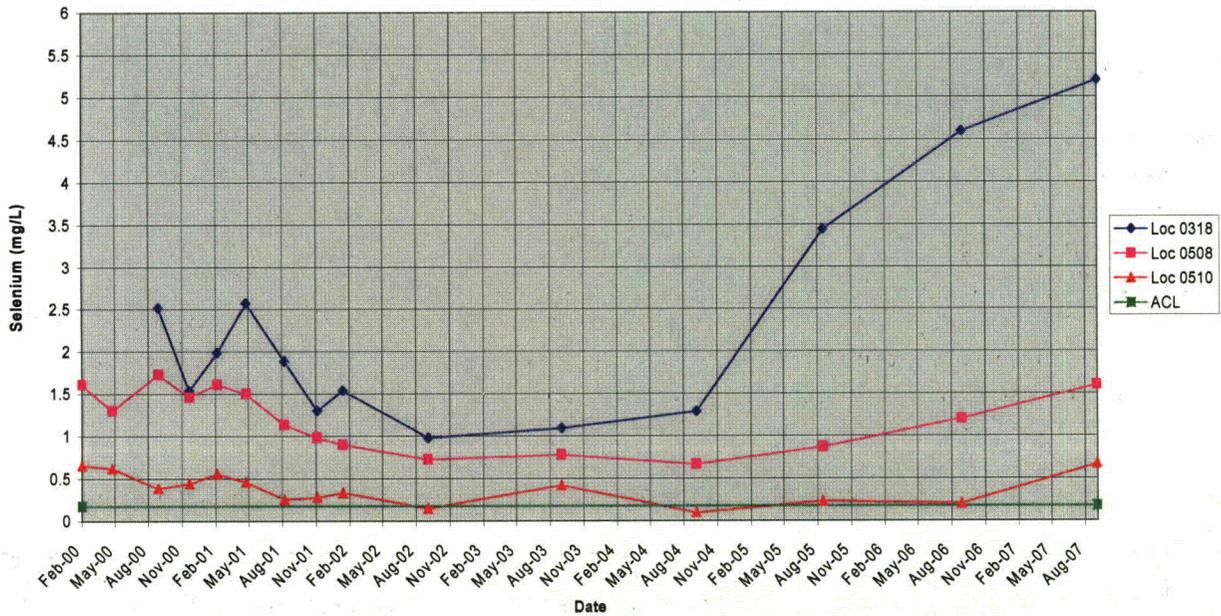


Figure 8. Selenium Concentrations Versus Time at the SRW Site

SLICK ROCK - West Site

Nitrate as NO3

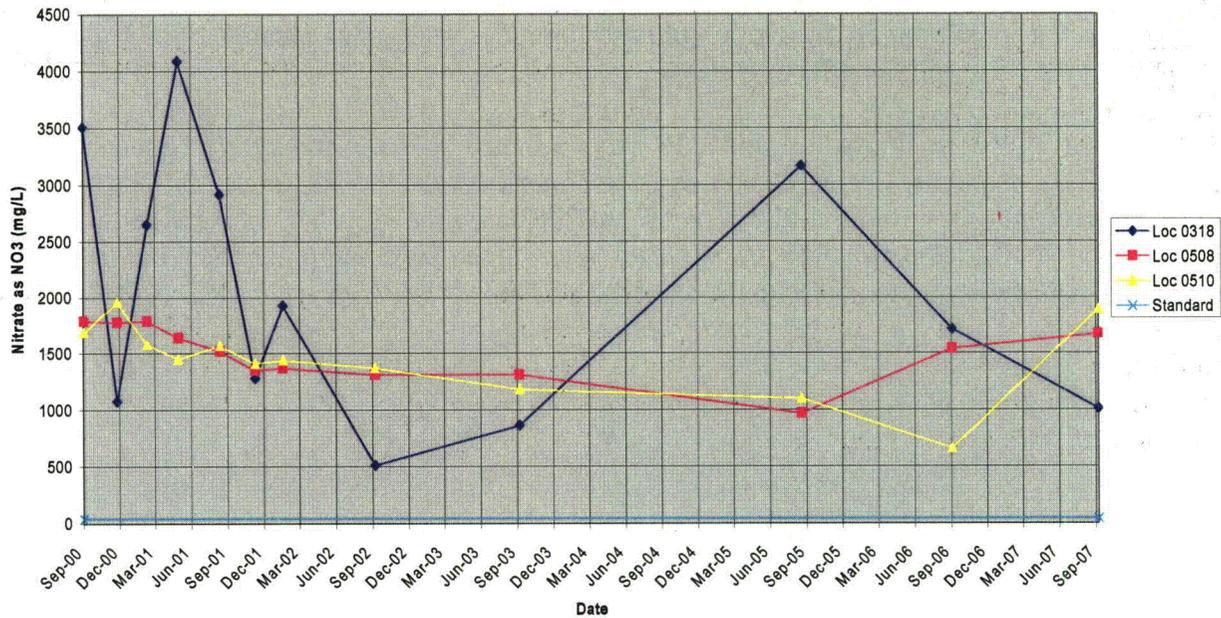


Figure 9. Nitrate Concentrations Versus Time at the SRW Site

Slick Rock -- West Site

Molybdenum Concentration

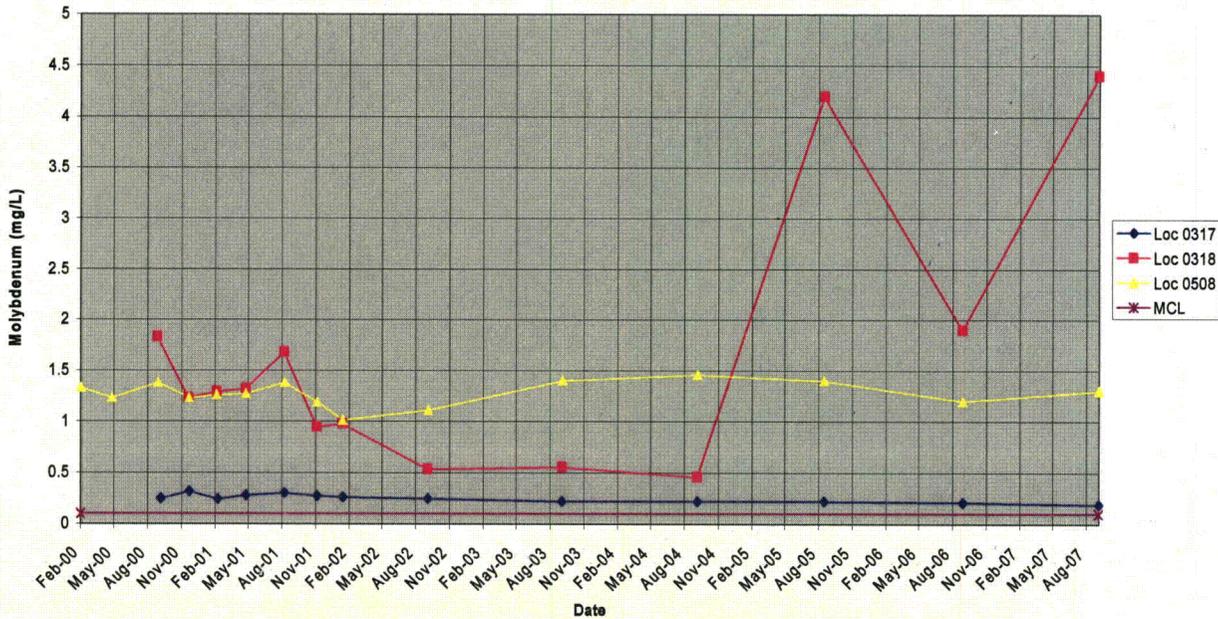


Figure 10. Molybdenum Concentrations Versus Time at the SRW Site

Concentrations of nitrate, molybdenum, and selenium in well 0508 versus model predictions are displayed in Figure 11, Figure 12, and Figure 13, respectively. As with the SRE site, observed concentrations are not consistent with model predictions. The fact that very mobile species such as nitrate and molybdenum are experiencing increases further supports that geochemical processes such as precipitation/dissolution or adsorption/desorption not accounted for in the groundwater model are likely affecting groundwater quality.

Several minor COPC are limited to well 0319 only. Benzene, toluene, and xylene concentrations in well 0319 had markedly decreased compared to historic levels, though concentrations have increased in recent years. Radium-226 plus radium-228 activities in well 0319 were below the standard of 5 picoCuries per liter (pCi/L) (Table 3) during the 2005 sampling event but increased slightly in 2006 and remained close to the standard in 2007.

Slick Rock - West Site
Well 508

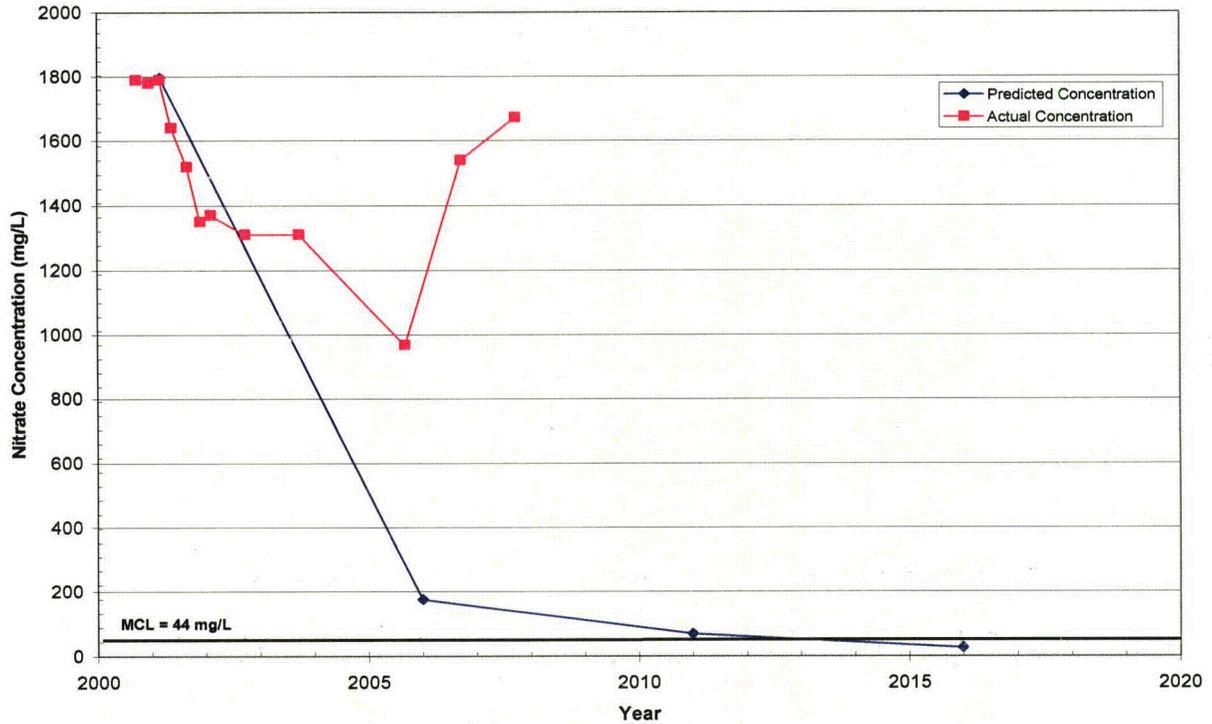


Figure 11. Predicted Nitrate Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site

Slick Rock - West Site
Well 508

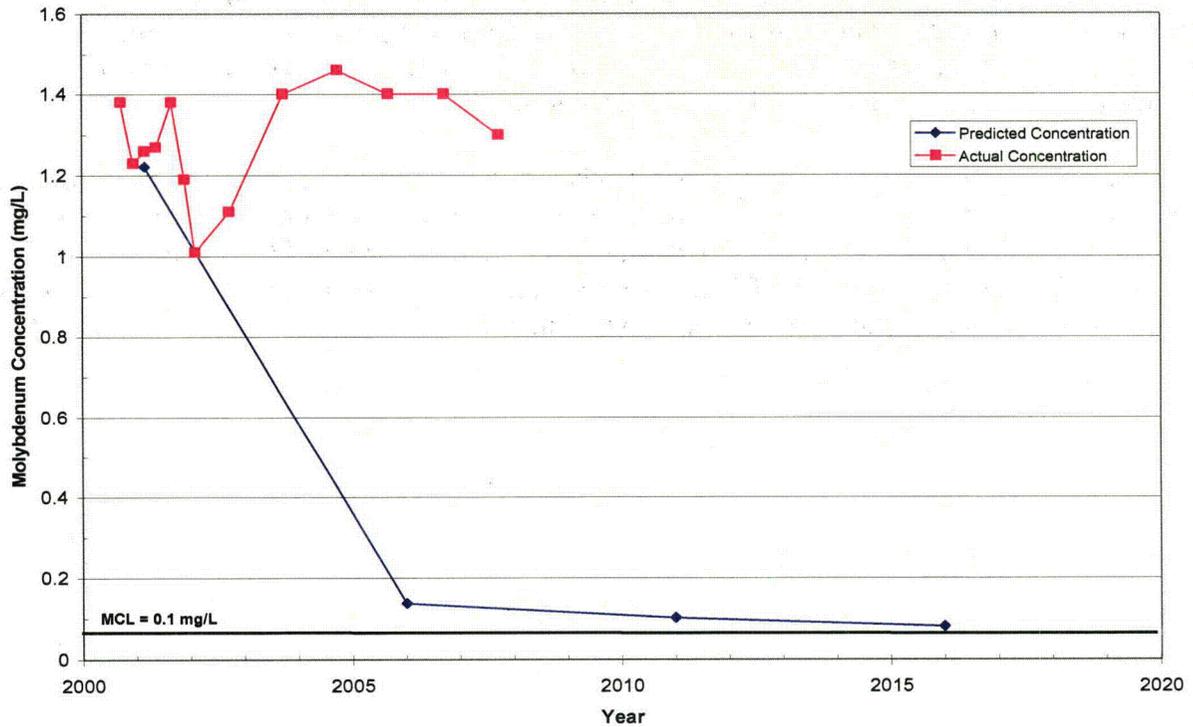


Figure 12. Predicted Molybdenum Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site

Slick Rock - West Site
Well 508

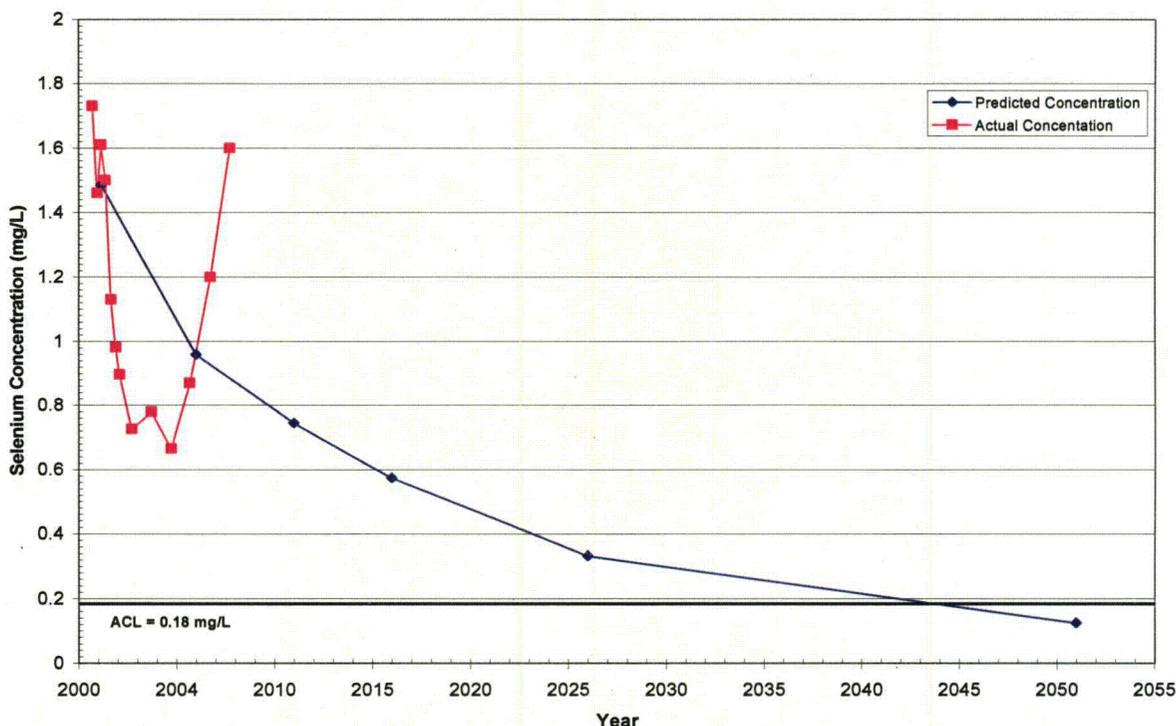


Figure 13. Selenium Concentrations in Well 0508 Versus Groundwater Model Predictions at the SRW Site

3.3 Surface Water

Results from surface water sampling (Appendix B) demonstrate essentially no impact to the Dolores River from site activities. In 2006, one sampling location was at the CDPHE water-quality benchmark for manganese and one slightly exceeded it. The same location exceeding the manganese benchmark also exceeded the selenium standard. A summary of results is provided in Table 4.

Table 4. Comparison of COPC Concentrations in the Dolores River to CDPHE Benchmarks

COPC	CDPHE Benchmark ^a (mg/L)	Dolores River Location						
		SRE Site			SRW Site			
		0696	0692	0700	0693	0347	0349	0694
		2006 Concentration (mg/L)						
Manganese ^b	0.05	-	-	-	0.0063	0.019	0.065	0.013
Selenium	0.005	-	-	-	0.0033	0.009	0.0088	0.0085
Uranium	0.059	0.0055	0.0007	0.0007	0.0007	0.0033	0.0035	0.0031

^aCDPHE surface water benchmark (CDPHE 1998).

^bStandard for chronic exposure.

4.0 Conclusions

4.1 Status of Site Compliance

Drought conditions have persisted in the western U.S. since about 2002 (Colorado River Water Conservation District website; <http://www.crwcd.org/>). That is approximately when contaminant trends at the Slick Rock sites began to deviate significantly from model predictions. It is possible that, after precipitation levels return to "normal," natural flushing will resume as predicted. Because contaminant levels are predicted to drop rapidly under average (non-drought) conditions, there should be enough time to meet compliance levels within the allotted natural flushing timeframe (i.e., 100 years).

4.2 Recommendations

It is recommended that verification monitoring of groundwater from designated monitor wells and surface water locations continue on an annual basis as specified in the draft final GCAP (DOE 2006). In accordance with the GCAP, a re-evaluation of monitoring requirements will be conducted after 10 years of monitoring have been completed. It had been anticipated that monitoring could eventually be decreased to every 5 years. However, if recently observed fluctuations in contaminant concentrations continue or if contamination persists on the other side of the Dolores River, it may be advisable to continue an annual monitoring frequency until contaminant concentrations begin to decline once more.

5.0 References

40 CFR 192. U.S. Environmental Protection Agency, 2002. Title 10, Part 192, "Health and Environmental Protection Standards for Uranium and Thorium Mill Tailings," *Code of Federal Regulations*, July 1.

CDPHE (Colorado Department of Public Health and Environment), 1998. *Classifications and Numeric Standards for Gunnison and Lower-Dolores River Basins*, Regulation No. 35, Water Quality Commission, Denver, Colorado.

DOE (U.S. Department of Energy), 2002. *Site Observational Work Plan for the Slick Rock, Colorado, UMTRA Project Site*, GJO-2001-257-TAR MAC-GWSKR 1.1, Grand Junction, Colorado.

DOE (U.S. Department of Energy), 2006. *Draft Final Groundwater Compliance Action Plan for the Slick Rock, Colorado, UMTRA Project Sites*, DOE-LM/1327-2006, Grand Junction, Colorado, September.

End of current text

Appendix A

Groundwater Quality Data by Parameter

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	LOCATION TYPE	SAMPLE:		DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS:			DETECTION LIMIT	UN-CERTAINTY
				DATE	ID			LAB	DATA	QA		
Alkalinity, Total (As CaCO3)	mg/L	0303	WL	09/25/2007	0001	4.30 - 14.30	473	F	#	-	-	
	mg/L	0305	WL	09/26/2007	0001	8.70 - 18.70	340	F	#	-	-	
	mg/L	0307	WL	09/25/2007	0001	4.40 - 14.40	717	F	#	-	-	
	mg/L	0309	WL	09/26/2007	0001	10.20 - 20.20	692	FQ	#	-	-	
	mg/L	0310	WL	09/25/2007	0001	14.70 - 19.70	224	F	#	-	-	
	mg/L	0311	WL	09/25/2007	0001	14.10 - 19.10	354	F	#	-	-	
	mg/L	0312	WL	09/25/2007	0001	14.50 - 19.50	338	F	#	-	-	
	mg/L	0317	WL	09/24/2007	0001	19.46 - 39.52	256	F	#	-	-	
	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	247	F	#	-	-	
	mg/L	0319	WL	09/25/2007	0001	4.55 - 14.58	1230	F	#	-	-	
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	390	F	#	-	-	
	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	337	F	#	-	-	
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	308	F	#	-	-	
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	218	F	#	-	-	
	Benzene	ug/L	0319	WL	09/25/2007	N001	4.55 - 14.58	6900	F	#	170	-
ug/L		0319	WL	09/25/2007	N002	4.55 - 14.58	6800	F	#	170	-	
m.p-Xylene	ug/L	0319	WL	09/25/2007	N001	4.55 - 14.58	2900	F	#	170	-	
	ug/L	0319	WL	09/25/2007	N002	4.55 - 14.58	2800	F	#	170	-	
Manganese	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	0.330	F	#	0.00082	-	
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	0.510	F	#	0.00016	-	
	mg/L	0320	WL	09/25/2007	0002	4.92 - 9.96	0.500	F	#	0.00016	-	
	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	4.900	F	#	0.00082	-	
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	6.100	F	#	0.00082	-	
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	0.750	F	#	0.00016	-	
Molybdenum	mg/L	0317	WL	09/24/2007	0001	19.46 - 39.52	0.190	F	#	0.00048	-	

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	LOCATION TYPE	SAMPLE: DATE	ID	DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS: LAB DATA QA	DETECTION LIMIT	UN-CERTAINTY
Molybdenum	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	4.400	F #	0.0096	-
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	0.0093	F #	9.6E-05	-
	mg/L	0320	WL	09/25/2007	0002	4.92 - 9.96	0.0087	F #	9.6E-05	-
	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	1.300	F #	0.0048	-
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	0.740	F #	0.0048	-
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	0.0051	F #	9.6E-05	-
Nitrate + Nitrite as Nitrogen	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	230	F #	2	-
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	0.014	F #	0.01	-
	mg/L	0320	WL	09/25/2007	0002	4.92 - 9.96	0.01	U F #	0.01	-
	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	380	F #	5	-
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	430	F #	5	-
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	0.056	F #	0.01	-
Oxidation Reduction Potent	mV	0303	WL	09/25/2007	N001	4.30 - 14.30	-107	F #	-	-
	mV	0305	WL	09/26/2007	N001	8.70 - 18.70	54	F #	-	-
	mV	0307	WL	09/25/2007	N001	4.40 - 14.40	-87	F #	-	-
	mV	0309	WL	09/26/2007	N001	10.20 - 20.20	-79	FQ #	-	-
	mV	0310	WL	09/25/2007	N001	14.70 - 19.70	-83	F #	-	-
	mV	0311	WL	09/25/2007	N001	14.10 - 19.10	109	F #	-	-
	mV	0312	WL	09/25/2007	N001	14.50 - 19.50	114	F #	-	-
	mV	0317	WL	09/24/2007	N001	19.46 - 39.52	157	F #	-	-
	mV	0318	WL	09/24/2007	N001	4.99 - 15.02	159	F #	-	-
	mV	0319	WL	09/25/2007	N001	4.55 - 14.58	-126	F #	-	-
	mV	0320	WL	09/25/2007	N001	4.92 - 9.96	-58	F #	-	-
	mV	0508	WL	09/24/2007	N001	1.01 - 11.01	164	F #	-	-
	mV	0510	WL	09/24/2007	N001	4.92 - 13.92	184	F #	-	-
	mV	0684	WL	09/25/2007	N001	11.00 - 21.00	-2	F #	-	-

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	LOCATION TYPE	SAMPLE:		DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS:			DETECTION LIMIT	UN-CERTAINTY
				DATE	ID			LAB	DATA	QA		
o-Xylene	ug/L	0319	WL	09/25/2007	N001	4.55 - 14.58	550	F	#	170	-	
	ug/L	0319	WL	09/25/2007	N002	4.55 - 14.58	510	F	#	170	-	
pH	s.u.	0303	WL	09/25/2007	N001	4.30 - 14.30	7.26	F	#	-	-	
	s.u.	0305	WL	09/26/2007	N001	8.70 - 18.70	7.25	F	#	-	-	
	s.u.	0307	WL	09/25/2007	N001	4.40 - 14.40	7.24	F	#	-	-	
	s.u.	0309	WL	09/26/2007	N001	10.20 - 20.20	7.82	FQ	#	-	-	
	s.u.	0310	WL	09/25/2007	N001	14.70 - 19.70	7.38	F	#	-	-	
	s.u.	0311	WL	09/25/2007	N001	14.10 - 19.10	7.05	F	#	-	-	
	s.u.	0312	WL	09/25/2007	N001	14.50 - 19.50	7.30	F	#	-	-	
	s.u.	0317	WL	09/24/2007	N001	19.46 - 39.52	7.34	F	#	-	-	
	s.u.	0318	WL	09/24/2007	N001	4.99 - 15.02	6.79	F	#	-	-	
	s.u.	0319	WL	09/25/2007	N001	4.55 - 14.58	7.00	F	#	-	-	
	s.u.	0320	WL	09/25/2007	N001	4.92 - 9.96	7.19	F	#	-	-	
	s.u.	0508	WL	09/24/2007	N001	1.01 - 11.01	6.67	F	#	-	-	
	s.u.	0510	WL	09/24/2007	N001	4.92 - 13.92	6.53	F	#	-	-	
	s.u.	0684	WL	09/25/2007	N001	11.00 - 21.00	7.38	F	#	-	-	
	Radium-226	pCi/L	0319	WL	09/25/2007	0001	4.55 - 14.58	2.03	F	#	0.257	± 0.74
pCi/L		0319	WL	09/25/2007	0002	4.55 - 14.58	2.66	F	#	0.59	± 0.90	
Radium-228	pCi/L	0319	WL	09/25/2007	0001	4.55 - 14.58	3.03	F	#	0.678	± 1.00	
	pCi/L	0319	WL	09/25/2007	0002	4.55 - 14.58	2.29	F	#	0.619	± 0.78	
Selenium	mg/L	0305	WL	09/26/2007	0001	8.70 - 18.70	0.023	F	#	0.00014	-	
	mg/L	0307	WL	09/25/2007	0001	4.40 - 14.40	0.00011	F	#	2.8E-05	-	
	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	5.200	F	#	0.028	-	
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	0.00005 B	F	#	2.8E-05	-	
	mg/L	0320	WL	09/25/2007	0002	4.92 - 9.96	0.00005 B	F	#	2.8E-05	-	

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION	LOCATION	SAMPLE		DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS:			DETECTION LIMIT	UN- CERTAINTY
		ID	TYPE	DATE	ID			LAB	DATA	QA		
Selenium	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	1.600	F	#		0.0056	-
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	0.670	F	#		0.0028	-
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	0.00008	B	F	#	2.8E-05	-
Specific Conductance	umhos/cm	0303	WL	09/25/2007	N001	4.30 - 14.30	3180		F	#		-
	umhos/cm	0305	WL	09/26/2007	N001	8.70 - 18.70	3364		F	#		-
	umhos/cm	0307	WL	09/25/2007	N001	4.40 - 14.40	6019		F	#		-
	umhos/cm	0309	WL	09/26/2007	N001	10.20 - 20.20	2288		FQ	#		-
	umhos/cm	0310	WL	09/25/2007	N001	14.70 - 19.70	1063		F	#		-
	umhos/cm	0311	WL	09/25/2007	N001	14.10 - 19.10	2679		F	#		-
	umhos/cm	0312	WL	09/25/2007	N001	14.50 - 19.50	3436		F	#		-
	umhos/cm	0317	WL	09/24/2007	N001	19.46 - 39.52	2446		F	#		-
	umhos/cm	0318	WL	09/24/2007	N001	4.99 - 15.02	3487		F	#		-
	umhos/cm	0319	WL	09/25/2007	N001	4.55 - 14.58	7989		F	#		-
	umhos/cm	0320	WL	09/25/2007	N001	4.92 - 9.96	946		F	#		-
	umhos/cm	0508	WL	09/24/2007	N001	1.01 - 11.01	5178		F	#		-
	umhos/cm	0510	WL	09/24/2007	N001	4.92 - 13.92	5192		F	#		-
	umhos/cm	0684	WL	09/25/2007	N001	11.00 - 21.00	868		F	#		-
	Temperature	C	0303	WL	09/25/2007	N001	4.30 - 14.30	18.71		F	#	
C		0305	WL	09/26/2007	N001	8.70 - 18.70	15.58		F	#		-
C		0307	WL	09/25/2007	N001	4.40 - 14.40	16.36		F	#		-
C		0309	WL	09/26/2007	N001	10.20 - 20.20	13.95		FQ	#		-
C		0310	WL	09/25/2007	N001	14.70 - 19.70	16.05		F	#		-
C		0311	WL	09/25/2007	N001	14.10 - 19.10	17.71		F	#		-
C		0312	WL	09/25/2007	N001	14.50 - 19.50	17.99		F	#		-
C		0317	WL	09/24/2007	N001	19.46 - 39.52	14.26		F	#		-
C		0318	WL	09/24/2007	N001	4.99 - 15.02	18.70		F	#		-

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	LOCATION TYPE	SAMPLE:		DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS:			DETECTION LIMIT	UN-CERTAINTY
				DATE	ID			LAB	DATA	QA		
Temperature	C	0319	WL	09/25/2007	N001	4.55 - 14.58	17.33	F	#	-	-	
	C	0320	WL	09/25/2007	N001	4.92 - 9.96	17.34	F	#	-	-	
	C	0508	WL	09/24/2007	N001	1.01 - 11.01	19.04	F	#	-	-	
	C	0510	WL	09/24/2007	N001	4.92 - 13.92	16.96	F	#	-	-	
	C	0684	WL	09/25/2007	N001	11.00 - 21.00	14.71	F	#	-	-	
Toluene	ug/L	0319	WL	09/25/2007	N001	4.55 - 14.58	4100	F	#	170	-	
	ug/L	0319	WL	09/25/2007	N002	4.55 - 14.58	4100	F	#	170	-	
Total Xylene	ug/L	0319	WL	09/25/2007	N001	4.55 - 14.58	170	U	F	#	170	-
	ug/L	0319	WL	09/25/2007	N002	4.55 - 14.58	170	U	F	#	170	-
Turbidity	NTU	0303	WL	09/25/2007	N001	4.30 - 14.30	2.40	F	#	-	-	
	NTU	0305	WL	09/26/2007	N001	8.70 - 18.70	8.03	F	#	-	-	
	NTU	0307	WL	09/25/2007	N001	4.40 - 14.40	3.82	F	#	-	-	
	NTU	0309	WL	09/26/2007	N001	10.20 - 20.20	67.8	FQ	#	-	-	
	NTU	0310	WL	09/25/2007	N001	14.70 - 19.70	1.02	F	#	-	-	
	NTU	0311	WL	09/25/2007	N001	14.10 - 19.10	2.64	F	#	-	-	
	NTU	0312	WL	09/25/2007	N001	14.50 - 19.50	2.90	F	#	-	-	
	NTU	0317	WL	09/24/2007	N001	19.46 - 39.52	1.85	F	#	-	-	
	NTU	0318	WL	09/24/2007	N001	4.99 - 15.02	2.83	F	#	-	-	
	NTU	0319	WL	09/25/2007	N001	4.55 - 14.58	6.89	F	#	-	-	
	NTU	0320	WL	09/25/2007	N001	4.92 - 9.96	2.71	F	#	-	-	
	NTU	0508	WL	09/24/2007	N001	1.01 - 11.01	1.77	F	#	-	-	
	NTU	0510	WL	09/24/2007	N001	4.92 - 13.92	8.35	F	#	-	-	
	NTU	0684	WL	09/25/2007	N001	11.00 - 21.00	8.37	F	#	-	-	
Uranium	mg/L	0303	WL	09/25/2007	0001	4.30 - 14.30	1.200	F	#	0.0003	-	
	mg/L	0305	WL	09/26/2007	0001	8.70 - 18.70	0.930	F	#	0.0003	-	

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01. Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION	LOCATION	SAMPLE		DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS:			DETECTION LIMIT	UN- CERTAINTY
		ID	TYPE	DATE	ID			LAB	DATA	QA		
Uranium	mg/L	0307	WL	09/25/2007	0001	4.40 - 14.40	0.530	F	#	5.9E-05	-	
	mg/L	0309	WL	09/26/2007	0001	10.20 - 20.20	0.060	FQ	#	5.9E-06	-	
	mg/L	0310	WL	09/25/2007	0001	14.70 - 19.70	0.033	F	#	5.9E-06	-	
	mg/L	0311	WL	09/25/2007	0001	14.10 - 19.10	0.130	F	#	0.00003	-	
	mg/L	0312	WL	09/25/2007	0001	14.50 - 19.50	0.072	F	#	0.00003	-	
	mg/L	0318	WL	09/24/2007	0001	4.99 - 15.02	0.028	F	#	5.9E-05	-	
	mg/L	0320	WL	09/25/2007	0001	4.92 - 9.96	0.015	F	#	5.9E-06	-	
	mg/L	0320	WL	09/25/2007	0002	4.92 - 9.96	0.015	F	#	5.9E-06	-	
	mg/L	0508	WL	09/24/2007	0001	1.01 - 11.01	0.100	F	#	0.0003	-	
	mg/L	0510	WL	09/24/2007	0001	4.92 - 13.92	0.110	F	#	0.0003	-	
	mg/L	0684	WL	09/25/2007	0001	11.00 - 21.00	0.013	F	#	5.9E-06	-	

GROUND WATER QUALITY DATA BY PARAMETER WITH DEPTH (USEE200) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	LOCATION TYPE	SAMPLE DATE	SAMPLE ID	DEPTH RANGE (FT BLS)	RESULT	QUALIFIERS: LAB. DATA QA	DETECTION LIMIT	UN-CERTAINTY
-----------	-------	-------------	---------------	-------------	-----------	----------------------	--------	--------------------------	-----------------	--------------

RECORDS: SELECTED FROM USEE200 WHERE site_code='SRK01' AND (data_validation_qualifiers IS NULL OR data_validation_qualifiers NOT LIKE '%N%' AND data_validation_qualifiers NOT LIKE '%R%' AND data_validation_qualifiers NOT LIKE '%X%') AND DATE_SAMPLED >= #1/1/2007#

SAMPLE ID CODES: 000X = Filtered sample (0.45 µm). N00X = Unfiltered sample. X = replicate number.

LOCATION TYPES: WL WELL

LAB QUALIFIERS:

- * Replicate analysis not within control limits.
- + Correlation coefficient for MSA < 0.995.
- > Result above upper detection limit.
- A TIC is a suspected aldol-condensation product.
- B Inorganic: Result is between the IDL and CRDL. Organic & Radiochemistry: Analyte also found in method blank.
- C Pesticide result confirmed by GC-MS.
- D Analyte determined in diluted sample.
- E Inorganic: Estimate value because of interference, see case narrative. Organic: Analyte exceeded calibration range of the GC-MS.
- H Holding time expired, value suspect.
- I Increased detection limit due to required dilution.
- J Estimated
- M GFAA duplicate injection precision not met.
- N Inorganic or radiochemical: Spike sample recovery not within control limits. Organic: Tentatively identified compound (TIC).
- P > 25% difference in detected pesticide or Arochlor concentrations between 2 columns.
- S Result determined by method of standard addition (MSA).
- U Analytical result below detection limit.
- W Post-digestion spike outside control limits while sample absorbance < 50% of analytical spike absorbance.
- X Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Y Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Z Laboratory defined (USEPA CLP organic) qualifier, see case narrative.

DATA QUALIFIERS:

- | | | |
|--|--|--|
| F Low flow sampling method used. | G Possible grout contamination, pH > 9. | J Estimated value. |
| L Less than 3 bore volumes purged prior to sampling. | N Presumptive evidence that analyte is present. The analyte is "tentatively identified". | Q Qualitative result due to sampling technique |
| R Unusable result. | U Parameter analyzed for but was not detected. | X Location is undefined. |

QA QUALIFIER: # = validated according to Quality Assurance guidelines.

Appendix B

Surface Water Quality Data by Parameter

SURFACE WATER QUALITY DATA BY PARAMETER (USEE800) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION ID	SAMPLE DATE	SAMPLE ID	RESULT	QUALIFIERS: LAB DATA QA	DETECTION LIMIT	UN-CERTAINTY
Alkalinity, Total (As CaCO3	mg/L	0347	09/24/2007	0001	53		#	-
	mg/L	0349	09/24/2007	0001	53		#	-
	mg/L	0692	09/25/2007	0001	71		#	-
	mg/L	0693	09/25/2007	0001	77		#	-
	mg/L	0694	09/24/2007	0001	59		#	-
	mg/L	0696	09/25/2007	0001	67		#	-
	mg/L	0700	09/26/2007	0001	100		#	-
Manganese	mg/L	0347	09/24/2007	0001	0.019	B U	#	0.00082
	mg/L	0349	09/24/2007	0001	0.065		#	0.00082
	mg/L	0693	09/25/2007	0001	0.0063		#	0.00016
	mg/L	0694	09/24/2007	0001	0.013		#	0.00016
Molybdenum	mg/L	0347	09/24/2007	0001	0.011		#	9.6E-05
	mg/L	0349	09/24/2007	0001	0.0078		#	9.6E-05
	mg/L	0693	09/25/2007	0001	0.0048		#	9.6E-05
	mg/L	0694	09/24/2007	0001	0.010		#	9.6E-05
Nitrate + Nitrite as Nitrogen	mg/L	0347	09/24/2007	0001	0.4		#	0.01
	mg/L	0349	09/24/2007	0001	0.38		#	0.01
	mg/L	0693	09/25/2007	0001	0.24		#	0.01
	mg/L	0694	09/24/2007	0001	0.36		#	0.01
Oxidation Reduction Potent	mV	0347	09/24/2007	N001	144		#	-
	mV	0349	09/24/2007	N001	170		#	-
	mV	0692	09/25/2007	N001	-24		#	-
	mV	0693	09/25/2007	N001	95		#	-
	mV	0694	09/24/2007	N001	181		#	-
	mV	0696	09/25/2007	N001	37		#	-
	mV	0700	09/26/2007	N001	-2		#	-
pH	s.u.	0347	09/24/2007	N001	7.90		#	-
	s.u.	0349	09/24/2007	N001	7.84		#	-
	s.u.	0692	09/25/2007	N001	8.24		#	-
	s.u.	0693	09/25/2007	N001	7.70		#	-
	s.u.	0694	09/24/2007	N001	7.80		#	-
	s.u.	0696	09/25/2007	N001	7.99		#	-
	s.u.	0700	09/26/2007	N001	8.27		#	-
Selenium	mg/L	0347	09/24/2007	0001	0.009		#	2.8E-05
	mg/L	0349	09/24/2007	0001	0.0088		#	2.8E-05
	mg/L	0693	09/25/2007	0001	0.0033		#	2.8E-05
	mg/L	0694	09/24/2007	0001	0.0085		#	2.8E-05

SURFACE WATER QUALITY DATA BY PARAMETER (USEE800) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION	SAMPLE		RESULT	QUALIFIERS:		DETECTION LIMIT	UN- CERTAINTY
		ID	DATE	ID		LAB DATA	QA		
Specific Conductance	umhos/cm	0347	09/24/2007	N001	1902		#	-	-
	umhos/cm	0349	09/24/2007	N001	1731		#	-	-
	umhos/cm	0692	09/25/2007	N001	1138		#	-	-
	umhos/cm	0693	09/25/2007	N001	1139		#	-	-
	umhos/cm	0694	09/24/2007	N001	1662		#	-	-
	umhos/cm	0696	09/25/2007	N001	1041		#	-	-
	umhos/cm	0700	09/26/2007	N001	789		#	-	-
Temperature	C	0347	09/24/2007	N001	15.83		#	-	-
	C	0349	09/24/2007	N001	15.87		#	-	-
	C	0692	09/25/2007	N001	16.37		#	-	-
	C	0693	09/25/2007	N001	18.43		#	-	-
	C	0694	09/24/2007	N001	15.48		#	-	-
	C	0696	09/25/2007	N001	18.82		#	-	-
	C	0700	09/26/2007	N001	13.79		#	-	-
Uranium	mg/L	0347	09/24/2007	0001	0.0033		#	5.9E-06	-
	mg/L	0349	09/24/2007	0001	0.0035		#	5.9E-06	-
	mg/L	0692	09/25/2007	0001	0.0016		#	5.9E-06	-
	mg/L	0693	09/25/2007	0001	0.0018		#	5.9E-06	-
	mg/L	0694	09/24/2007	0001	0.0031		#	5.9E-06	-
	mg/L	0696	09/25/2007	0001	0.0016		#	5.9E-06	-
	mg/L	0700	09/26/2007	0001	0.0012		#	5.9E-06	-

SURFACE WATER QUALITY DATA BY PARAMETER (USEE800) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:43 am

PARAMETER	UNITS	LOCATION		SAMPLE		RESULT	QUALIFIERS		DETECTION LIMIT	UN-CERTAINTY
		ID		DATE	ID		LAB	DATA QA		

RECORDS: SELECTED FROM USEE800 WHERE site_code='SRK01' AND (data_validation_qualifiers IS NULL OR data_validation_qualifiers NOT LIKE '%N%' AND data_validation_qualifiers NOT LIKE '%R%' AND data_validation_qualifiers NOT LIKE '%X%') AND DATE_SAMPLED >= #1/1/2007#

SAMPLE ID CODES: 000X = Filtered sample (0.45 µm). N00X = Unfiltered sample. X = replicate number.

LAB QUALIFIERS:

- * Replicate analysis not within control limits.
- + Correlation coefficient for MSA < 0.995.
- > Result above upper detection limit.
- A TIC is a suspected aldol-condensation product.
- B Inorganic: Result is between the IDL and CRDL. Organic & Radiochemistry: Analyte also found in method blank.
- C Pesticide result confirmed by GC-MS.
- D Analyte determined in diluted sample.
- E Inorganic: Estimate value because of interference, see case narrative. Organic: Analyte exceeded calibration range of the GC-MS.
- H Holding time expired, value suspect.
- I Increased detection limit due to required dilution.
- J Estimated
- M GFAA duplicate injection precision not met.
- N Inorganic or radiochemical: Spike sample recovery not within control limits. Organic: Tentatively identified compound (TIC).
- P > 25% difference in detected pesticide or Arochlor concentrations between 2 columns.
- S Result determined by method of standard addition (MSA).
- U Analytical result below detection limit.
- W Post-digestion spike outside control limits while sample absorbance < 50% of analytical spike absorbance.
- X Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Y Laboratory defined (USEPA CLP organic) qualifier, see case narrative.
- Z Laboratory defined (USEPA CLP organic) qualifier, see case narrative.

DATA QUALIFIERS:

- | | |
|--|--|
| F Low flow sampling method used. | G Possible grout contamination, pH > 9. |
| J Estimated value. | L Less than 3 bore volumes purged prior to sampling. |
| N Presumptive evidence that analyte is present. The analyte is "tentatively identified". | Q Qualitative result due to sampling technique |
| R Unusable result. | U Parameter analyzed for but was not detected. |
| X Location is undefined. | |


QA QUALIFIER: # = validated according to Quality Assurance guidelines.

Appendix C

Static Water Level Data


Slick Rock Processing Sites (SRK01)

Hydrograph

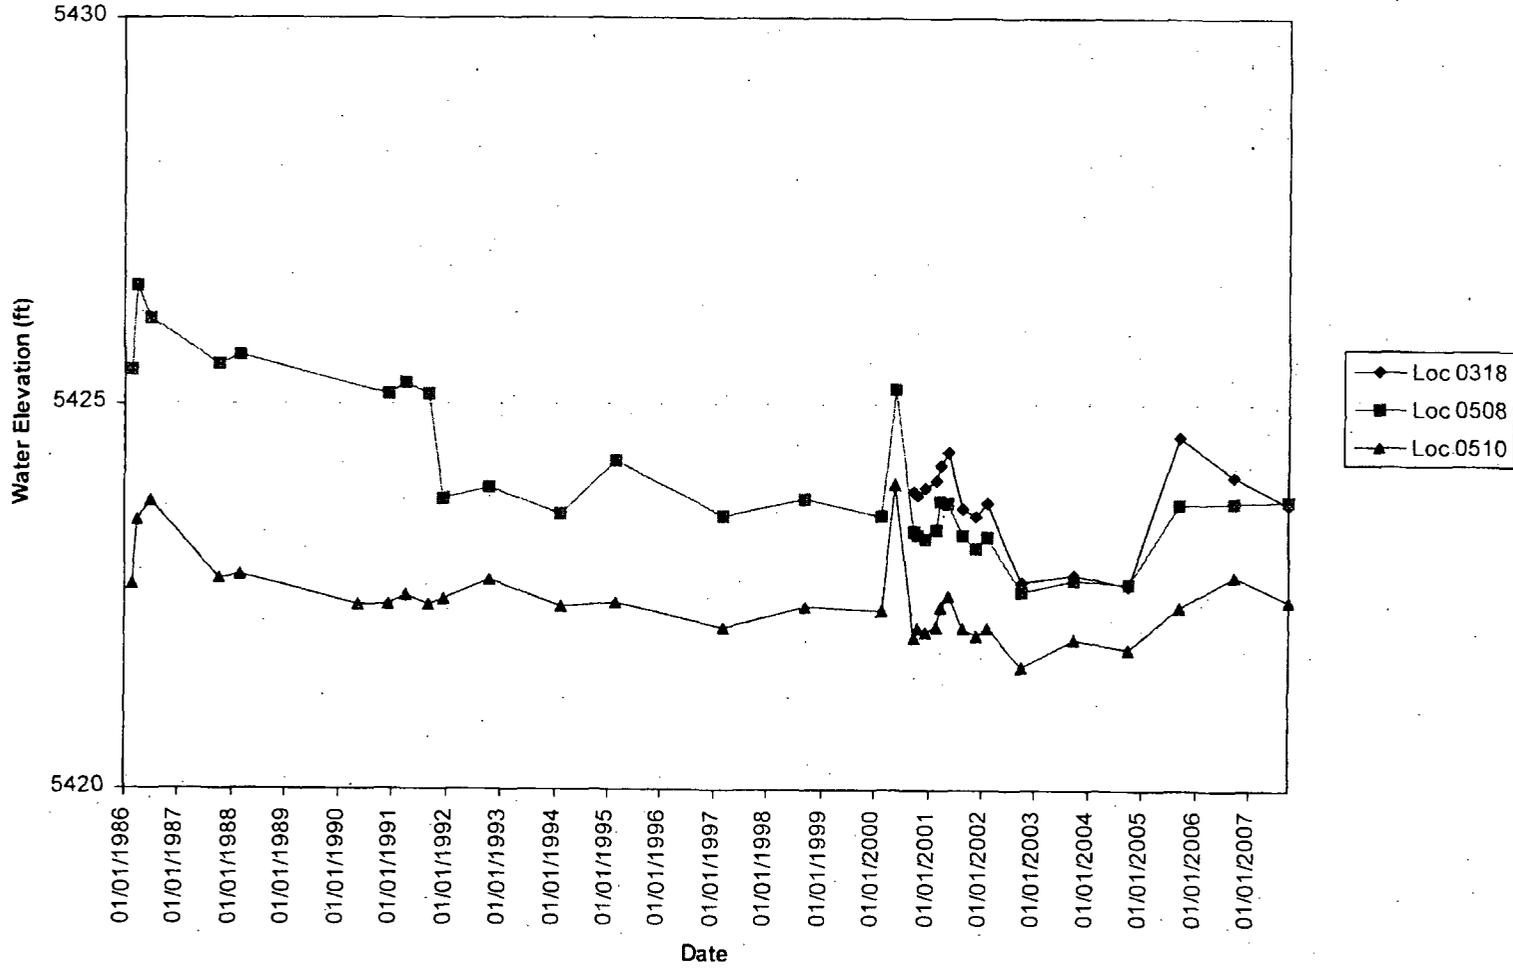


Slick Rock Processing Sites (SRK01)

Hydrograph

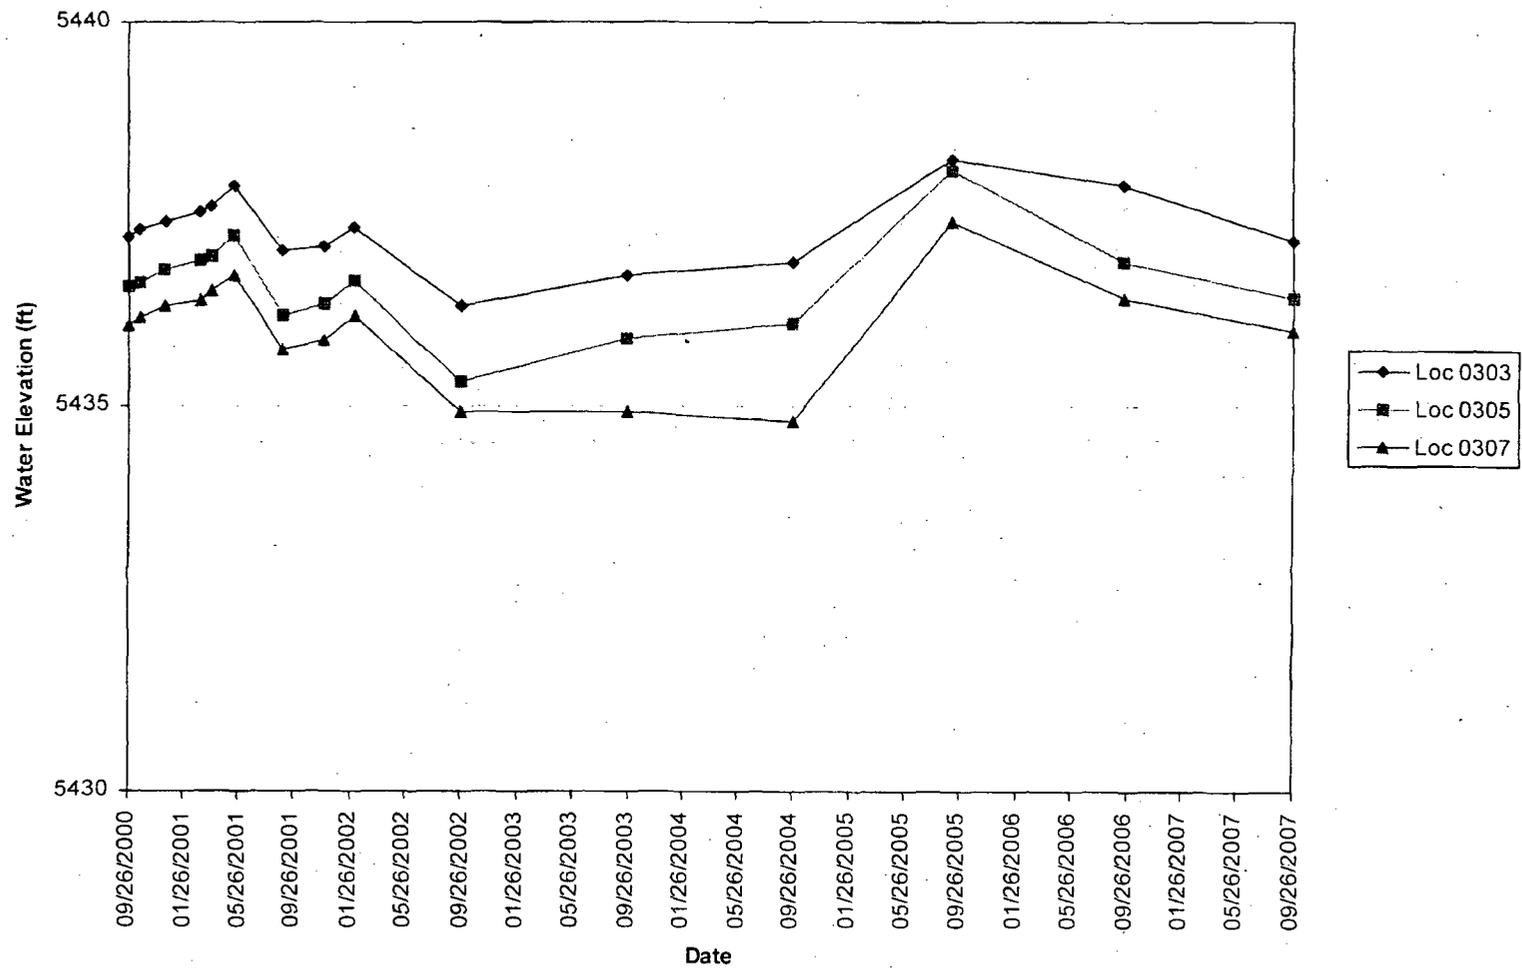

Slick Rock Processing Sites (SRK01)

Hydrograph

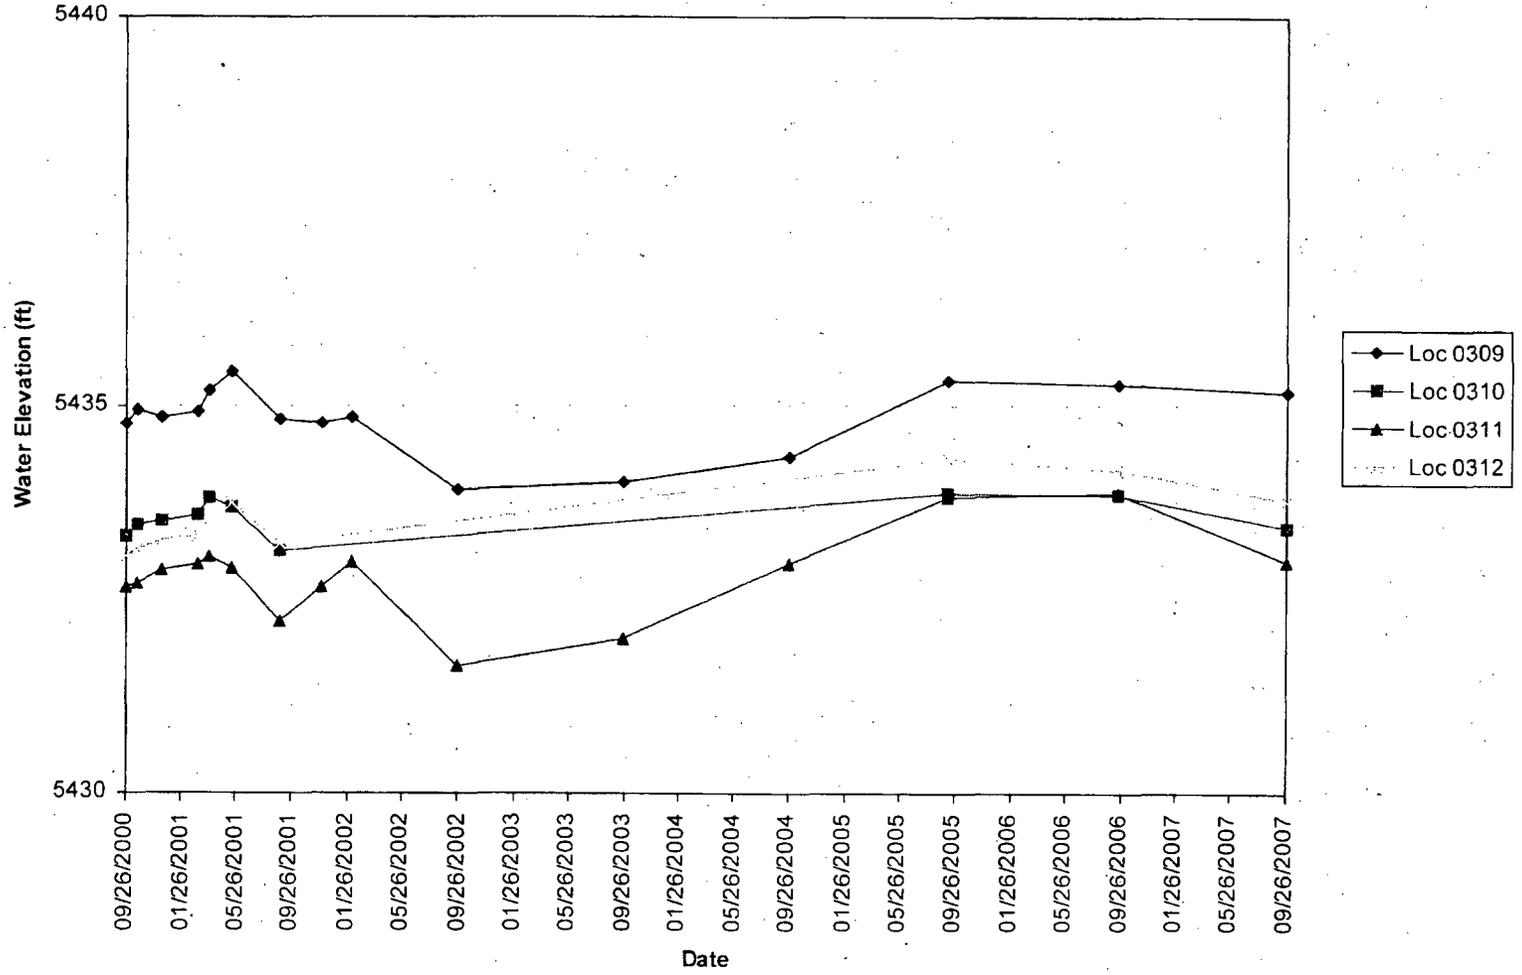

STATIC WATER LEVELS (USEE700) FOR SITE SRK01, Slick Rock Processing Sites
 REPORT DATE: 2/5/2008 11:48 am

LOCATION CODE	FLOW CODE	TOP OF CASING ELEVATION (FT)	MEASUREMENT		DEPTH FROM TOP OF CASING (FT)	WATER ELEVATION (FT)	WATER LEVEL FLAG
			DATE	TIME			
0303	O	5446.91	09/20/2006	15:35	9.05	5437.86	
		5446.91	09/25/2007		9.75	5437.16	
0305	O	5448.75	09/20/2006	14:32	11.87	5436.88	
		5448.75	09/26/2007		12.35	5436.40	
0307	O	5447.10	09/20/2006	13:51	10.68	5436.42	
		5447.10	09/25/2007		11.11	5435.99	
0309	O	5450.18	09/20/2006	12:34	14.90	5435.28	
		5450.18	09/26/2007		15.00	5435.18	
0310	D	5450.56	09/19/2006	17:34	16.73	5433.83	
		5450.56	09/25/2007		17.15	5433.41	
0311	D	5450.70	09/19/2006	17:11	16.85	5433.85	
		5450.70	09/25/2007		17.72	5432.98	
0312	D	5451.06	09/19/2006	16:42	16.90	5434.16	
		5451.06	09/25/2007		17.29	5433.77	
0317		5435.18	09/21/2006	12:09	10.72	5424.46	
		5435.18	09/24/2007		11.28	5423.90	
0318	O	5435.22	09/21/2006	12:42	11.17	5424.05	
		5435.22	09/24/2007		11.52	5423.70	
0319	O	5430.66	09/21/2006	09:49	7.64	5423.02	
		5430.66	09/25/2007		8.47	5422.19	
0320	O	5427.40	09/21/2006	16:15	4.31	5423.09	
		5427.40	09/25/2007		5.15	5422.25	
0347	O	5425.02	09/24/2007		-	-	
0349	O	-	09/24/2007		-	-	
0508	O	5430.20	09/21/2006	14:14	6.48	5423.72	
		5430.20	09/24/2007		6.45	5423.75	
0510	O	5427.87	09/21/2006	15:17	5.13	5422.74	
		5427.87	09/24/2007		5.45	5422.42	
0684	D	5432.68	09/19/2006	15:08	14.98	5417.70	
		5432.68	09/25/2007		15.82	5416.86	
0692	O	-	09/25/2007		-	-	
0693	U	-	09/25/2007		-	-	
0694	D	-	09/24/2007		-	-	

STATIC WATER LEVELS (USEE700) FOR SITE SRK01, Slick Rock Processing Sites
REPORT DATE: 2/5/2008 11:48 am

LOCATION CODE	FLOW CODE	TOP OF CASING ELEVATION (FT)	MEASUREMENT		DEPTH FROM TOP OF CASING (FT)	WATER ELEVATION (FT)	WATER LEVEL FLAG
			DATE	TIME			
0696	U	-	09/25/2007		-		
0700		-	09/26/2007		-		

RECORDS: SELECTED FROM USEE700 WHERE site_code='SRK01' AND LOG_DATE >= #1/1/2006#

FLOW CODES: D DOWN GRADIENT O ON-SITE U UPGRADIENT

WATER LEVEL FLAGS: