

A 07/26/78

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)  
DISTRIBUTION FOR INCOMING MATERIAL 50-335

REC: REID R W  
NRC

ORG: UHRIG R E  
FL PWR & LIGHT

DOC DATE: 07/18/78  
DATE RCVD: 07/24/78

DOCTYPE: LETTER NOTARIZED: NO

COPIES RECEIVED

SUBJECT: LTR 3 ENCL 3

RESPONSE TO NRC LTR DTD 05/17/78... FORWARDING INFO RE CHEMICAL VOLUME CONTROL SYSTEM VIBRATORY LOADS ASSOCIATED WITH THE OPERATION OF POSITIVE DISPLACEMENT CHARGING PUMPS.

PLANT NAME: ST LUCIE #1

REVIEWER INITIAL: XJM  
DISTRIBUTOR INITIAL: *u*

\*\*\*\*\* DISTRIBUTION OF THIS MATERIAL IS AS FOLLOWS \*\*\*\*\*

GENERAL DISTRIBUTION FOR AFTER ISSUANCE OF OPERATING LICENSE.  
(DISTRIBUTION CODE A001)

FOR ACTION: BR CHIEF ORB#4 BC\*\*W/7 ENCL

INTERNAL:

REG FILE\*\*W/ENCL  
I & E\*\*W/2 ENCL  
HANAUER\*\*W/ENCL  
AD FOR SYS & PROJ\*\*W/ENCL  
REACTOR SAFETY BR\*\*W/ENCL  
EEB\*\*W/ENCL  
J. MCGOUGH\*\*W/ENCL

NRC PDR\*\*W/ENCL  
OELD\*\*LTR ONLY  
CORE PERFORMANCE BR\*\*W/ENCL  
ENGINEERING BR\*\*W/ENCL  
PLANT SYSTEMS BR\*\*W/ENCL  
EFFLUENT TREAT SYS\*\*W/ENCL

EXTERNAL:


LPDR'S  
FT PIERCE, FL\*\*W/ENCL  
TERA\*\*W/ENCL  
NSIC\*\*W/ENCL  
ACRS CAT B\*\*W/16 ENCL


DISTRIBUTION: LTR 40 ENCL 39  
SIZE: 1P+2P

CONTROL NBR: 782060021

*PA 4*  
*GP*

\*\*\*\*\* THE END \*\*\*\*\*

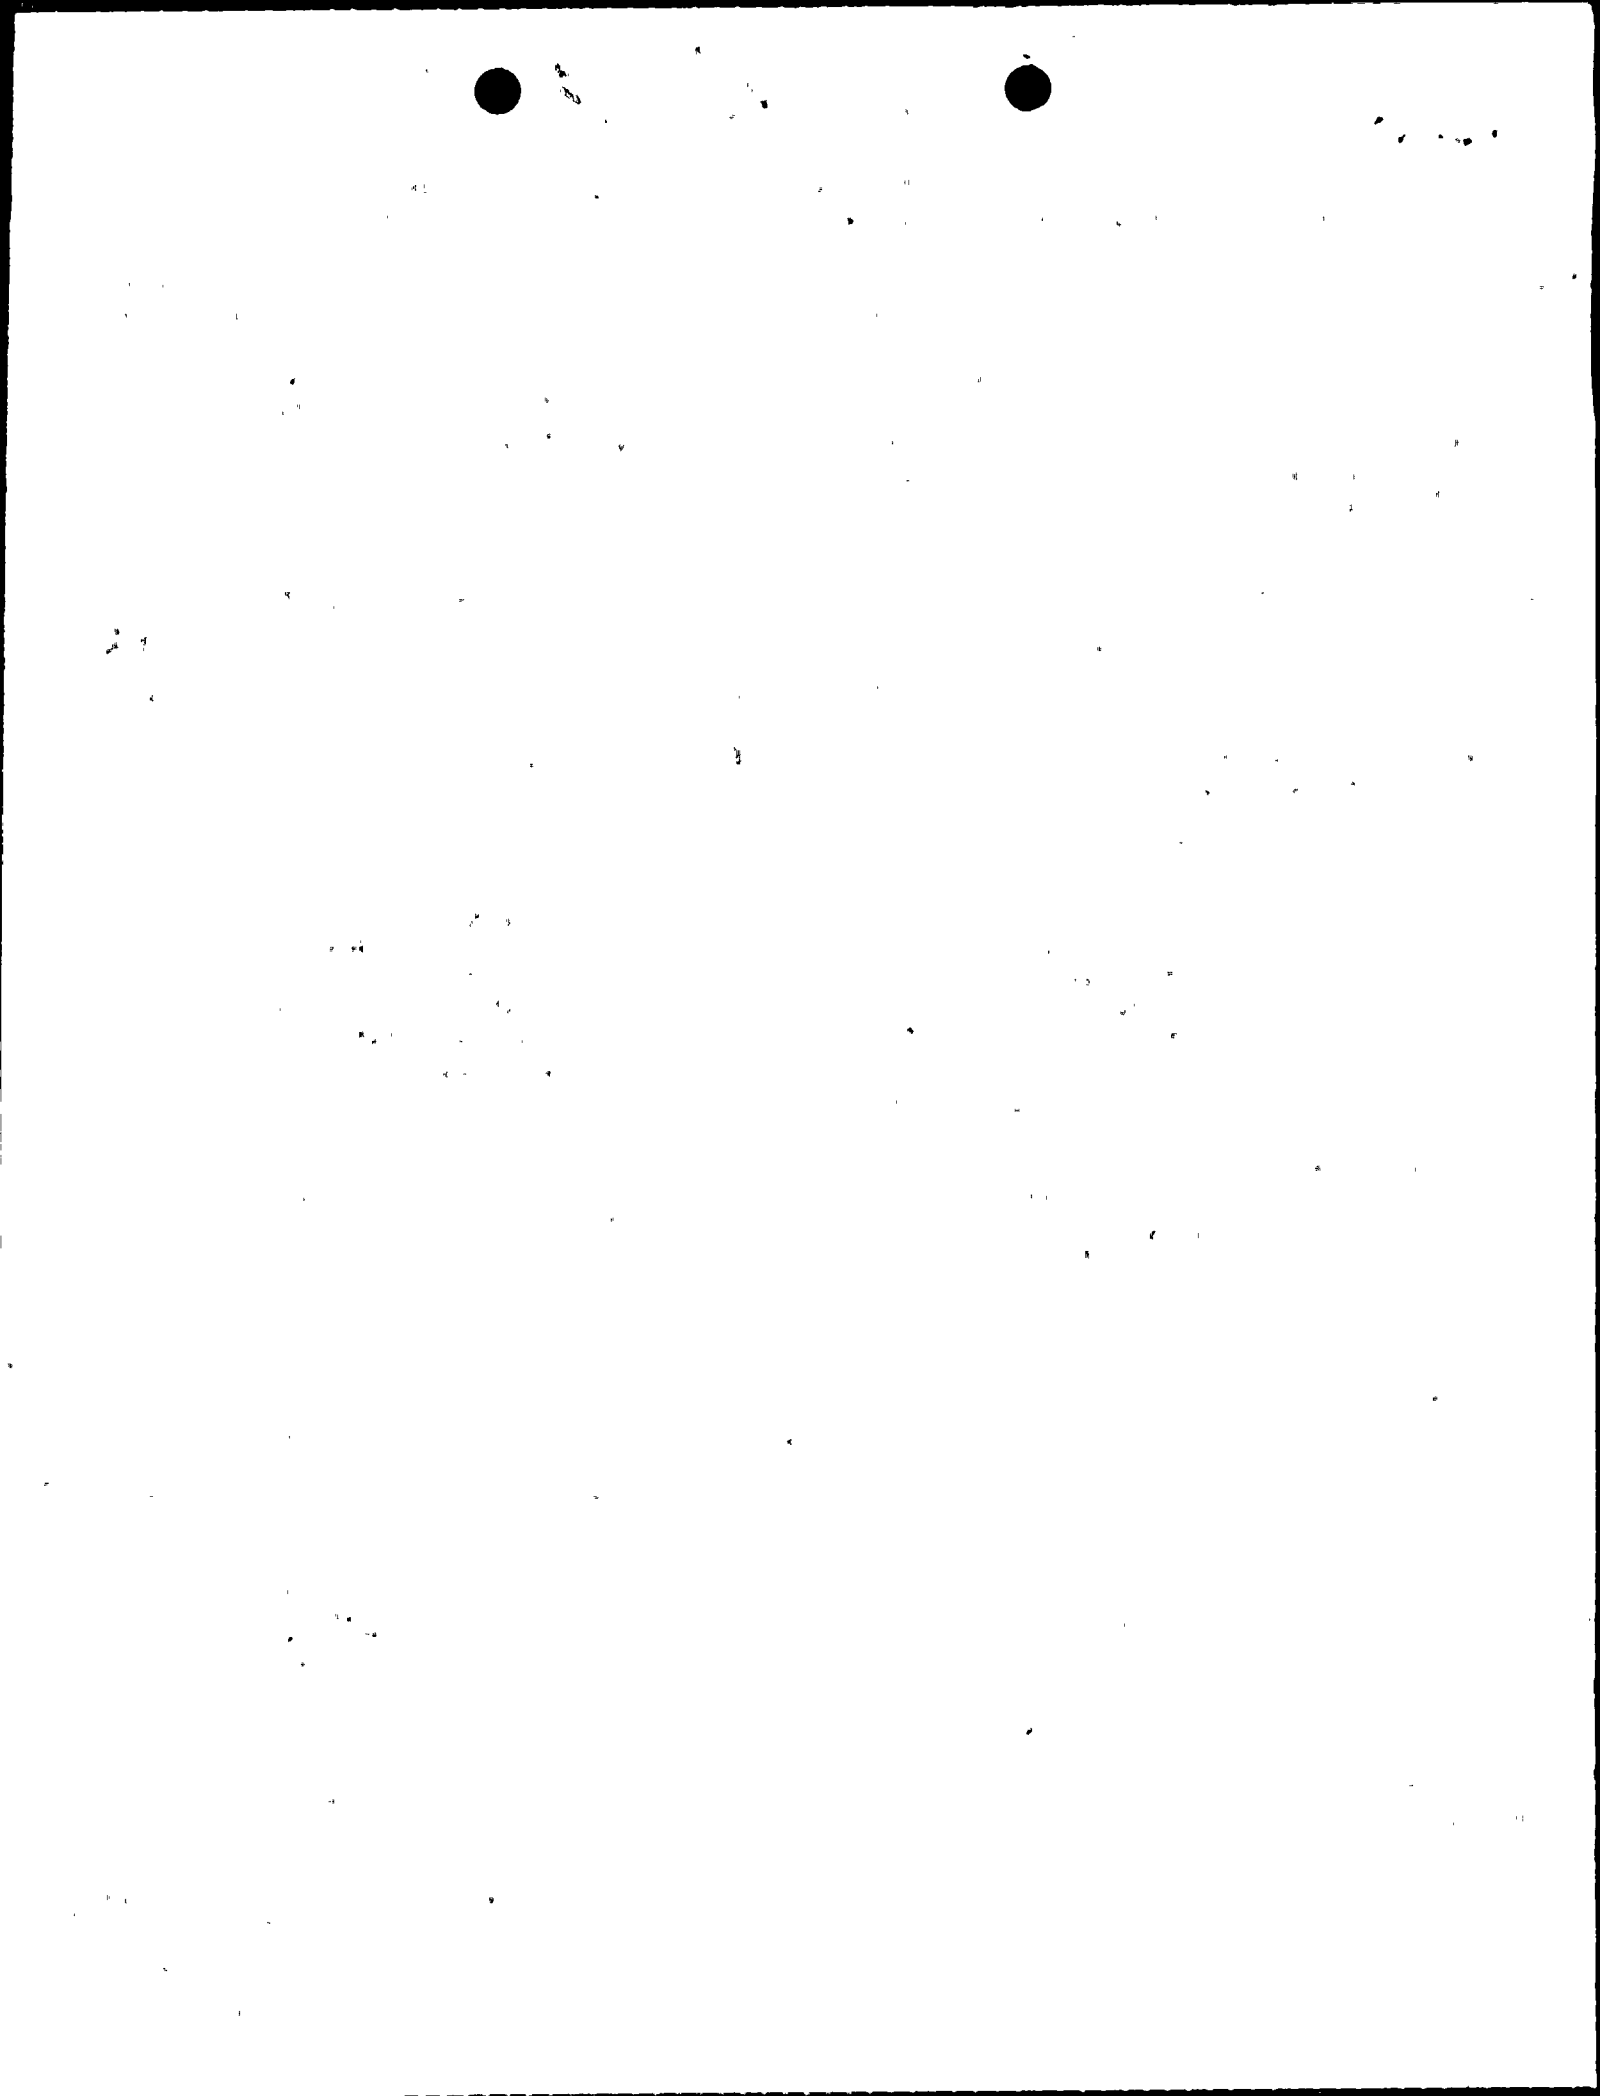

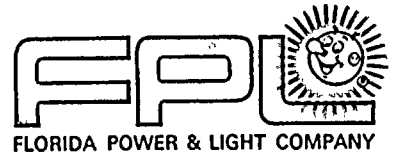

July 18, 1978  
L-78-239

RECEIVED DISTRIBUTION SERVICES UNIT  
1978 JUL 24 AM 11 40  
US NRC  
DISTRIBUTION SERVICES

Office of Nuclear Reactor Regulation  
Attention: Mr. R. W. Reid, Chief  
Operating Reactors Branch #4  
Division of Operating Reactors  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Dear Mr. Reid:

Re: St. Lucie Unit 1  
Docket No. 50-335  
CVCS Pipe Vibration

Your letter of May 17, 1978 requested information regarding Chemical Volume Control System (CVCS) vibratory loads associated with the operation of positive displacement charging pumps. We have reviewed the letter and a response is attached.

Very truly yours,

Robert E. Uhrig  
Vice President

REU/MAS/cpc

Attachment

cc: Mr. James P. O'Reilly, Region II  
Harold F. Reis, Esquire

REGULATORY DOCKET FILE COPY

782060021

A001  
5/3



11

11

discharge of each pump and at the common discharge header. Vibration was limited to the range of 0-10 mils peak to peak ( $\pm 5$  mils) at measured points on the discharging piping including branch connections. Strain readings taken on a branch connection immediately downstream of the "A" pump and its associated accumulator were less than 10 microinches per inch. Thus the recorded field data indicates that vibration and peak alternating stress on the discharge piping is minimal and well below endurance limits.

Suction: Field recorded data on the suction piping (no devices installed) indicated minimal vibration; a maximum of 10 mils peak to peak ( $\pm 5$  mils) at all points tested. Pressure pulsations were typically around 20 psi peak to peak ( $\pm 10$  psi). Simulation of the suction piping on the analog computer, with the Greer device described above, resulted in pressure pulsations of 1.0 to 1.5 psi peak to peak. Thus the decision was made to install suction devices as a pump preventive maintenance measure. Recorded field data on the suction piping, with no suction devices installed, indicates vibration is minimal with the peak alternating stress well below endurance limits. Nevertheless, suction devices will be installed, thereby reducing pressure pulsations to about 10% of that recorded in the field and reducing vibration and peak alternating stress to virtually nil.

#### Questions 2 through 6

These questions were to be answered only if pulsation dampeners are not used. Therefore, based on the response to question 1, responses to questions 2 through 6 have not been prepared.

ATTACHMENT

Re: St. Lucie Unit 1  
Docket No. 50-335  
CVCS Pipe Vibration

Question 1

Furnish the following information if pulsation dampeners or other mechanical devices are used at the positive displacement pump to reduce vibratory loads transmitted to the pipe systems.

- a. Describe the mechanical device employed, i.e., manufacturer, type, size, location (suction or discharge sides of the pump or both), etc.
- b. Furnish the percentage of the total vibratory load that is absorbed by the mechanical device.
- c. Furnish the peak alternating stress of the affected pipe system. Is this peak alternating stress below the endurance limits?

Response to Question 1.a

Greer "Pulse-Tone" accumulators, model number 30A 2 1/2 FTNS, are installed on the discharge of each of the three charging pumps. These devices are of 2 1/2 gallon capacity and have N<sub>2</sub> filled BUNA N bladders for pressure pulsation dampening. They attach directly to the discharge flange of each pump.

Plans are currently being made to install pulsation dampening devices on the suction of each of the existing charging pumps. Preliminary plans and schedules provide for installation of a device such as Greer "Suction Stabilizers", Model No. SPC-10 during the 1980 refueling outage. These devices are 10 gallon capacity and have N<sub>2</sub> filled rubber bladders for pressure pulsation dampening. The dampening devices will probably be installed directly to the suction flange of each pump.

Response to Questions 1.b and 1.c

A field evaluation study was performed on the St. Lucie Unit 1 charging system in September of 1977. Vibration, strain and pressure pulsation data was recorded, with the RCS at operating conditions, on both the suction and discharge sides of each pump. In addition, an analog computer simulation of the entire CVCS system was performed in January 1978 to evaluate system performance with suction devices installed on the charging pumps.

Discharge: Field recorded vibration, strain, and pressure pulsation data indicates excellent performance of the Greer discharge accumulators. Pressure pulsations were less than 20 psi peak to peak (+0.5% of line pressure) at the



11  
12  
13  
14  
15  
16  
17  
18  
19  
20  
21  
22  
23  
24  
25  
26  
27  
28  
29  
30  
31  
32  
33  
34  
35  
36  
37  
38  
39  
40  
41  
42  
43  
44  
45  
46  
47  
48  
49  
50  
51  
52  
53  
54  
55  
56  
57  
58  
59  
60  
61  
62  
63  
64  
65  
66  
67  
68  
69  
70  
71  
72  
73  
74  
75  
76  
77  
78  
79  
80  
81  
82  
83  
84  
85  
86  
87  
88  
89  
90  
91  
92  
93  
94  
95  
96  
97  
98  
99  
100