

Table 1

Millstone Unit No. 2

Steam Generator Eddy-Current Test Results

January 10, 1982

<u>Number of Imperfections</u>	<u>Steam Generator</u>	
	<u>No. 1</u>	<u>No. 2</u>
$\geq 40\%$	98	49
$< 40\%$	150	60
Total	248	109

8201210238

FIGURE A


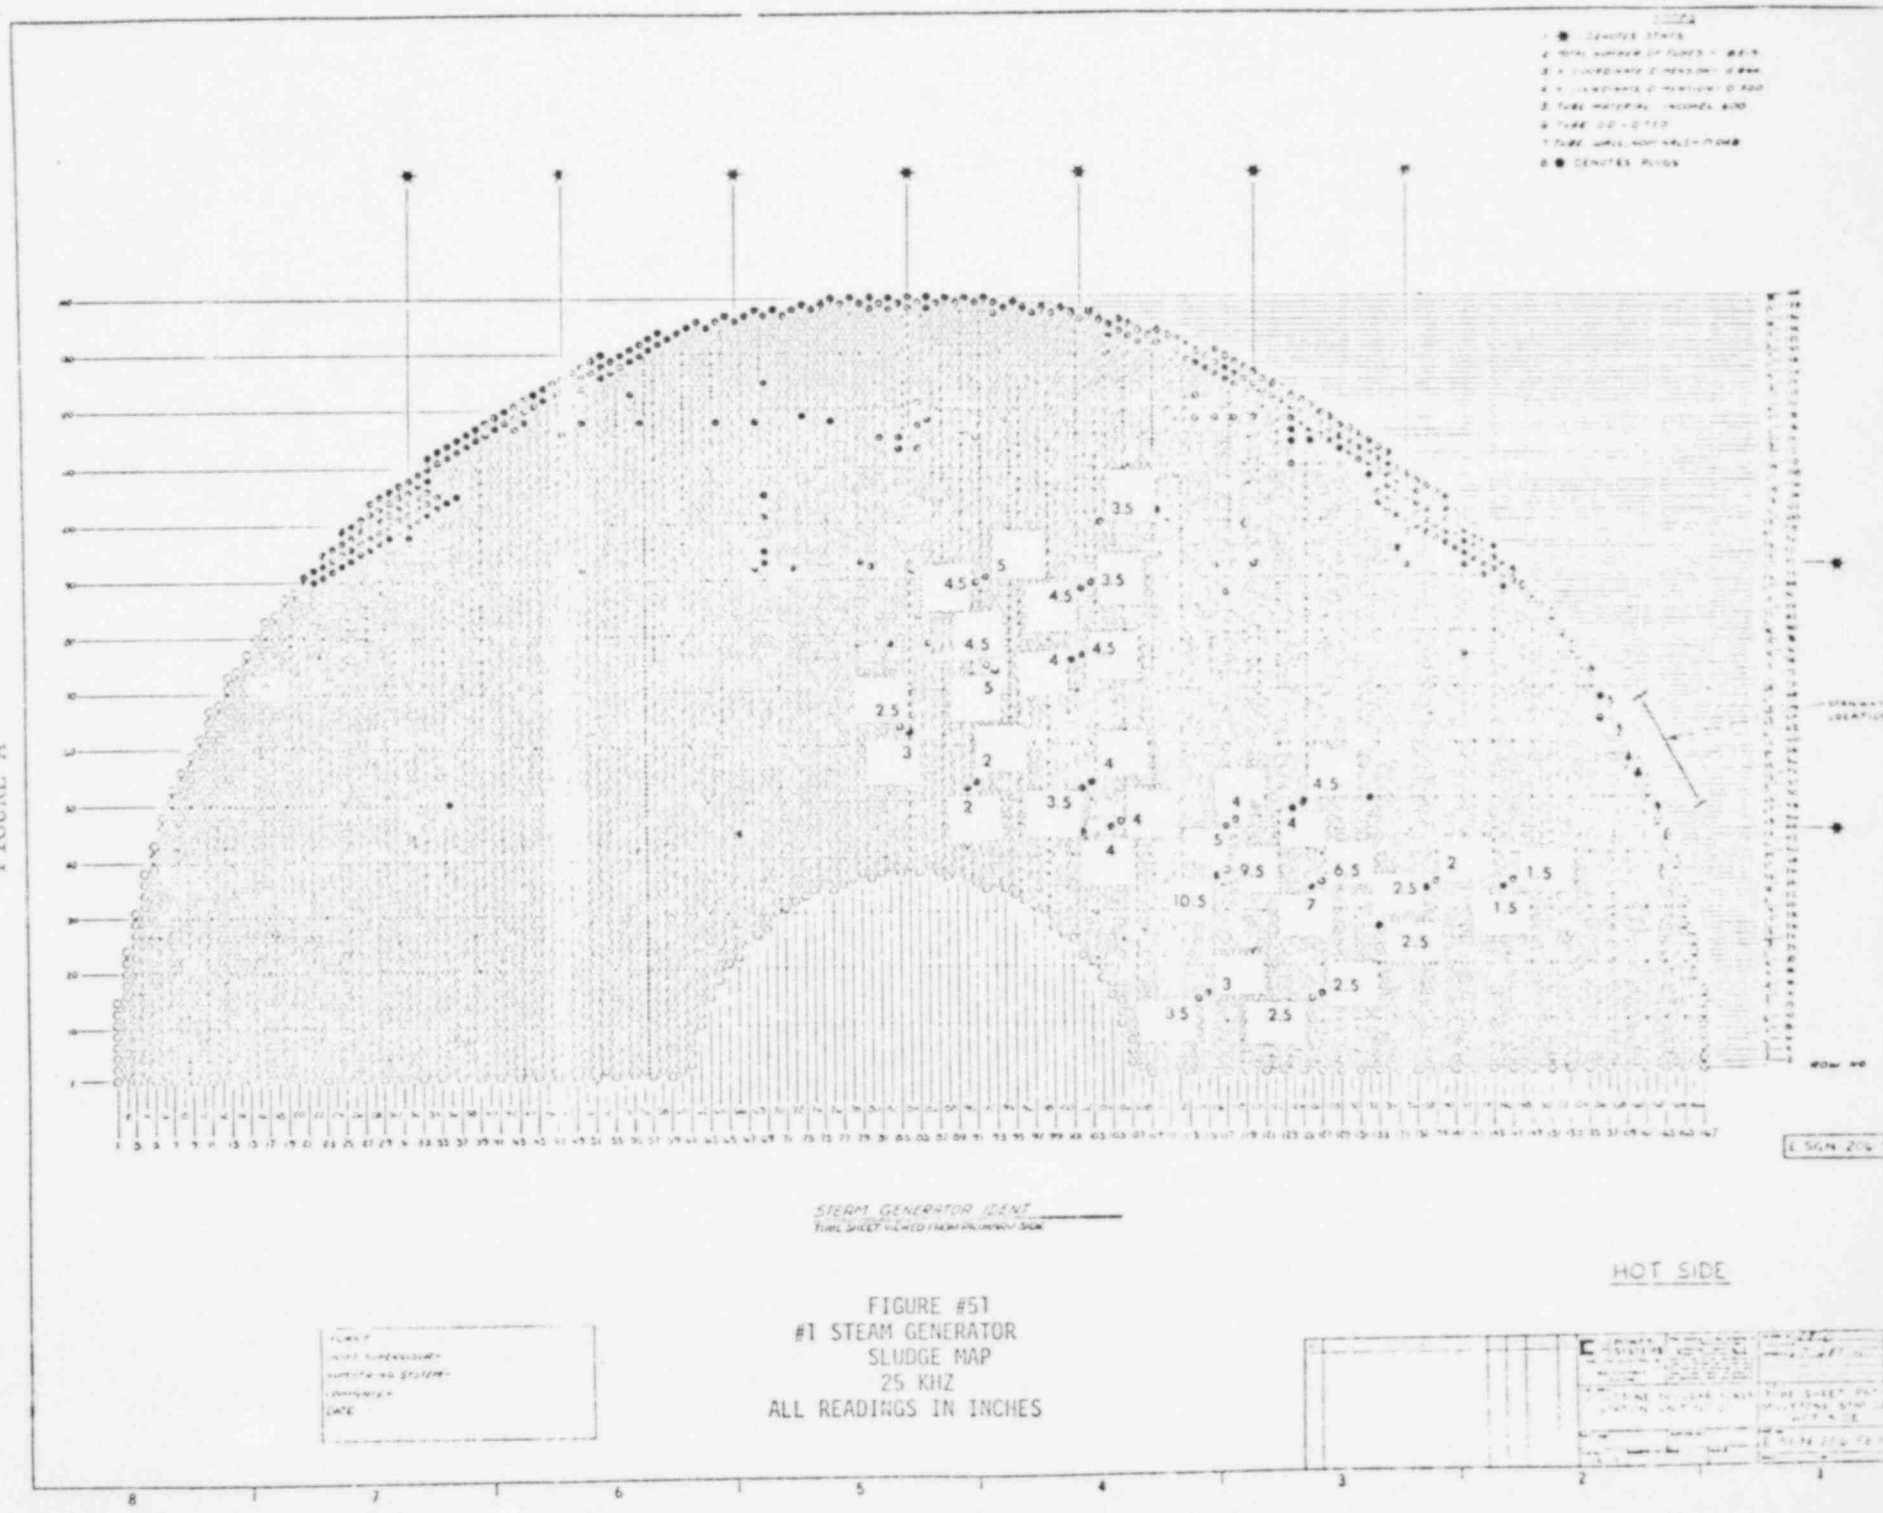


FIGURE B

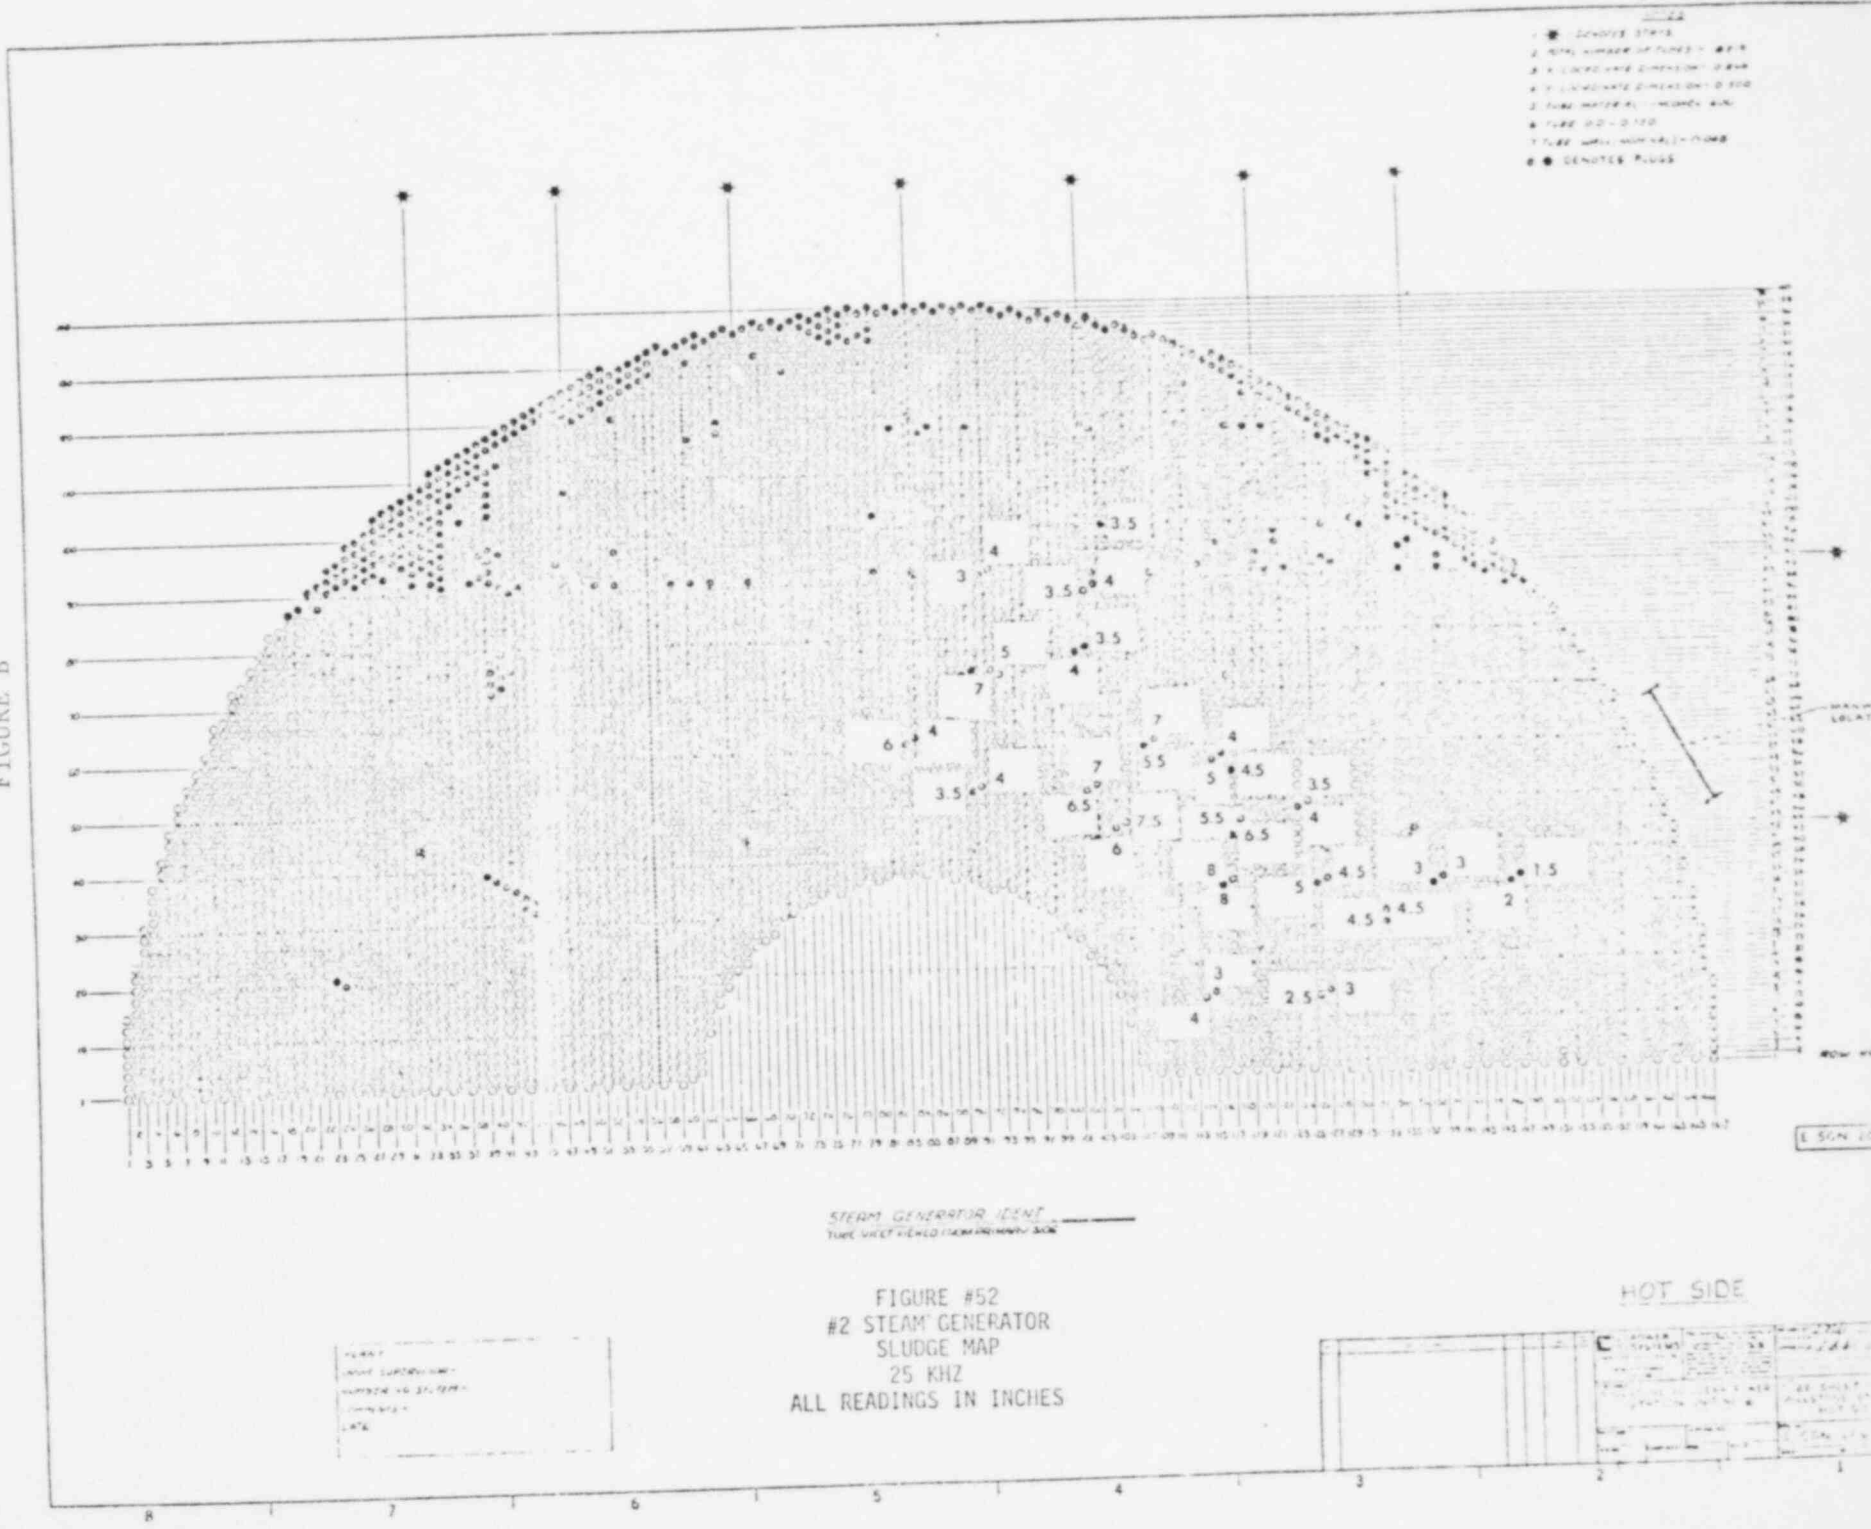

- 1. □ SCHEMATIC SYMBOL
- 2. ○ SLUDGE DEPOSIT
- 3. ▲ SLUDGE DEPOSIT - 0.5 IN
- 4. ▼ SLUDGE DEPOSIT - 0.75 IN
- 5. ◆ SLUDGE DEPOSIT - 1.0 IN
- 6. ★ SLUDGE DEPOSIT - 1.5 IN
- 7. ⬡ SLUDGE DEPOSIT - 2.0 IN
- 8. ⬢ SLUDGE DEPOSIT - 2.5 IN
- 9. ● DENOTES PLUGS

STEAM GENERATOR ISSENT
TUBE SHEET VIEWED FROM PRIMARY SIDE

FIGURE #52
#2 STEAM GENERATOR
25 KHZ
ALL READINGS IN INCHES

HOT SIDE

PLANT #
DATE

NO.	DATE	BY	REVISION